AIR CONDITIONING—BLOWER MOTOR INOPERATIVE	Article No. 00-3-1

LINCOLN: 1998-2000 TOWN CAR

ISSUE

The A/C blower motor may be inoperative. This may be caused by water entry into the blower motor housing due to a mispositioned or missing foam water block.

ACTION

Replace the blower motor and verify installation and correct positioning of the foam water block. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

1. Replace the Blower Motor (YW1Z-19805-CA) as outlined in the appropriate Town Car Workshop Manual.
2. Verify the foam water block is installed in the correct position.
3. If the water block is out of position, reposition the foam water block.
4. If the water block is missing, install a new Foam Water Block (XW1Z-54020A20-AA) in the correct position. Refer to Figures 1 and 2.

PART NUMBER	PART NAME
XW1Z-54020A20-AA	Foam Water Block
YW1Z-19805-CA	Blower Motor Kit

OTHER APPLICABLE ARTICLES: NONE

WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
000301A	Replace Blower Motor (Includes Time To Verify, Replace, Or Reposition Foam Water Block As Required)	0.5 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
19805	49

OASIS CODES: 208000, 208100, 208200, 208300, 208999

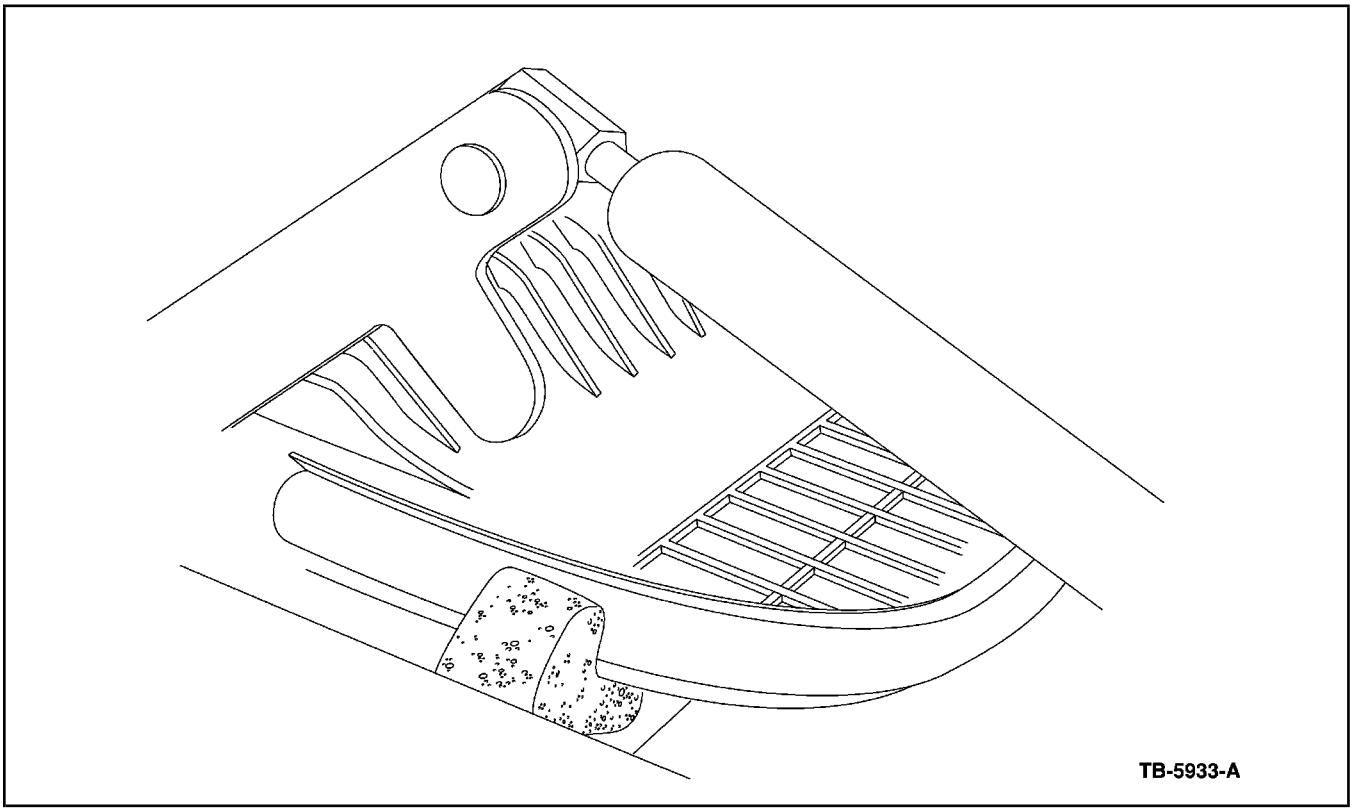

Figure 1 - Article 00-3-1

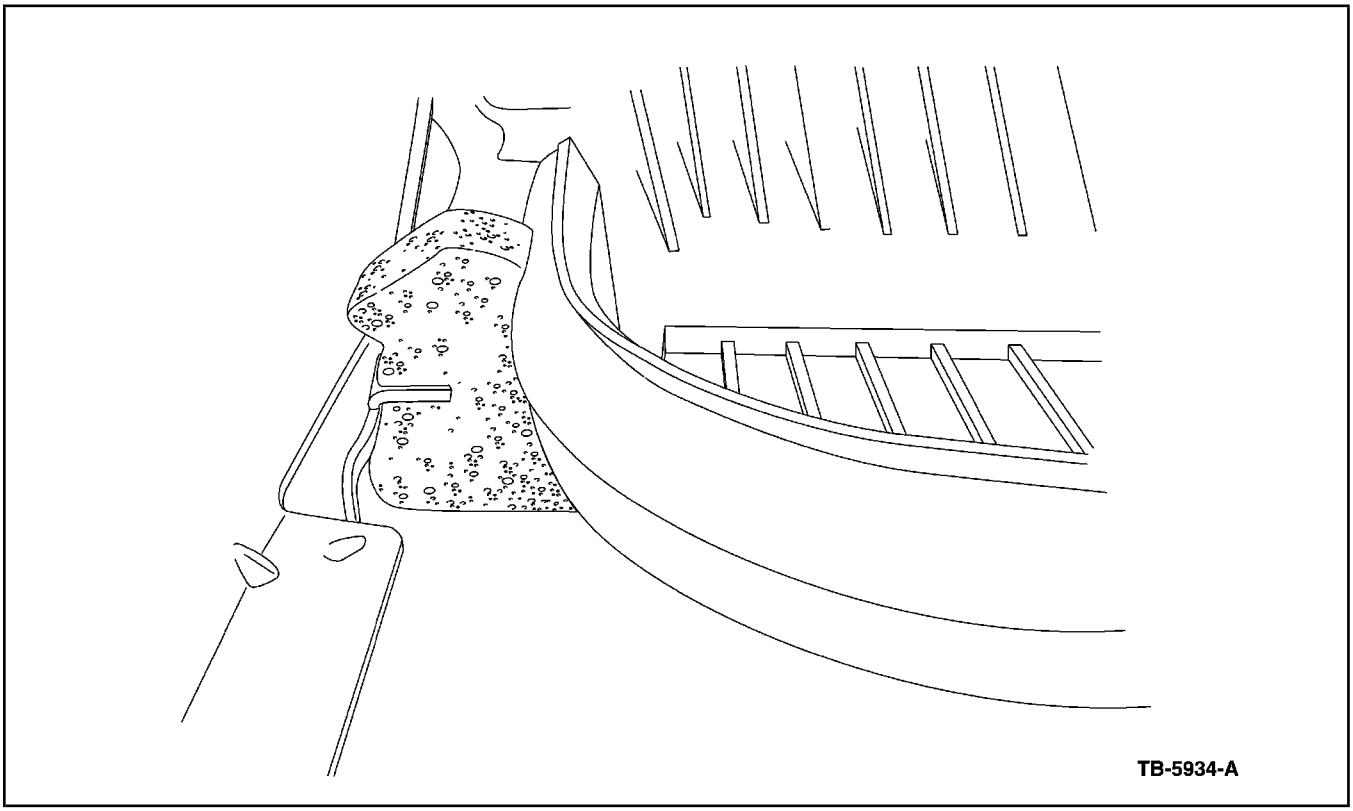

Figure 2 - Article 00-3-1