Ford Motor Company

A. R. O'Neill
Director
Vehicle Service and Programs
48121
Ford Customer Service Division

Ford Motor Company
P. O. Box 1904
Dearborn, Michigan

May 25, 2001

TO: All Ford and Lincoln Mercury Dealers

SUBJECT: Owner Notification Program 00B59 Supplement #1: Revised Technical Instructions (See Attachment III)

REFERENCE: Owner Notification Program 00B59: Certain 2000 Model Year Focus Vehicles Built with 5-Speed Manual Transaxles – Clutch Master Cylinder and Pedal Return Spring Replacement

OASIS : Yes
OWNER LIST: Yes
PARTS RETURN: No
PROGRAM TERMS: This program will be in effect until June 30, 2001, regardless of mileage.

AFFECTED VEHICLES

Certain 2000 model year Focus vehicles equipped with 2.0L SPI or 2.0L Zetec engines and 5-speed manual transaxles, built at the Wayne Assembly Plant and Hermosillo Assembly Plant from Job #1 through April 17, 2000.

REASON FOR SUPPLEMENT

This supplement provides additional instructions to help technicians complete the service repair without affecting the brake lamp switch adjustment or function. It is important that technicians follow the revised technical instructions in Attachment III. The revisions are highlighted in red.

REASON FOR PROGRAM

Some of the affected vehicles may experience premature seal wear in the clutch master cylinder. Also, some of the affected vehicles may experience a fracture of the clutch pedal return spring end hook. Either of these conditions could affect shift quality.

SERVICE ACTION

At no charge to the owner of the vehicle, the dealer will install a new clutch pedal return spring and clutch master cylinder.

ATTACHMENTS

Attachment I: Administrative Information
Attachment II: Labor Allowances and Parts Ordering Information
Attachment III: Revised Technical Information
Customer Notification Letter

QUESTIONS?

Claims Information: ……1-800-423-8851
Other Program Questions: ……1-800-325-5621

Sincerely,

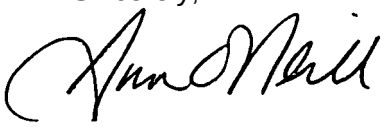

Ann O'Neill
Director
Vehicle Service and Programs

Owner Notification Program 00B59-S1
Certain 2000 Focus vehicles built with 5-Speed Manual Transaxles
Clutch Master Cylinder and Pedal Return Spring Replacement

OASIS

You must use OASIS to determine if a vehicle is eligible for this program. Please note that not all vehicles in the affected build date range are involved in this program.

PLEASE NOTE

Correct all vehicles in stock before delivery.

DEALER-OWNER CONTACT

Promptly correct all affected vehicles on the enclosed list and other eligible vehicles which are brought to your dealership.

CLAIMS PREPARATION AND SUBMISSION

- Enter claims using DWE.
- Refer to ACESII manual for claims preparation and submission information.

OWNER REFUNDS

Ford Motor Company will only refund owner-paid repairs made before the date of the Owner Letter (or after the date of the Owner Letter if an emergency repair was made away from the servicing dealer). Refer to ACESII manual for refund information.

Program Code:	00B59
Misc. Expense:	REFUND
Misc. Expense:	ADMIN
Misc. Expense:	0.2 Hr.

RENTAL CARS

Rental vehicles are not approved for this program.

Owner Notification Program 00B59-S1
Certain 2000 Focus vehicles built with 5-Speed Manual Transaxles
Clutch Master Cylinder and Pedal Return Spring Replacement

LABOR ALLOWANCES

Description	Labor Operation	Labor Time
Replace Clutch Master Cylinder and Return Spring		
- On Focus with IB5 Transmission	00B59B	1.0 Hours
- On Focus with MTX 75 Transmission	00B59C	1.1 Hours

PARTS REQUIREMENTS

Parts Ordering Information

Parts will not be direct shipped for this program. Order your parts requirement through normal order processing channels as noted below:

Stock Orders	Effective immediately	Normal order process
Interim Orders	Effective immediately	Normal order process
Emergency Orders	First 30 days after launch	Call 1-800-325-5621
Emergency Orders	31 days after launch	Normal order process

DOR/COR Number 50204 identifies parts ordered for this campaign through the Recall Hotline (1-800-325-5621).

Part Number	Description	Quantity
YS4Z-7A543-AA	Clutch Master Cylinder Assembly	1
YS4Z-7534-AA	Clutch Return Spring	1
YS4Z-19542-AA (Quantity of four 16 oz. Containers.)	Super DOT-4 Brake Fluid	1 Container per vehicle.

DEALER PRICE

For latest prices, check:

- DOES II
- Updated Price Book

EXCESS STOCK RETURN

Excess stock returned for credit must have been purchased from Ford Customer Service Division in accordance with Policy Procedure Bulletin 4000.

Ford Motor Company

Ford Motor Company
P. O. Box 1904
Dearborn, Michigan 48121

December 2000

00B59

Mr. John Sample
123 Main Street
Anywhere, USA 12345

Your Vehicle Identification Number: 12345678901234567

Ford Motor Company is providing a no-charge service, Program 00B59, to owners of certain 2000 model year Focus vehicles equipped with 2.0L SPI or 2.0L Zetec engines and 5-speed manual transaxles.

Reason For This Program…

Some of the affected vehicles may experience premature seal wear in the clutch master cylinder. Also, they may experience a fracture of the clutch pedal return spring end hook. If either of these conditions should occur, shift quality could be affected.

What *Ford Motor Company* and your dealer will do…

At no cost to you, the dealer will install a new clutch pedal return spring and clutch master cylinder.

This program will be in effect until June 31, 2001, regardless of mileage.

What we are asking you to do…

Call your dealer without delay. Provide the dealer with your Vehicle Identification Number (located at the beginning of this letter). Ask for a service date and whether parts are in stock for Owner Notification Program 00B59.

If your dealer does not have the parts in stock, they can be ordered before scheduling your service date. Parts would be expected to arrive within a week after ordering.

How long will it take…

The time needed for this repair is less than one-half day. However, due to service scheduling issues, your dealer may need your vehicle for a longer period of time. Please call your dealer for a service date.

When you bring your vehicle in, show the dealer this letter. If you misplace this letter, your dealer will still do the work, free of charge.

Refund…

If you paid to have this service done before the date of this letter, Ford Motor Company is offering a full refund. For the refund, please give your paid original receipt to your dealer. To avoid delays, do not send receipts to Ford Motor Company.

If you've changed address or sold the vehicle…

Please fill out the enclosed prepaid postcard and mail it to us if you have changed address or sold the vehicle.

If you have concerns…

If you have trouble getting your vehicle repaired promptly and without charge, please contact your dealership Service Manager. If you still need assistance, please contact the Ford Motor Company Customer Relationship Center and one of our representatives will be happy to assist you:

CALL: (800) 392-3673
(800) 232-5952 (TDD for the Hearing Impaired)

Office Hours: (Eastern Standard Time)

Monday-Friday: 8am - 11pm

Saturday: 9am - 6pm

or you may contact us through the Internet at:
www.ownerconnection.com

Our current response time to Internet inquiries is three business days.

Quality Care service is there for you all year round.

QualityCare™ at your service

Quality Care is the commitment of Ford Motor Company and its dealerships to provide you with a superior service and ownership experience. While we regret the inconvenience caused by this program, we stand committed with our dealers to assist you with all of your automotive service needs. With our nationwide dealer network, we're here to ensure you receive Quality Care service so that your vehicle maintains peak performance throughout your ownership experience.

We pride ourselves on becoming the world's leading consumer company for automotive products and services. Again, we are sorry for the inconvenience. Thank you for your attention to this important matter.

Sincerely,

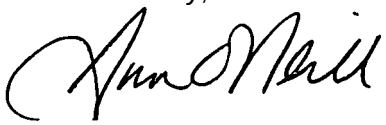

Ann O'Neill
Director
Vehicle Service and Programs