• BRAKES—BRAKE LAMPS REMAIN ILLUMINATED • ELECTRICAL—LAMPS—BRAKE LAMPS REMAIN ILLUMINATED	Article No. 02-5-1

FORD: 2000 TAURUS

MERCURY: 2000 SABLE

ISSUE

On some vehicles, there may be an inadvertent stop lamp switch activation with the brake pedal not depressed. This may be caused by the stoplamp switch wire harness.

ACTION

Install a new Stoplamp Switch Jumper Harness. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

NOTE

IF EQUIPPED, MOVE THE ADJUSTABLE PEDALS TO THE FULL FORWARD POSITION FOR EASIER ACCESSIBILITY.

1. Install a memory saver, then disconnect the battery negative cable.
2. Remove the instrument panel (I/P) lower steering column cover.
3. Disconnect the following three (3) electrical connectors (Figure 1).
   - Stop lamp switch
   - Speed control deactivation switch, if equipped
   - Adjustable Pedal Motor, if equipped
4. Remove the wire harness push-pin retainers from the brake pedal bracket, then position the harness to gain access to the splice area (Figure 2).
5. Install the “new” stop lamp repair harness, (1F1Z-14A411-BA - Wagon) or (1F1Z-14A411-CA - Sedan) (Figure 3).
   a. Obtain the stop lamp switch connector repair harness, (wagon or sedan), see parts list.
   b. Use the “new” harness assembly as a guide and measure back along the vehicle harness to locate the area to be spliced, then remove the tape from the splice area.
   c. Select one (1) wire from the vehicle wire harness by matching the wire color to the wire color in the repair harness, then cut the vehicle harness wire.
   d. Strip 6 mm (1/4″) of insulation from the vehicle harness wire and from the corresponding wire in the repair harness.
   e. Splice the two (2) wires together using splice connectors F2AZ-14488-A and appropriate crimp tool.
   f. Test the integrity of the splice after crimping. Grasp the wires at each end of the splice and pull gently. If any wire is not attached securely, replace the splice connector and crimp firmly.
   g. Repeat these steps for the remaining wire.
   h. Using the Rotunda Heat Gun R07-10300 or equivalent, heat each splice connector thoroughly until the tubing shrinks and sealant flows from each end.
6. Wrap the spliced wire with black vinyl tape.
7. Route the wire harness back around the brake pedal bracket and install the push-pin retainers.

CAUTION

DO NOT SECURE THE ADJUSTABLE PEDAL MOTOR CONNECTOR WITH THE TIE STRAP. ROUTE THE TIRE STRAP BETWEEN THE ADJUSTABLE PEDAL MOTOR CONNECTOR AND THE BRAKE PEDAL BRACKET. ALSO BE SURE TO USE THE SMALLER OF THE TWO HOLES TO ROUTE THE TIE STRAP THROUGH.

NOTE

VEHICLES EQUIPPED WITH ADJUSTABLE PEDALS DO NOT REQUIRE THE USE OF THE TIE STRAP FOR THIS REPAIR. ONLY THE FIXED PEDAL CONFIGURATION REQUIRES THE TIE STRAP.

Copyright © 2002 Ford Motor Company

8. Secure the wire harness to the brake pedal bracket with a tie strap (Figure 4).
9. Connect the three (3) electrical connectors.
10. Install the I/P lower steering column cover. Tighten the bolts to 9 N•m (80 Lb-in).
11. Connect the battery negative cable, then remove the memory saver.
12. Check the stop lamp and transmission shift interlock operation.

PART NUMBER	PART NAME
1F1Z-14A411-BA	Stoplamp Switch Jumper Harness - Wagon
1F1Z-14A411-CA	Stoplamp Switch Jumper Harness - Sedan
F2AZ-14488-A	Splice Connector

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
020501A	Install New Stoplamp Switch Jumper Harness	0.6 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
14A411	42

OASIS CODES: 201000, 201200, 203200, 301000

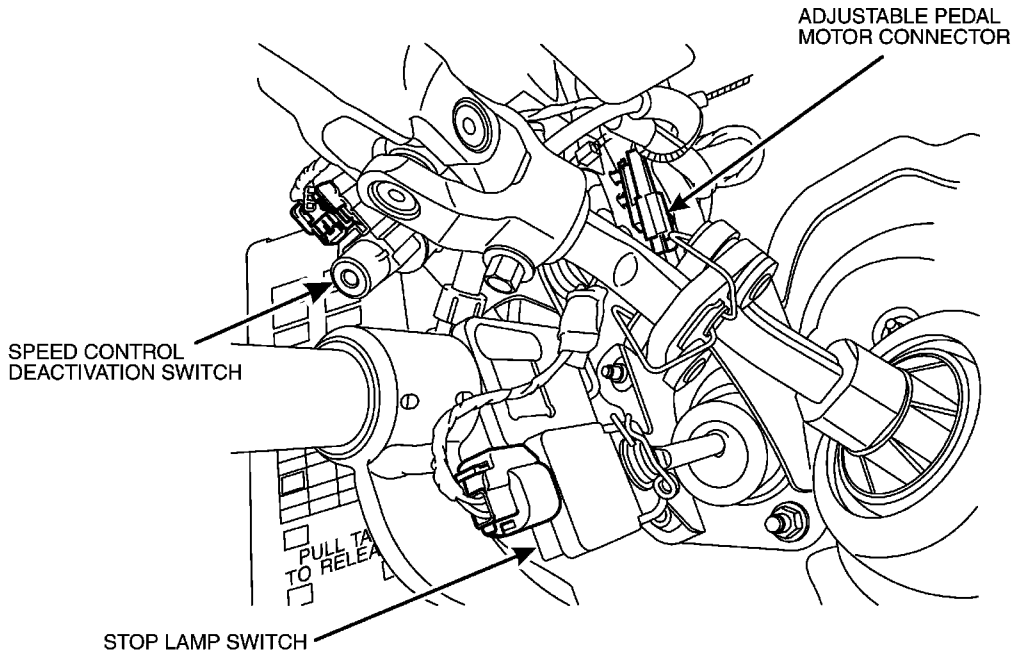


Figure 1 - Article 02-5-1

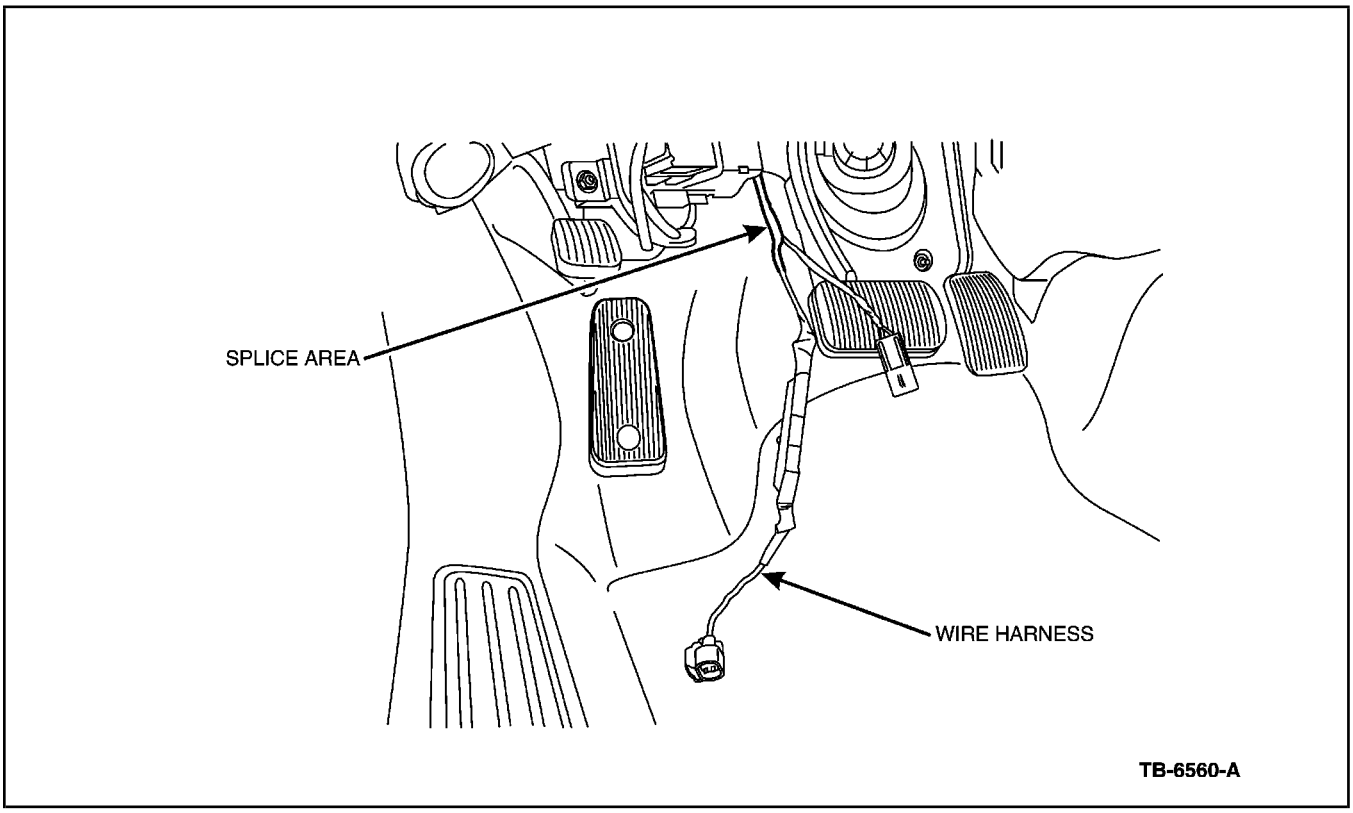


Figure 2 - Article 02-5-1

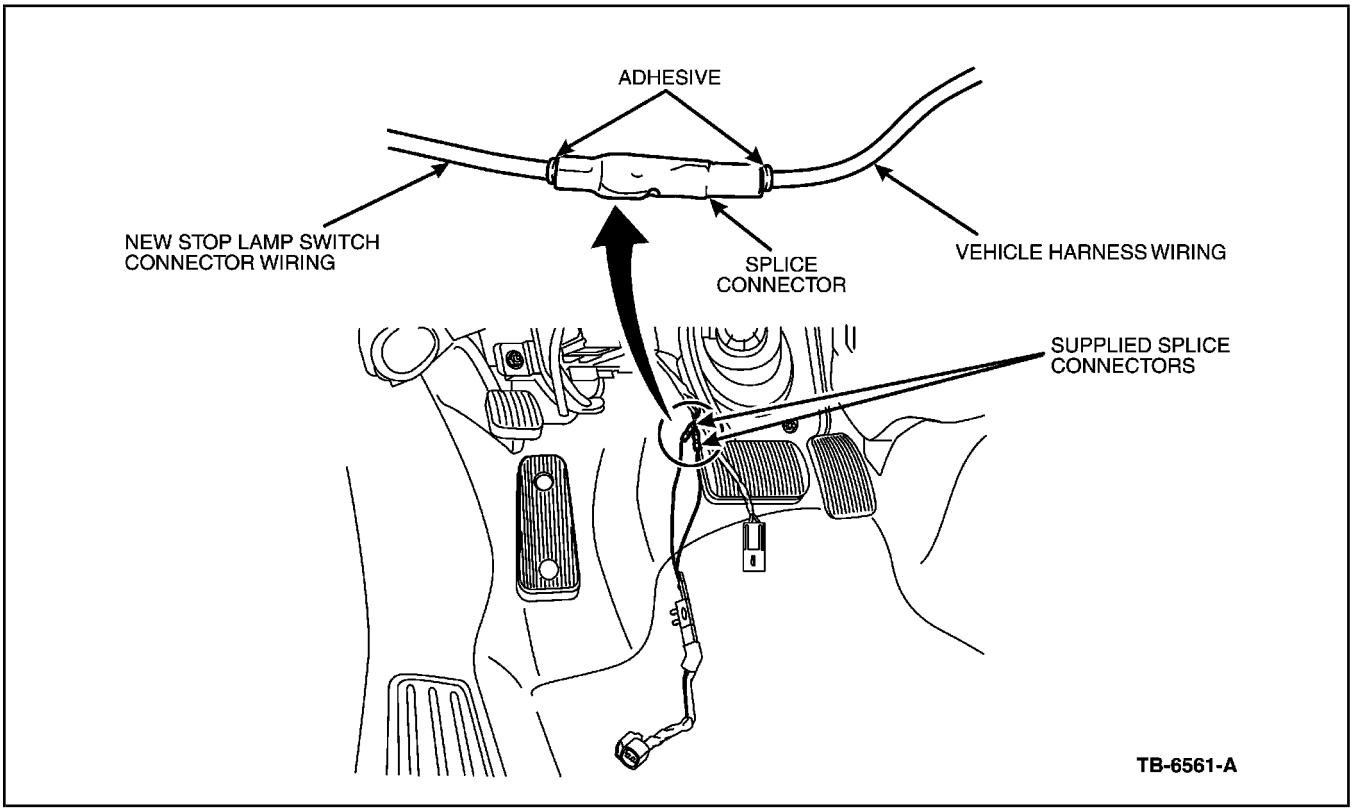


Figure 3 - Article 02-5-1

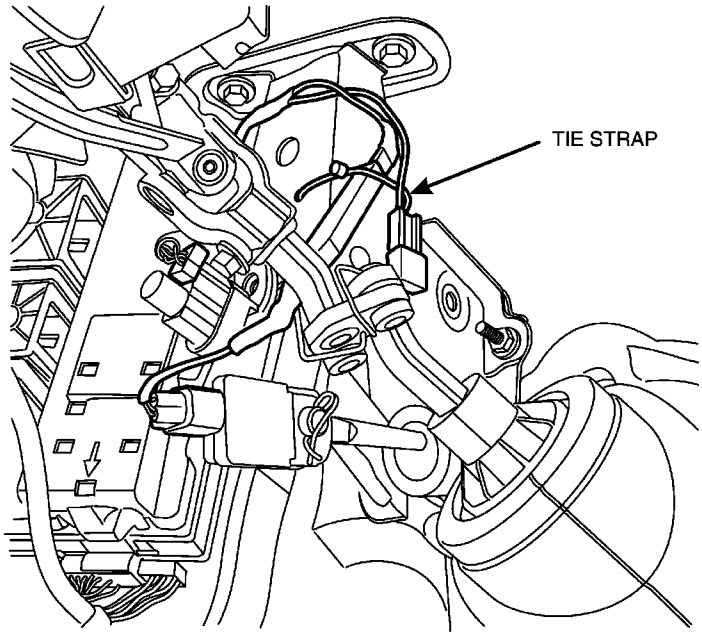


Figure 4 - Article 02-5-1