ENGINE—OIL LEAK FROM POSITIVE CRANKCASE VENTILATION (PCV) VALVE AREA—VEHICLES BUILT BEFORE 5/17/2002 EQUIPPED WITH 4.6L 2V ENGINE ONLY

Article No. 02-17-2

FORD: 2002 MUSTANG

ISSUE

Some vehicles equipped with a 4.6L 2V engine built before May 17, 2002, may exhibit an oil leak coming from the camshaft/valve cover area, where the positive crankcase ventilation (PCV) valve mounts. This leak may be caused by the stack up tolerance between the PCV valve and tube assembly.

ACTION

Verify condition. To service, install hose clamp onto the PCV tube assembly at the PCV valve. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

1. Verify that oil is present on the cam cover area.
2. If oil is present, remove the Air cleaner outlet tube per the Workshop Manual (Section 303-12-3).
3. Disconnect the tube from the PCV valve per the Workshop Manual (Section 303-08-7).
4. Install hose clamp (376240-S100) onto tube assembly, with the worm gear down (Figure 1).
5. Re-install tube assembly onto the PCV valve per the Workshop Manual.
6. Tighten the hose clamp to 12-20 Lb-in (1.3-2.3 N•m).
7. Re-install air cleaner outlet tube per the Workshop Manual.
8. Clean excess oil from the cam cover area.
9. Check to make sure the engine has the proper oil level.
10. Verify repair.

PART NUMBER	PART NAME
376240-S100	Hose Clamp

OTHER APPLICABLE ARTICLES: NONE

WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage And Emissions Warranty Coverage

OPERATION	DESCRIPTION	TIME
021702A	Install Hose Clamp Onto The PCV Tube Assembly	0.4 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
6A666	42

OASIS CODES: 401000

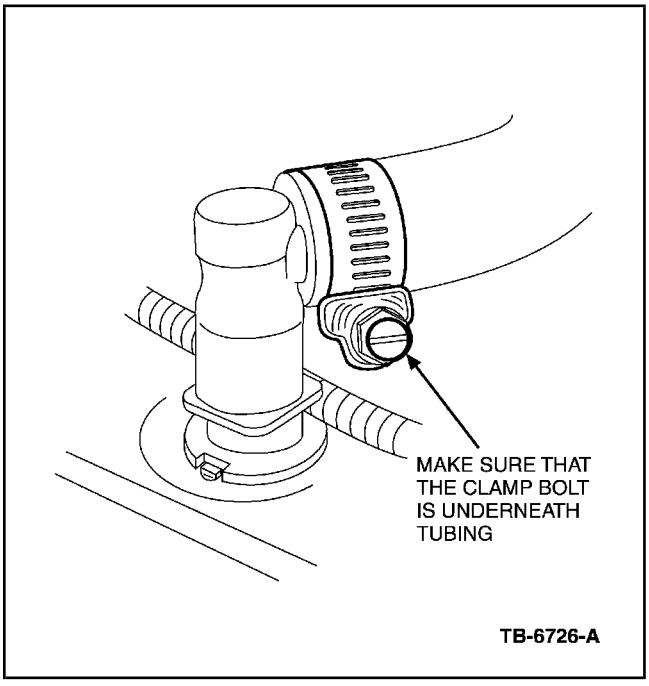


Figure 1 - Article 02-17-2

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the Bulletin applies to your vehicle.

Copyright © 2002 Ford Motor Company