• **SUSPENSION—POP/CLUNK NOISE FROM THE FRONT SPRINGS OVER BUMPS OR WHEN TURNING—DEBRIS ACCUMULATION IN SPRING SEAT—CANADA VEHICLES ONLY** • **NOISE—POP/CLUNK NOISE FROM THE FRONT SPRINGS OVER BUMPS OR WHEN TURNING—DEBRIS ACCUMULATION IN SPRING SEAT—CANADA VEHICLES ONLY**	**Article No. 02-15-2**

FORD: 1996-2003 WINDSTAR

ISSUE

Some vehicles may exhibit a popping/grinding noise from the front of the vehicle when going over bumps or making turns. This may be caused by stones or debris building up on the front strut lower spring seat.

ACTION

Install rubber isolators to each of the front springs. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

Confirm the noise is in the front of the vehicle from the springs. Inspect the front springs for rocks or other debris building up on the lower spring seat. If rocks are built up on the spring seat perform the following service procedure and install 3F2Z-5414-AA rubber isolators on the front springs.

1. Remove the front springs per Section 204-01 (1999-2003) or Section 04-01 (1996-1998) of the appropriate model year Workshop Manual.
2. The existing rubber isolator (5414) on the lower spring should be removed and discarded.
3. The service repair requires 3 rubber isolators 3F2Z-5414-AA, per vehicle. Each front spring requires 1 1/2 isolators. One of the three isolators should be cut in half (Figure 1).
4. The half piece (180 degree arc) should be installed on the coil first, starting at the lower end.
5. The full piece (360 degree arc) should be installed in the spring starting where the first piece ended (Figure 2).
6. Re-assemble per Section 204-01 (1999-2003) or Section 04-01 (1996-1998) of the appropriate model year Workshop Manual.

PART NUMBER	PART NAME
3F2Z-5414-AA	Spring Isolator

OTHER APPLICABLE ARTICLES: NONE

WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
021502A	Install Revised Front Spring Isolators Following Service Procedure (Includes Time To Remove And Install Springs)	1.8 Hrs.

Copyright © 2002 Ford Motor Company

Article No. 02-15-2 Cont'd.

DEALER CODING

BASIC PART NO.	CONDITION CODE
5310	55

OASIS CODES: 304000, 702000, 702100

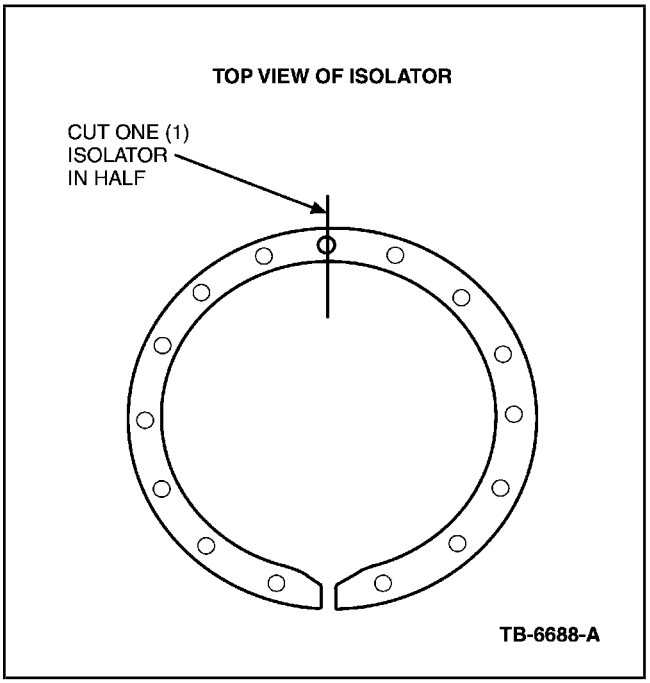

Figure 1 - Article 02-15-2

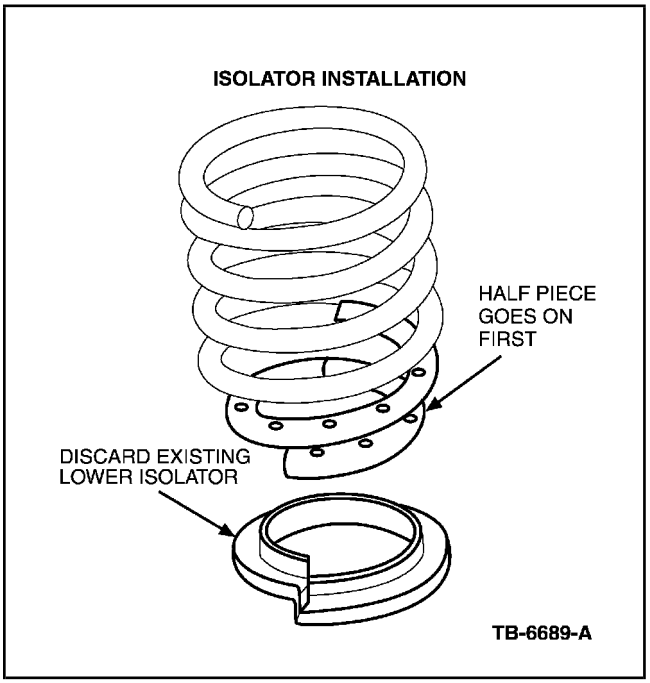

Figure 2 - Article 02-15-2