DRIVEABILITY—COLD START IDLE DIP—VEHICLES EQUIPPED WITH 4.0L SOHC AND AUTOMATIC TRANSMISSION—VEHICLES BUILT BEFORE 11/27/2000

Article No. 01-2-3

FORD: 2001 RANGER

ISSUE

Some vehicles equipped with a 4.0L engine and automatic transmission built prior to 11/27/2000 may exhibit a cold start neutral idle dip. This may be caused by the Powertrain Control Module (PCM) calibration.

ACTION

Verify the condition. If normal diagnostics cannot pinpoint condition, reprogram the PCM to the latest level calibration. Refer to the following PCM Calibration Information Chart.

PCM CALIBRATION INFORMATION

Application	Old Part Number (-12A650-)	Tear Tag	New Part Number (-12A650-)	Old Calibration	New Calibration	NGS/WDS Qualifier
2001, 4.0L, A/T, 4X2 with Regular Cab	1L5F-LB	HJG0	1L5Z-BDA	1R31A40505	1R31A40515	WDS Release B11_3
2001, 4.0L, A/T, 4X2 with SuperCab	1L5F-MB	VQP0	1L5Z-BFA	1R31B40505	1R31B40515	WDS Release B11_3
2001, 4.0L, A/T, 4X4 with 3.55 or 4.10 axle	1L5F-MB	VQP0	1L5Z-BFA	1R31B40505	1R31B40515	WDS Release B11_3
2001, 4.0L, A/T, 4X4 with 3.73 axle	1L5A-AHA	MEA0	1L5Z-BBA	1R31C40500	1R31C40515	WDS Release B11_3

Obtain an Authorized Modifications Decal (FPS 8262 - obtainable through DOES II, 25/pkg) and list the date, dealer number, and summary of modifications performed. Select a prominent place adjacent to the Vehicle Emission Control Information Decal suitable for installing the Authorized Modifications Decal. Clean the area, install the decal, and cover it with a clear plastic decal shield.

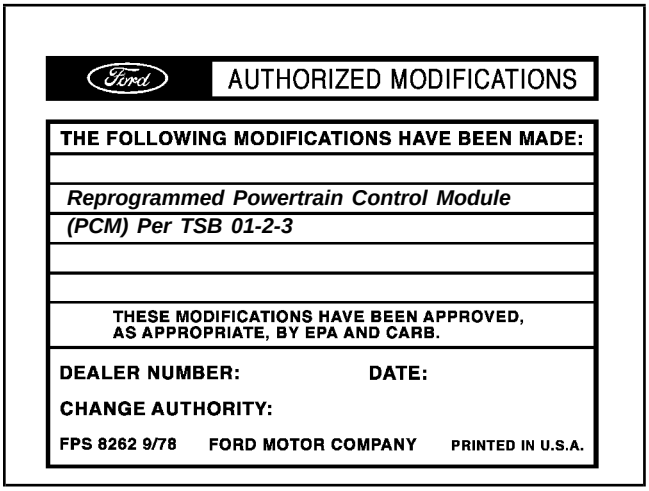

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: INFORMATION ONLY
OASIS CODES: 608000, 608400, 618400

Copyright © 2001 Ford Motor Company