- **AIR CONDITIONING—"FLUTTERING" NOISE FROM DEFROST DOOR DURING A/C FULL COOL MODE AND BLOWER MOTOR ON HIGH—VEHICLES BUILT THROUGH 1/1/2000**
- **NOISE—"FLUTTERING" HEARD WITH A/C FULL COOL MODE AND BLOWER MOTOR ON HIGH—VEHICLES BUILT THROUGH 1/1/2000**

Article No. 00-6-6

FORD: 2000 FOCUS

ISSUE

Some vehicles may exhibit a panel/defrost door "fluttering" noise when the climate control system is in full cool, blower on high speed, and 1 to 2 clicks above panel/floor mode.

ACTION

Verify that all washers are in place on the banana linkage, install missing washers on the banana linkage, and/or tighten the mounting screw 1/4-1/2 turn. This should reduce the possibility of noise. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

1. Locate the banana linkage on the plenum which is located under the driver side instrument panel on the plenum assembly. The banana linkage connects the gear box cam to the panel/defrost door crank on the air handling case (plenum).
2. Inspect the banana linkage and verify that all washers are in place and installed correctly. Two (2) black Washers (44711-S2) should be found between the banana linkage and the door crank. One gold Washer (E830293-S72) should be located under the banana linkage mounting screw. Install any missing washers (Figure 1).
3. If all the washers are present and correctly installed, tighten the banana linkage mounting screw 1/4-1/2 turn until the flutter noise cannot be detected.
4. Verify concern is corrected.

PART NUMBER	PART NAME
44711-S2 E830293-S72	Washer (Black) Washer (Gold)

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
000606A	Repair Panel/Defrost Door Flutter Noise	0.2 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
19B555, 18478	33

OASIS CODES: 208000, 208300, 208999, 702300

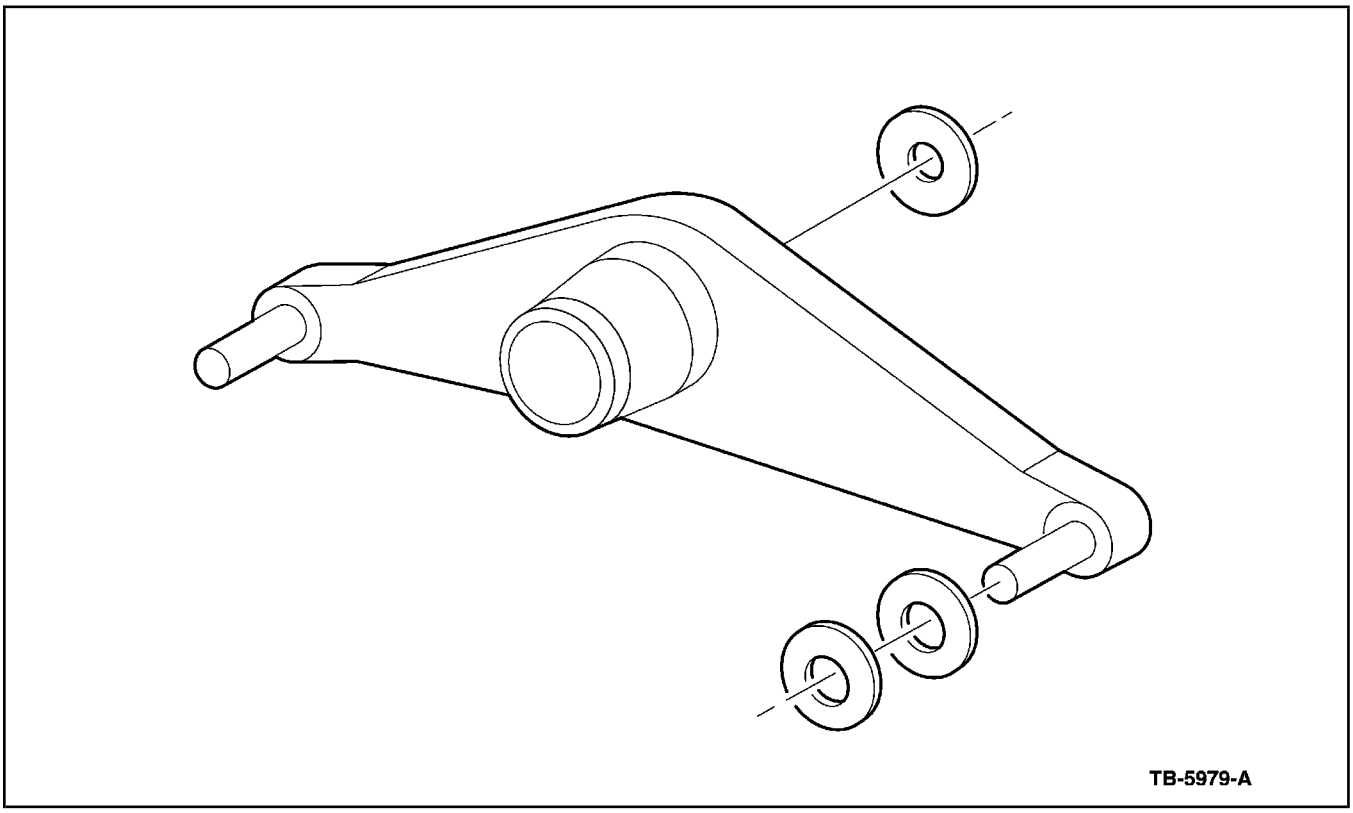

Figure 1 - Article 00-6-6