ELECTRICAL—BRAKE LAMPS STAY ON—VEHICLES BUILT THROUGH 9/22/2000	Article No. 01-16-2

MERCURY: 1999-2001 COUGAR

ISSUE

Some vehicles built prior to 09/22/2000 may exhibit the brake lamps staying on. This may be caused by the brake lamp switch being moved out of position.

ACTION

Install clip 1S8Z-2C540-AA, to secure the Brake Lamp Switch to the pedal bracket. Refer to the following Service Procedure for details.

Service Procedure

Remove the Brake Lamp Switch and reinstall to ensure proper positioning. Install "Clip" 1S8Z-2C540-AA, to secure the Brake Lamp Switch to the pedal bracket. Refer to Figure 1 for location description.

PART NUMBER	PART NAME
1S8Z-2C540-AA	Clip

OTHER APPLICABLE ARTICLES: NONE

WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
011602A	Install Clip To Secure Brake Lamp Switch (Includes Time To Reinstall Brake Lamp Switch)	0.2 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
2C540	42

OASIS CODES: 201000, 201200

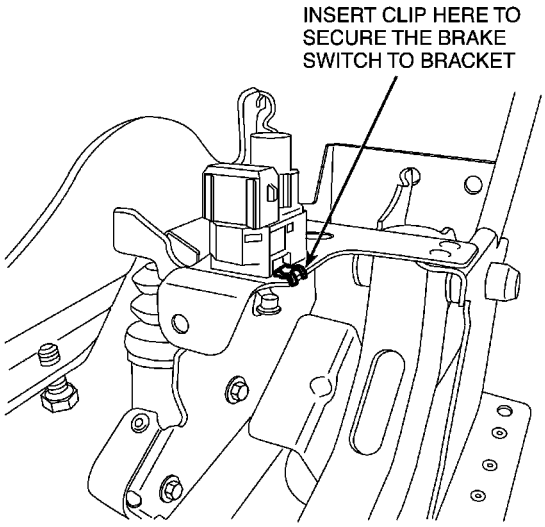


Figure 1 - Article 01-16-2

Copyright © 2001 Ford Motor Company