Ford Motor Company

A.R. O'Neill
Director
Vehicle Service and Programs
48121
Ford Customer Service Division

Ford Motor Company
P. O. Box 1904
Dearborn, Michigan

September 2001

TO: All Ford and Lincoln Mercury Dealers

SUBJECT: Owner Notification Program 01B84: Certain 2001 Model Year Taurus and Sable Vehicles – Improper Ethylene Glycol Concentration

OASIS : Yes
OWNER LIST: Yes
PARTS RETURN: No
PROGRAM TERMS: This program will be in effect until February 28, 2002, regardless of mileage.

AFFECTED VEHICLES

Certain 2001 model year Taurus and Sable vehicles equipped with either the 3.0L Vulcan 2V engine or the 3.0L Duratec 4V engine built from June 25, 2001 through June 27, 2001 at the Atlanta Assembly Plant.

REASON FOR PROGRAM

Some of the affected vehicles may have a high concentration of ethylene glycol in the engine's cooling system. A high concentration of ethylene glycol in the engine's cooling system may result in engine damage if the coolant is not adjusted to the proper mixture. Performing the recommended service procedure will prevent engine damage from occurring.

SERVICE ACTION

Dealers must perform the cooling system service procedure on all affected vehicles. The cooling system service procedure for most vehicles will entail checking and adjusting the ethylene glycol concentration. Some vehicles will have the proper ethylene glycol concentration. These vehicles will not require any further service.

NOTE: Adjusting the ethylene glycol concentration to its proper concentration will protect the engine against permanent damage. In rare cases, where engine damage has occurred, the dealership must call the Special Service Support Center at 1-800-325-5621 for engine replacement approval. Claims for engine replacement without prior approval will not be accepted for payment.

© Copyright 2001 Ford Motor Company

ATTACHMENTS

Attachment I: Administrative Information
Attachment II: Labor Allowances and Parts Ordering Information
Attachment III: Technical Information
Customer Notification Letter

QUESTIONS?

Claims Information:……1-800-423-8851
Other Program Questions:……..1-800-325-5621

Sincerely,

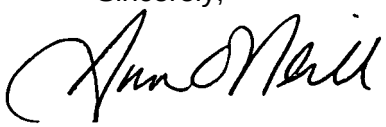

Ann O'Neill
Director
Vehicle Service and Programs

© Copyright 2001 Ford Motor Company

Owner Notification Program 01B84
Certain 2001 Model Year Taurus and Sable Vehicles
Improper Ethylene Glycol Concentration

OASIS

You must use OASIS to determine if a vehicle is eligible for this program.

PLEASE NOTE

Correct all vehicles in stock before delivery.

DEALER-OWNER CONTACT

Promptly correct all affected vehicles on your dealer Recall/ONP Online Involved Unit Listings available on QCDealer.com. Also, correct other eligible vehicles which are brought to your dealership.

NOTE: These dealer listings may contain customer names and addresses obtained from Motor Vehicle Registration Records. The use of such motor vehicle registration data for any purpose other than in connection with this field service action is a violation of law in several states/provinces/countries. Accordingly, limit the use of this listing to the follow-up necessary to complete this action.

CLAIMS PREPARATION AND SUBMISSION

- Enter claims using DWE.
- Refer to ACESII manual for claims preparation and submission information.

OWNER REFUNDS

Ford Motor Company will only refund owner-paid repairs made before the date of the Owner Letter (or after the date of the Owner Letter if an emergency repair was made away from the servicing dealer.) Refer to ACESII manual for refund information.

Program Code:	01B84
Misc. Expense:	REFUND
Misc. Expense:	ADMIN
Misc. Expense:	0.2 Hr.

RENTAL CARS

Ford Motor Company will pay for a rental vehicle (except insurance and fuel which will be at the owners expense) under this program for customers only if approved for engine replacement by the Special Service Support Center. Enter the word "RENTAL" plus the number of days the vehicle was used in the Miscellaneous Expense field of the claim.

© Copyright 2001 Ford Motor Company

Owner Notification Program 01B84
Certain 2001 Model Year Taurus and Sable Vehicles
Improper Ethylene Glycol Concentration

LABOR ALLOWANCES

Description	Labor Operation	Labor Time
Vulcan (2V) or Duratec (4V) Engines - Inspect Coolant Only (Coolant Mixture OK)	01B84A	0.2 Hrs
Vulcan (2V) Engine - Inspect Coolant, Check for DTC's, Perform Engine Load Test and Adjust Ethylene Glycol Concentration	01B84B	0.9 Hrs
Duratec (4V) Engine - Inspect Coolant and Adjust Ethylene Glycol Concentration	01B84C	0.8 Hrs
Vulcan (2V) Engine With DTC's or Drivability Symptoms*: Inspect Coolant, Check for DTC's, Perform Engine Load Test, Inspect Spark Plugs, Perform Compression Test and Adjust Ethylene Glycol Concentration	01B84D	1.5 Hrs

*This operation (01B84D) is only to be used when there was a DTC or drivability symptom but diagnostics revealed the cause is unrelated to the ethylene glycol concentration in the engine. Do not use this operation if engine damage has resulted from the ethylene glycol concentration and engine replacement will be performed. The **Special Service Support Center** will provide labor operations upon approval for a replacement engine. Base engine diagnostics are covered in the operation for engine replacement. The engine replacement procedure may be found in the 2001 Taurus/Sable shop manual. Drivability symptoms that persist (as well as their repairs) are considered unrelated to the ethylene glycol concentration in the engine and this program. The repairs for unrelated drivability symptoms may still be covered under any remaining vehicle warranty coverage.

© Copyright 2001 Ford Motor Company

PARTS REQUIREMENTS

Parts Ordering Information

No parts are required to perform this service procedure. If a replacement engine is required due to mechanical damage, **Vulcan (2V)** engines and claiming instructions are available though the **Special Service Support Center.** Please have compression test and/or spark plug inspection results ready to provide to the analyst as well as the engine serial number, part number, build date, engine code, model number, and description of the concern.

Since the **Duratec (4V)** engines are equipped with aluminum cylinder heads which transfer heat more efficiently, it is unlikely engine damage may have occurred as a result of a high ethylene glycol concentration. If engine damage due to a high ethylene glycol concentration is suspected, base engine diagnostics should be performed per the 2001 Taurus/Sable Shop Manual. If the cause is determined to be damage that resulted from a high ethylene glycol concentration, contact the **Special Service Support Center**.

Special Service Support Center 1-800-325-5621

DEALER PRICE

For latest prices, check DOES II or updated price book.

EXCESS STOCK RETURN

Excess stock returned for credit must have been purchased from Ford Customer Service Division in accordance with Policy Procedure Bulletin 4000.

© Copyright 2001 Ford Motor Company