TRANSMISSION—5R55W—FLUID LEAK FROM TRANSMISSION COOLER LINES AT TRANSMISSION CASE CONNECTION—EXPLORER/MOUNTAINEER 4-DOOR VEHICLES BUILT 11/13/2000 THROUGH 4/2/2001 ONLY

Article No. 01-10-2

FORD: 2002 EXPLORER

MERCURY: 2002 MOUNTAINEER

ISSUE

Some 2002 Explorer/Mountaineer 4-door vehicles built 11/13/2000 through 4/2/2001 equipped with the 5R55W transmission may exhibit a fluid leak at the transmission cooler line-to-transmission case connection. This may be caused by contamination on the cooler tube between the tube nut and flare, contamination on the tube nut threads or improper installation torque.

ACTION

If fluid is leaking from the cooler lines at the transmission, the cooler line tube nuts and lines will need to be disconnected, cleaned and a service O-ring installed into the case fitting. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

Use the following service procedure to repair the cooler line leak.

1. Remove the cooler lines from the transmission (Figure 1).
2. Clean the cooler tube nut threads, clean the cooler lines at the flare and the cooler line surfaces between the line and the cooler tube nuts (Figure 2).
3. Install the service O-rings (W702015-S300) as shown in Figure 3.
4. Reinstall the cooler lines into the case and tighten the cooler tube nuts to 30 N•m (22 lb-ft) (Figure 4).
5. Clean all residual fluid from around the cooler line fittings.
6. Start vehicle and check for leaks.
7. Verify fluid level (refer to the appropriate Workshop Manual, Section 307-01) for proper procedure. Add fluid as necessary.

PART NUMBER	PART NAME
W702015-S300	O-Ring (2 Required Per Vehicle)

OTHER APPLICABLE ARTICLES: NONE

WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
011002A	Install O-Rings On Transmission Cooler Lines (Includes Time To Disconnect, Clean And Install O-Rings)	1.0 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
7D273	42

OASIS CODES: 501000, 504000

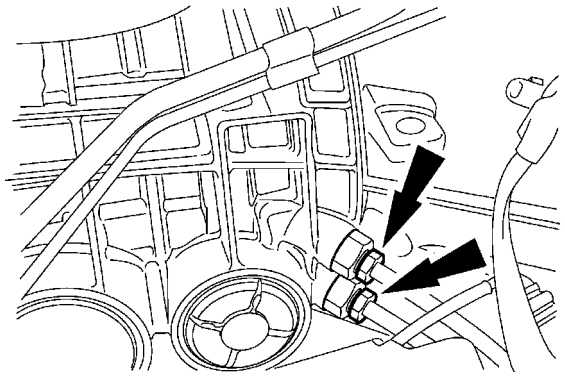

Figure 1 - Article 01-10-2

Copyright © 2001 Ford Motor Company

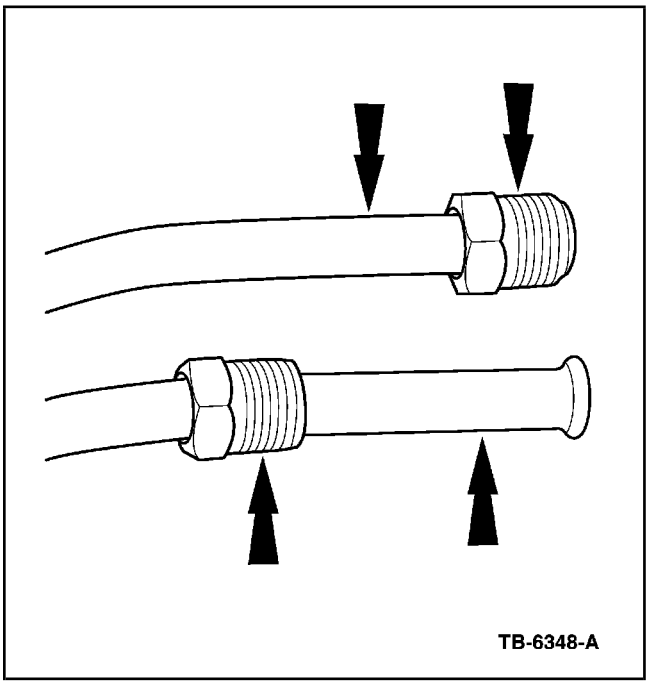

Figure 2 - Article 01-10-2

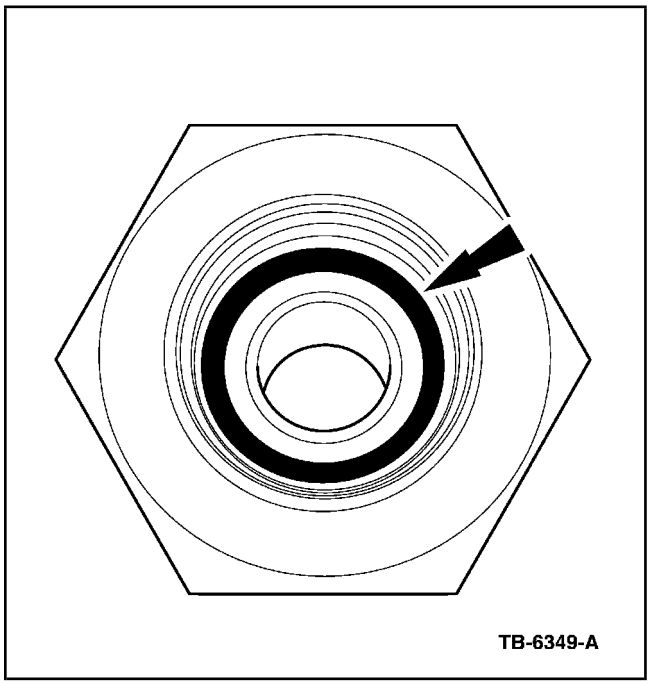

Figure 3 - Article 01-10-2

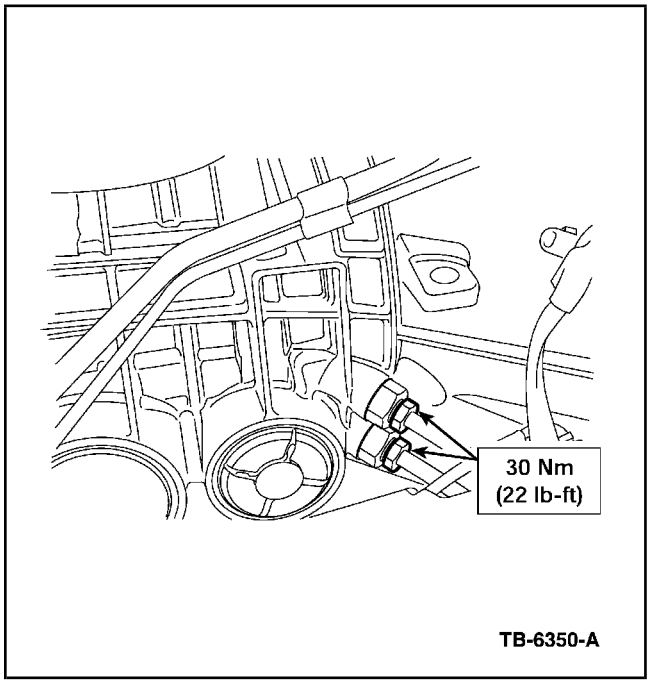

Figure 4 - Article 01-10-2