Ford Motor Company

A.R. O'Neill
Director
Vehicle Service and Programs
48121
Ford Customer Service Division

Ford Motor Company
P. O. Box 1904
Dearborn, Michigan

May 2002

TO: All Ford and Lincoln Mercury Dealers

SUBJECT: Owner Notification Program 01B78 - Supplement #2 - All 1999 and 2000 Model Year Contour and Mystique Vehicles - Instrument Panel Cover Warpage:

1. Revised Repair and Technical Instructions
2. Availability of New Repair Components
3. New Labor Times for Revised Repair Procedure

OASIS : Yes (OASIS will be reactivated the week of June 10, 2002 for this program)
OWNER LIST: Yes
PARTS RETURN: No
PROGRAM TERMS: This program will be in effect until August 31, 2002, regardless of mileage.

This program will be temporarily suspended on Tuesday May 28, 2002 and will be reinstated the week of June 10, 2002 to allow time to roll out the revised repair kit. All repairs after June 10, 2002 must be completed per Attachment III of this supplement.

REFERENCE: Owner Notification Program 01B78, dated August, 2001 and 01B78 Supplement #1 dated December 2001: All 1999 and 2000 Model Year Contour and Mystique Vehicles - Instrument Panel Cover Warpage

NOTE: Owner Notification Program 01B78 is being republished in its entirety. 01B78 Supplement #2 supersedes 01B78 and 01B78 Supplement #1. Please discard all previous copies and replace them with this supplement.

REASON FOR THIS SUPPLEMENT

The instrument panel repair procedure has been enhanced to address some of the dealer-identified issues regarding appearance and repair complexity. These concerns have led to both dealer dissatisfaction and a high instrument panel replacement rate. Since the repair procedure has been revised, please note that the labor time for the new repair procedure has been revised as well. The revised repair procedure requires the use of a new repair kit that includes a **new defroster grille cover that is placed on top of the defroster grille**.

AFFECTED VEHICLES

All 1999 and 2000 MY Contour and Mystique vehicles built from the beginning of production for the 1999 model year to the end of production for the 2000 model year. All vehicles that have **not** had 01B78 or 01B78 S1 completed, regardless of whether the warpage is visible or not, should be serviced as soon as possible before expiration of this program.

© Copyright 2001 Ford Motor Company

REASON FOR PROGRAM

Some of the original affected vehicles may experience warpage of the instrument panel cover at the front edge of the instrument panel cover near the windshield, above the instrument cluster and around the glove compartment. The warpage is accelerated in warmer climates and may not yet be apparent on vehicles operated in cooler climates. The warpage does not prevent normal function, but results in objectionable appearance.

SERVICE ACTION

Dealers must install instrument panel repair kits on all vehicles that have not had the repair performed per Owner Notification Program 01B78 or 01B78 Supplement #1. This repair must be performed even if visible warpage is not yet present.

Note: Instrument panel replacement is no longer covered under this program. Claims for instrument panel replacement with a repair date after May 28, 2002 will not be accepted for payment.

Note: Vehicles that were repaired previously by either 01B78 or 01B78 Supplement #1 were repaired with a validated repair kit and do not require any further repair.

IMPORTANT FACTS

- Since all instrument panels on affected vehicles are expected to warp, we highly recommended that OASIS be accessed to determine eligibility, and dealers should repair any in-stock units or vehicles currently at dealership for repair or maintenance.
- This program duration will not be extended nor will customers be notified again.
- This program expires August 31, 2002.
- This program does not cover instrument panel replacement. Instrument panel replacement can be requested using the following provisions:
    1. **Contact Dealers** - Your Ford Field Service Engineer must grant an approval after inspection of the instrument panel and deems the instrument panel "not repairable" for warpage. This program does not cover cosmetic issues such as foam voids or bubbles, damage or discoloration with the instrument panel.
    2. **Select Dealers** – Must call the Special Service Support Center at 1-800-325-5621 for prior approval. Failure to obtain approval will result in denial of the warranty claim. Replaced Instrument panels will be requested for inspection on a random basis.

© Copyright 2001 Ford Motor Company

ATTACHMENTS

Attachment I:	Administrative Information
Attachment II:	Labor Allowances and Parts Ordering Information
Attachment III:	Technical Information
Owner Notification Letter:	Previously Sent to all 1999-2000 Contour and Mystique Owners

QUESTIONS?

Claims Information:……1-800-423-8851
Other Program Questions:……..1-800-325-5621

Sincerely,



Ann O'Neill
Director
Vehicle Service and Programs

© Copyright 2001 Ford Motor Company

Owner Notification Program 01B78-S2
All 1999 and 2000 Model Year Contour and Mystique Vehicles
Instrument Panel Cover Warpage

OASIS

You must use OASIS to determine if a vehicle is eligible for this program. OASIS will be deactivated on May 28, 2002 and reactivated June 10, 2002.

PLEASE NOTE

Correct all vehicles in stock before delivery.

DEALER-OWNER CONTACT

Promptly correct all affected vehicles on your dealer Recall/ONP Involved Unit Listing available on QCDealer.com. Also, correct other eligible vehicles, which are brought to your dealership and contact customers who have not yet scheduled an appointment for their instrument panel repair.

CLAIMS PREPARATION AND SUBMISSION

- Enter claims using DWE.
- Refer to ACESII manual for claims preparation and submission information.
- **No** "MT" time will be allowed for the repair procedure. Only labor operations listed in Attachment II will be accepted unless authorized by the Special Service Support Center. If the Special Service Support Center approves the actual time, an approval code will be provided.
- Repairs dated prior to May 28, 2002 will use the original labor operations (01B78C, 01B78E and 01B78F).
- Repairs dated after June 10, 2002 will use the labor operation 01B78G, 01B78F will no longer be accepted for payment with repair dates after June 10, 2002.
- Claims for instrument panel replacement with a repair date after May 28, 2002 will not be accepted for payment.

OWNER REFUNDS

Ford Motor Company will only refund owner-paid repairs made before the date of the Owner Letter (or after the date of the Owner Letter if an emergency repair was made away from the servicing dealer). Refer to ACESII manual for refund information.

Program Code:	01B78
Misc. Expense:	REFUND
Misc. Expense:	ADMIN
Misc. Expense:	0.2 Hr.

Refer to ACESII manual for refund information.

RENTAL CARS

Rental vehicles are not authorized for this program.

© Copyright 2001 Ford Motor Company

Owner Notification Program 01B78-S2
All 1999 and 2000 Model Year Contour and Mystique Vehicles
Instrument Panel Cover Warpage

LABOR ALLOWANCES

Base Labor Operations		
Description	**Labor Operation**	**Labor Time**
Install Instrument Panel Repair Kit Using Revised Procedure From Attachment III of 01B78-S2 (Repairs dated from June 10, 2002 forward)	**01B78G**	**1.9 Hours**

***for repairs dated prior to May 28, 2002, refer to previous labor operations**

PARTS REQUIREMENTS

Parts Ordering Information

The new instrument panel repair kit will be available the week of June 10, 2002. They will not be direct shipped for this program. Order your parts requirements as outlined below.

Repair Kit

All Orders	*Effective immediately	Call 1-800-325-5621
Stock and Interim Orders	July 1, 2002 and after	Normal order process
Emergency Orders	July 10, 2002 and after	Normal order process

*Part will not be available until the week of June 10, 2002.

Part Number	Description	Quantity
1S2Z-5404282-DA	Instrument Panel Repair Kit	1

Tool Allowance		
Tool Allowance for Touch-up Paint and Drill Stop Procurement	$1.00 Per claim	Misc. Expense Code **"HANDLG"**

ORDER INFORMATION

DOR/COR number **50256** identifies parts ordered for this campaign.

DEALER PRICE

For latest prices, check DOES II or updated price book.

EXCESS STOCK RETURN

Excess stock returned for credit must have been purchased from Ford Customer Service Division in accordance with Policy Procedure Bulletin 4000.

© Copyright 2001 Ford Motor Company

Ford Motor Company

A.R. O'Neill
Ford Motor Company
P. O. Box 1904
Dearborn, Michigan 48121
www.ownerconnection.com

August 2001

01B78

Mr. John Sample
123 Main Street
Anywhere, USA 12345

Your Vehicle Identification Number: 12345678901234567

At Ford Motor Company, we always have your satisfaction in mind. As a result, we are providing a no-charge service to our 1999 and 2000 model year Ford Contour and Mercury Mystique owners, Customer Satisfaction Program Number 01B78.

Reason For This Program…

The cover on your instrument panel may warp. This warpage, if present, will first occur in the areas around the defroster grill opening at the top of the instrument panel. This may occur when the instrument panel cover begins to separate from the instrument panel substrate during exposure to high ambient temperatures and may eventually progress to a noticeable level.

What *Ford Motor Company* and your dealer will do…

Ford Motor Company is providing repair coverage to all owners of affected vehicles. At no cost to you, your dealership will evaluate the condition of your instrument panel and repair as required. This program will be in effect until August 31, 2002, regardless of mileage.

What we are asking you to do…

Call your dealer without delay. Provide the dealer with your Vehicle Identification Number (located at the beginning of this letter). Ask for a service date and whether parts are in stock for Owner Notification Program 01B78. If parts are not in stock, they can be ordered prior to scheduling a service appointment. Parts would be expected to arrive within a week of ordering. If you do not have a servicing dealer, please access www.dealerconnection.com for dealer addresses, maps, and driving instructions.

How long will it take…

The time needed for this repair is less than one-half day. However, due to service scheduling requirements, your dealer may need your vehicle for a longer period of time.

© Copyright 2001 Ford Motor Company

Refunds…

If you already paid to have your instrument panel replaced due to warpage before the date of this letter, Ford Motor Company is offering a refund. For the refund, please give your paid original receipt to your dealer. To avoid delays, do not send receipts to Ford Motor Company.

If you've changed address or sold the vehicle…

Please fill out the enclosed prepaid postcard and mail it to us so we can update our records. If you have sold the vehicle, the information you provide on the postcard will be used to notify the new owner about this program.

If you have concerns …

If you have trouble getting your vehicle repaired promptly and without charge, please contact your dealership's Service Manager for assistance.

If you still have concerns, please contact the Ford Motor Company Customer Relationship Center and one of our representatives will be happy to assist you:

Call (866) 436-7332
(800) 232-5952 (TDD for the hearing impaired.)

Office Hours: (Eastern Standard Time)

Monday-Friday: 8AM – 11PM
Saturday: 9AM – 6PM

Or you may contact us through the Internet …

www.ownerconnection.com


Quality Care service is there for you all year long.

QualityCare™ at your service

Quality Care is the commitment of Ford Motor Company and its dealerships to provide you with a superior service and ownership experience. While we regret the inconvenience caused by this program, we stand committed with our dealers to assist you with all of your automotive service needs. With our nationwide dealer network, we're here to ensure you receive Quality Care service so that your vehicle maintains peak performance throughout your ownership experience.

We pride ourselves on becoming the world's leading consumer company for automotive products and services. Again, we are sorry for the inconvenience. Thank you for your attention to this important matter.

Sincerely,

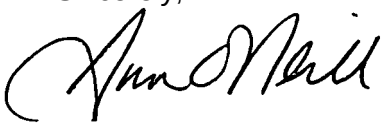

Ann O'Neill
Director
Vehicle Service and Programs

© Copyright 2001 Ford Motor Company