• **BRAKES—ANTI-LOCK BRAKE SYSTEM (ABS)—TIE STRAPS REQUIRED TO PREVENT SENSOR WIRE CHAFING—VEHICLES EQUIPPED WITH AIR BRAKES BUILT 11/23/1998 THROUGH 8/29/2000—SERVICE TIPS** • **ELECTRICAL—ANTI-LOCK BRAKE SYSTEM (ABS)—TIE STRAPS REQUIRED TO PREVENT SENSOR WIRE CHAFING—VEHICLES EQUIPPED WITH AIR BRAKES BUILT 11/23/1998 THROUGH 8/29/2000—SERVICE TIPS**	**Article No. 00-23-11**

FORD: 2000-2001 F-650, F-750

ISSUE

If the wheel speed sensor wires are not tie strapped correctly, it is possible for the wire to contact the wheel and/or brake drum. If the wire then becomes chafed, a false signal may be sent to the ABS electronic controller. The controller may then misinterpret these signals and falsely determine that the wheel is rotating at a different speed than it actually is. This may result in unwanted ABS activation.

ACTION

If any repairs to the air brake system or surrounding components require that these tie straps be removed, they must be replaced. Also, if any other tie straps are found missing from the wheel speed sensor wires on the vehicle, they should be installed. Refer to Figures 1 and 2 for the correct location of the tie straps for the wheel speed sensor wires.

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: INFORMATION ONLY
OASIS CODES: 203000, 203200, 206000, 301000

Copyright © 2000 Ford Motor Company

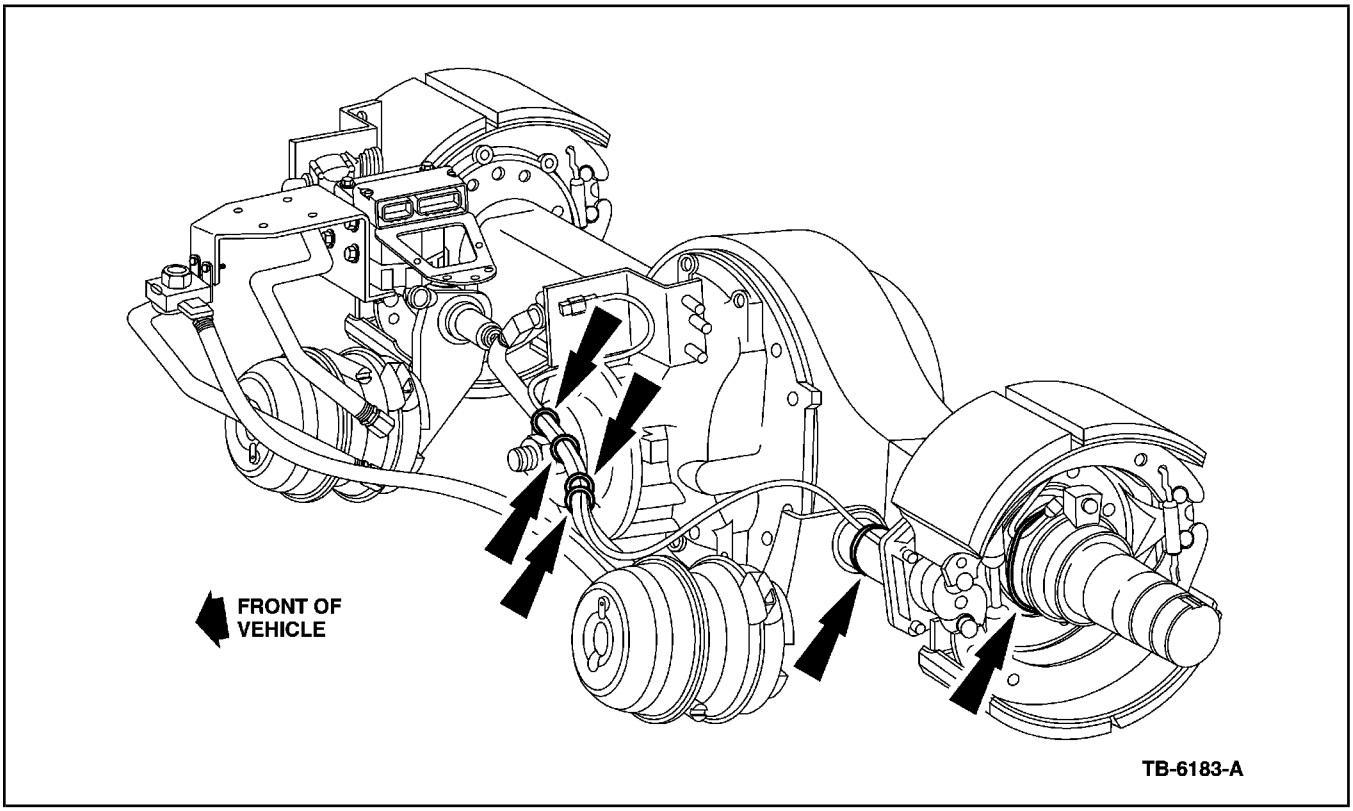

Figure 1 - Article 00-23-11

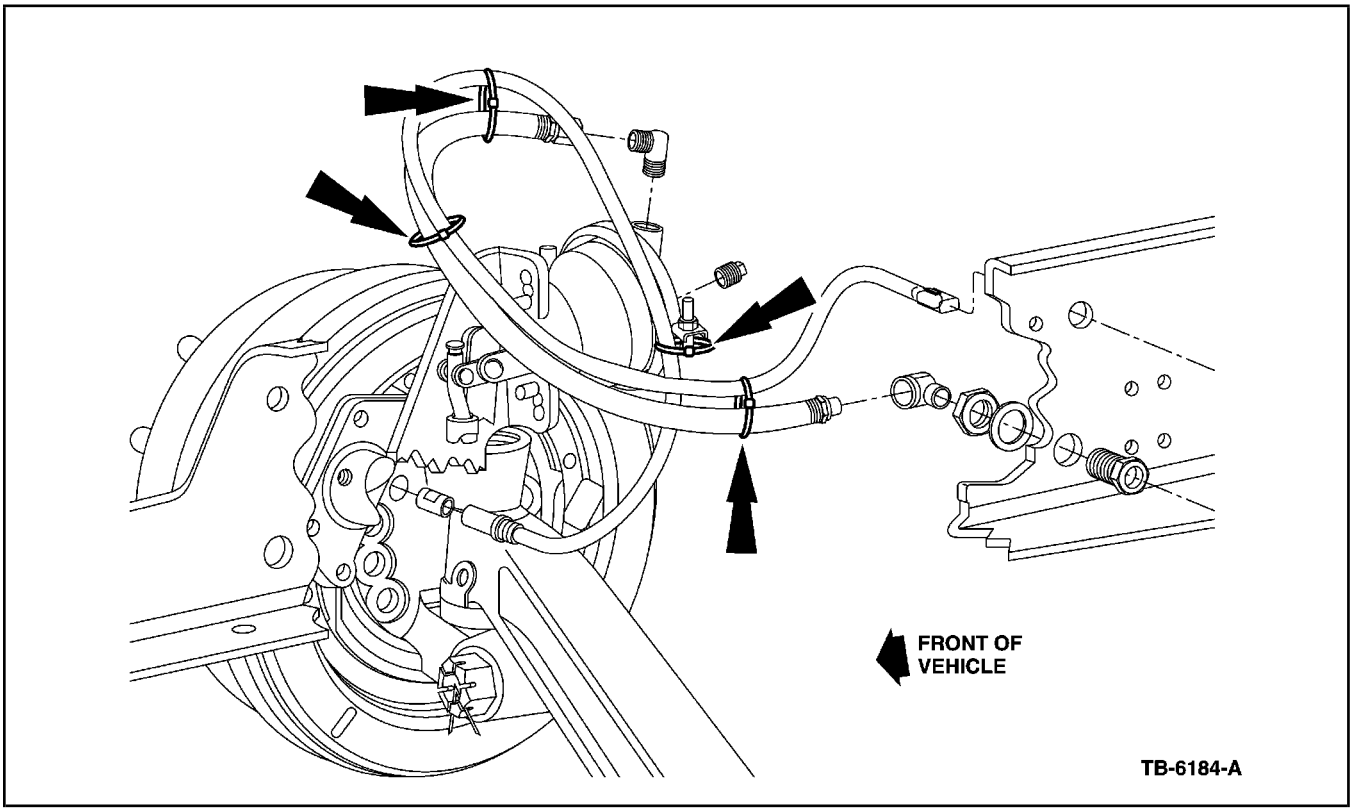

Figure 2 - Article 00-23-11