TRANSMISSION—4R100—DELAYED OR NO 2ND GEAR—DIAGNOSTIC TROUBLE CODES P0781, P0755 AND/OR P0756—VEHICLES EQUIPPED WITH 4R100 TRANSMISSION WITH TRANSMISSION BUILD DATES BETWEEN 7/27/2000 AND 3/23/2001 ONLY

Article No. 01-13-5

FORD: 2001 E SERIES, EXCURSION, EXPEDITION, F-150, SUPER DUTY F SERIES, SUPER DUTY F-53 STRIPPED CHAS.

LINCOLN: 2001 NAVIGATOR

ISSUE

Some 2001 vehicles equipped with 4R100 transmission, having a transmission build date between 7/27/2000 and 3/23/2001, may exhibit an intermittent, delayed or no second gear condition. Diagnostic Trouble Codes (DTC's) that may be set with this concern are P0781 (1-2 shift error), P0755 (shift solenoid B malfunction) and P0756 (shift solenoid B performance). This may be caused by the Intermediate One Way Clutch (mechanical diode style) not operating properly.

ACTION

Verify condition, follow normal diagnostics per the appropriate Workshop Manual. If diagnostics leads to the described condition, replace the Intermediate One Way Clutch (OWC) (mechanical diode style 7A089), Intermediate Brake Drum (7D044) and Intermediate Clutch internally splined friction plates (7B164). Refer to the following Service Procedure for details.

SERVICE PROCEDURE

Verify above "ISSUE". Refer to Figure 1 for replacement components. Refer to the appropriate Workshop Manual for Transmission Disassembly and Assembly procedures. If contamination is present, a full disassembly and cleaning will be required. Follow all the normal service procedures as indicated in the appropriate Workshop Manual.

NOTE

MAKE SURE ALL MATING COMPONENTS LISTED ARE CHANGED. THE MATING COMPONENTS OF THE TWO DESIGN ONE WAY CLUTCHES (7A089) ARE NOT INTERCHANGEABLE. IF ALL THE COMPONENTS ARE NOT CHANGED, INTERNAL TRANSMISSION DAMAGE MAY RESULT.

NOTE

THE MECHANICAL DIODE DESIGN ONE WAY CLUTCH, DID NOT USE A #7 THRUST WASHER. THERE ARE NO MACHINED SLOTS IN THE INTERMEDIATE BRAKE DRUM FOR THE THRUST WASHER TABS. THE SPRAG DESIGN ONE WAY CLUTCH MUST BE USED WITH A #7 THRUST WASHER. THE INTERMEDIATE BRAKE DRUM USED WITH THE SPRAG OWC DESIGN HAS SLOTS MACHINED IN THE DRUM FOR THE #7 THRUST WASHER TABS.


PART NUMBER	PART NAME
E9TZ-7A089-B	Intermediate OWC (Sprag Design) - All
1C3Z-7B164-BA	Intermediate Clutch Plates, Friction (Internal Spline) - All
YC3Z-7D044-AA	Intermediate Brake Drum (4 Plate) - 5.4L And 6.8L
YC3Z-7D044-BA	Intermediate Brake Drum (5 Plate) - 7.3L Only
F3TZ-7G401-A	Thrust Washer #7 - Intermediate OWC - All

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: INFORMATION ONLY
OASIS CODES: 501000, 503000, 504000

Copyright © 2001 Ford Motor Company

REMOVE
MECHANICAL DIODE ONE-WAY CLUTCH (OWC)
DESIGN COMPONENTS

INSTALL
SPRAG ONE-WAY CLUTCH (OWC)
DESIGN COMPONENTS

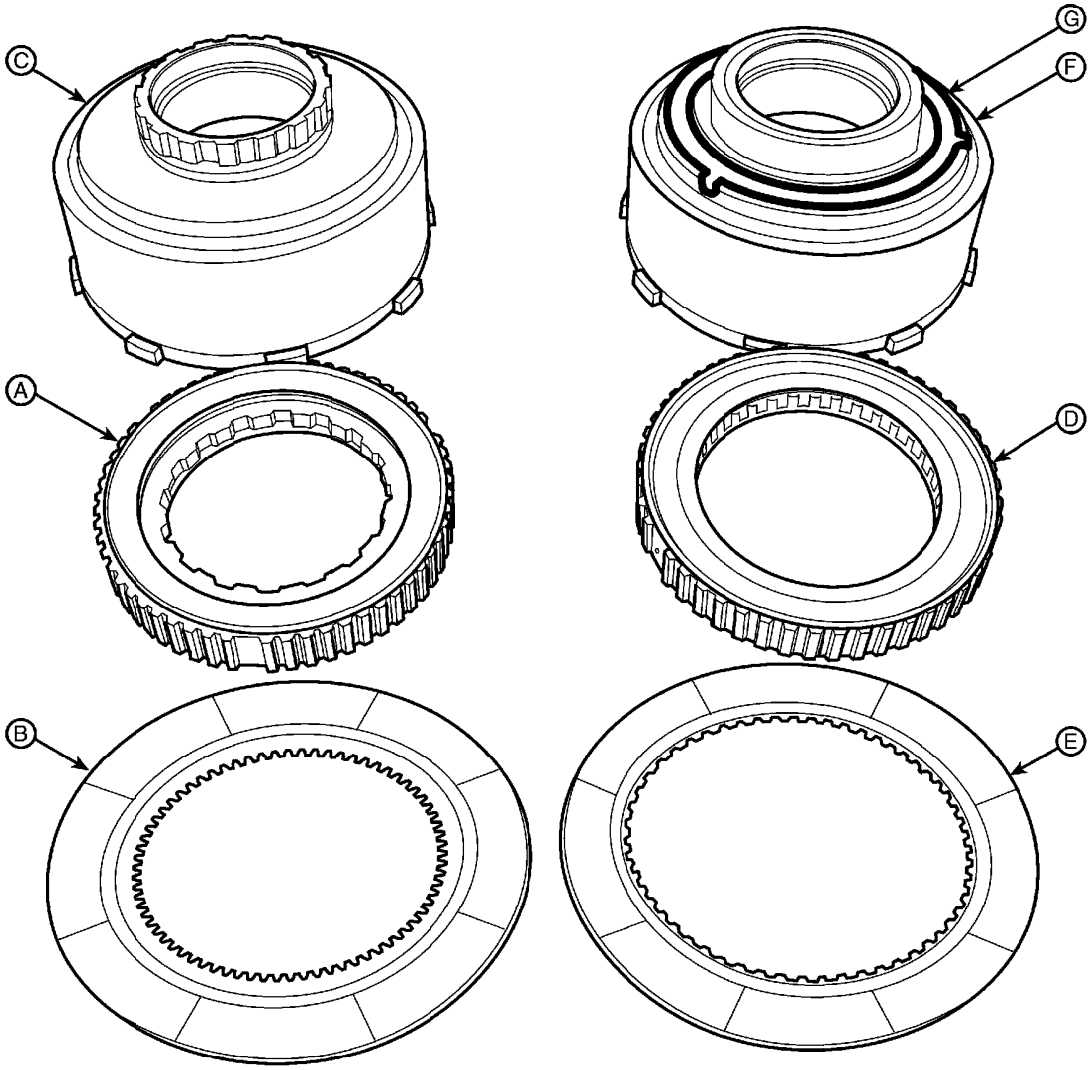

REMOVE

REF.	PART NUMBER	DESCRIPTION	ENGINE APPLICATION
A	1C3Z-7A089-AA	Intermediate OWC (Mechanical Diode Design)	7.3L Only
	1C3Z-7A089-AB	Intermediate OWC (Mechanical Diode Design)	5.4L/6.8L
B	1C3Z-7B164-AA	Intermediate Clutch Plates, Friction (Internal Spline)	All
C	1C3Z-7D044-AA	Intermediate Brake Drum (4 Plate)	5.4L and 6.8L
	1C3Z-7A044-BA	Intermediate Brake Drum (5 Plate)	7.3L Only

INSTALL

REF.	PART NUMBER	DESCRIPTION	ENGINE APPLICATION
D	E9TZ-7A089-B	Intermediate OWC (Sprag Design)	All
E	1C3Z-7B164-BA	Intermediate Clutch Plates, Friction (Internal Spline)	All
F	YC3Z-7D044-AA	Intermediate Brake Drum (4 Plate)	5.4L and 6.8L
	YC3Z-7D044-BA	Intermediate Brake Drum (5 Plate)	7.3L Only
G	F3TZ-7G401-A	Thrust Washer #7, Intermediate OWC	5.4L/6.8L/7.3L

TB-6381-A

Figure 1 - Article 01-13-5