• NOISE—"BUZZING" COMING FROM ACCELERATOR PEDAL—4.0L OHV VEHICLES • VIBRATION—VIBRATION COMING FROM ACCELERATOR PEDAL—4.0L OHV VEHICLES	Article No. 00-7-5

FORD: 1999-2000 EXPLORER

ISSUE

Some vehicles equipped with a 4.0L OHV engine may exhibit a vibration or buzz at the accelerator pedal. This may be caused by engine vibration that is transmitted through the accelerator cable to the pedal.

ACTION

Replace the accelerator cable. This cable is approximately 30 cm (12″) longer and will require a different routing which should reduce the possibility of noise and vibration. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

Refer to the appropriate Workshop Manual Section 310-02 and the following text for replacement procedures.

1. Attach new Accelerator Cable (F87Z-9A758-KA) on the same plastic retaining clip used with the original cable.
2. Position the cable so that the clip is between the two (2) foam sleeves.
3. Use a tie wrap to loosely attach the cable to the wiring harness which is in the back of the engine compartment as shown in Figure 1.4 of the Workshop Manual.
4. Verify that the condition is resolved.

PART NUMBER	PART NAME
F87Z-9A758-KA	Accelerator Cable

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
000705A	Replace Accelerator Cable	0.4 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
9A758	16

OASIS CODES: 703000, 703100, 703200, 703300

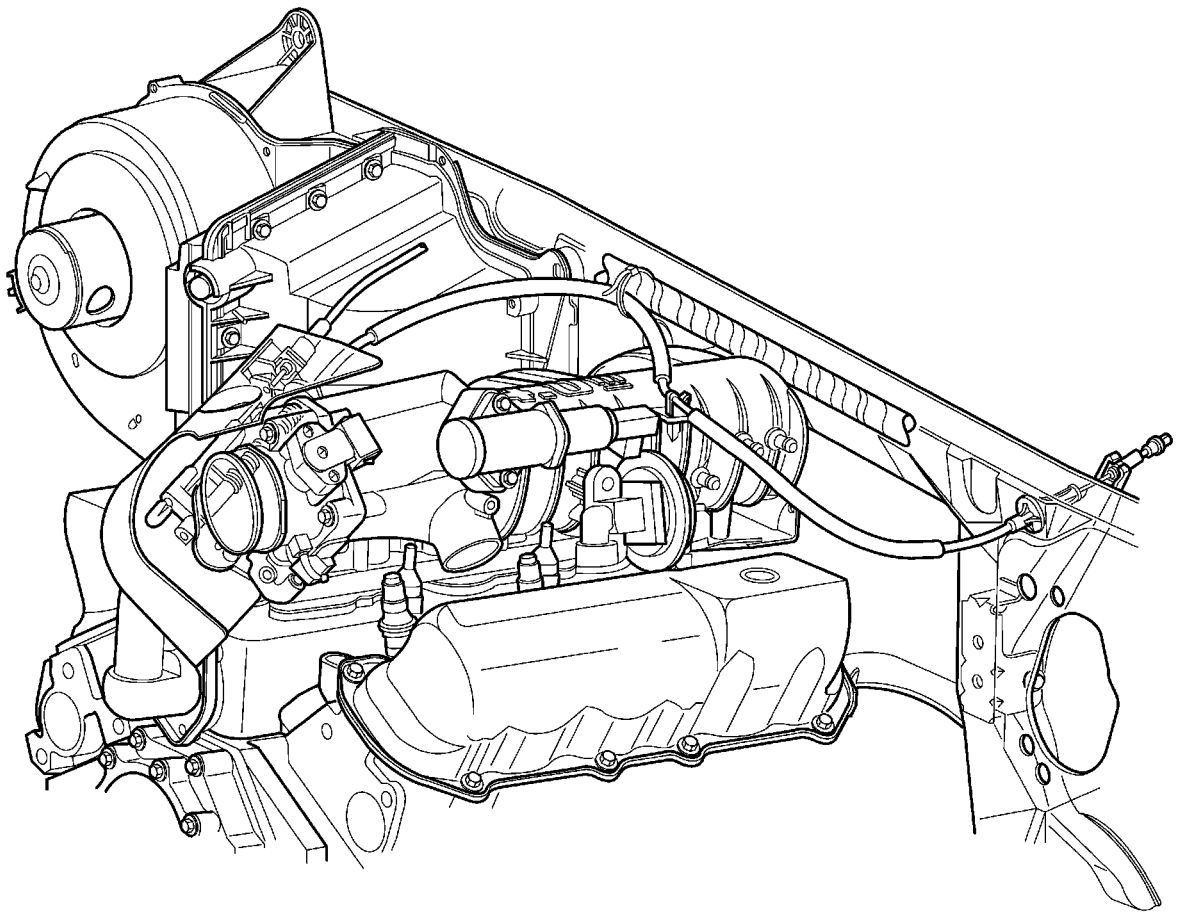

TB-6063-A

Figure 1 - Article 00-7-5