• **ENGINE—ROUGH IDLE/MISS AFTER START-UP DURING COLD AMBIENT TEMPERATURES LESS THAN -12 DEGREES C (10 DEGREES F)—VEHICLES BUILT 3/1/1996 THROUGH 7/31/2000** • **NOISE—FROM ENGINE—ROUGH IDLE/MISS AFTER START-UP DURING COLD AMBIENT TEMPERATURES LESS THAN -12 DEGREES C (10 DEGREES F)—VEHICLES BUILT 3/1/1996 THROUGH 7/31/2000**	**Article No. 00-26-1**

FORD: 1997-1999 F-250 LD
1997-2000 ECONOLINE, EXCURSION, EXPEDITION, F-150
1999-2000 F SUPER DUTY

LINCOLN: 1998-1999 NAVIGATOR

ISSUE

Some vehicles equipped with a 4.6L, 5.4L, or 6.8L engine may exhibit a rough idle/miss after start-up in cold ambient temperatures (less than -12°C/10 °F). This may be caused by a roller finger follower(s) being dislodged from the valve. This may result in damage to the camshaft, roller finger follower, valve, retainer, etc. A procedure is now available to service this condition.

ACTION

Inspect and replace any worn or damaged engine valve components and install new retaining clip and lash adjuster for service. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

Perform normal engine diagnostic routines before opening valve covers. If the valve train is suspect, remove the valve covers and look for Roller Finger Follower(s) (RFF) that may have become dislodged.

1. Inspect the following parts that may have been damaged by any dislodged roller finger followers:
   - Cam lobes (chipped or grooved)
   - Valve stem tips (mushroomed, metal displaced, or bent)
   - Roller finger followers (chipped or grooved)
   - Inspect valve guide only if its corresponding RFF or valve stem tip is damaged.

Replace damaged parts as necessary.

2. If follower(s) are damaged, replaced as necessary, otherwise re-use followers in same location as removed from head.
3. Remove all intake and exhaust lash adjusters from the engine and replace with service-only Lash Adjusters (YL3Z-6500-AA). Refer to the appropriate Workshop Manual, Section 303-01B for service procedures and tooling necessary to compress the valve springs and remove the roller followers.

NOTE
REFER TO FIGURE 1 FOR INSTALLATION OF THE NEW RETAINING CLIPS (YL3Z-6A539-AA), TO THE ROLLER FINGER FOLLOWER.

4. Using a valve spring compression tool, install followers and the attached retaining clips by pushing clips onto lash adjuster.

NOTE
THE CLIP IS NOT REMOVABLE FROM ADJUSTER ONCE IT HAS BEEN SNAPPED INTO PLACE. IF THE ENGINE NEEDS TO BE SERVICED AT A LATER DATE, REMOVE THE RFF BY BENDING UP THE CLIP. LEAVE LASH ADJUSTER IN THE ENGINE WITH THE CLIP WHILE REMOVING THE FOLLOWER. THEN REMOVE THE LASH ADJUSTER FROM THE HEAD AND SNIP/CUT THE CLIP FROM THE LASH ADJUSTER. REPLACE WITH A NEW CLIP ON FOLLOWER DURING INSTALLATION.

Copyright © 2000 Ford Motor Company

5. Check valve train for proper assembly and reinstall valve covers as outlined in the Workshop Manual, Section 303-01B.

PART NUMBER	PART NAME
YL3Z-6A539-AA YL3Z-6500-AA	Retaining Clip - Roller Finger Follower Lash Adjuster

OTHER APPLICABLE ARTICLES: NONE

WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
002601A	Install New Retaining Clips And Lash Adjusters - 1997-2000 F-150/250 LD/Expedition (4.6L And 5.4L Engines)	3.6 Hrs.
002601B	Install New Retaining Clips And Lash Adjusters - 1997-2000 Econoline (4.6L And 5.4L Engines)	6.7 Hrs.
002601C	Install New Retaining Clips And Lash Adjusters - 1997-2000 Econoline (6.8L Engine)	9.4 Hrs.
002601D	Install New Retaining Clips And Lash Adjusters - 1999-2000 F-250/350 SD And 2000 Excursion (5.4L Engine)	4.4 Hrs.
002601E	Install New Retaining Clips And Lash Adjusters - 1999-2000 F-250/350 SD And 2000 Excursion (6.8L Engine)	4.7 Hrs.

DEALER CODING

BASIC PART NO.	CONDITION CODE
6C301	42

OASIS CODES: 497000, 499000, 602300, 608000, 608400, 609000, 609400, 613000, 613500, 702000, 702100

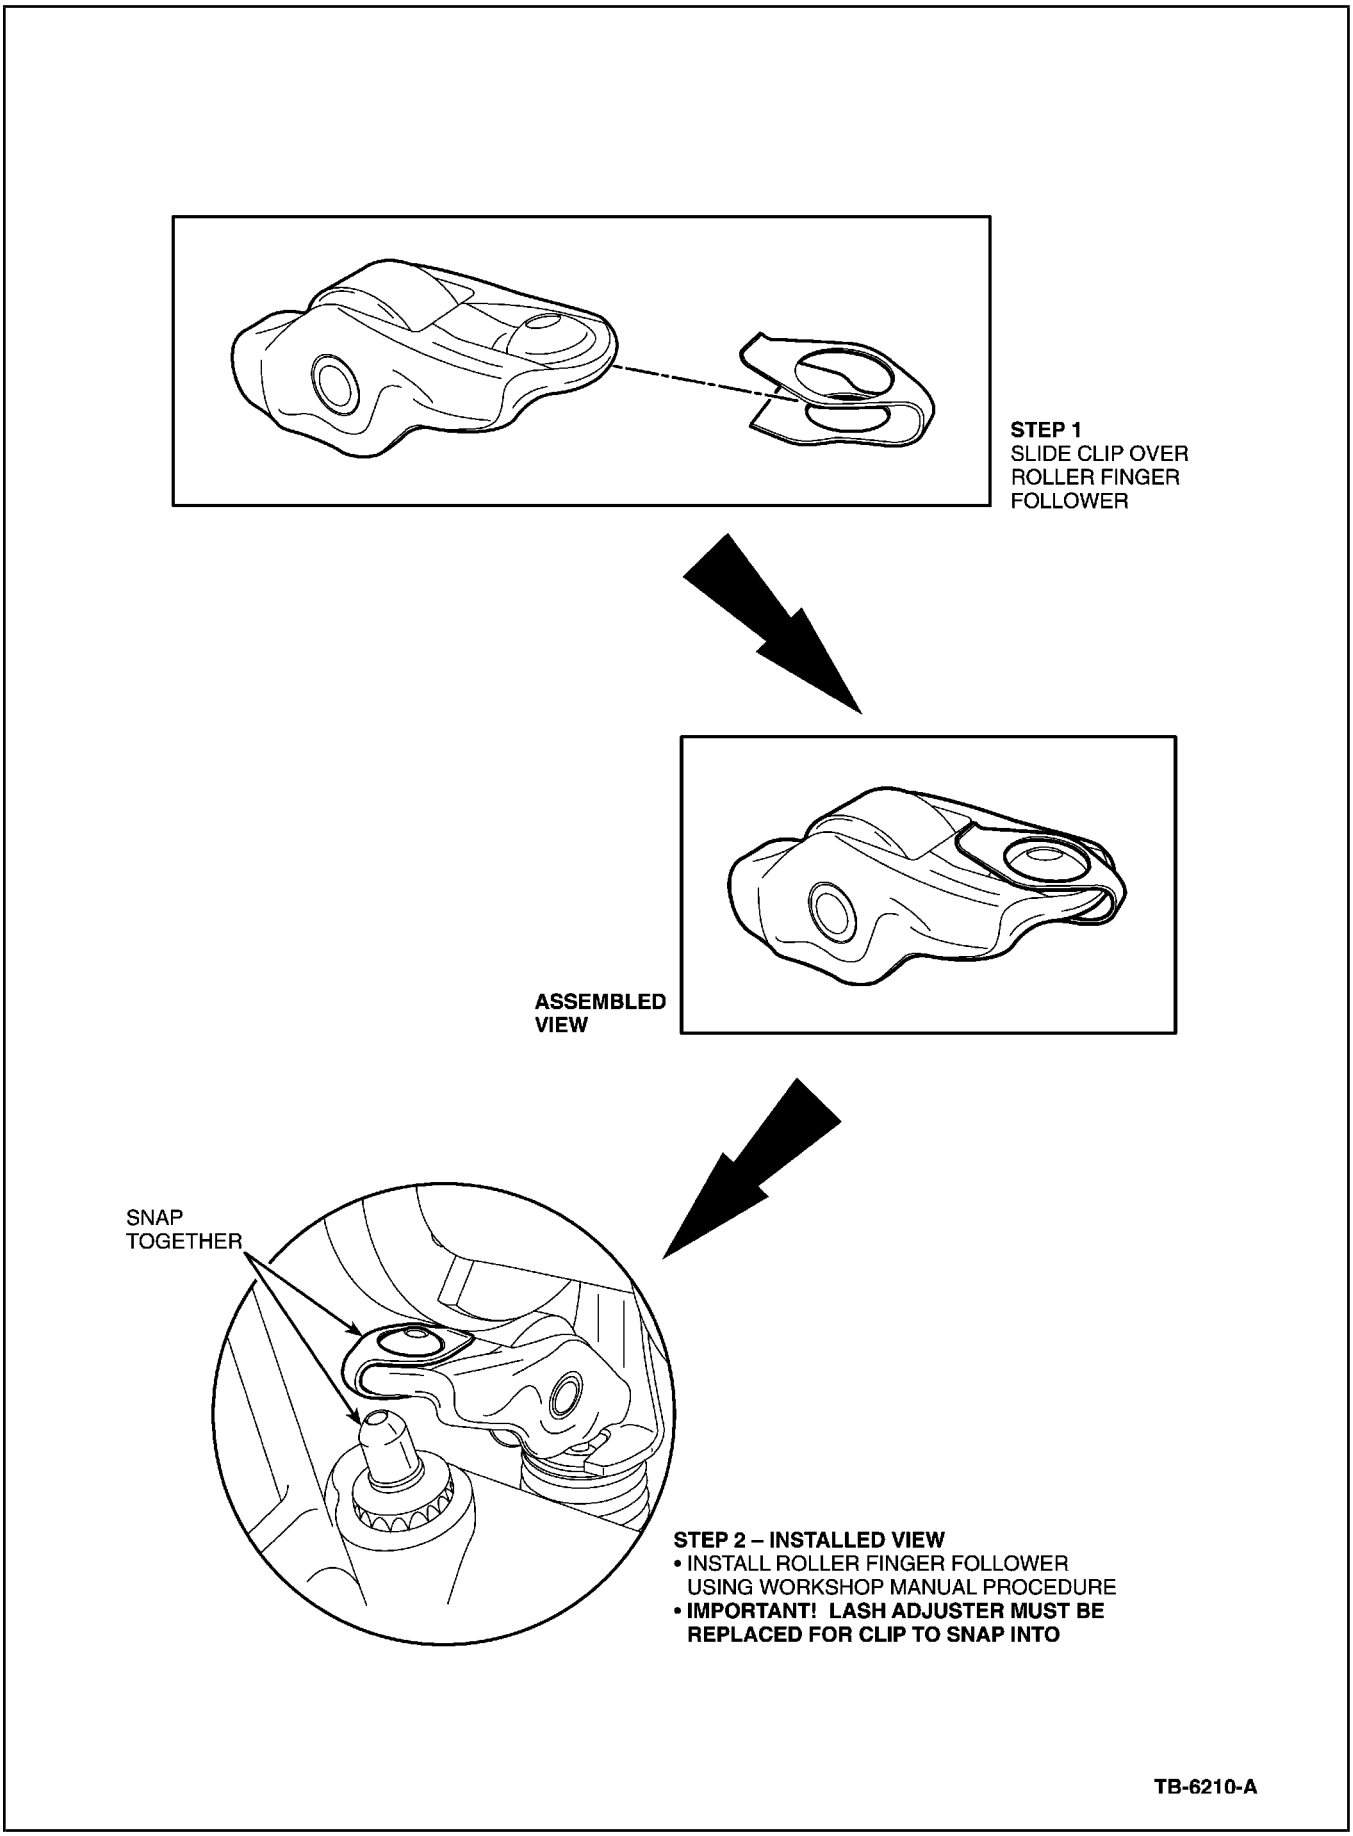

Figure 1 - Article 00-26-1