Ford Motor Company

A. R. O'Neill
Director
Vehicle Service and Programs
48121
Ford Customer Service Division

Ford Motor Company
P. O. Box 1904
Dearborn, Michigan

April 2001

TO: All Ford and Lincoln Mercury Dealers

SUBJECT: Special Service Instruction 01T02: Certain 2002 Model Year Explorer and Mountaineer Vehicles – Liftgate Glass Bracket Inspection and Torque Procedure

OASIS: Yes
OWNER LIST: Yes
OWNER LETTER: No
PARTS RETURN: No
PROGRAM TERMS: Through applicable new vehicle warranty coverage only

AFFECTED VEHICLES

Certain 2002 model year Explorer and Mountaineer vehicles built at the Louisville and St. Louis Assembly Plants from February 5, 2001 through March 30, 2001.

REASON FOR SPECIAL SERVICE INSTRUCTION

In some of the affected vehicles, the brackets connecting the lift cylinders to each side of the liftgate glass could rotate out of position if either the urethane bond or torque are not sufficient. Rotation of the brackets could potentially cause the lift cylinders to detach from the glass or, in some cases, could potentially cause the liftgate glass to break. Either condition is most likely to occur when the glass is being closed.

SPECIAL SERVICE INSTRUCTION

The dealer must inspect all of the affected vehicles for the position of both the left and right liftgate glass lift cylinder brackets. If the brackets are in the proper position, tighten the bracket retainers to a higher torque. In cases where the bracket is not properly positioned, the bracket must be re-aligned; 'Threadlock' must be applied to the retainer threads and then the retainer must be tightened to a higher torque (See Attachment III for both repair procedures).

IMPORTANT INFORMATION

- It is estimated that only a small percentage of the approximately 56,000 potentially affected vehicles will have a mis-aligned liftgate glass bracket and require the bracket re-alignment and thread sealer repair.
- As of the date of this letter, we estimate that roughly 20% of the potentially affected vehicles have been delivered to owners. An opportunity exists to inspect and perform this service on the remaining vehicles before they are delivered to the owners.
- Inspection of these affected in-stock vehicles avoids potential owner concerns after vehicle is delivered.

OWNER NOTIFICATION

- For vehicles already delivered to owners, we urge you to personally contact your customers and invite them back to the dealership to have the liftgate glass bracket inspection performed.
- Individual dealer Involved Unit Listings will be available on QCDealer.com by the end of the day on 4/6/01.
- We have provided a "Dealer-to-Owner Phone Script" as a thought starter to help you communicate the inspection and repair procedure to owners (See Attachment V).

SPECIAL CUSTOMER HANDLING PROCEDURE

The Special Customer Handling Procedure has been activated for all Explorer and Mountaineer owners affected by this Special Service Instruction. Please see dealer announcement dated 12/17/98, Special Handling Procedure (Attachment IV). The special handling procedure provides additional allowance to enable dealers to offer Explorer and Mountaineer owners convenient handling.

Note: Special Handling does not apply to vehicles in dealer stock.

We are asking for your support and the cooperation of your sales and service teams to make this a positive experience for our Explorer and Mountaineer owners, many of whom are new to the Ford Motor Company family.


ATTACHMENTS

Attachment I: Administrative Information
Attachment II: Labor Allowances and Parts Ordering Information
Attachment III: Technical Information
Attachment IV: Special Handling Procedure
Attachment V: Dealer-to-Owner Phone Script

QUESTIONS?

Claims Information: 1-800-423-8851
Other Program Questions: 1-800-325-5621

Sincerely,

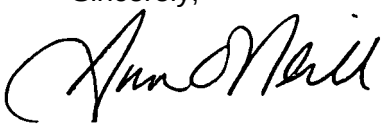

Ann O'Neill
Director
Vehicle Service and Programs

Special Service Instruction 01T02
Certain 2002 Model Year Explorer and Mountaineer Vehicles
Liftgate Glass Bracket Inspection and Torque Procedure

OASIS

You must use OASIS to determine if a vehicle is eligible for this Special Service Instruction.

PLEASE NOTE

Correct all vehicles in stock before delivery.

DEALER-OWNER CONTACT

Promptly correct all affected vehicles on your dealer Involved Unit Listings available on QCDealer.Com. Also, correct other eligible vehicles which are brought to your dealership within the applicable new vehicle warranty coverage period.

NOTE: Owners should receive Special Handling as described in Attachment IV. Before calling owners, please familiarize yourself with the procedure.

CLAIMS PREPARATION AND SUBMISSION

- Enter claims using DWE.
- Refer to ACESII manual for claims preparation and submission information.
- Claim for "Special Handling", follow the instructions on page two of Attachment IV.

NOTE: Prepare and submit claims on the ACESII **warranty** screen rather than the ACESII recall screen.

- Use code information shown below:
    - Program Code – 01T02
    - Causal Component – 78422A12
    - Condition Code – 33
    - Labor Operation – Refer to Attachment II
    - Customer Concern Code – G05

Special Service Instruction 01T02
Certain 2002 Model Year Explorer and Mountaineer Vehicles
Liftgate Glass Bracket Inspection and Torque Procedure

OWNER REFUNDS

Ford Motor Company will refund owner-paid repairs, including damage related to a mis-aligned liftgate glass bracket, made before the date of this Special Service Instruction (or after the date of the Special Service Instruction if an emergency repair was made away from the servicing dealer). Refer to ACESII manual for refund information.

Program Code:	01T02
Misc. Expense:	REFUND
Misc. Expense:	ADMIN
Misc. Expense:	0.2 Hr.

RENTAL CARS

Ford Motor Company will pay for a rental vehicle, except for fuel which will be at owner's expense. Follow Extended Service Plan (ESP) guidelines for rental dollar amounts. Enter the word "RENTAL" plus the number of days the vehicle was used in the Miscellaneous Expense area.

Special Service Instruction 01T02
Certain 2002 Model Year Explorer and Mountaineer Vehicles
Liftgate Glass Bracket Inspection and Torque Procedure

LABOR ALLOWANCES

Description	Labor Operation	Labor Time
Inspect Liftgate Glass Brackets and Torque to Revised Specification **(Bracket Alignment Correct)**	01T02B	0.3 Hours
Inspect Liftgate Glass Brackets, Re-align One or Both Brackets, Apply Thread Sealer and Torque to Revised Specification **(Bracket Alignment Incorrect)**	01T02C	0.5 Hours
Special Handling *	Misc. Expense Code "LCHP"	See Attachment IV

* Special Handling does not apply to vehicles in dealer stock.

PARTS REQUIREMENTS

Parts Ordering Information

Parts will not be direct shipped for this program. Order your parts requirement through normal order processing channels.

Part Number	Description	Quantity
EOAZ-19554-AA *	Threadlock and Sealer (Loctite™ 242) **(Package of 10)**	1 Tube Is Capable Of Repairing Multiple Vehicles

* It is estimated that a small percentage of the approximately 56,000 potentially affected vehicles will have a mis-aligned liftgate glass bracket. Therefore, only a small number of vehicles will require the ThreadLock and Sealer part number listed above.

In rare cases where the liftgate glass is damaged due to a mis-aligned liftgate glass bracket, please order your replacement glass through normal order processing channels. Claim "MT" time or "OSL" (Outside Labor) for the glass replacement. Install glass and perform torque procedure. Claim labor operation 01T02B. Glass replacement can be submitted on same repair.

Special Service Instruction 01T02
Certain 2002 Model Year Explorer and Mountaineer Vehicles
Liftgate Glass Bracket Inspection and Torque Procedure

DEALER PRICE

For latest prices, check:

- DOES II
- Updated Price Book

EXCESS STOCK RETURN

Excess stock returned for credit must have been purchased from Ford Customer Service Division in accordance with Policy Procedure Bulletin 4000.

Program Announcement Letter
Lincoln Commitment Special Handling

Ford Customer Service Division

Ford Motor Company
P.O. Box 1904
Dearborn, Michigan 48121

December 17, 1998

To: All Lincoln Mercury and Ford Dealers

cc: Parts Managers
Service Managers

Subject: Announcing Lincoln Commitment Special Customer Handling Procedure for Certain Recalls and Owner Notification Programs

As part of our ongoing commitment to Lincoln customers, we are pleased to announce the Lincoln Commitment Special Customer Handling Procedure to provide additional dealer compensation for certain Recalls and Owner Notification Programs(ONP's) that affect Lincoln brand vehicles.

This additional compensation is being provided to allow dealers to provide personalized service designed to make the recall repair a positive experience for the Lincoln customer, many of whom are new to the Lincoln family.

Each Recall/ONP Bulletin affecting Lincoln vehicles will indicate whether the Lincoln Commitment Special Customer Handling Procedure is authorized; please note that not every Recall/ONP will qualify for this procedure and that the procedure will not be communicated to customers as a normal benefit of the Lincoln Commitment Program. Special handling and claiming instructions are included on the attached page. This program will apply only to Lincoln vehicles which have been delivered to customers (This Special Customer Handling does not apply to vehicles in stock or in daily rental fleets).

We ask you to make maximum usage of these special enhancements to the Lincoln Commitment Program when applicable. Thank you in advance for your support of this program and our commitment to surprise and delight our Lincoln customers.

/O.S.B./
Mark Hutchins
President
Lincoln Mercury

/O.S.B./
M. D. Jordan
Executive Director
Ford Customer Service Division
North America

If Dealer Picks up and Returns Vehicle for Customer:

Special Service	Dealer Compensation	Claim Procedure
• Pick up the customer's vehicle (at a location of their preference such as home or place of business) and return after repair* • Drop off comparable loaner vehicle • Refill fuel tank • Wash and vacuum vehicle • Return vehicle to customer after repair is completed	Up to 2 hours additional labor (converted to a dollar amount) plus actual cost of fuel and wash/vacuum Note: Labor time to fill tank and wash/vacuum has been included in 2 hour allowance Labor subject to time recording procedures as outlined in Warranty & Policy Manual	Submit total dollar value (labor+fuel+wash/vacuum) using Misc. Expense Code "LCHP" EXAMPLE (using example labor rate of $58/hour and fuel cost of $1.05/gallon): 1.2 hrs. labor* = $69.60 9.0 gals fuel = 9.45 Wash/vacuum = 3.50 Total Submitted = $82.55 *travel time+fueling/washing labor
Provide comparable loaner vehicle to customer when vehicle is picked up	Use ESP Guidelines (This does not count against TAP allocation)	Submit up to 3 days maximum using "LOANER" (if additional days are required, call 1-800-325-5621 for authorization)
Perform Recall/ONP repair at dealership	Inspection/repair labor allowance as specified in Recall/ONP Bulletin	See applicable Recall/ONP Bulletin

*Or repair on-site if appropriate; if on-site repair is performed, rental charges do not apply.

If Customer Brings Vehicle to Dealer:

Special Service	Dealer Compensation	Claim Procedure
Perform Recall/ONP repair at dealership	Inspection/repair labor allowance as specified in Recall/ONP Bulletin	See applicable Recall/ONP Bulletin
Provide comparable loaner vehicle to customer	Use ESP Guidelines (This does not count against TAP allocation)	Submit up to 3 days maximum using "LOANER" (if additional days are required, call 1-800-325-5621 for authorization)
Refill fuel tank and wash/ vacuum vehicle	Up to 0.5 hour additional labor (converted to a dollar amount) plus actual cost of fuel and wash/vacuum	Submit total dollar value (labor+fuel+wash/vacuum) using Misc. Expense Code "LCHP"

Ford Explorer Dealer-to-Owner Phone Script

NOTE: If an answering machine or a non-driver of the vehicle is reached, we suggest you do not leave a detailed message.

- **Answering machine:** This is (your name) from (name of dealership) calling about your new Explorer. I'll try to reach you at another time.
- **Non-driver:** Please tell (owner name) that I called and that I'll try to reach them at another time.
- **Owner of the vehicle is reached:**

Good morning/afternoon -- this is _____ from _____ (Dealership Name)?

How is your new Explorer?

The purpose of my call is to let you know that Ford has informed us that some of the new Explorer vehicles may need their liftgate glass lift cylinder brackets inspected.

These brackets are attached to the lift cylinders and hold the rear glass up. We would like to check to make sure the brackets on your vehicle are installed securely.

Because we don't want to inconvenience you for this inspection, we'd like to offer one of two options: we'll pick up your vehicle at the location of your choice and drop off a vehicle for you to use OR if you'd prefer to drop your vehicle off at our dealership, we'll provide you a rental vehicle at no cost.

The inspection doesn't take very long, and any repair that is necessary in most cases will take less than (fill in time/day).

Ford does its best to make sure every vehicle we at (Dealership Name) deliver is trouble-free. And, in fact, there may be nothing wrong with the brackets on your vehicle – but we would rather make sure.

What day would be the most convenient for you to have this inspection performed?

Until the inspection is performed we recommend you do not open the liftgate glass. The liftgate door may still be used.

Thank you Mr./Ms./Mrs. – we look forward to seeing you!

_____ _____ _____ _____
(Inspection Date) (Time) (Service Advisor Name) (Pickup/Drop-Off/Rental)

Mercury Mountaineer Dealer-to-Owner Phone Script

NOTE: If an answering machine or a non-driver of the vehicle is reached, we suggest you do not leave a detailed message.

- **Answering machine:** This is (your name) from (name of dealership) calling about your new Mountaineer. I'll try to reach you at another time.
- **Non-driver:** Please tell (owner name) that I called and that I'll try to reach them at another time.
- **Owner of the vehicle is reached:**

Good morning/afternoon -- this is _____ from _____ (Dealership Name)?

How is your new Mountaineer?

The purpose of my call is to let you know that Mercury has informed us that some of the new Mountaineer vehicles may need their liftgate glass lift cylinder brackets inspected.

These brackets are attached to the lift cylinders and hold the rear glass up. We would like to check to make sure the brackets on your vehicle are installed securely.

Because we don't want to inconvenience you for this inspection, we'd like to offer one of two options: we'll pick up your vehicle at the location of your choice and drop off a vehicle for you to use OR if you'd prefer to drop your vehicle off at our dealership, we'll provide you a rental vehicle at no cost.

The inspection doesn't take very long, and any repair that is necessary in most cases will take less than (fill in time/day).

Mercury does its best to make sure every vehicle we at (Dealership Name) deliver is trouble-free. And, in fact, there may be nothing wrong with the brackets on your vehicle – but we would rather make sure.

What day would be the most convenient for you to have this inspection performed?

Until the inspection is performed we recommend you do not open the liftgate glass. The liftgate door may still be used.

Thank you Mr./Ms./Mrs. – we look forward to seeing you!

_____ _____ _____ _____
(Inspection Date) (Time) (Service Advisor Name) (Pickup/Drop-Off/Rental)