• **ENGINE—4.2L—MEXICO VEHICLES ONLY—VIBRATION IN GEAR WITH A/C ENGAGED—VEHICLES EQUIPPED WITH AUTOMATIC TRANSMISSION ONLY** • **VIBRATION—MEXICO VEHICLES ONLY—VIBRATION IN GEAR WITH A/C ENGAGED—VEHICLES EQUIPPED WITH 4.2L ENGINE AND AUTOMATIC TRANSMISSION ONLY**	**Article No. 02-7-1**

FORD: 2000-2001 F-150

ISSUE

Some vehicles built at the Cuautitlan Assembly plant equipped with the 4.2L engine and Automatic Transmission, may exhibit a vibration condition when the engine is at idle in Drive and/or Reverse with the A/C turned on. This may be caused by an exhaust vibration condition.

ACTION

Verify the condition before replacing any components or before attempting any repairs. If necessary, install an Exhaust System Damper. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

1. Perform the diagnostic self-test to check for Diagnostic Trouble Codes (DTCs). Resolve all codes that are present using the appropriate Powertrain Control/Emissions Diagnosis (PC/ED) Service Manual before proceeding.
2. Verify if contact exist between exhaust system and chassis.
3. Verify the correct engine mounts application as follows:
   - A/T engineering numbers YL34-6038-CA (R.H.) & YL34-6B032-AA (L.H.)
   - M/T engineering numbers YL34-6038-DA (R.H.) & YL34-6B032-DA (L.H.)
4. Make sure that the flywheel and torque converter alignment marks are aligned.
5. Install the Exhaust System Damper 1L3Z-5G209-BA as shown (Figure 1).

NOTE

IF THE VIBRATION IS STILL PRESENT AFTER THE FRONT DAMPER INSTALLATION, IT WILL BE NECESSARY TO INSTALL A SECOND DAMPER P/N 1L3Z-5G209-AA AT THE REAR OF THE MUFFLER.

PART NUMBER	PART NAME
1L3Z-5G209-BA	Damper Assembly - Front
1L3Z-5G209-AA	Damper Assembly - Rear

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: INFORMATION ONLY
OASIS CODES: 403000, 504000, 703000, 703100

Copyright © 2002 Ford Motor Company

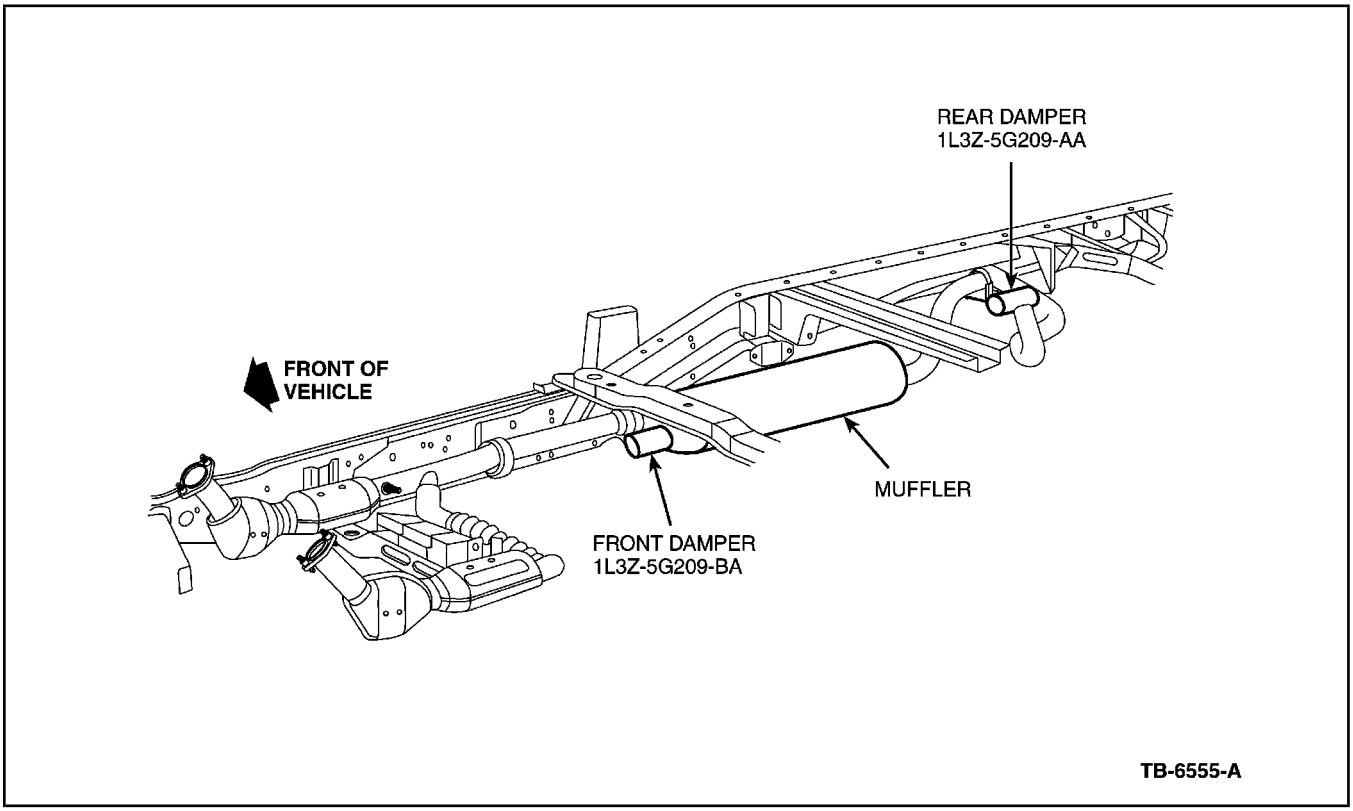


Figure 1 - Article 02-7-1