Ford Motor Company

A.R. O'Neill
Director
Vehicle Service and Programs
48121
Ford Customer Service Division

Ford Motor Company
P. O. Box 1904
Dearborn, Michigan

April 2001

TO: All Ford and Lincoln Mercury Dealers

SUBJECT: Owner Notification Program 01B69: Supplement #1: Certain 1998 through 2000 Model Year Ranger-EV – Electric Coolant Pump Replacement

REFERENCE: Owner Notification Program 01B69: Certain 1998 through 2000 Model Year Ranger-EV – Electric Coolant Pump Replacement

SUPPLEMENTAL INFORMATION

This bulletin has been revised to reflect electric coolant pump replacement for all affected 1998 model year vehicles, without the need of performing a 'wiggle test'.

OASIS: Yes
OWNER LIST: Yes
PARTS RETURN: Yes
PROGRAM TERMS: This program will be in effect until November 30, 2001, regardless of mileage. (After this program expires, the vehicle may still be eligible for this service under any remaining vehicle warranty coverage).

AFFECTED VEHICLES

- Certain 1998 model year Ranger-EV vehicles built at the Edison Assembly Plant from October 27, 1997 through July 31, 1998
- Certain 1999 model year Ranger-EV vehicles built at the Edison Assembly Plant from May 6, 1998 through August 2, 1999
- Certain 2000 model year Ranger-EV vehicles built at the Edison Assembly Plant from August 17, 1999 through July 25, 2000

REASON FOR PROGRAM

Certain affected vehicles may have a duty cycle (user driving/charging habits) that minimizes the useful life of the electric water pump. When the water pump malfunctions the coolant temperature gauge will indicate a high reading and the vehicle will switch to a "limited operating strategy" (LOS) mode and a red "Power Limit" lamp will illuminate in the instrument cluster, indicating that available vehicle power is being reduced. Within one minute, the "Power Limit" lamp will begin flashing, indicating that available vehicle power is being further reduced. Continued driving will result in vehicle shutdown.

SERVICE ACTION

There are two different repair procedures, depending on model year application.

1998 Model Year Application

Authorized EV-dealers are to replace the electric coolant pump on all vehicles.

1999 through 2000 Model Year Application

Authorized EV-dealers are to perform a 'wiggle' test to determine if the electric coolant pump is near the end of its useful life, and replace those pumps that fail this test.


ATTACHMENTS

Attachment I:	Administrative Information
Attachment II:	Labor Allowances and Parts Ordering Information
Attachment III:	Technical Information
Owner Notification Letters:	1998 Owners
	1999-2000 Owners

QUESTIONS?

Claims Information:……1-800-423-8851
Other Program Questions:……..1-800-325-5621

Sincerely,

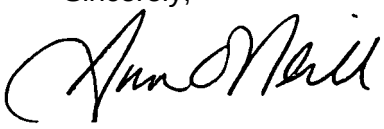

Ann O'Neill
Director
Vehicle Service and Programs

Owner Notification Program 01B69-S1
Certain 1998 through 2000 Model Year Ranger-EV
Electric Coolant Pump Replacement

OASIS

You must use OASIS to determine if a vehicle is eligible for this program.

PLEASE NOTE

Correct all vehicles in stock before delivery.

DEALER-OWNER CONTACT

Promptly correct all affected vehicles on your dealer Recall/ONP Involved Unit Listings available on QCDealer.com. Also, correct other eligible vehicles which are brought to your dealership.

CLAIMS PREPARATION AND SUBMISSION

- Enter claims using DWE.
- Refer to ACESII manual for claims preparation and submission information.

OWNER REFUNDS

Ford Motor Company will only refund owner-paid repairs made before the date of the Owner Letter (or after the date of the Owner Letter if an emergency repair was made away from the servicing dealer). Refer to ACESII manual for refund information.

Program Code:	01B69
Misc. Expense:	REFUND
Misc. Expense:	ADMIN
Misc. Expense:	0.2 Hr.

Refer to ACESII manual for refund information.

RENTAL CARS

Rental vehicles are not authorized for this program.

Owner Notification Program 01B69-S1
Certain 1998 through 2000 Model Year Ranger-EV
Electric Coolant Pump Replacement

LABOR ALLOWANCES

Description	Labor Operation	Labor Time
1999-2000 Vehicles Only Perform "Wiggle Test" on Electric Coolant Pump (Passes Test – release vehicle)	01B69A	0.2 Hours
Replace Electric Coolant Pump (Includes 'Wiggle Test' for 1999 and 2000 model year vehicles)	01B69B	0.7 Hours

PARTS REQUIREMENTS

Parts Ordering Information

Approximately 50 authorized EV-dealers will be receiving 2-5 parts by seed stock within the week after this campaign launches. All parts will be shipped as **stock orders**. If additional parts are needed after your seed stock allotment is received, order through the order processing channels noted below:

All order types Effective immediately Normal order process

Part Number	Description	Quantity
F8YZ-8501-AA	Electric Coolant Pump	1
E2FZ-19549-AA	Ford Premium Cooling System Fluid (use 50-50 mix)	1 Quart *

* If required. If hoses are firmly clamped when old pump is removed, there will be negligible coolant loss.

ORDER INFORMATION DOR/COR

DOR/COR number 50230 identifies seed stock issued to the specific EV-dealers.

DEALER PRICE

For latest prices, refer to:

- DOES II
- Updated Price Book

EXCESS STOCK RETURN

Excess stock returned for credit must have been purchased from Ford Customer Service Division in accordance with Policy Procedure Bulletin 4000.

Ford Motor Company

A.R. O'Neill
Ford Motor Company
P. O. Box 1904
Dearborn, Michigan 48121
www.ownerconnection.com

May 2001

01B69, 01B70, 01B76
1998 Owners

Mr. John Sample
123 Main Street
Anywhere, USA 12345

Your Vehicle Identification Number: 12345678901234567

Ford Motor Company is providing three no-charge service programs to owners of certain 1998 model year Ranger-EV vehicles.

Reason For These Programs …

The purpose of these programs is to enhance the long-term customer satisfaction with your Ranger EV.

The first program, 01B69 – Your vehicle may have an electric coolant pump that could malfunction under certain duty cycles. If the pump malfunctions, the coolant temperature will increase as indicated by the temperature gauge and the red "power limit" light will illuminate, indicating that available vehicle power is being reduced. Within one minute, the "power limit" lamp will begin flashing, indicating that available vehicle power is being further reduced. Continued driving will result in vehicle shutdown.

The second program, 01B70 – An intermittent illumination of the oil light could occur, which indicates that the oil pressure is below minimum requirements. This could result in reduced vehicle performance (15-25 MPH maximum speed).

The third program, 01B76 – Ford Motor Company has determined that Battery Controller software version 3.3.1 will provide optimum vehicle range and battery life. Your vehicle should be updated to this level to take advantage of these improvements.

What *Ford Motor Company* and your dealer will do…	Program 01B69 – Dealers will replace the electric coolant pump. Program 01B70 – Dealers will update the software of the Traction Inverter Module (TIM) to eliminate the possibility of reduced vehicle performance. Program 01B76 – Dealers will update the Battery Control Module software to the version 3.3.1 level. These programs will be in effect until November 30, 2001, regardless of mileage. (After this program expires, the vehicle may still be eligible for this service under any remaining vehicle warranty coverage).
What we are asking you to do…	Call your dealer without delay. Provide the dealer with your Vehicle Identification Number (located at the beginning of this letter). Ask for a service date and whether parts are in stock for Owner Notification Program 01B69 (no parts are required for 01B70, 01B76). If your dealer does not have the parts in stock, they can be ordered before scheduling your service date. Parts would be expected to arrive within a week after ordering.
How long will it take…	The time needed for these repairs is less than one-half day. However, due to service scheduling issues, your dealer may need your vehicle for a longer period of time. Please call your dealer for a service date. When you bring your vehicle in, show the dealer this letter. If you misplace this letter, your dealer will still do the work, free of charge.
Refund…	If you paid to have this service done before the date of this letter, Ford Motor Company is offering a refund. For the refund, please give your paid original receipt to your dealer. To avoid delays, do not send receipts to Ford Motor Company.
If you've changed address or sold the vehicle…	Please fill out the enclosed prepaid postcard and mail it to us so we can update our records. If you have sold the vehicle, the information you provide on the postcard will be used to notify the new owner about this program.

If you have concerns …

If you have trouble getting your vehicle repaired promptly and without charge, please contact your dealership's Service Manager for assistance.

If you still have concerns, please contact the Ford Motor Company Customer Relationship Center and one of our representatives will be happy to assist you:

Call (866) 436-7332 …

Office Hours: (Eastern Standard Time)

Monday-Friday: 8AM – 11PM
Saturday: 9AM – 6PM

Hearing impaired, call (800) 232-5952…

Or you may contact us through the Internet …

www.ownerconnection.com
Our current response time to Internet inquiries is three business days.

Quality Care service is there for you all year long.

QualityCare™ at your service

Quality Care is the commitment of Ford Motor Company and its dealerships to provide you with a superior service and ownership experience. While we regret the inconvenience caused by this program, we stand committed with our dealers to assist you with all of your automotive service needs. With our nationwide dealer network, we're here to ensure you receive Quality Care service so that your vehicle maintains peak performance throughout your ownership experience.

We pride ourselves on becoming the world's leading consumer company for automotive products and services. Again, we are sorry for the inconvenience. Thank you for your attention to this important matter.

Sincerely,

Ann O'Neill
Director
Vehicle Service and Programs

Ford Motor Company

A.R. O'Neill
Ford Motor Company
P. O. Box 1904
Dearborn, Michigan 48121
www.ownerconnection.com

May 2001

01B69, 01B70, 01B72, 01B76
1999-2000 Owners

Mr. John Sample
123 Main Street
Anywhere, USA 12345

Your Vehicle Identification Number: 12345678901234567

Ford Motor Company is providing four no-charge service programs to owners of certain 1999 and 2000 model year Ranger-EV vehicles.

Reason For These Programs …

The purpose of these programs is to enhance the long-term customer satisfaction with your Ranger EV.

The first program, 01B69 – Your vehicle may have an electric coolant pump that could malfunction under certain duty cycles. If the pump malfunctions, the coolant temperature will increase as indicated by the temperature gauge and the red "power limit" light will illuminate, indicating that available vehicle power is being reduced. Within one minute, the "power limit" lamp will begin flashing, indicating that available vehicle power is being further reduced. Continued driving will result in vehicle shutdown.

The second program, 01B70 – An intermittent illumination of the oil light could occur, which indicates that the oil pressure is below minimum requirements. This could result in reduced vehicle performance (15-25 MPH maximum speed).

The third program, 01B72 – The rear axle to spring attachment in your vehicle may have been assembled improperly. This condition, if not corrected, could lead to loosening of the fasteners, which could give you a 'sense of looseness' in the rear axle area.

The fourth program, 01B76 – Ford Motor Company has determined that Battery Controller software version 3.3.1 will provide optimum vehicle range and battery life. Your vehicle should be updated to this level to take advantage of these improvements.

What *Ford Motor Company* and your dealer will do…	Program 01B69 – Dealers will perform a test to determine if the electric coolant pump is near the end of its useful life, and will replace those pumps that fail this test. Program 01B70 – Dealers will update the software of the Traction Inverter Module (TIM) to eliminate the possibility of reduced vehicle performance. Program 01B72 – Dealers will inspect the rear axle spring attachment. If the attachment is not properly assembled, dealers will correct it. Program 01B76 – Dealers will update the Battery Control Module software to the version 3.3.1 level. These programs will be in effect until November 30, 2001, regardless of mileage. (After this program expires, the vehicle may still be eligible for this service under any remaining vehicle warranty coverage).
What we are asking you to do…	Call your dealer without delay. Provide the dealer with your Vehicle Identification Number (located at the beginning of this letter). Ask for a service date and whether parts are in stock for Owner Notification Program 01B69 (no parts are required for 01B70, 01B72, 01B76). If your dealer does not have the parts in stock, they can be ordered before scheduling your service date. Parts would be expected to arrive within a week after ordering.
How long will it take…	The time needed for these repairs is less than one-half day. However, due to service scheduling issues, your dealer may need your vehicle for a longer period of time. Please call your dealer for a service date. When you bring your vehicle in, show the dealer this letter. If you misplace this letter, your dealer will still do the work, free of charge.
Refund…	If you paid to have this service done before the date of this letter, Ford Motor Company is offering a refund. For the refund, please give your paid original receipt to your dealer. To avoid delays, do not send receipts to Ford Motor Company.
If you've changed address or sold the vehicle…	Please fill out the enclosed prepaid postcard and mail it to us so we can update our records. If you have sold the vehicle, the information you provide on the postcard will be used to notify the new owner about this program.

If you have concerns …

If you have trouble getting your vehicle repaired promptly and without charge, please contact your dealership's Service Manager for assistance.

If you still have concerns, please contact the Ford Motor Company Customer Relationship Center and one of our representatives will be happy to assist you:

Call (866) 436-7332 …

Office Hours: (Eastern Standard Time)

Monday-Friday: 8AM – 11PM
Saturday: 9AM – 6PM

Hearing impaired, call (800) 232-5952…

Or you may contact us through the Internet …

www.ownerconnection.com
Our current response time to Internet inquiries is three business days.


Quality Care service is there for you all year long.



Quality Care is the commitment of Ford Motor Company and its dealerships to provide you with a superior service and ownership experience. While we regret the inconvenience caused by this program, we stand committed with our dealers to assist you with all of your automotive service needs. With our nationwide dealer network, we're here to ensure you receive Quality Care service so that your vehicle maintains peak performance throughout your ownership experience.

We pride ourselves on becoming the world's leading consumer company for automotive products and services. Again, we are sorry for the inconvenience. Thank you for your attention to this important matter.

Sincerely,



Ann O'Neill
Director
Vehicle Service and Programs