TRANSMISSION—5R44E OR 5R55E—FLUID LEAK AT SERVO COVER—VEHICLES PRODUCED 6/1/2001 THROUGH 3/31/2002 EQUIPPED WITH 2.3L, 3.0L OR 4.0L ENGINES	Article No. 02-8-3

FORD: 2001-2002 EXPLORER SPORT TRAC, EXPLORER SPORT, RANGER

ISSUE

Some vehicles equipped with a 2.3L, 3.0L or 4.0L engine and 5R44E or 5R55E automatic transmission, produced 6/1/2001 through 3/31/02, operating in cold climates, may exhibit a fluid leak at the transmission Servo Cover(s). This may be caused by the Servo Cover.

ACTION

Verify the condition. If the condition exists, the Servo Cover(s) may need to be replaced with new cover(s) (Figure 1). Check the transmission fluid level and fluid condition. If fluid is just low and the fluid condition is not burnt, refer to the following Service Procedure to replace the Servo Cover(s). If the transmission shows evidence of damage due to no fluid, no engagements or severely burnt fluid, the transmission may need additional repair or replacement. Follow normal repair or replacement procedures when servicing anything other than the Servo Cover(s).

SERVICE PROCEDURE

Service Procedure for replacing the Front or Intermediate Servo Cover:

NOTE
AN IN-LINE FLUID FILTER OR AN IN-LINE FLUID FILTER KIT IS NOT REQUIRED FOR THIS PROCEDURE.

1. Remove the catalytic converter.
2. Following the procedures in the Workshop Manual “In-Vehicle Repair”, “Main Control Valve Body”, Section 307-01, remove the Main Control assembly.

NOTE
DO NOT ALLOW THE BAND ADJUSTMENT SCREW TO BACK OUT COMPLETELY OR THE BAND STRUT WILL FALL OUT OF POSITION.

3. Remove and discard the band lock nut, then back out the adjusting screw three to four turns.
4. Install special service tool 307-340 (T95L-77028-A).
5. Tighten special tool to compress the servo spring.

CAUTION
THE SERVO COVER IS UNDER SPRING TENSION.

6. Remove the Servo Cover retaining ring.
7. Slowly remove the tension on the J-hook nut and remove the Servo Cover compressor.

NOTE
DO NOT ALLOW THE PISTON TO COME OUT OF THE BORE.

8. Tap lightly on the cover, then remove the cover.

NOTE
DO NOT DAMAGE THE COVER SEALS DURING INSTALLATION. DO NOT PRESS SERVO COVER AND SEALS PAST THE RELIEF HOLE IN THE CASE OR SEALS MAY BE DAMAGED.

9. Lubricate Servo Cover Seal and install a new Servo Cover Assembly onto the piston and into the piston bore Refer to the Servo Cover Application Chart for Servo Cover applications.
10. Install special service tool 307-340 (T95L-77028-A).
11. Tighten special tool to compress the Servo Cover and spring.
12. Install retaining ring.
13. Slowly remove the tension on the J-hook nut and remove the Servo Cover compressor. Clean residual fluid from Servo Cover area.

NOTE
INSTALL, BUT DO NOT TIGHTEN, A NEW LOCK NUT ON THE SCREW.

Copyright © 2002 Ford Motor Company

NOTE
THE WRENCH WILL CLICK AT THE SPECIFIED TORQUE.

NOTE
IF REPLACING BOTH SERVO COVERS, ORDER TWO (2) NEW LOCK NUTS.

14. Apply petroleum jelly to the lock nut seal. Install new locknut, but do not tighten at this time. Using special service tool 307-S022, tighten the band adjusting screw to 14 N•m (10 Lb-ft), then back off the adjusting screw exactly two (2) turns and hold that position.
15. Hold the band adjusting screw stationary and tighten the band locknut to 47-61 N•m (35-44 lb-ft).
16. Following the procedures in the Workshop Manual "In-Vehicle Repair", "Main Control Valve Body", Section 307-01, Install the Main Control assembly.
17. Reinstall the catalytic converter.

LABOR OPERATION CLAIMING CHART			
Operation	**Labor Description**	**Engine**	**Time**
020803A	Verify condition then replace one servo cover	2.3L	2.2
		3.0L	2.1
		4.0L SOHC	2.4
020803B	Verify condition then replace both servo covers	2.3L	2.5
		3.0L	2.4
		4.0L SOHC	2.8

SERVO COVER APPLICATION CHART			
Cover Assembly	**2.3L**	**3.0L**	**4.0L**
2L5Z-7D027-AA	n/a	Overdrive	Intermediate
2L5Z-7D027-BA	Overdrive and Intermediate	Intermediate	n/a
F77Z-7D027-ZC	n/a	n/a	Overdrive

PART NUMBER	PART NAME
XW4Z-71000-AA	Band Adjustment Lock Nut
F5TZ-7A191-A	Fluid Pan Gasket
D4ZZ-7L173-A	Reverse Servo Cover Gasket
2L5Z-7D027-AA	Servo Cover 3.0L - Overdrive, 4.0L Intermediate
2L5Z-7D027-BA	Servo Cover 2.3L Overdrive and Intermediate, 3.0L Intermediate
F77Z-7D027-ZC	Servo Cover 4.0L - Overdrive

OTHER APPLICABLE ARTICLES: 02-8-2
WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

DEALER CODING

BASIC PART NO.	CONDITION CODE
7L173	01

OASIS CODES: 504000, 510000

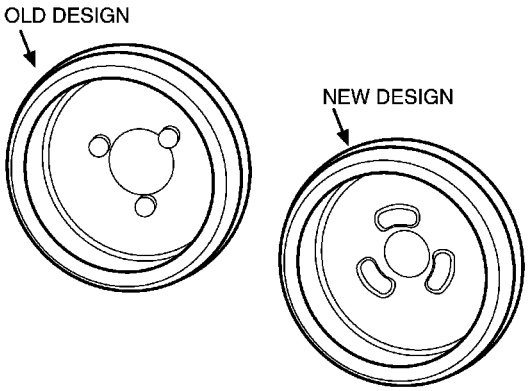


Figure 1 - Article 02-8-3