• **DRIVEABILITY—DIAGNOSTIC TROUBLE CODE (DTC) P1572 STORED IN MEMORY—MALFUNCTION INDICATOR LAMP (MIL) ILLUMINATED—VEHICLES BUILT PRIOR TO 2/28/2001** • **ELECTRICAL—LAMP—MALFUNCTION INDICATOR LAMP (MIL) ILLUMINATED—DIAGNOSTIC TROUBLE CODE (DTC) P1572 STORED IN MEMORY—VEHICLES BUILT PRIOR TO 2/28/2001**	**Article No. 01-3-3**

LINCOLN: 2001 LS

ISSUE

Some vehicles may exhibit a Malfunction Indicator Lamp (MIL) illuminated due to Diagnostic Trouble Code (DTC) P1572 (Brake Pedal Switch Circuit Fault) stored in memory. This DTC may be caused by the Powertrain Control Module (PCM) calibration.

ACTION

If normal diagnostics cannot pinpoint the condition and no other concerns are found, reprogram the PCM. Refer to the following PCM Calibration Information Chart.

SERVICE PROCEDURE

Perform normal diagnostics for P1572 DTC. Verify that P1572 DTC is not the result of the Brake Pedal Position Switch (brake light switch), Brake Pressure Switch (speed control deactivation switch), wiring, or adjustment of the switches.

Copyright © 2001 Ford Motor Company

Article No. 01-3-3 Cont'd.

PCM CALIBRATION INFORMATION						
Application	Old Part Number (-12A650-)	Tear Tag	New Part Number (-12A650-)	Old Calibration	New Calibration	NGS/WDS Qualifier
2001 LS 3.0L Base, A/T	1W4A-AC	MSU1	1U7Z-JB	1LQ16B0507	1LQ16B0507	WDS B11_7 Release
2001 LS 3.0L Sport, A/T	1W4A-BC	DJY1	1U7Z-KB	1LQ16S0507	1LQ16S0507	WDS B11_7 Release
2001 LS 3.0L Sport, M/T	1W4A-EB	KVN1	1U7Z-NB	1LQ26S0506	1LQ26S0506	WDS B11_7 Release
2001 LS 3.9L Base, A/T	1W4A-GB	KQI1	1U7Z-DB	1LQ18B0506	1LQ18B0506	WDS B11_7 Release
2001 LS 3.9L Sport, A/T	1W4A-HB	FMS1	1U7Z-FB	1LQ18S0506	1LQ18S0506	WDS B11_7 Release
2001 LS 3.9L Base, A/T Mexico	1W4A-JB	KSF1	1U7Z-GB	1LQ19B0506	1LQ19B0506	WDS B11_7 Release
2001 LS 3.9L Sport, A/T Mexico	1W4A-KB	MFF1	1U7Z-HB	1LQ19S0506	1LQ19S0506	WDS B11_7 Release
2001 LS 3.0L Base, A/T	1W4A-AEA	PSI0	1U7Z-TA	1LQ16B0510	1LQ16B0510	WDS B11_7 Release
2001 LS 3.0L Sport, A/T	1W4A-AEB	PSI0	1U7Z-TA	1LQ16B0511	1LQ16B0511	WDS B11_7 Release
2001 LS 3.0L Sport, A/T	1W4A-AFA	SYV0	1U7Z-TA	1LQ16S0510	1LQ16S0510	WDS B11_7 Release
2001 LS 3.0L Sport, A/T	1W4A-AFB	SYV0	1U7Z-UA	1LQ16S0511	1LQ16S0511	WDS B11_7 Release
2001 LS 3.0L Sport, M/T	1W4A-AGA	NRW0	1U7Z-SA	1LQ26S0510	1LQ26S0510	WDS B11_7 Release
2001 LS 3.0L Sport, M/T	1W4A-AGB	NRW0	1U7Z-SA	1LQ26S0511	1LQ26S0511	WDS B11_7 Release
2001 LS 3.9L Base, A/T	1W4A-AAA	QEC0	1U7Z-VA	1LQ18B0510	1LQ18B0510	WDS B11_7 Release
2001 LS 3.9L Sport, A/T	1W4A-ABA	REM0	1U7Z-WA	1LQ18S0510	1LQ18S0510	WDS B11_7 Release
2001 LS 3.9L Base, A/T Mexico	1W4A-ACA	MDR0	1U7Z-YA	1LQ19B0510	1LQ19B0510	WDS B11_7 Release
2001 LS 3.9L Sport, A/T Mexico	1W4A-ADA	ZRF0	1U7Z-ZA	1LQ19S0510	1LQ19S0510	WDS B11_7 Release

Obtain an Authorized Modifications Decal (FPS 8262 - obtainable through DOES II, 25/pkg) and list the date, dealer number, and summary of modifications performed. Select a prominent place adjacent to the Vehicle Emission Control Information Decal suitable for installing the Authorized Modifications Decal. Clean the area, install the decal, and cover it with a clear plastic decal shield.

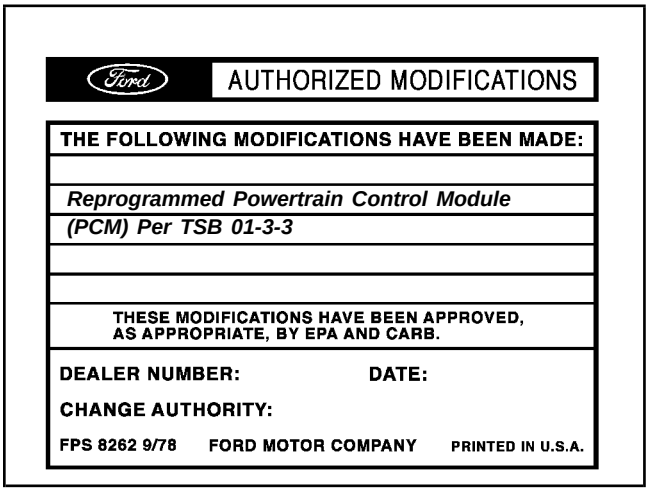

AUTHORIZED MODIFICATIONS

THE FOLLOWING MODIFICATIONS HAVE BEEN MADE:

Reprogrammed Powertrain Control Module (PCM) Per TSB 01-3-3

THESE MODIFICATIONS HAVE BEEN APPROVED, AS APPROPRIATE, BY EPA AND CARB.

DEALER NUMBER: DATE:

CHANGE AUTHORITY:

FPS 8262 9/78 FORD MOTOR COMPANY PRINTED IN U.S.A.

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: INFORMATION ONLY
OASIS CODES: 206000, 698298