HESITATION—DURING STEADY STATE OPERATION BETWEEN 64-72 KM/H (40-45 MPH) AND/OR 96-105 KM/H (60-65 MPH)—VEHICLES BUILT THROUGH 10/18/1999	Article No. 00-2-3

LINCOLN: 1999-2000 CONTINENTAL

ISSUE

Some vehicles may exhibit a hesitation/trailer hitch feel during steady state operation at 64-72 km/h (40 to 45 mph) or 96-105 km/h (60 to 65 mph). This may be caused by the Powertrain Control Module (PCM) calibration.

ACTION

Reprogram the PCM with the revised calibration. The revised calibration should reduce the possibility of hesitation. Refer to the following Calibration Information Chart.

Calibration Information		
Application	**Tear Tag**	**NGS/SBDS Qualifier**
9VWA-BCD	YPT3	9VWA-BC OR 0JC1BN0B CALIBRATION

Obtain an Authorized Modifications Decal (FPS 8262 - obtainable through DOES II, 25/pkg) and list the date, dealer number, and summary of modifications performed. Select a prominent place adjacent to the Vehicle Emission Control Information Decal suitable for installing the Authorized Modifications Decal. Clean the area, install the decal, and cover it with a clear plastic decal shield.

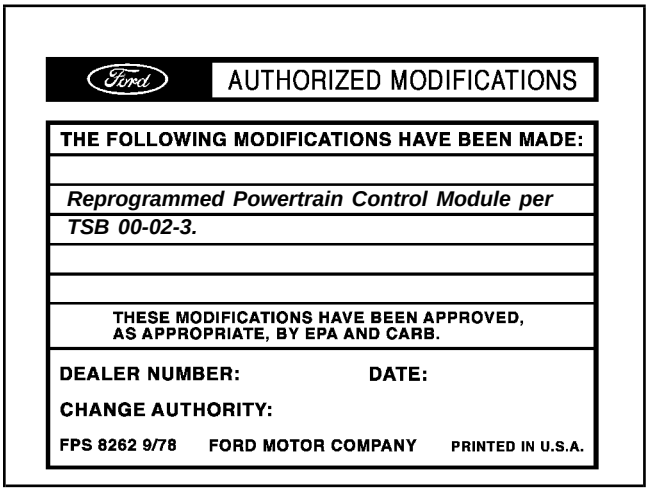

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
000203A	Reprogram Powertrain Control Module (PCM)	0.4 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
RECAL	08

OASIS CODES: 610000, 610600, 611000, 612000, 612600