2001 ESCAPE SPEED CONTROL CABLE AND SERVO REPLACEMENT

AFFECTED VEHICLE: **2001 MODEL YEAR ESCAPE EQUIPPED WITH V-6 ENGINE AND SPEED CONTROL**

INSPECTION PROCEDURE

1. Locate the speed control actuator (passenger side, top of fenderwell).
2. Separate the speed control cable cap from the speed control actuator as follows. See Figure 1.
   - Depress the speed control cable cap-retaining tab.
   - Rotate the speed control cable cap in a counterclockwise direction and separate the cap from the actuator. Do not disengage the cable from the actuator.

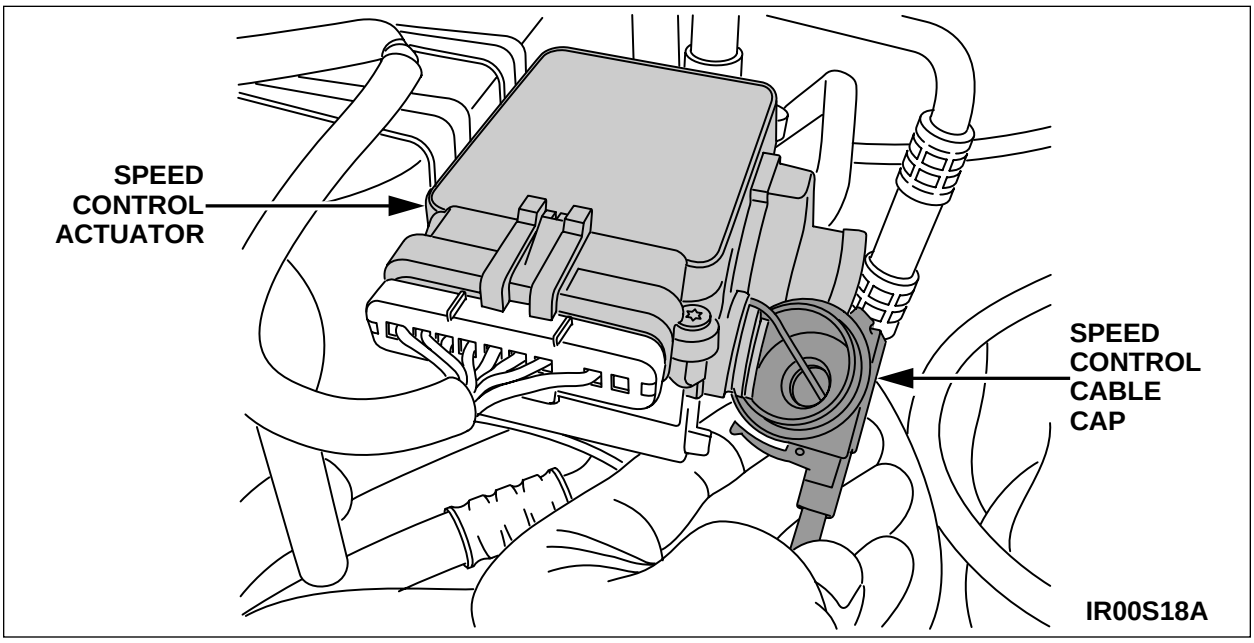

FIGURE 1

CPR © 2000 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
07/00

3. Locate the character (letter or number) on the speed control cable cap, as shown in the illustration. See Figure 2.

A. Vehicles with letter A, B, C, or D or number 1 or 2 **DO NOT** require any repair. Reconnect the speed control cable cap to the speed control actuator. Return the vehicle to the customer.

B. Vehicles with either number 3 or 4 will require replacement of the speed control actuator and the speed control cable. Refer to the service procedures in section 310-03 of the appropriate Workshop Manual.

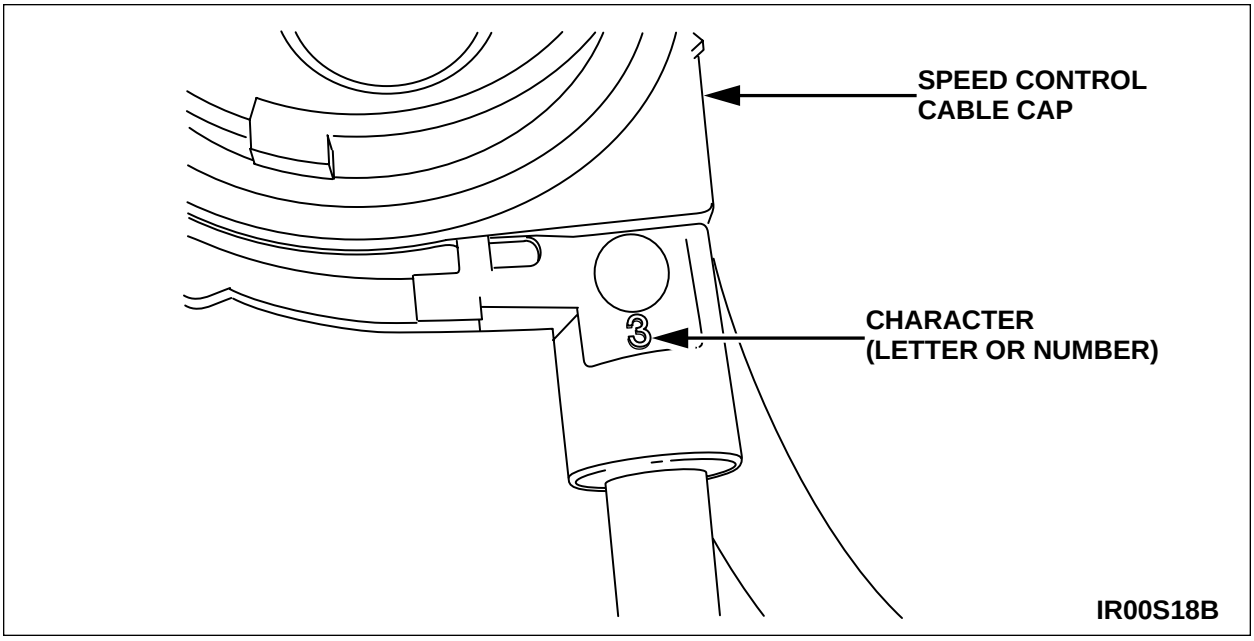

FIGURE 2

CPR © 2000 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
07/00