| NOISE—"CHUCKING/SQUEAKING/CREAKING" COMING FROM REAR DOORS WHILE DRIVING OVER BUMPS AND/OR DURING HARD TURNS WHILE STOPPING | Article No. 00-5-5 |
|---|---|

**FORD:** 1999-2000 RANGER

## ISSUE

A "chucking/squeaking" and/or "creaking" noise may be heard from the rear doors while driving over bumps and/or during a hard turn while stopping. This may be caused by the rear door striker bar positioned incorrectly.

## ACTION

Correctly position striker bar. Refer to the following Service Procedure for details.

### SERVICE PROCEDURE

1. Verify chucking, squeaking, and/or creaking sound(s) are present while driving on non-smooth surfaces (e.g. gravel/rough roads). The sound may also be present under a hard turn (stop-to-stop) condition and/or when the vehicle is in a body-flex situation (i.e. turning in parking lot or driveway).
2. If noise(s) are present, determine if the rear doors' upper striker bars are positioned correctly (Figure 1). The upper striker bar must meet the center of the rear door locking-latch assembly as shown in Figure 1.
3. If not, lightly tap upper striker bar with a rubber/plastic mallet or equivalent, so it is positioned correctly as shown in Figure 1.
4. Verify fix with road test by driving over rough or non-smooth surfaces.

**OTHER APPLICABLE ARTICLES:** NONE

**WARRANTY STATUS:** Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

| OPERATION | DESCRIPTION | TIME |
|---|---|---|
| 000505A | Reposition Striker Bar And Road Test (One Door) | 0.7 Hr. |
| 000505B | Reposition Striker Bar And Road Test (Both Doors) | 0.8 Hr. |

**DEALER CODING**

| BASIC PART NO. | CONDITION CODE |
|---|---|
| 13268B89, 13268B88 | 07 |

**OASIS CODES:** 702000, 702100, 702200, 702300

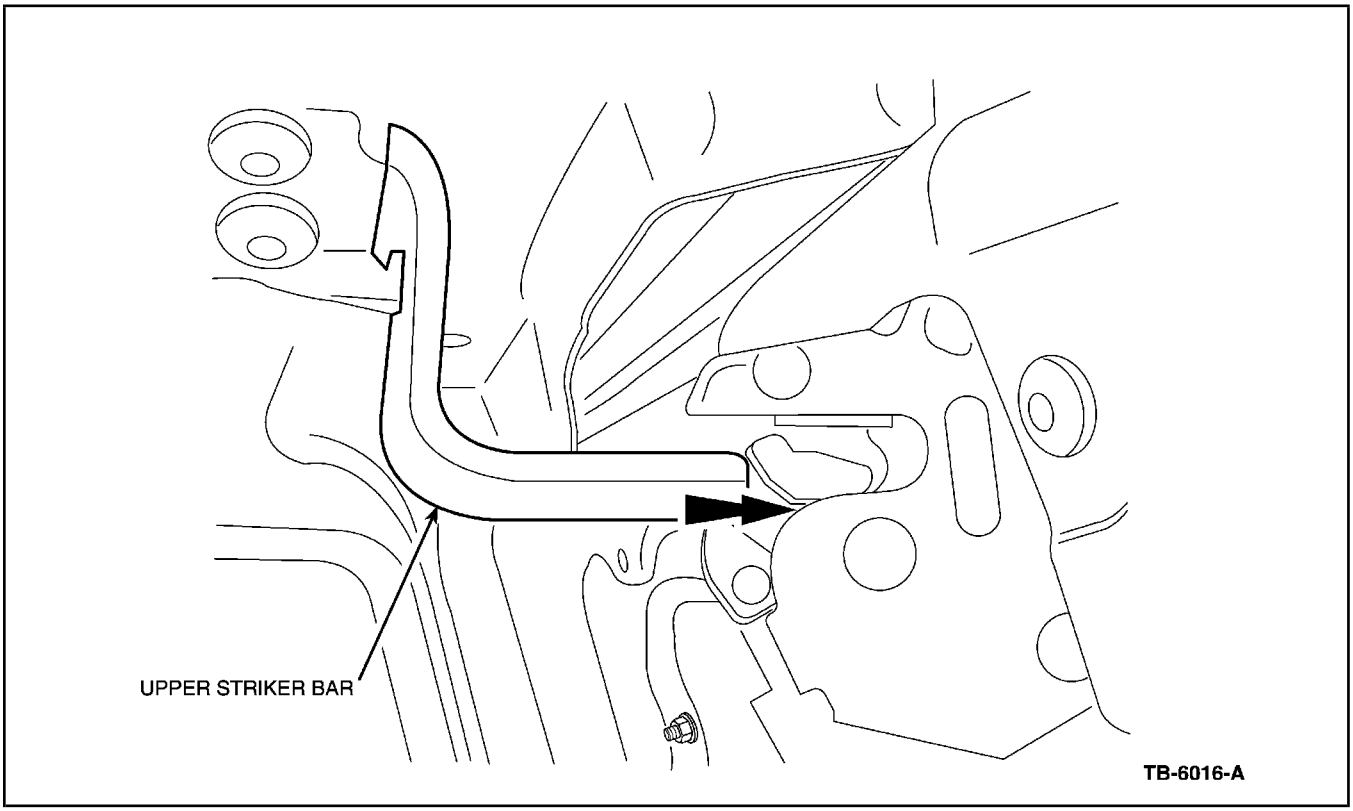


Figure 1 - Article 00-5-5