• **VIBRATION—VIBRATION FELT AT HIGH SPEEDS—TRANSMISSION OUTPUT SHAFT BUSHING OR SEAL DAMAGED OR OUT OF POSITION—4X2 MODELS EQUIPPED WITH 4R70W AUTOMATIC TRANSMISSION AND 139 INCH WHEELBASE ONLY—BUILT BEFORE 3/1/2001** • **TRANSMISSION—4R70W—TRANSMISSION OUTPUT SHAFT BUSHING OR SEAL DAMAGED OR OUT OF POSITION—4X2 MODELS EQUIPPED WITH 4R70W AUTOMATIC TRANSMISSION AND 139 INCH WHEELBASE ONLY—BUILT BEFORE 3/1/2001**	**Article No. 01-9-1**

FORD: 2001 F-150

ISSUE

Some vehicles built before 3/1/2001 may exhibit a high speed driveline vibration that may cause possible transmission and/or driveshaft damage. This may result in the 4R70W transmission extension housing bushing to be spun out of the extension housing or may cause the extension housing seal to leak.

ACTION

Verify the extension housing bushing is spun out of position or damaged or the extension housing seal is leaking. If normal diagnostics cannot pinpoint the cause, reprogram the Powertrain Control Module (PCM). The updated calibration will reduce the maximum top speed of the vehicle to reduce the possibility of vibration. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

If the driveshaft or extension housing bushing is damaged, replace or repair per the following procedure and 2001 Workshop Manual Procedures. Reprogram the PCM with an updated calibration. Refer to the following PCM Calibration Information Chart.

1. Raise the vehicle on a hoist and inspect the transmission extension housing bushing and seal for damage.
2. If the extension housing bushing or seal is damaged, remove the driveshaft and transmission extension housing per 2001 Workshop Manual, Section 307-01B. Install a new Extension Housing Assembly (F3LY-7A039-A), and a new Extension Housing Gasket (F6AZ-7086-A). Verify transmission fluid level.
3. If the driveshaft or yoke is damaged, replace as necessary. Use the part list for the correct driveshaft application. During driveshaft installation, follow the procedure outlined in the following note.

NOTE

THE INDEX PAINT MARKS ON THE OUTPUT SHAFT, DRIVESHAFT, AND REAR AXLE MUST BE ALIGNED. THE INDEXED BALANCE MARK ON THE OUTPUT SHAFT AND THE INDEXED BALANCE MARK ON THE NEW DRIVESHAFT YOKE MUST BE ALIGNED (FIGURE 1). ALIGNMENT OF THE INDEX MARKS ON THE REAR DRIVESHAFT TUBE AND THE REAR AXLE FLANGE MUST BE PERFORMED (FIGURE 2).

Copyright © 2001 Ford Motor Company

PCM CALIBRATION INFORMATION						
Application	**Old Part Number (-12A650-)**	**Tear Tag**	**New Part Number (-12A650-)**	**Old Calibration**	**New Calibration**	**NGS/WDS Qualifier**
4.2L, 4R70W with 3.31, 3.55 Axle, 50-State F-150	1L3F-DD	XAZ4	1L3Z-DE	1F512C0510	1F512C0511	WDS B12.11 Release
4.6L, 4R70W, 4X2, Federal F-150	1L3F-AVC	WIZ3	1L3Z-AVD	1F516M0A10	1F516M0A11	WDS B12.11 Release
4.6L, 4R70W, 4X2, Calif. F-150	1L3F-KC	EME3	1L3Z-KD	1F516D0A10	1F516D0A11	WDS B12.11 Release
5.4L, 4R70W, Base/Harley, Federal F-150	1L3F-ASB	SVB2	1L3Z-ASC	1F514F0A05	1F514F0A10	WDS B12.11 Release
5.4L, 4R70W, Base/Harley, Calif. F-150	1L3F-ARB	CML2	1L3Z-ARC	1F514E0B05	1F514E0B10	WDS B12.11 Release

PART NUMBER	PART NAME
F85Z-4602-FA	Driveshaft (4.2L/4.6L, 4X2, 4R70W, 139″ WB)
XL3Z-4602-BA	Driveshaft (5.4L, 4X2, 4R70W, 139″ WB)
F3LY-7A039-A	Transmission Extension Housing
F6AZ-7086-A	Gasket - Extension Housing

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: INFORMATION ONLY
OASIS CODES: 504000, 510000, 597997, 703000, 703300

Obtain an Authorized Modifications Decal (FPS 8262 - obtainable through DOES II, 25/pkg) and list the date, dealer number, and summary of modifications performed. Select a prominent place adjacent to the Vehicle Emission Control Information Decal suitable for installing the Authorized Modifications Decal. Clean the area, install the decal, and cover it with a clear plastic decal shield.

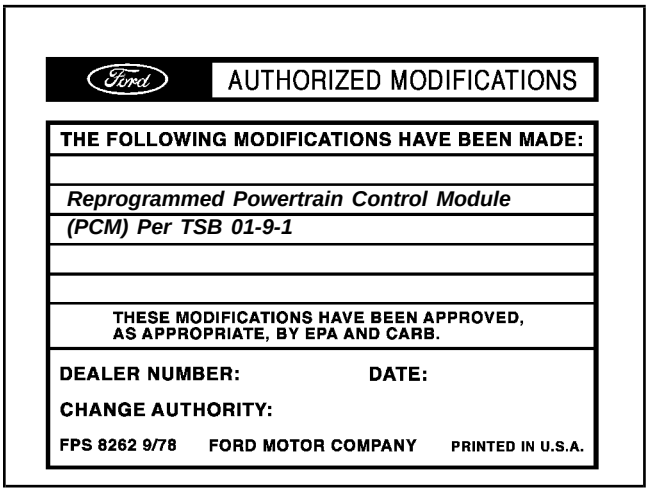

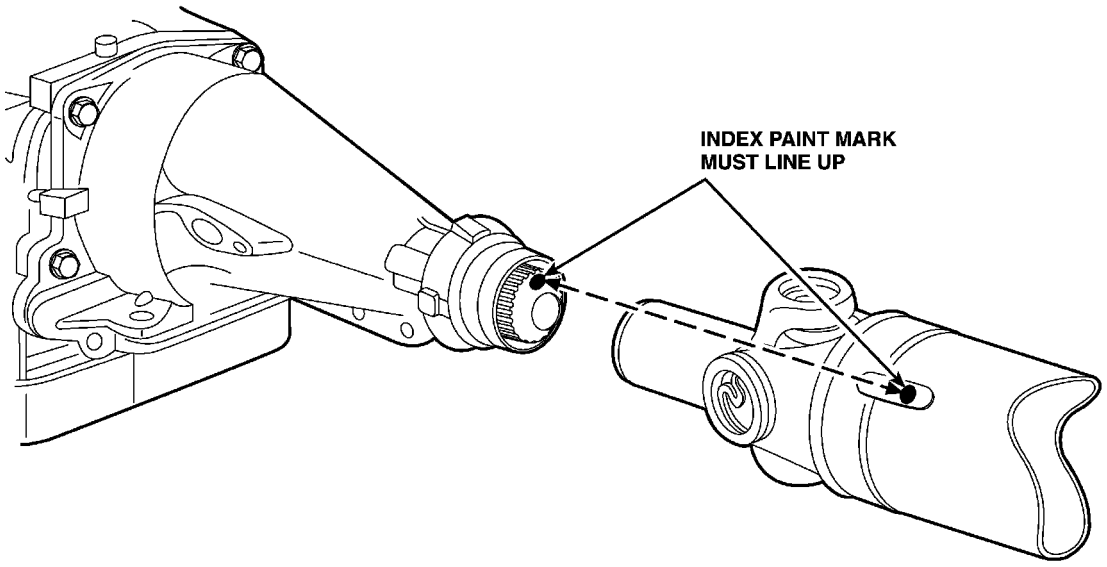

Figure 1 - Article 01-9-1

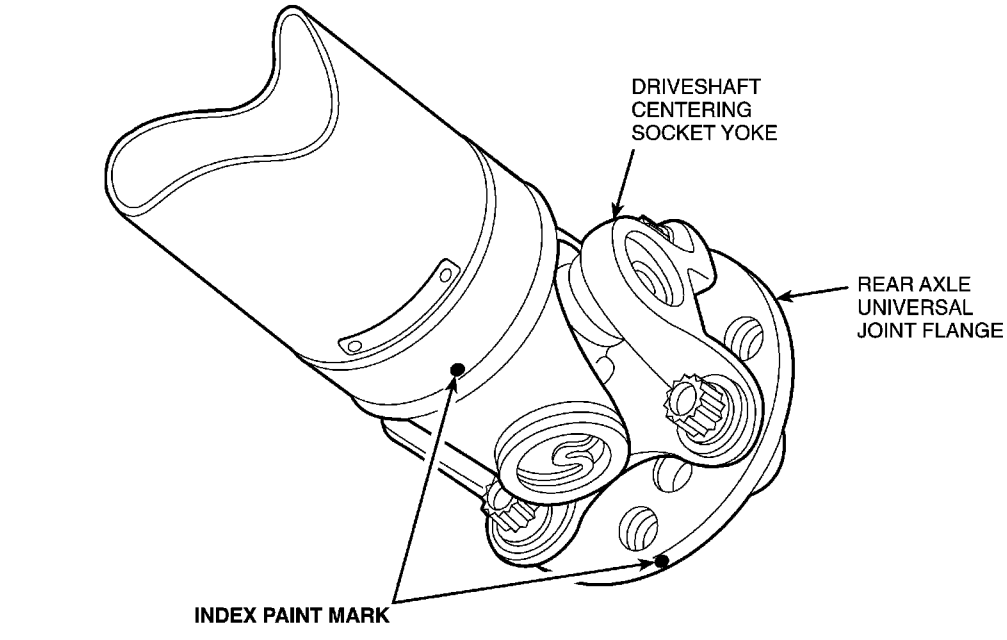

Figure 2 - Article 01-9-1