BRAKE LAMP SWITCH REPLACEMENT

AFFECTED VEHICLES: **CERTAIN 2000 AND 2001 MODEL YEAR TAURUS/SABLE EQUIPPED WITH POWER ADJUSTABLE FOOT PEDALS**

OVERVIEW

The brake lamp switch on the affected vehicles must be replaced. Lubricating grease applied to the power adjustable foot pedal assembly may have contaminated the brake lamp switch. Excess lubricating grease from the outer surfaces of the pedal assembly will be removed before a ***new*** switch is installed. This procedure will give the details for cleaning of the pedal assembly and replacement of the brake lamp switch.

SERVICE PROCEDURE

1. Note the position of the power adjustable foot pedals then move the pedals to the full upward position.
2. Install a memory saver, then disconnect the battery negative cable.
3. Disconnect the electrical connector from the brake lamp switch. See Figure 1.
4. Remove the retaining clip, then remove and discard the brake lamp switch. See Figure 1.

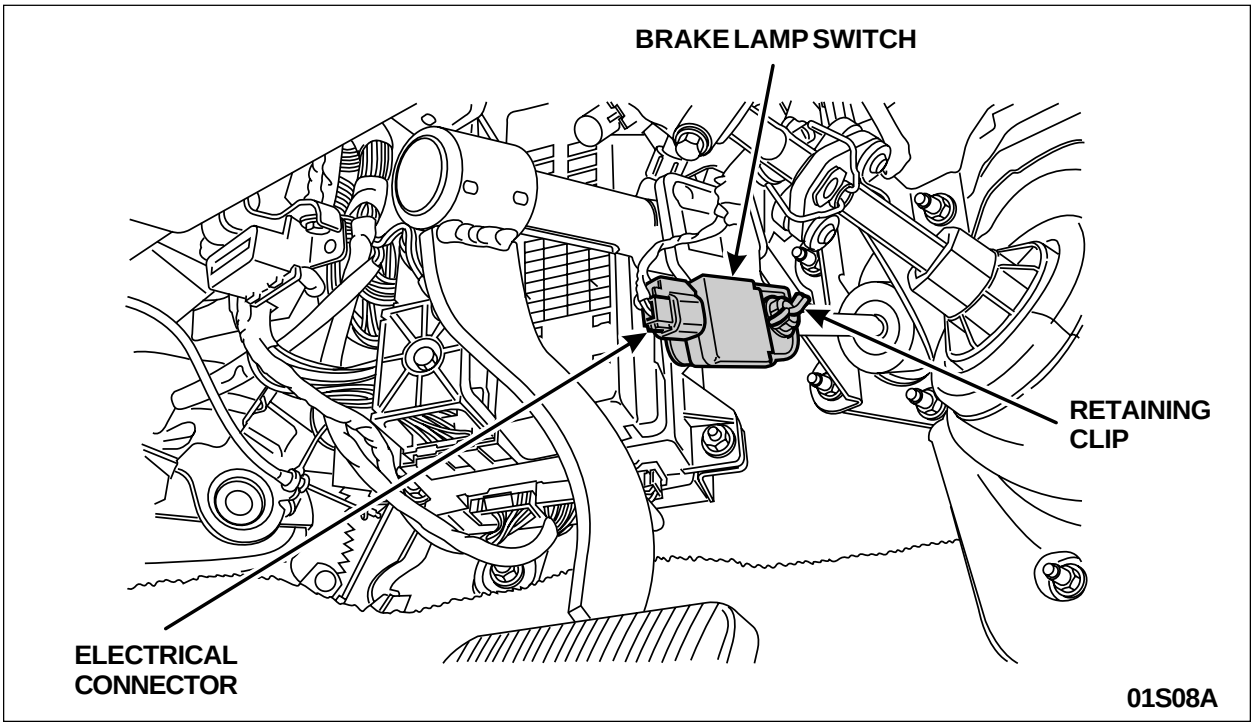


FIGURE 1

Ford Motor Company

CPR © 2001 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
02/01

5. NOTE: Do not use solvents when removing the lubricating grease from the brake pedal assembly.

   Use a shop cloth to remove any lubricating grease from the outer surfaces of the following brake pedal assembly components. See Figure 2.
   - Cable connection
   - Pivot spring
   - Guide rod
   - Guide bracket
   - Booster pin

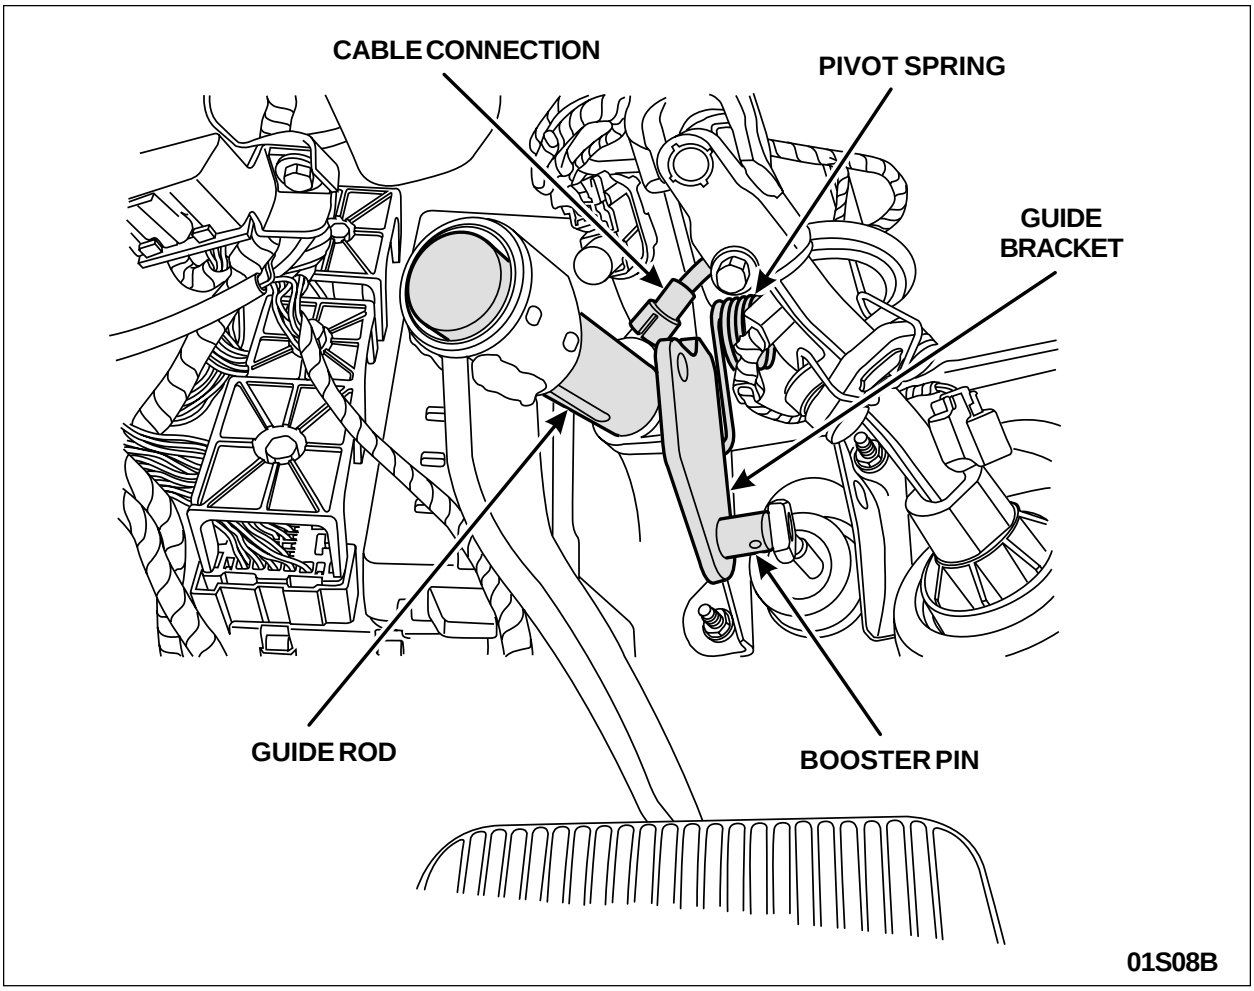


FIGURE 2

6. Install a ***new*** brake lamp switch, then install the retaining clip.
7. Connect the electrical connector to the brake lamp switch.
8. Connect the battery negative cable, then remove the memory saver.
9. Move the pedals to their original position.
10. Verify proper brake lamp operation.

Ford Motor Company

CPR © 2001 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
02/01