- **COOLANT—COOLANT SEEPAGE AT INTAKE MANIFOLD CROSS-OVER—VEHICLES EQUIPPED WITH 4.6L 2V ENGINE ONLY**
- **ENGINE—4.6L 2V—COOLANT SEEPAGE AT INTAKE MANIFOLD CROSS-OVER**

Article No. 02-2-2

FORD: 1996-1997 THUNDERBIRD
1996-2001 CROWN VICTORIA, MUSTANG
2002 EXPLORER

LINCOLN: 1996-2001 TOWN CAR

MERCURY: 1996-1997 COUGAR
1996-2001 GRAND MARQUIS

ISSUE

Some vehicles may exhibit an Intake Manifold crossover (first runner) coolant seepage condition. This may be caused by a crack in the Intake Manifold coolant crossover.

ACTION

Inspect the suspect Intake Manifold for a coolant leak at the first runner cross-over area (Figure 1). If coolant seepage is found in this area, order the appropriate Service Kit and install parts, by referring to the appropriate Model Year Workshop Manual (Section 303-01).

4.6L 2V INTAKE MANIFOLD INSPECTION/REPLACEMENT

Refer to Figure 1 for inspection of coolant seepage. If seepage is found, order one of the following Service Kits to repair.

1998-2000 - Police/Limo - Crown Victoria, Grand Marquis, Town Car - KIT- F8AZ-9424-CA

Part Number	Description	Quantity
F8AZ-9424-CB	Intake Manifold	1
F8AZ-10153-GA	Alternator Brace	1
N806178-S309	Water Outlet Connection Bolts	2
XW7Z-9439-AA	Intake Manifold Gasket	2
F1VY-8255-AA	O-Ring For Thermostat	1
XW13-8B274-AA	Upper Radiator Hose	1
1W7Z-8592-AA	Water Outlet Connector	1
F8AZ-6A946-CA	Engine Cover	1
N808455-S100	Nut	1
W705310-S309	Stud	1
SK 1W7E-9E473-BA	Instruction Sheet	1

2002 Explorer - KIT- 1L2Z-9424-AA

Part Number	Description	Quantity
1L2Z-9424-FA	Intake Manifold	1
1L2Z-10153-DA	Alternator Brace	1
W708309-S437	Water Outlet Connection Bolts	2
YL3Z-9439-BA	Intake Manifold Gasket	2
F1VY-8255-AA	O-Ring For Thermostat	1
SK 1W7E-9E473-BA	Instruction Sheet	1

1999-2001 Mustang - KIT- 1R3Z-9424-AAA

Part Number	Description	Quantity
1W7Z-9424-AA	Intake Manifold	1
1R3Z-10153-AA	Alternator Brace	1
W708309-S437	Water Outlet Connection Bolts	2
YL3Z-9439-BA	Intake Manifold Gasket	2
F1VY-8255-AA	O-Ring For Thermostat	1
2R33-12B637-AD	Wiring Harness	1
SK 1W7E-9E473-BA	Instruction Sheet	1

1996-1998 Mustang, 1996-1997 Thunderbird, Cougar - KIT- F6SZ-9424-AA

Part Number	Description	Quantity
F8AZ-9424-CB	Intake Manifold	1
F8AZ-10153-EA	Alternator Brace	1
W708309-S437	Water Outlet Connection Bolts	2
XW7Z-9439-AA	Intake Manifold Gasket	2
F1VY-8255-AA	O-Ring For Thermostat	1
XL1U-10329-BA	Alternator Insulator (10.6 N•m (93 Lb-in.) Nut torque)	1
SK 1W7E-9E473-BA	Instruction Sheet	1

Copyright © 2002 Ford Motor Company

2001 - Retail - Crown Victoria, Grand Marquis, Town Car - KIT- 1W7Z-9424-AAA		
Part Number	**Description**	**Quantity**
1W7Z-9424-AA	Intake Manifold	1
1W7Z-10153-CA	Alternator Brace	1
W708309-S437	Water Outlet Connection Bolts	2
YL3Z-9439-BA	Intake Manifold Gasket	2
F1VY-8255-AA	O-Ring For Thermostat	1
SK 1W7E-9E473-BA	Instruction Sheet	1

1998-2000 - Retail - Crown Victoria, Grand Marquis, Town Car - KIT- F8AZ-9424-BAA		
Part Number	**Description**	**Quantity**
F8AZ-9424-CB	Intake Manifold	1
F8AZ-10153-FA	Alternator Brace	1
N806178-S309	Water Outlet Connection Bolts	2
XW7Z-9439-AA	Intake Manifold Gasket	2
F1VY-8255-AA	O-Ring For Thermostat	1
XW13-8B274-AA	Upper Radiator Hose	1
1W7Z-8592-AA	Water Outlet Connector	1
F8AZ-6A946-CA	Engine Cover	1
N808455-S100	Nut	1
W705310-S309	Stud	1
SK 1W7E-9E473-BA	Instruction Sheet	1

1996-1997 Crown Victoria, Grand Marquis, Town Car - KIT- F8AZ-9424-AAA		
Part Number	**Description**	**Quantity**
F8AZ-9424-CB	Intake Manifold	1
F8AZ-10153-EA	Alternator Brace	1
W708309-S437	Water Outlet Connection Bolts	2
XW7Z-9439-AA	Intake Manifold Gasket	2
F1VY-8255-AA	O-Ring For Thermostat	1
SK 1W7E-9E473-BA	Instruction Sheet	1

2001 - Police/Limo - Crown Victoria, Grand Marquis, Town Car - KIT- 1W7Z-9424-BA		
Part Number	**Description**	**Quantity**
1W7Z-9424-AA	Intake Manifold	1
1W7Z-10153-DA	Alternator Brace	1
W708309-S437	Water Outlet Connection Bolts	2
YL3Z-9439-BA	Intake Manifold Gasket	2
F1VY-8255-AA	O-Ring For Thermostat	1
SK 1W7E-9E473-BA	Instruction Sheet	1

PART NUMBER	PART NAME
F8AZ-9424-CA	Service Kit - Intake Manifold
1L2Z-9424-AA	Service Kit - Intake Manifold
1R3Z-9424-AAA	Service Kit - Intake Manifold
F6SZ-9424-AA	Service Kit - Intake Manifold
1W7Z-9424-AAA	Service Kit - Intake Manifold
F8AZ-9424-BAA	Service Kit - Intake Manifold
F8AZ-9424-AAA	Service Kit - Intake Manifold
1W7Z-9424-BA	Service Kit - Intake Manifold

OTHER APPLICABLE ARTICLES: NONE
WARRANTY STATUS: INFORMATION ONLY
OASIS CODES: 402000, 499000

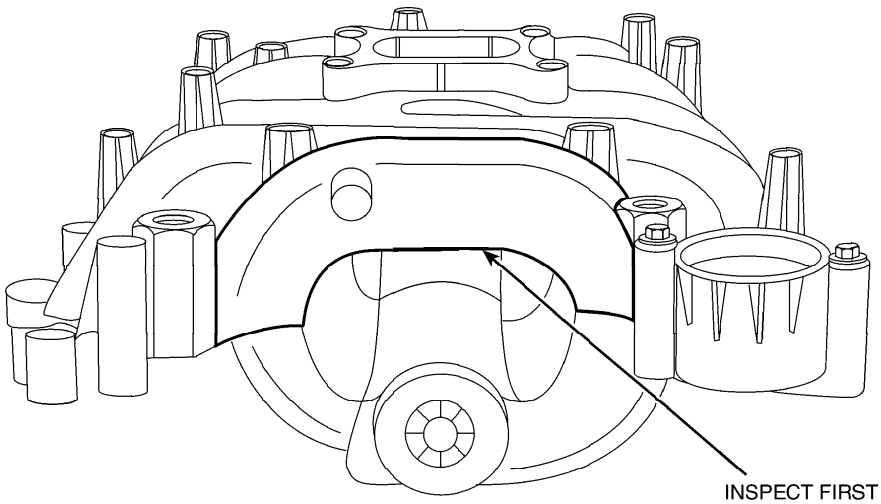

Figure 1 - Article 02-2-2