ELECTRICAL—SIDE AIR BAG DIAGNOSTIC CODES (DTC) B1994 AND/OR B1998—VEHICLES BUILT BEFORE 2/18/02 ONLY	Article No. 02-13-7

LINCOLN: 2000-2002 LS

Article **01-25-2** is being republished in its entirety to update the Service Parts used.

ISSUE

On some vehicles built before 2/18/02, the Air Bag Warning Lamp may illuminate with Diagnostic Trouble Codes (DTCs) B1994 (Driver - Side Air Bag Circuit High Resistance) and/or B1998 (Passenger - Side Air Bag Circuit High Resistance) stored. This may be caused by a broken circuit to the Side Impact Air Bags.

ACTION

Repair the broken circuit(s) by installing service connector and pigtail, part number 2W4Z-14S411-BA. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

1. Check the Air Bag Restraint Control Module (RCM) for DTCs. If DTCs B1994 and/or B1998 are present, continue with this Service Procedure. These DTCs may be stored as either Intermittent or Hard Fault codes.
2. The suspect circuits are part of the 14A005 vehicle electrical harness that enters the passenger compartment through an opening in the carpet below each front seat. The break may occur slightly above or inside the end of the protective conduit near the Air Bag connector for the seat (Figure 1).
3. Move the seat to the full forward position. Inspect the suspect circuits for breakage depending on DTC observed during self test:
   a. B1994 - Inspect circuits 30S-JA37 & 31S-JA37 at C316 under the Drivers Seat. Refer to Wiring Diagrams Manual Section 501-20B.
   b. B1998 - Inspect circuits 30S-JA38 & 31S-JA38 at C314 under the Passenger Seat. Refer to Wiring Diagrams Manual Section 501-20B.

CAUTION

FOLLOW THE AIR BAG DEACTIVATION PROCEDURE BEFORE CONTINUING WITH THIS ARTICLE. FAILURE TO DO SO MAY RESULT IN ACCIDENTAL AIR BAG DEPLOYMENT. REFER TO THE APPROPRIATE WORKSHOP MANUAL SECTION 501-20B.

4. Remove the seat on affected side of the vehicle to gain access to the broken wiring. Refer to the appropriate Workshop Manual Section 501-10.
5. Cut one of the wires in the affected harness to a length of 1.5″ from the base of the take-out. Cut the other wire to a length of 3.5″ from the base of the take-out. By stagger cutting the wires, this will provide 2 ″ of clearance between each splice (Figure 2). Refer to the appropriate Workshop Manual Section 501-20B, General Procedures - Wiring Repair, for further details.

NOTE

THE OVERALL LENGTH OF THE REPAIRED HARNESS SHOULD BE 6″ - 6.5 ″ (BASE OF THE TAKE-OUT TO THE END OF CONNECTOR). IF THE REPAIRED HARNESS IS SHORTER THAN THIS LENGTH, DAMAGE MAY RESULT FROM THE HARNESS BEING PULLED APART DURING NORMAL SEAT TRAVEL.

NOTE

THE REPAIR CONNECTOR AND PIGTAIL WIRING COLORS ARE DUPLICATED FROM THE DRIVERS SIDE VEHICLE WIRING. IF THIS REPAIR IS PERFORMED ON THE PASSENGER SIDE, CARE MUST BE TAKEN TO BE SURE THE CORRECT WIRES ARE SPLICED DURING THIS PROCEDURE.

6. Trim the repair connector and pigtail, part number 2W4Z-14S411-BA, in a staggered fashion that matches the repair on the vehicle harness.

Copyright © 2002 Ford Motor Company

Article No. 02-13-7 Cont'd.

7. Splice in the repair connector using two (2) Butt-Splice connectors, part number F2AZ-14488-A. This Butt-Splice connector is heat shrinking nylon, 18-22 Gauge, water-proof and transparent, approved for Air Bag system wiring repairs.
8. Wrap the repaired circuits in electrical tape from the take-out to within 1/2″ from the connector.
9. Install the seat.
10. Follow the Air Bag Reactivation procedure. Refer to the appropriate Workshop Manual Section 501-20B.
11. Operate the seat in the full range of motion, including Easy Access/East Out feature (if equipped) on the Drivers Seat, checking for free movement for the harness.
12. Clear DTCs from the Air Bag RCM.

PART NUMBER	PART NAME
2W4Z-14S411-BA	Pigtail - Wire Connector Assembly
F2AZ-14488-A	Butt-Splice Wire Connector

OTHER APPLICABLE ARTICLES: NONE
SUPERSEDES: 01-25-2
WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
021307A	Replace Connector (Includes Time To Remove And Reinstall One Front Seat)	2.3 Hrs.
021307B	Replace Connector Both Front Seats (Includes Time To Remove And Reinstall Both Front Seats)	2.7 Hrs.

DEALER CODING

BASIC PART NO.	CONDITION CODE
14A005	30

OASIS CODES: 104000, 203000, 203200, 206000

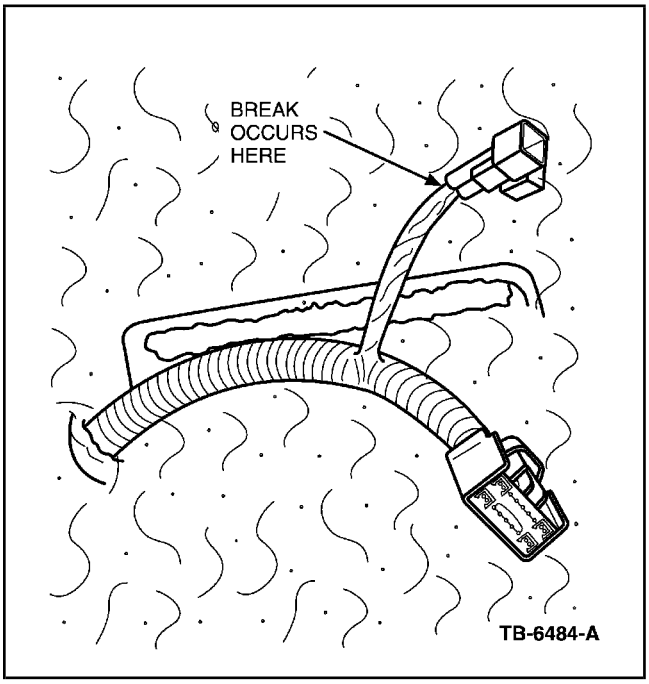


Figure 1 - Article 02-13-7

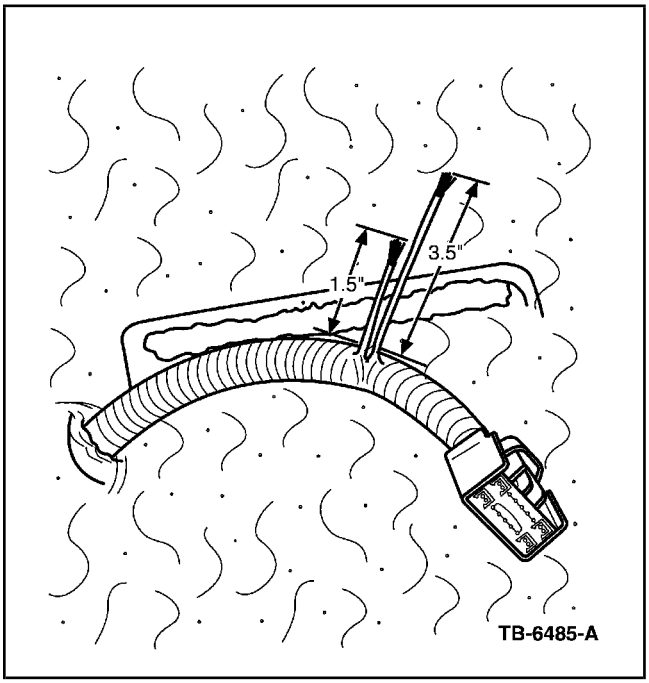


Figure 2 - Article 02-13-7