Ford Motor Company

March 2001

TO: All Ford and Lincoln Mercury Dealers

SUBJECT: Safety Recall 01S06: Certain 2000 and 2001 Model Year Ford Taurus Sedans - Deck Lid Spoiler Center High Mount Stop Lamp Resistor Installation

AFFECTED VEHICLES

Certain 2000 and 2001 model year Taurus sedans built at the Atlanta Assembly Plant beginning April 5, 2000 through October 31, 2000 and at the Chicago Assembly Plant beginning March 10, 2000, through October 31, 2000. In addition, certain 2000 and 2001 model year Taurus vehicles with dealer or customer installed Ford deck lid spoilers sold during the 2000 calendar year.

NON-COMPLIANCE

In some of the affected vehicles the center high mount stop lamp located in the deck lid spoiler may illuminate when the emergency flashers are activated. This illumination does not comply with Federal Motor Vehicle Safety Standard #108 (FMVSS108), which states that high mount stop lamps shall be activated only upon application of the service brake. Service Spoiler Kits (base part # 5444210) installed on a vehicle may cause the same non-compliance condition.

Additionally, although not a compliance issue, the brake shift interlock locking mechanism may disengage allowing the shift lever to be moved out of park without depressing the brake pedal.

SERVICE ACTION

- The dealer must install an in-line resistor to correct the condition. This must be done on all of the affected vehicles.
- Dealers must contact any customer who purchased an aftermarket spoiler kit during the 2000 calendar year and provide the customer with a copy of this safety recall Owner Letter.

SPECIAL ACTION

Approximately 6,000 owners of the affected 2000 through 2001 Model Year Taurus Sedans have purchased Ford spoiler kits from their Ford Dealer. If a dealer is aware of any customer who purchased a Ford spoiler kit during the 2000 calendar year (base part # 5444210; see Attachment II for complete part number details), either for installation at the dealership or independently, please:

1. Call the Recall Hotline at 1-800-325-5621 for instructions and prior approval.
2. Contact these customers and provide them a copy of the attached Safety Recall 01S06 Owner Letter.

Claims without prior approval will be returned to dealer unpaid.

PLEASE NOTE:

Correct all vehicles in stock before delivery. Federal law requires dealers to complete any outstanding safety recall service before a new vehicle is delivered to the buyer or lessee. Violation of this requirement by a dealer could result in a civil penalty of up to $5,000 per vehicle.


ATTACHMENTS

Attachment I: Administrative Information
Attachment II: Labor Allowances and Parts Ordering Information
Attachment III: Technical Information
Customer Notification Letter

QUESTIONS?

Claims Information:……...1-800-423-8851
Other (Dealer Only) Recall Questions:……...1-800-325-5621

Sincerely,

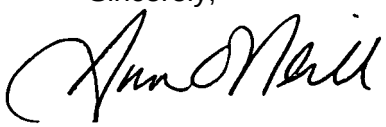

Ann O'Neill
Director
Vehicle Service and Programs

SAFETY RECALL 01S06

Certain 2000 and 2001 Model Year Ford Taurus Sedans equipped with Deck Lid Spoiler Center High Mount Stop Lamp Resistor Installation

OASIS

You must use OASIS to determine if a vehicle is eligible for this recall.

Please note: Vehicles that had a Ford accessory spoiler service kit installed were not included in the affected vehicles date range listed in the first page of this bulletin.

PROMPTLY CORRECT

Promptly correct all affected vehicles on your dealer Recall/ONP Involved Unit Listings available on QCDealer.com. Also, correct other eligible vehicles that are brought to your dealership.

DEALER-OWNER CONTACT

Approximately 6,000 owners of the affected 2000 through 2001 model year Taurus Sedans have purchased Ford aftermarket spoiler kits from their Ford Dealer. Please check your records according to the directions in Attachment II. If you sold any of these Ford aftermarket spoiler kits during the 2000 calendar year, immediately contact any affected owner whose name is not on the list. Give the owner a copy of the Owner Letter and schedule a service date.

REGIONAL CONTACT

Advise regional office if an owner:

- Cannot be contacted.
- Does not make a service date.

CLAIMS PREPARATION AND SUBMISSION

- Enter claims using DWE.
- Refer to ACESII manual for claims preparation and submission information.

OWNER REFUNDS

Ford Motor Company will only refund owner-paid repairs made before the date of the Owner Letter (or after the date of the Owner Letter if an emergency repair was made away from the servicing dealer). Refer to ACESII manual for refund information.

SAFETY RECALL 01S06
Certain 2000 and 2001 Model Year Ford Taurus Sedans Equipped with Deck Lid Spoiler
Center High Mount Stop Lamp Resistor Installation

LABOR ALLOWANCES

Description	Labor Operation	Labor Time
Install In-line resistor – Factory Spoiler	01S06B	0.3 Hours
Install In-line resistor – Accessory Spoiler	01S06C	0.3 Hours
Administrative Allowance	Misc. Expense Code "ADMIN"	0.1 Hours

PARTS REQUIREMENTS

Parts will not be direct shipped for this recall. There are approximately 28,000 involved vehicles. Please refrain from ordering excessive stock. Order your parts requirement through normal order processing channels as noted below:

Stock Orders	Effective immediately	Normal order process
Interim Orders	Effective immediately	Normal order process
Emergency Orders	First 30 days after launch	Call 1-800-325-5621
Emergency Orders	31 days after launch	Normal order process

Part Number	Description	Quantity
1F1Z-14A411-AA	Third Brake Lamp Resistor Assembly	1

DOR/COR NUMBER

DOR/COR Number 50217 identifies parts ordered for this campaign through the Recall Hotline (1-800-325-5621).

DEALER PRICE

For latest prices, refer to:

- DOES II
- Updated Price Book

EXCESS STOCK RETURN

Excess stock returned for credit must have been purchased from Ford Customer Service Division in accordance with Policy Procedure Bulletin 4000.

SAFETY RECALL 01S06
Certain 2000 and 2001 Model Year Ford Taurus Sedans Equipped with Deck Lid Spoiler Center High Mount Stop Lamp Resistor Installation

SPECIAL ACTIONS

A) Dealer installed or over the counter parts sales of spoiler kits

Approximately 6,000 aftermarket spoiler kits have been sold for 2000 through 2001 Model Year Taurus Sedans. If a dealer is aware of any customer who purchased a Ford accessory spoiler kit during the 2000 calendar year, (service part numbers listed below), either for installation at the dealership or independently, please:

1. Call Recall Hotline at 1-800-325-5621 for instructions and prior approval.
2. Contact these customers and provide them with a copy of the Safety Recall 01S06 Owner Letter.

Claims without prior approval will be returned to dealer unpaid.

NOTE: Service part numbers are for reference only, do not order for the purpose of completing this recall.

PART NUMBER (Do Not Order)	DESCRIPTION	QTY SOLD
YF1Z5444210AA	2000-2001 TAURUS PRIMED SPOILER	612
YF1Z5444210AAA	2000-2001 TAURUS HARVEST GOLD SPOILER	716
YF1Z5444210AAB	2000-2001 TAURUS AUTUMN BROWN SPOILER	353
YF1Z5444210AAC	2000-2001 TAURUS TOREADOR RED SPOILER	721
YF1Z5444210AAD	2000-2001 TAURUS GRAPHITE BLUE SPOILER	374
YF1Z5444210AAE	2000-2001 TAURUS AMAZON GREEN SPOILER	158
YF1Z5444210AAF	2000-2001 TAURUS EBONY SPOILER	792
YF1Z5444210AAG	2000-2001 TAURUS PERFORMANCE WHITE SPOILER	593
YF1Z5444210AAH	2000-2001 TAURUS SILVER FROST METALIC SPOILER	836

B) Rework of existing dealer stock

Dealer stock of the spoiler kits listed in the above chart must be reworked prior to installation on a vehicle. If you have any of these kits in your stock, please call the Recall Hotline at 1-800-325-5621 to obtain information on returning spoiler kits for rework.

Ford Motor Company

Ford Motor Company
P. O. Box 1904
Dearborn, Michigan 48121

March 2001

01S06

Mr. John Sample
123 Main Street
Anywhere, USA 12345

Your Vehicle Identification Number: 12345678901234567

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

Ford Motor Company has decided that certain 2000 and 2001 model year Taurus sedans equipped with center high mount stop lamps located in the deck lid spoiler fail to conform to the requirements specified in the Federal Motor Vehicle Safety Standard (FMVSS) No. 108, Lamps, Reflective Devices, and Associated Equipment.

What the non-compliance issue is…

In some of the affected vehicles, it may be possible for the center high mounted stop lamps located in the deck lid spoiler to illuminate when the emergency flashers are activated. In addition, although not a compliance issue, the brake shift interlock locking mechanism may disengage allowing the shift lever to be moved out of park without depressing the brake pedal.

What Ford Motor Company and your dealer will do…

Ford Motor Company will repair your vehicle free of charge (parts and labor). Owners who are affected by this recall are requested to return their vehicle to their dealer. Your dealer will install a resistor in the brake lamp circuit at the spoiler to correct the condition.

How long will it take?

The time needed for this repair is less than one-half day. However, due to service scheduling issues, your dealer may need your vehicle for a longer period of time.

What we are asking you to do …

Call your dealer without delay. Ask for a service date and whether parts are in stock for Safety Recall 01S06.

If your dealer does not have the parts in stock, they can be ordered before scheduling your service date. Parts would be expected to arrive within a week after ordering.

When you bring your vehicle in, show the dealer this letter. If you misplace this letter, your dealer will still do the work, free of charge.

If you've changed address or sold the vehicle …

Please fill out the enclosed prepaid postcard and mail it to us if you have changed address or sold the vehicle.

If you have concerns …

If you have trouble getting your vehicle repaired promptly and without charge, please contact your dealership's Service Manager. If you still need assistance, please contact the Ford Motor Company Customer Relationship Center and one of our representatives will be happy to assist you:

CALL: (800) 392-3673
(800) 232-5952 (TDD for the Hearing Impaired)
Office Hours: (Eastern Standard Time)
Monday-Friday: 8am - 11pm
Saturday: 9am - 6pm
or you may contact us through the Internet at:
www.ownerconnection.com
Our current response time to Internet inquiries is three business days.

You also may send a complaint to the Administrator, National Highway Traffic Safety Administration, 400 Seventh Street, S. W., Washington, D. C. 20590 or call the toll free Auto Safety Hotline 1-800-424-9393 or 1-888-327-4863.


Quality Care service is there for you all year round.

QualityCare™ at your service

Quality Care is the commitment of Ford Motor Company and its dealerships to provide you with a superior service and ownership experience. While we regret the inconvenience caused by this program, we stand committed with our dealers to assist you with all of your automotive service needs. With our nationwide dealer network, we're here to ensure you receive Quality Care service so that your vehicle maintains peak performance throughout your ownership experience.

We pride ourselves on becoming the world's leading consumer company for automotive products and services. Thank you for your attention to this important matter.

Sincerely,

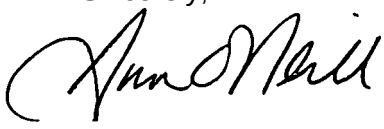

Ann O'Neill
Director
Vehicle Service and Programs