SUSPENSION—VEHICLE SITS LOW IN REAR	Article No. 00-10-6

FORD: 1998-2000 RANGER

This TSB is being republished in its entirety to add a Note to clarify the parts application.

ISSUE

Some vehicles may appear to be low in the rear. This may be caused by the rear springs.

ACTION

Replace the existing rear springs with revised springs. The revised springs provide a higher ride height at curb and reduce the possibility of the rear being too low. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

1. Verify that vehicle is low in the rear by measuring the ride height. To measure ride height, park truck on a known flat ground with no load in box.

   a. For 4X2: Measure from the top of the axle to the bottom of the frame in the area near the middle of the jounce bumper. The rear height for 4X2 should be at a minimum 170mm (Figure 1).

   b. For 4X4: Measure from the top of the spring spacer bar to the bottom of the frame in the area near the middle of the jounce bumper. The rear height for 4X4 should be at a minimum of 156mm (Figure 1).

2. If the vehicle is below the minimum specifications noted, remove existing rear springs and replace them with revised springs. Refer to the appropriate Ranger Workshop Manual for replacement procedures.

NOTE

FINAL SPRING BUSHING TORQUE MUST BE PERFORMED WITH CURB WEIGHT ON THE VEHICLE. IF THIS IS NOT PERFORMED, THE VEHICLE MAY LOSE RIDE HEIGHT AFTER LOADING/UNLOADING.

NOTE

REFER TO THE VEHICLE CERTIFICATION LABEL AND THE PARTS CATALOG TO DETERMINE THE CORRECT SPRING TO INSTALL. IF THE VEHICLE CURRENTLY HAS A "-K" LEVEL SPRING, REPLACE IT WITH A "-KA" LEVEL SPRING. IF THE VEHICLE CURRENTLY HAS A "-C" LEVEL SPRING, REPLACE IT WITH A "-CA" LEVEL SPRING.

PART NUMBER	PART NAME
F87Z-5560-KA	Rear Leaf Spring
F87Z-5560-CA	Rear Leaf Spring

OTHER APPLICABLE ARTICLES: NONE
SUPERSEDES: 99-22-1
WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
001006A	Measure Vehicle Ride Height	0.1 Hr.
001006BB	Replace Rear Spring - Both	0.9 Hr.
001006B	Replace Rear Spring - One	0.6 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
5560	63

OASIS CODES: 304000

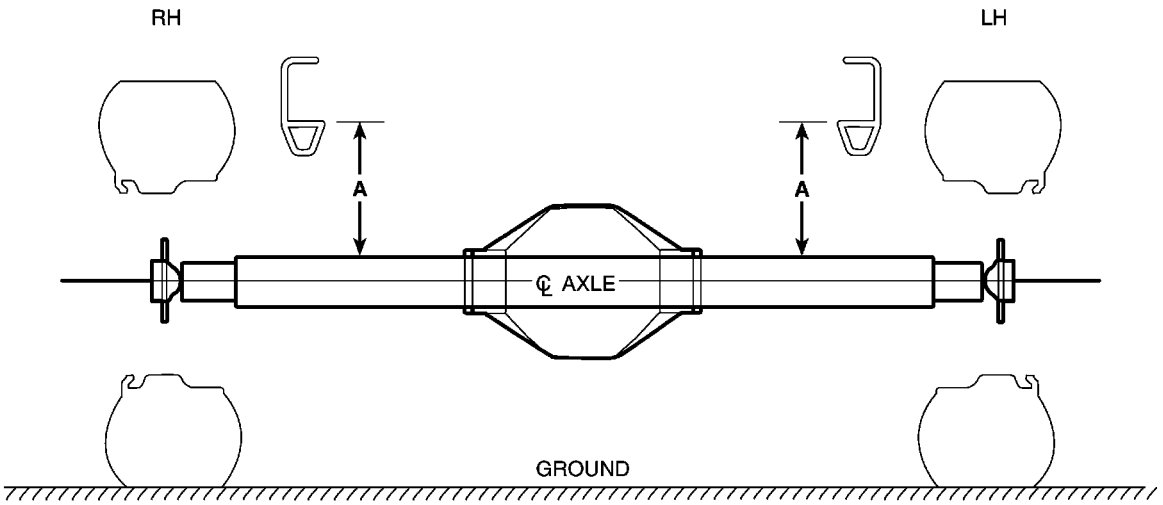

RANGER 4X2
REAR SUSPENSION

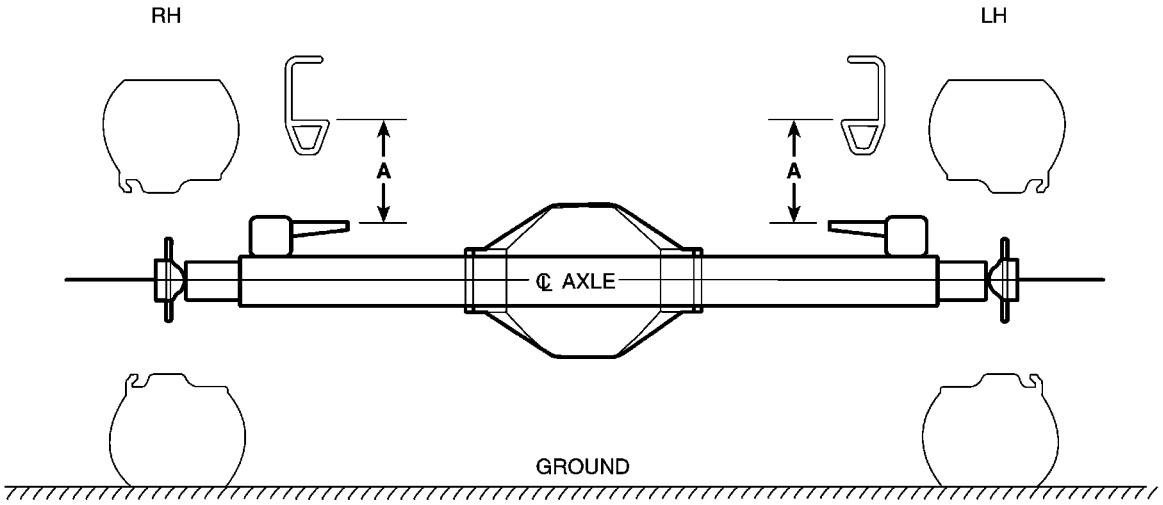

RANGER 4X4
REAR SUSPENSION

TB-5872-A

Figure 1 - Article 00-10-6