• **TRIM—SEATS—SEAT VIBRATION OR SHAKE AT IDLE IN GEAR—VEHICLES EQUIPPED WITH 4.6L OR 5.4L ENGINE ONLY** • **DRIVEABILITY—IDLE—SEAT VIBRATION OR SHAKE AT IDLE IN GEAR—VEHICLES EQUIPPED WITH 4.6L OR 5.4L ENGINE ONLY**	**Article No. 01-24-8**

FORD: 2001 F-150

ISSUE

Some vehicles equipped with (Seat Integrated Restraint) "SIR" seats may exhibit a seat vibration or shake while at idle in gear. This may be caused by a combination of engine idle speed, motor mount material and the need to neutralize the Powertrain system.

ACTION

Verify the condition. Reprogram the Powertrain Control Module (PCM) to raise the base idle speed, replace engine mounts (vehicles produced 11/1/01 through 5/1/01 only) with a softer design mount and perform the Powertrain Neutralize Procedure to help reduce the amount of energy transferred from the engine block to the seats.

SERVICE PROCEDURE

Reprogram the PCM with a new calibration to increase base idle speed. Refer to the following PCM Information Chart.

On vehicles built 11/1/00 through 5/1/01 only, also replace Engine Mounts. Install the following engine mount service parts (Left Hand XL7Z-6038-CA, Right Hand XL7Z-6038-AA). Follow the procedure in the 2001 Work Shop Manual, Section 303-01

Perform Powertrain Neutralize Procedure:

To neutralize the exhaust, transmission and engine mounts, perform the following procedure:

1. Loosen the following components:
   - Transmission mount nuts to cross member
   - Passenger's side engine mount to frame
   - Driver's side engine mount bolt
   - Exhaust pipe to exhaust manifold
   - Exhaust hanger at transmission mount
2. Apply parking brake, apply service brake and start engine.
   a. Shift transmission in Drive and raise engine RPM to 1600-2000 RPM, return engine to idle.
   b. Shift transmission to Reverse and raise engine RPM to 1600-2000 RPM, return to idle, repeat Drive and Reverse procedure.
   c. Shift transmission to Neutral and raise engine RPM one time to 3000 RPM, turn off engine and shift transmission into Park.
3. Torque all related fasteners:
   - Torque driver's side engine mount bolt to 80 N•m (58 Lb-ft)
   - Torque passenger side engine mount to frame nuts to 90 N•m (66 Lb-ft)
   - Torque transmission mount nuts to 103 N•m (76 Lb-ft)
   - Tighten the driver's side exhaust pipe to exhaust manifold nuts evenly and torque to 40 N•m (30 Lb-ft)
   - Tighten the passenger's side exhaust pipe to exhaust manifold nuts evenly and torque to 40 N•m (30 Lb-ft)
   - Torque exhaust pipe hanger nut and bolt to 40 N•m (30 Lb-ft)

Copyright © 2001 Ford Motor Company

Article No. 01-24-8 Cont'd.

PCM CALIBRATION INFORMATION						
Application	**Old Part Number (-12A650-)**	**Tear Tag**	**New Part Number (-12A650-)**	**Old Calibration**	**New Calibration**	**NGS/WDS Qualifier**
2001 4.6L F150 Calif. 4R70W 4X2	1L3F-KE	FJCO	1U7Z-BFA	1F516D0B12	1F516D0B12	WDS B16.2 Release or Later
2001 4.6L F150 Calif. 4R70W 4X4	1L3F-LE	GATO	1U7Z-BGA	1F516E0B12	1F516E0B12	WDS B16.2 Release or Later
2001 4.6L F150 Fed. 4R70W 4X2	1L3F-AVE	HCDO	1U7Z-BHA	1F516M0A12	1F516M0A12	WDS B16.2 Release or Later
2001 4.6L F150 Fed. 4R70W 4X4	1L3F-AXE	JAFO	1U7Z-BJA	1F516N0A12	1F516N0A12	WDS B16.2 Release or Later
2001 5.4L F150 Base/Harley Calif. 4R70W	1L3F-ARD	KKMO	1U7Z-BKA	1F514E0B11	1F514E0B11	WDS B16.2 Release or Later
2001 5.4L F150 Base/Harley Fed. 4R70W	1L3F-ASD	LDNO	1U7Z-BLA	1F514F0A11	1F514F0A11	WDS B16.2 Release or Later

Obtain an Authorized Modifications Decal (STAT 5941-2 - obtainable through the PDC) and list the date, dealer number, and summary of modifications performed. Select a prominent place adjacent to the Vehicle Emission Control Information Decal suitable for installing the Authorized Modifications Decal. Clean the area, install the decal, and cover it with a clear plastic decal shield.

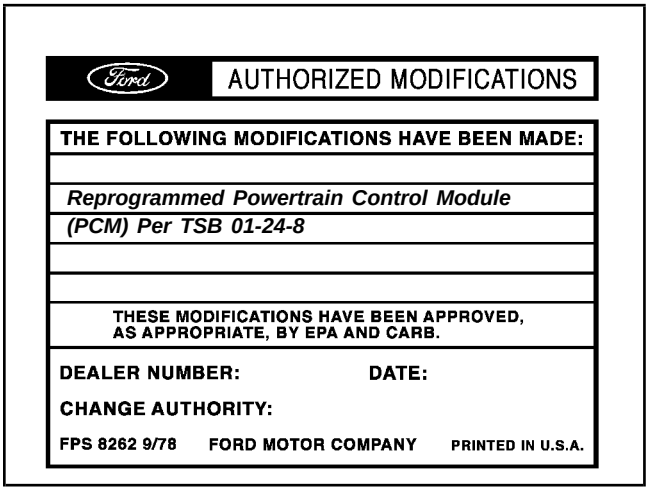

PART NUMBER	PART NAME
XL7Z-6038-CA	Motor Mount - Left Hand
XL7Z-6038-AA	Motor Mount - Right Hand

OTHER APPLICABLE ARTICLES: NONE

WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
012408A	Replace Engine Mounts, Perform Powertrain Neutralize Procedure, And Reprogram Powertrain Control Module	2.8 Hrs.
012408B	Perform Powertrain Neutralize Procedure, And Reprogram Powertrain Control Module	1.0 Hr.

DEALER CODING

	CONDITION CODE
BASIC PART NO.	
RECAL	42

OASIS CODES: 101000, 703100