



Barwood Condominiums - Building #5

MILESTONE INSPECTION



CREATED FOR:

Barwood Condominium IV Association, Inc.
c/o Ian Land

PREPARED BY:


BUILDINGMAVENS

2000 PGA Blvd. Suite 4440 | Palm Beach Gardens, FL 33408
www.BUILDINGMAVENS.com

28 APR 2023

This item has been digitally signed and sealed by
Matthew G. Duckstein Jr, PE on 05/16/2023.

Printed copies of this document are not considered
signed and sealed, and the signature must be verified on
any electronic copies.

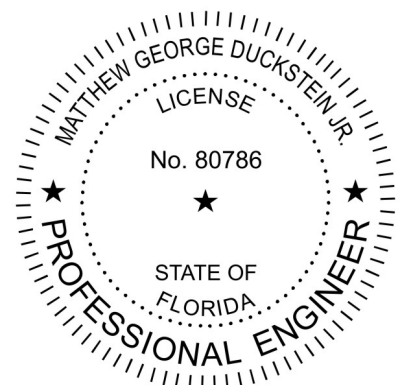

*THIS **SPACE** INTENTIONALLY LEFT BLANK*

TABLE OF CONTENTS

1. PREFACE.....	1
1.1. - INTRODUCTION	1
1.2. - METHODOLOGY	1
2. MILESTONE INSPECTION REPORT.....	4
2.1. - INSPECTION CERTIFICATION	4
2.2. - BUILDING OWNER INFORMATION	5
2.3. - BUILDING INFORMATION	5
2.4. - PRESENT CONDITION OF BUILDING	6
2.5. - INSPECTION(S).....	8
2.6. - SUPPORTING DATA	8

APPENDIX A: PHOTOGRAPHS

1. PREFACE

1.1. - Introduction

Barwood Condominium IV Association, Inc. ("Client") retained Building Mavens, Inc ("Maven") to provide the Milestone Inspections and Report for Barwood Condominiums, Building #5 ("Property"). In compliance with section 553.899 of the Florida Statutes, and local building code requirements, the purpose of this inspection report is to submit a qualitative assessment, in a reasonable fashion, of the structural conditions of the buildings, three stories or more, located on the Property by:

- a) Indicating the manner and type of inspections utilized
- b) Identifying, describing, and recommending repairs for any observed substantial structural deterioration¹ ("SSD")
- c) Stating whether unsafe or dangerous conditions exist²
- d) Recommending remedial or preventative repairs for damages not deemed SSD
- e) Identifying and describing any items requiring further inspection

1.2. - Methodology

The Milestone Inspection process generally consists of five (5) components:

- 1) Document Review of each building's structural system and history of repairs and violations
- 2) On-site inspections to assess each building's structural system condition on dates noted herein
- 3) Conducting interviews with property personnel familiar with the building's use and operation
- 4) A signed & sealed Milestone Inspection Report (MIR)
- 5) A Milestone Inspection Summary (MIS) which includes the assessment details of each system and component with the respective supporting information and photographs.

Phase 1 inspections are limited to visually accessible elements and carried out in selected habitable and non-habitable areas of the building as a representative sample of the entire project. Phase 1 inspections are non-invasive, *readily accessible*³ observations that are not *technically exhaustive*⁴. Maven did not test materials, explore concealed conditions, or undergo destructive efforts unless otherwise listed herein as part of Phase 2 inspections.

Any Phase 2 inspections detailed within this report involved destructive or nondestructive testing performed at locations selected to be least disruptive and most easily repairable while still being representative of the structure and with the assistance of a licensed contractor, where necessary, named herein.

¹ Substantial structural distress that negatively affects a building's general structural condition and integrity but does not include surface imperfections such as cracks, distortion, sagging, deflections, misalignment, signs of leakage, or peeling of finishes.

² If Maven finds that there are conditions in the building or structure causing an actual or immediate danger of the failure or collapse of a building or structure, or there is a health, windstorm, or fire hazard, we shall report such conditions to directly the Building Official within twenty-four (24) hours of the time of discovery.

³ Readily Accessible - Areas of the property that are promptly made available for observation and do not require the removal of materials or personal property, and are safely accessible in the opinion of the field observer.

⁴ Technically exhaustive - Describes using measurements, instruments, testing, calculations, exploratory probing, discovery, or troubleshooting physical deficiencies.

Maven's evaluation methodology is generally based on the recommendations of ASCE 11, "*Guideline for Structural Condition Assessment of Existing Buildings*," and ASCE 30, "*Guideline for Condition Assessment of The Building Envelope*." Maven applied ASTM Standard E2018-15, *Standard Guide for Property Condition Assessments: Baseline Property Condition Assessment Process* as a basis to classify the condition of each component or system⁵.

Based on the document review, interviews, and site evaluations, Maven provides the following Milestone Inspection Report and Summary^{6, 7, 8}:

Prepared and Submitted by,

BUILDINGMAVENS

THIS SPACE INTENTIONALLY LEFT BLANK

⁵ Good - Average to above-average condition for the system or component evaluated, considering its age, design, and geographic location. Generally, other than normal maintenance, no remedial work is recommended or required.

Fair – Average condition for the system or component evaluated. Some work is required or recommended to return the system to good condition.
Poor – Below average condition for the system or component evaluated. Significant work (major repair or replacement) is anticipated to restore the system or material to an acceptable condition.

⁶ According to our project-specific assignment and observations made during specific site visits, this report was prepared exclusively for the Client. Therefore, this document is time sensitive. Please note that on-site conditions are subject to change. As such, the reliance upon our noted observations should not exceed ninety (90) calendar days from our last site visit.

⁷ The content of this report is based solely on the visual evaluation of the areas made accessible at the time of our inspection and is not based on any material testing or exploration of concealed conditions unless noted otherwise. Maven does not imply that we have observed or recorded all possible structural issues. Furthermore, this report is not a zoning or code compliance report. Maven offers no opinion as to the accuracy of the design or Building Code conformance.

⁸ Maven conclusions and opinions are based on a reasonable degree of engineering certainty and probability and the information made available in our review and analysis. Should any additional information be uncovered or available, we retain the right to revise or supplement the report accordingly.

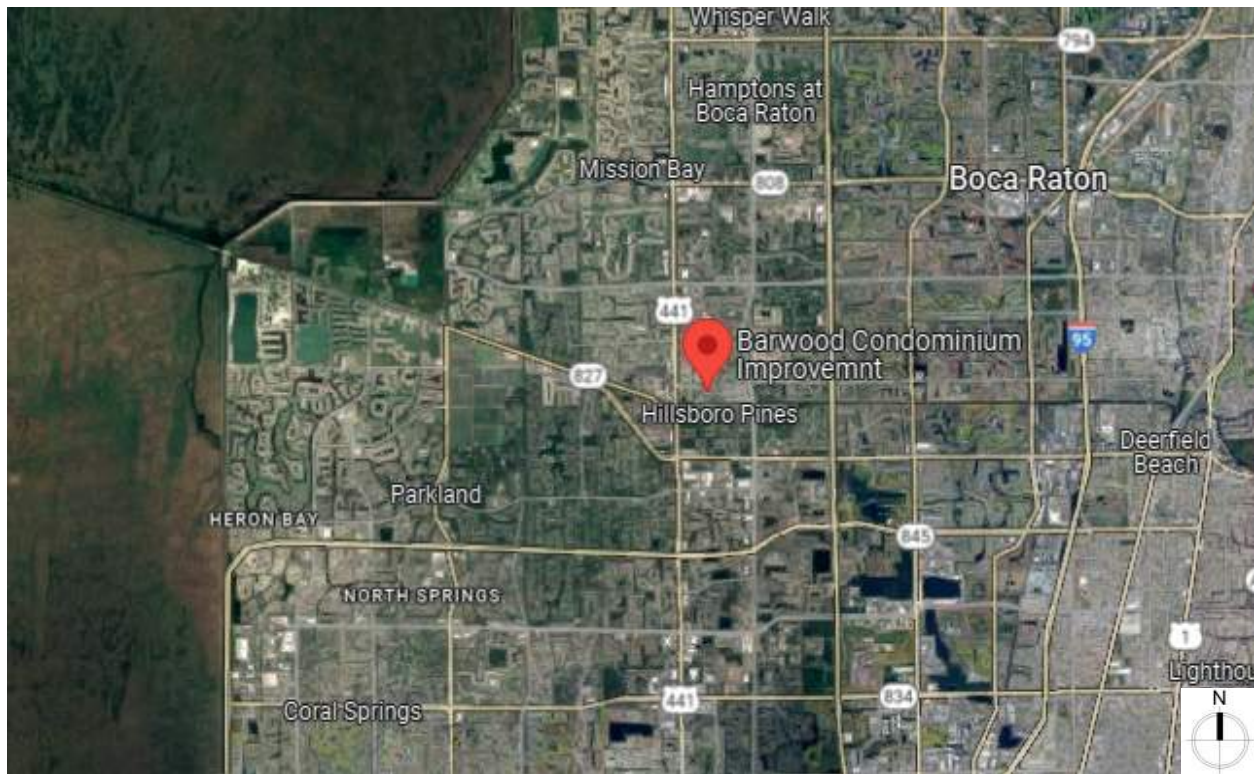


Figure 1: Location View - Barwood Condominium (source: Google)

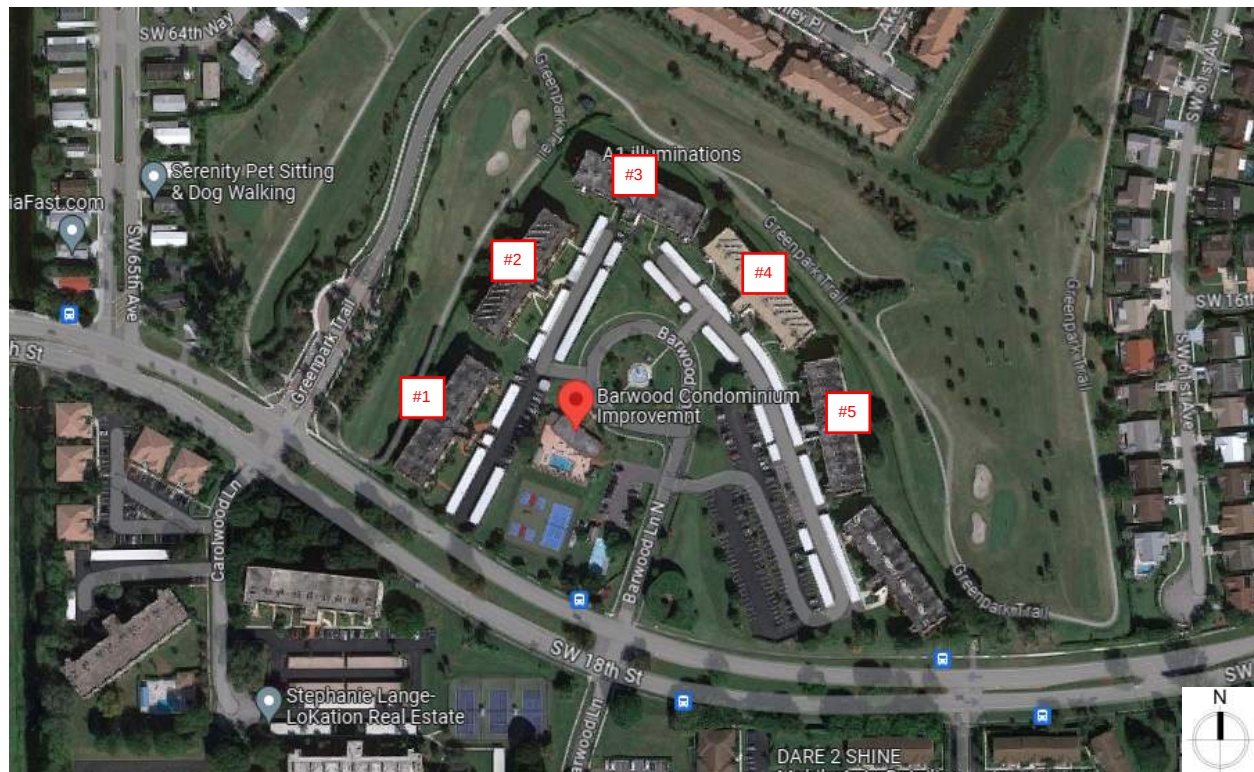


Figure 2: Aerial View - Barwood Condominium, Building #5 (source: Google)

2. MILESTONE INSPECTION REPORT**2.1. - Inspection Certification**Inspection Firm or Individual Name: Building MAVens, Inc.Address: 2000 PGA Blvd., Suite 4440, Palm Beach Gardens, FL 33408Phone Number: 561-421-3274Email Address: info@BuildingMavens.comArchitect/Engineer Performing Inspection Name: Matthew G. Duckstein Jr, PELicense Number: FL PE #80786Certified Special Inspector Required: Yes ☐ No ☒**Type of Inspection Performed:**

Phase 1 Inspection:

☒Inspection Commencement Date: 4/12/2023

Phase 2 Inspection:

☐Inspection Completion Date: 4/12/2023No Additional Inspections Needed (Yes/No)**Inspection Summary:**General Structural Condition: Good ☒ Fair ☐ Poor ☐Yes Building Safe for continued use and occupancy (Yes/No)No Substantial Structural Deterioration Observed (Yes/No)Yes Non-SSD remedial/preventative repairs recommended (Yes/No)Yes Repairs outlined in the attached report (Yes/No)☒

Building can remain occupied during repairs

☐

Immediate repairs are needed; restricted use

☐

Building Deemed Unsafe and Shall Be Vacated

I am qualified to practice in the discipline in which I am hereby signing,

Signature and Date:

Matthew G. Duckstein Jr28 APR 2023

As a routine matter, and to avoid possible misunderstanding, nothing in this document and its attachments should be construed directly or indirectly as guaranteed or warranty for any portions of the structure. To the best of our knowledge and ability, this report represents an accurate appraisal of the present condition of the structure based upon careful evaluation of observed conditions to the extent reasonably possible. It is understood by all parties, including the property owner, that our assessments do not release or indemnify the property owner in any way or form from always properly maintaining the property for safe and continued use and occupancy.

2.2. - Building Owner InformationBuilding/Structure address: 23249 Barwood LN N, Boca Raton, FL 33428Legal Description: BARWOOD COND IV UNIT "XXX"PCN or Folio # 00-42-47-31-05-004-"XXXX"Owner's Name*: Barwood Condominium IV Association, Inc.Owner's mailing address*: 2750 NE 26th Terr, Boca Raton, FL 33431Owner's Phone number and Email: 561-302-9383 Email: ian@elitepropmgt.com

***Building Owner.** This means the fee simple title holder of the land on which a building subject to Building Recertification Inspection is situated or, in the case of a condominium or cooperative type of ownership, shall mean the person or entity responsible for the structure and common systems of a building subject to Building Recertification Inspection.

2.3. - Building InformationBuilding Occupancy Classification: 0400 - CONDOMINIUM Present Use CondominiumConstruction Type: CBS w/PT Number of Stories: 4 Square Footage: variesCO Issue or Reasonable Age of Building Date: 1979 Resource: pbcgov.orgIs this a Threshold Building per F.S. 553.71: ☒ Yes ☐ No

General Description of Building (overall description, structural systems):

Stucco clad concrete masonry unit buildings with concrete columns and post tensioned slab reinforcement. Concrete and masonry unit "core" elevator, mechanical room area, and exterior access staircases.

Special Features:

Non-gated community with clubhouse, pool, and tennis area central to the property.

Describe any additions to original structure:

N/A

Additional Comments:

See Section 2.57 for summary of recommendations.

2.4. - Present Condition of Building

a. General Alignment: (Note Good, Fair, Poor; Explain if significant)

1. Bulging: ☒ Good ☐ Fair ☐ Poor Significant (explain):
No observed issues.
2. Settlement: ☒ Good ☐ Fair ☐ Poor Significant (explain):
No observed issues.
3. Deflections: ☒ Good ☐ Fair ☐ Poor Significant (explain):
No observed issues.
4. Expansion: ☒ Good ☐ Fair ☐ Poor Significant (explain):
No observed issues.
5. Contraction: ☒ Good ☐ Fair ☐ Poor Significant (explain):
No observed issues.

b. Portions showing stress (Note Good, Fair, Poor; Explain if significant)

1. Beams: ☒ Good ☐ Fair ☐ Poor Significant (explain):
No observed stress issues.
2. Columns: ☒ Good ☐ Fair ☐ Poor Significant (explain):
No observed stress issues.
3. Struct. walls: ☒ Good ☐ Fair ☐ Poor Significant (explain):
No observed stress issues.
4. Floors: ☒ Good ☐ Fair ☐ Poor Significant (explain):
No observed stress issues.
5. Roof: ☐ Good ☒ Fair ☒ Poor Significant (explain):
Widespread areas of standing water, corroded flashing, and cracked sealant, but no roof leaks reported.
6. Other: ☐ Good ☐ Fair ☐ Poor Significant (explain):
N/A

c. Surface Condition – describe general conditions of finishes, noting cracking, spalling, peeling, signs of moisture penetration or stains:

The building appears to have been recently painted, but has areas of cracked stucco and paint bubbling that require repair. The exterior is generally in good to fair condition with few previously repaired stucco cracks and a few requiring repair.

d. Cracks – note location in significant members. Identify crack size as HAIRLINE if barely discernible; FINE if less than 1 mm in width; MEDIUM if between 1- and 2-mm width; WIDE if over 2 mm:

1) Vertical cracks and/or spalls in unit balcony walls of a few units (example Unit 209, see photos).

Repair before next review cycle:

1) Multiple exterior balcony edge cracks and spalls.

2) Intermittent unit access walkway slab underside cracks and spalls.

e. General extent of deterioration – cracking or spalling of concrete or masonry, oxidation of metals; rot or borer attack in wood

No observed masonry, metals, or wood issues.

f. Note previous patching or repairs:

Some previous stucco crack repairs observed. Some previous railing post pocket repairs observed.

g. Nature of present loading indicate residential, commercial, other estimate magnitude:

Residential

2.5. - Inspection(s)

1. Date of Inspection Commencement: 4/12/2023
2. Date of Inspection Completion: 4/12/2023
3. Name and Qualifications of Individual Submitting Report: Building Mavens, Inc.
Scott Harvey-Lewis, PE

4. Description of laboratory or other formal testing, if required, rather than manual or visual procedures

N/A

5. Substantial Structural Repair Required: ☐ Yes ☒ No

- a. If required, describe, and indicate acceptance:

No observed issues.

6. Property record has been researched for any current code violations / unsafe structure cases?:

☒ Yes ☐ No

Explanation/comments:

N/A

7. Additional Comments (non-structural repairs, recommendations, observations)

The building condition is generally consistent with its age, but requires some repairs (under the guidance of a FL licensed engineer) and ongoing maintenance to remain in good standing:

- 1) Remove/replace roof membrane, terminations, flashing, etc., before the next review cycle.
- 2) Remove/replace cracked and unsound stucco areas from the exterior balcony edges, walls, and slab undersides.
- 3) Repaint and reseal the exterior unit windows as needed; consider installing building-wide upgraded impact resistant windows before the next review cycle.

2.6. - Supporting Data

- | | |
|---|--|
| 1. ☒ Color Photographs ⁹ | 2. ☐ Sheet Written Data |
| 3. ☒ Drawings or Sketches | 4. ☐ Test Reports |

⁹ See Appendix A for sample photographs of indicated conditions. Additional and full-size photos are available upon request.

APPENDIX A – Photographs





● **#76 - Bldg 5 exterior**

Bldg 5, Barwood IV | Corey Pruneski | 0. General

Plan: Bldg 5 - Level 1 | Location: Bldg 5 - 23249 - Barwood IV > Elevations

Photos

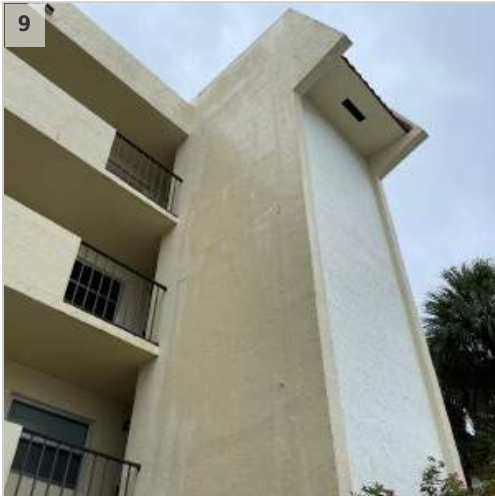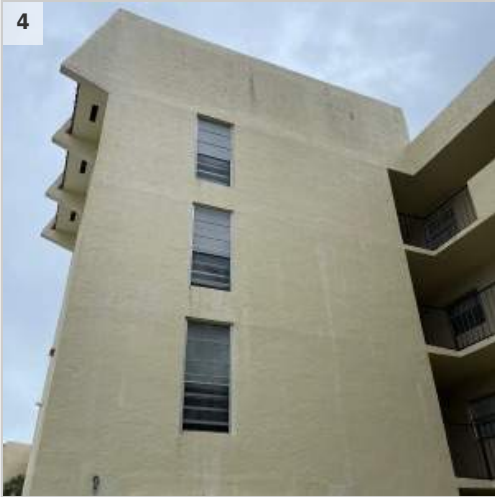




● **#80 - Balcony edge spalls**

Bldg 5, Barwood IV | Matt Duckstein | 5. Concrete Framing System

Plan: Bldg 5 - Level 1 | Location: Bldg 5 - 23249 - Barwood IV > Elevations




Photos

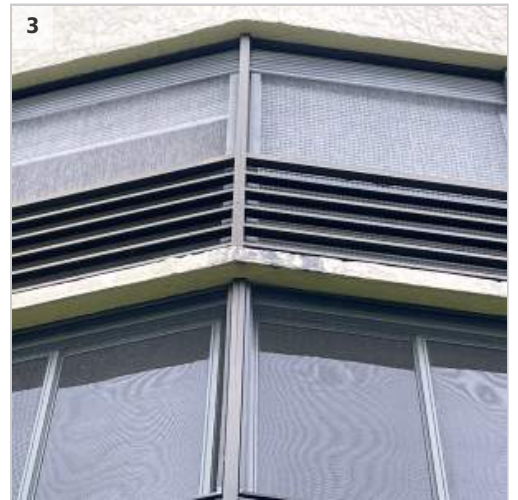

● **#79 - Stucco Cracks**

Bldg 5, Barwood IV | Matt Duckstein | 8. Building Facade
Plan: Bldg 5 - Level 1 | Location: Bldg 5 - 23249 - Barwood IV > Elevations

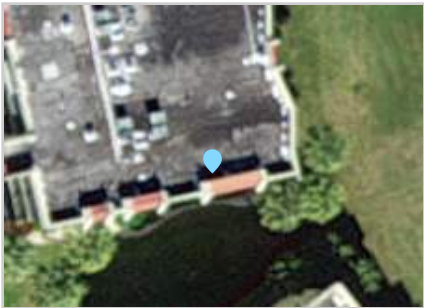


Photos



● **#82 - Stucco cracks**

Bldg 5, Barwood IV | Matt Duckstein | 8. Building Facade
Plan: Bldg 5 - Level 1 | Location: Bldg 5 - 23249 - Barwood IV > Elevations

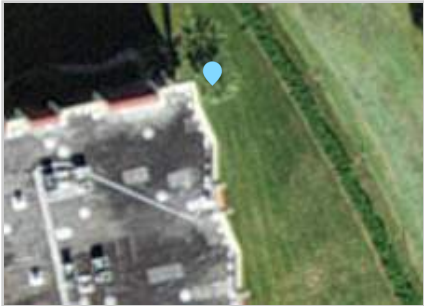


Photos



● **#95 - Stucco cracks**

Bldg 5, Barwood IV | Corey Pruneski | 0. General
Plan: Bldg 5 - Level 4 | Location: Bldg 5 - 23249 - Barwood IV > Common Area

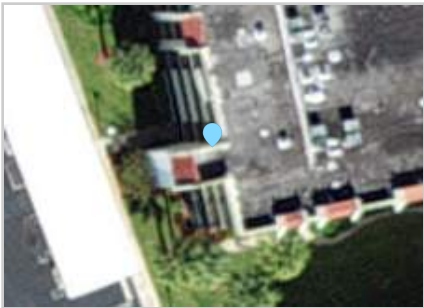

Photos




● **#87 - Bldg 5 - roof**

Bldg 5, Barwood IV | Matt Duckstein | 3. Roof and Floor System

Plan: Bldg 5 - Level 5 - Roof | Location: Bldg 5 - 23249 - Barwood IV > Roof

Photos

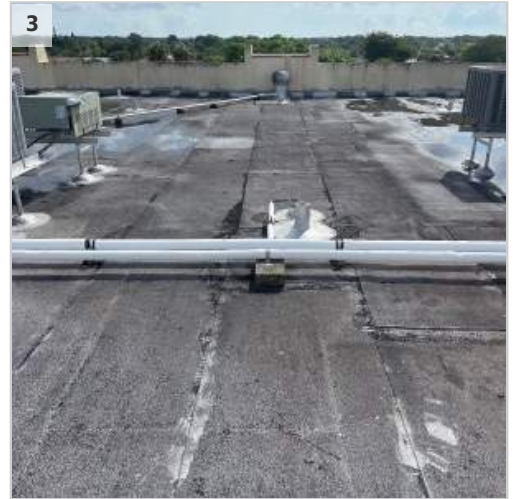




#59 - Bldg 5 - Unit 209


Bldg 5, Barwood IV | Corey Pruneski | 0. General

Plan: Bldg 5 - Level 2 | Location: Bldg 5 - 23249 - Barwood IV > Units

Location Specific: 209

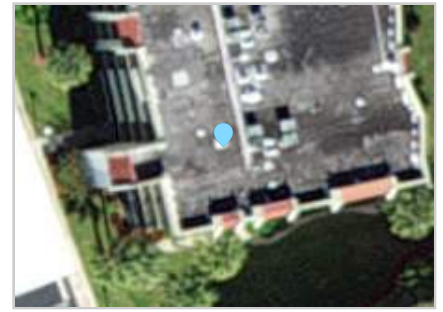

Photos



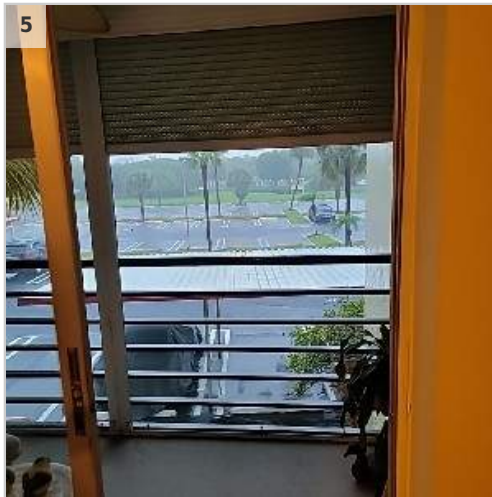


● **#84 - Common level 4**

Bldg 5, Barwood IV | Corey Pruneski | 0. General

Plan: Bldg 5 - Level 4 | Location: Bldg 5 - 23249 - Barwood IV > Common Area

Photos

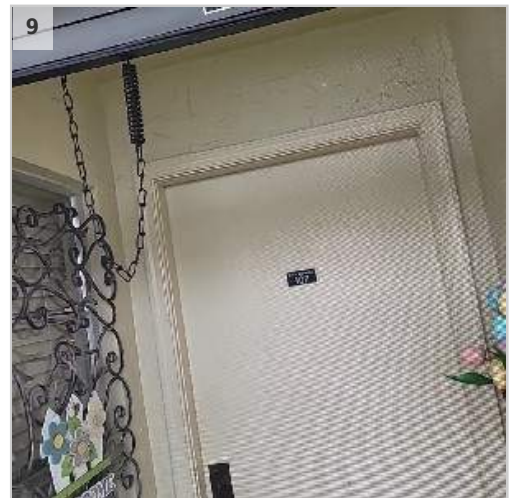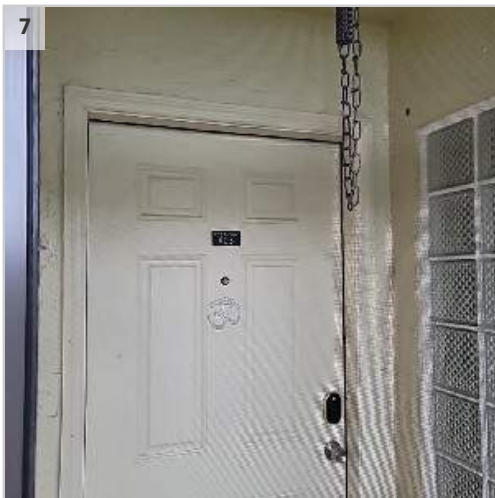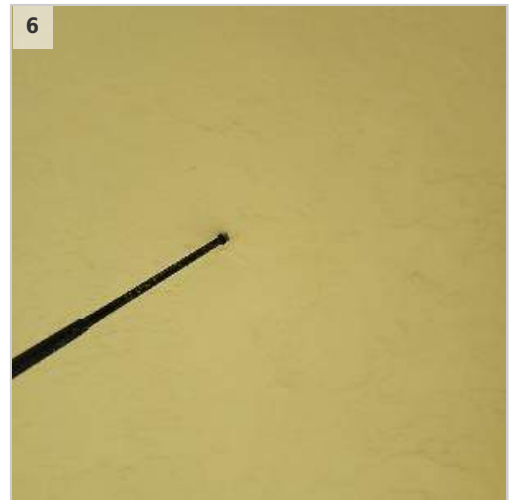


● **#68 - Bldg 5 - Storage**




Bldg 5, Barwood IV | Corey Pruneski | 0. General

Plan: Bldg 5 - Level 4 | Location: Bldg 5 - 23249 - Barwood IV > Common Area

Location Specific: level 4

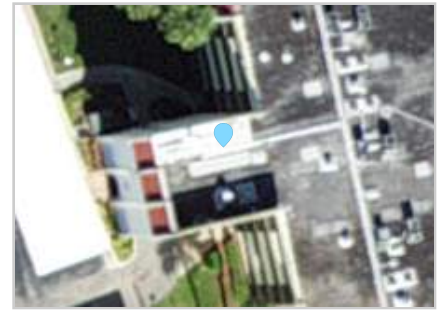

Photos

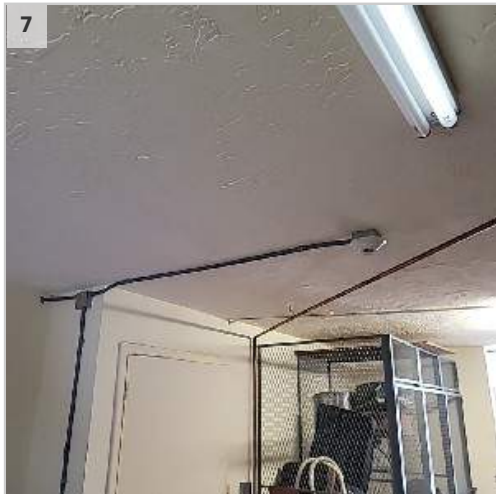
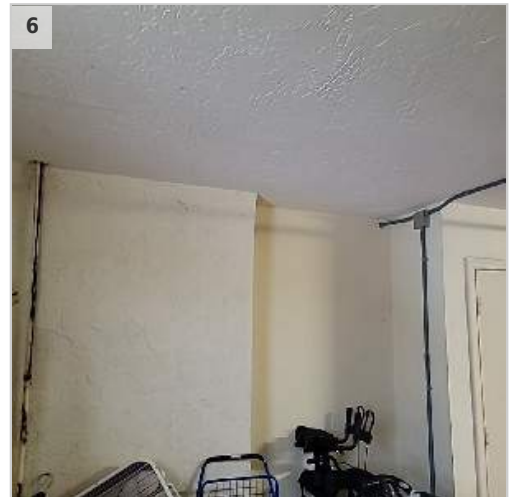
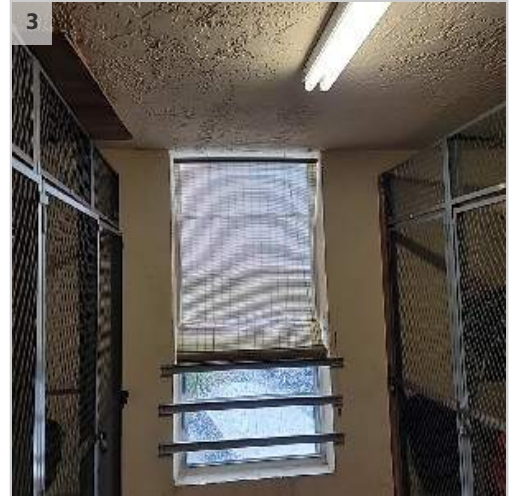


#81 - Common level 3

Bldg 5, Barwood IV | Corey Pruneski | 0. General

Plan: Bldg 5 - Level 3 | Location: Bldg 5 - 23249 - Barwood IV > Common Area

Photos

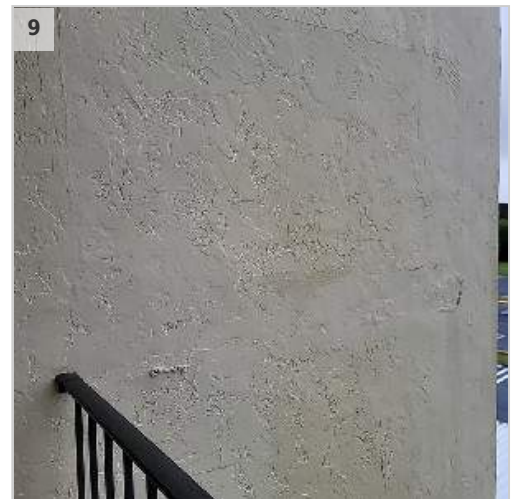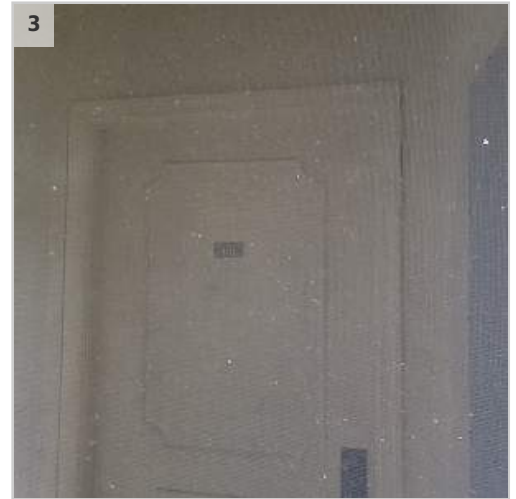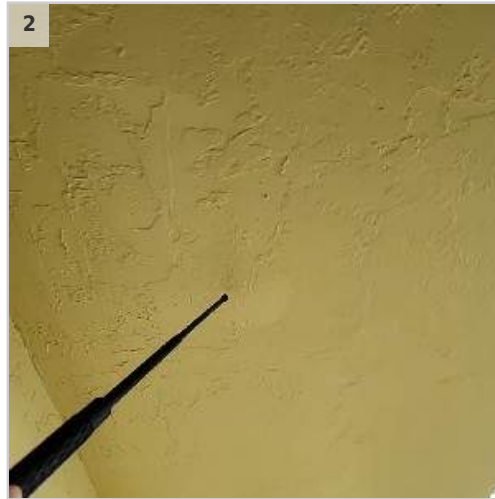

● **#64 - Bldg 5 - Storage**




Bldg 5, Barwood IV | Corey Pruneski | 0. General

Plan: Bldg 5 - Level 3 | Location: Bldg 5 - 23249 - Barwood IV > Common Area

Location Specific: Level 3



Photos

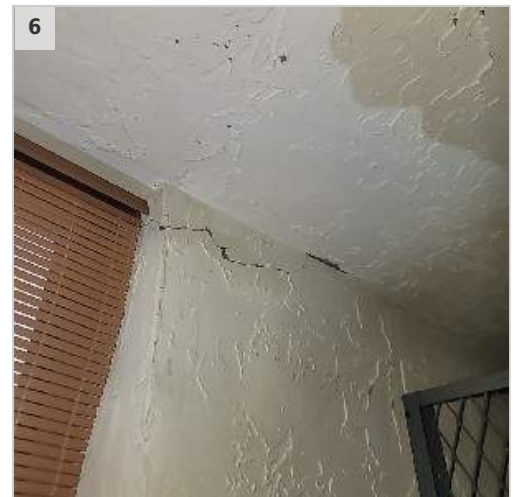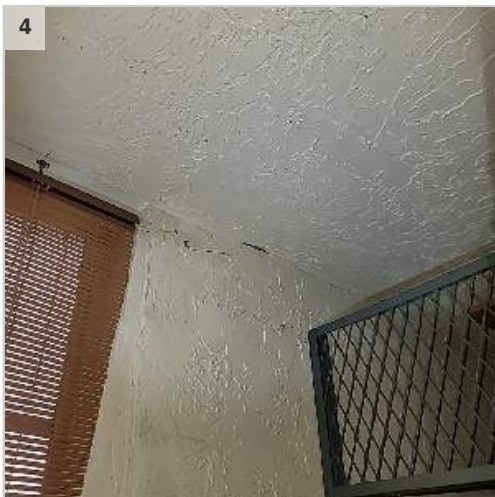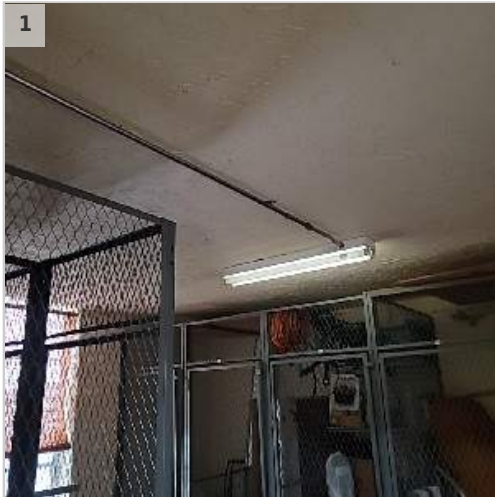


#72 - Common level 2

Bldg 5, Barwood IV | Corey Pruneski | 0. General

Plan: Bldg 5 - Level 2 | Location: Bldg 5 - 23249 - Barwood IV > Common Area

Photos



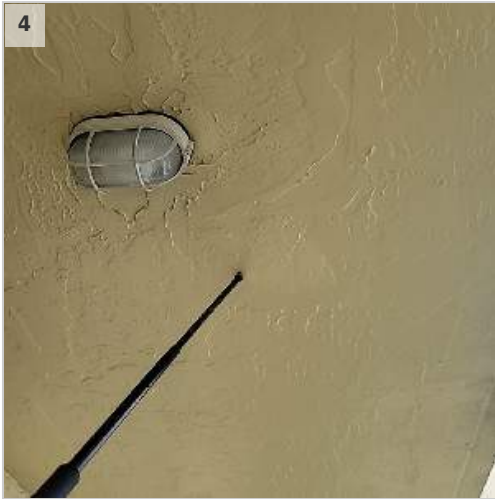



● **#69 - Common level 1**


Bldg 5, Barwood IV | Corey Pruneski | 0. General

Plan: Bldg 5 - Level 1 | Location: Bldg 5 - 23249 - Barwood IV > Common Area

Photos

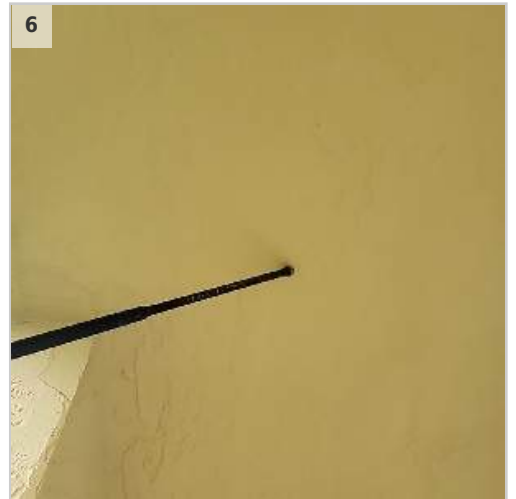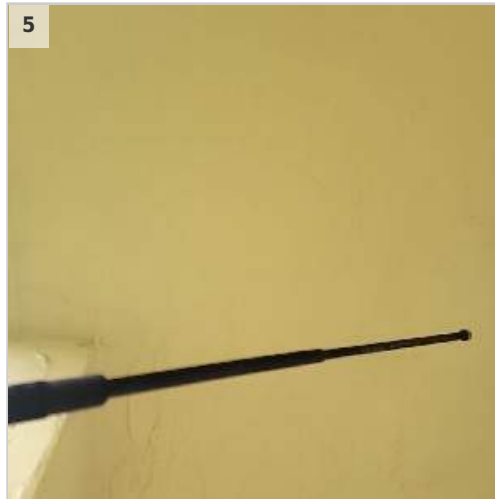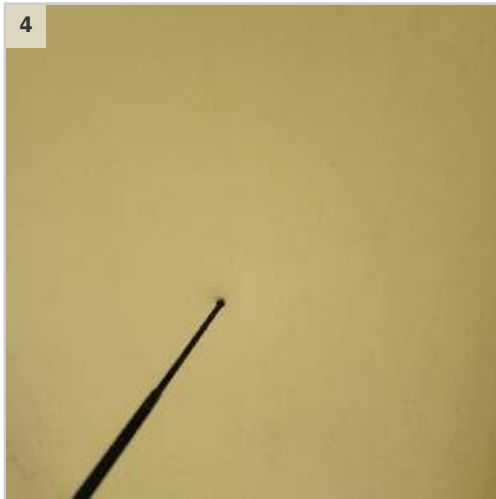

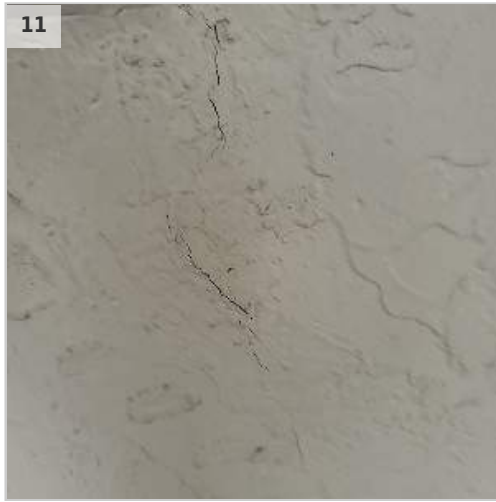

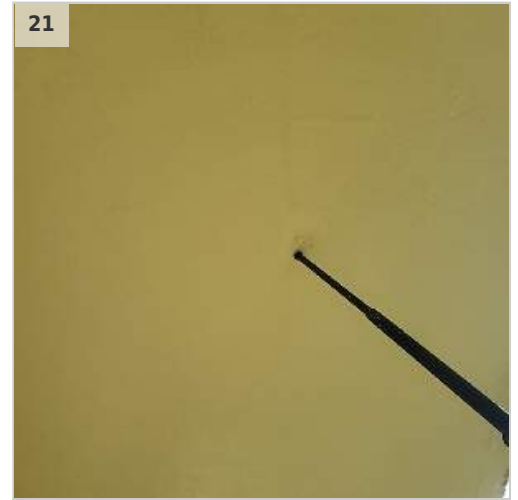

● **#97 - Bldg 5 - Storage**

Bldg 5, Barwood IV | Matt Duckstein | 0. General
Plan: Bldg 5 - Level 1 | Location: Bldg 5 - 23249 - Barwood IV > Common Area



Photos

