


CSM V3 -- WOOD BASE | Upright hole drilling template
500 x 400 x 12.7 mm Baltic Birch plywood, top face shown
4 x M5 clearance holes at (± 150 , ± 120) mm from center -- drill through, both sides

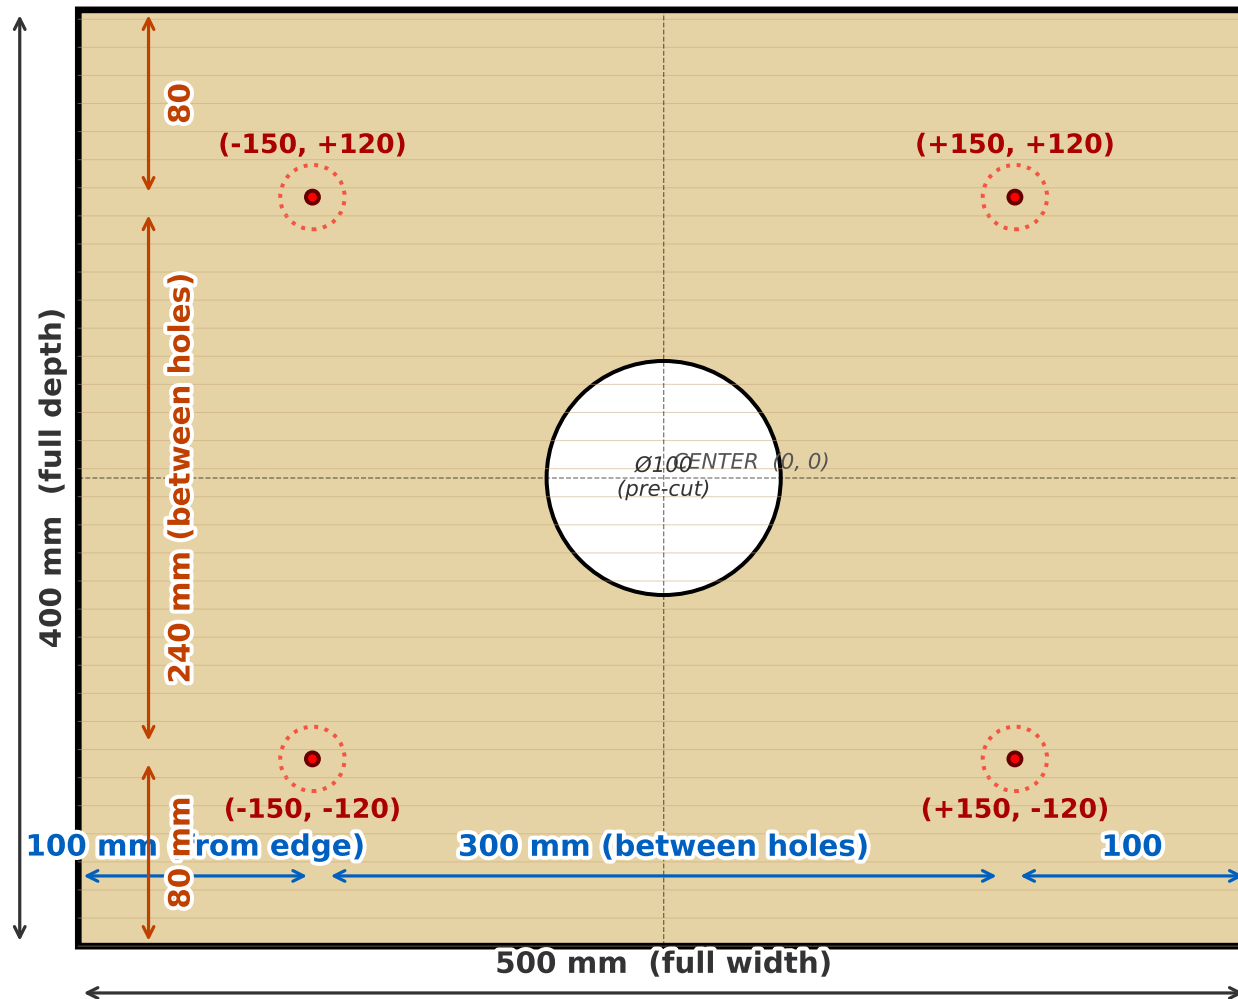

DRILL SPEC

Bit: Ø5.5 mm (M5 clearance)
Depth: THROUGH (12.7 mm plywood)
Fastener: M5 x 25 SHCS from below + Loctite 242 (self-taps into 2020 end bore)

HAND-DRILL PROCEDURE

1. Place wood base TOP FACE UP
2. Measure and mark 4 hole positions:
 - 100 mm from each X-edge (left & right)
 - 80 mm from each Y-edge (front & back)
 - > 4 crosses at the 4 corners of a 300 x 240 mm rectangle centered on the take-down hole.
3. Center-punch each mark to keep the bit from wandering when you start the hole.
4. Place scrap plywood UNDER the wood base to prevent tear-out on the exit face.
5. Drill straight down at each mark with a Ø5.5 mm bit (14/64" or 7/32" imperial).
6. Break the top edges lightly with a countersink or larger bit for clean look.

TOLERANCE

Position: ± 1 mm (the 2020's end bore)

LEGEND

Red circle: NEW hole to drill (Ø5.5 mm)
Red dotted: Drilling target area (not to scale)
White circle: Existing pre-cut hole (Ø100 take-down)
Dashed cross: Center reference axes