Rockchip Linux PCIe Trouble Shooting Guide

ID: RK-KF-YF-C63

Release Version: V1.1.0

Release Date: 2026-04-16

Security Level: □Top-Secret □Secret □Internal ■Public

DISCLAIMER

THIS DOCUMENT IS PROVIDED “AS IS”. ROCKCHIP ELECTRONICS CO., LTD.(“ROCKCHIP”)DOES NOT PROVIDE ANY WARRANTY OF ANY KIND, EXPRESSED, IMPLIED OR OTHERWISE, WITH RESPECT TO THE ACCURACY, RELIABILITY, COMPLETENESS,MERCHANTABILITY, FITNESS FOR ANY PARTICULAR PURPOSE OR NON-INFRINGEMENT OF ANY REPRESENTATION, INFORMATION AND CONTENT IN THIS DOCUMENT. THIS DOCUMENT IS FOR REFERENCE ONLY. THIS DOCUMENT MAY BE UPDATED OR CHANGED WITHOUT ANY NOTICE AT ANY TIME DUE TO THE UPGRADES OF THE PRODUCT OR ANY OTHER REASONS.

Trademark Statement

"Rockchip", "瑞芯微", "瑞芯" shall be Rockchip’s registered trademarks and owned by Rockchip. All the other trademarks or registered trademarks mentioned in this document shall be owned by their respective owners.

All rights reserved ©2026 Rockchip Electronics Co., Ltd.

Beyond the scope of fair use, neither any entity nor individual shall extract, copy, or distribute this document in any form in whole or in part without the written approval of Rockchip.

Rockchip Electronics Co., Ltd.

No.18 Building, A District, No.89, software Boulevard Fuzhou, Fujian,PRC

Website: www.rock-chips.com

Customer service Tel: +86-4007-700-590

Customer service Fax: +86-591-83951833

Customer service e-Mail: fae@rock-chips.com

Preface

Overview

Product Version

Chip Name	Kernel Version
ALL	All SDK version

Intended Audience

This document (this guide) is primarily intended for the following engineers:

Technical Support Engineers

Software Development Engineers

Revision History

Version	Author	Date	Change Description
V1.0.0	Lin Tao	2026-03-05	Initial version
V1.1.0	Lin Dingqiang	2026-04-16	Supplement PCIe peripheral cache coherence handling explanation; Optimize training failure troubleshooting steps, add debug property description

Table of Contents

Rockchip Linux PCIe Trouble Shooting Guide

1. Common Application Issues
    - 1.1 Hardware related issuesCan lanes be interwoven when the routing position is not optimal?
        - 1.1.1 Can Differential Signals on the Same Lane be Intertwined?
        - 1.1.2 Can a Single PCIe Interface Support Splitting or Merging?
        - 1.1.3 What Clock Input Modes Does PCIe 3.0 Interface Support?
        - 1.1.4 Does PCIe switch support exist? Are there any recommendations from your company?
    - 1.2 Software related issues
        - 1.2.1 How to Determine the Correspondence Between Controllers and Devices in the System?
        - 1.2.2 How to Determine the Link Status of a PCIe Device?
        - 1.2.3 Does it support Legacy INT mode? How to force the use of Legacy INTA to INTD interrupts?
        - 1.2.4 How to Access BAR Space if the CPU Runs in 32-bit Address Mode?
        - 1.2.5 How to View the CPU Domain Address and PCIe Bus Domain Address Allocated to Peripherals by the Chip, and How Do They Correspond?
        - 1.2.6 How to Rescan a Single Downstream Device or Replace a Device Online?
        - 1.2.7 How to Handle Cache Coherence for PCIe Peripherals and Their Function Drivers?
        - 1.2.8 How to Initiate MSI Interrupts from RK PCIe EP via Command?
        - 1.2.9 How to Initiate MSI-X Interrupts from RK PCIe EP via Command?
        - 1.2.10 How to Modify and Increase the 32bits-np Mapping Address Space?
        - 1.2.11 How to Configure Maximum Payload Size?
        - 1.2.12 How to Fix the ID Numbers of Enumerated Devices?
    - 1.3 Test related issues
        - 1.3.1 How to Enter PCIe Test Mode?
    - 1.4 Power related issues
        - 1.4.1 Does PCIe Device Support Using Beacon Method to Wake Up the Host Controller?
        - 1.4.2 How to Keep PCIe Operational During Secondary Sleep State
2. Troubleshooting Anomalies
    - 2.1 Link setup issues
        - 2.1.1 Driver Loading Failure
        - 2.1.2 Training Failure
        - 2.1.3 PCIe3.0 Controller Initialization Device System Exception
        - 2.1.4 PCIe2.0 Controller Initialization Device System Exception
    - 2.2 Devices enumeration and usage issues
        - 2.2.1 PCIe Peripheral Memory BAR Resource Allocation Anomalies
        - 2.2.2 PCIe Peripheral IO BAR Resource Allocation Anomaly
        - 2.2.3 Error Reporting During Peripheral Enumeration and Communication
        - 2.2.4 Firmware Exception During Peripheral Enumeration Process
        - 2.2.5 Accessing PCIe Device BAR Address Space After Remapping Causes Exceptions
        - 2.2.6 PCIe to USB Device Driver (xhci) Loading Exception
        - 2.2.7 Inability to Access the IO Address Space Allocated to Peripherals
        - 2.2.8 PCIe Devices Can Link but Fail to Enumerate
        - 2.2.9 PCIe Devices Can Be Enumerated but Access Is Abnormal
    - 2.3 Interrupt issues
        - 2.3.1 MSI/MSI-X Unavailability
        - 2.3.2 Device Allocated to Legacy Interrupt Number 0
    - 2.4 Suspend resume issues
        - 2.4.1 PCIe 3.0 Interface System Anomaly During Sleep Wake-Up
        - 2.4.2 PCIe Device Transition to PM Mode Causes Module Exception
        - 2.4.3 PCIe Peripheral Sleep Wake-Up Failures and Connectivity Issues
    - 2.5 Stability issues
        - 2.5.1 NVMe Device Exhibits Anomalies Under Long-Term Operation
    - 2.6 Other issues
        - 2.6.1 PCIe to SATA Device Disk Numbers Are Not Fixed
        - 2.6.2 PCIe peripheral malfunctions in GKI mode
3. Appendix


3.1 LTSSM State Machine
3.2 Detailed Explanation of PCIe Address Space Configuration
3.3 M.2 Interface Hardware

1. Common Application Issues

1.1 Hardware related issuesCan lanes be interwoven when the routing position is not optimal?

1. Support for lane interweaving (Lane reversal) is a hardware protocol behavior, and no software changes are required. However, there are the following restrictions:

- In the case of 4 lanes, the RK platform currently only supports full reverse interweaving, meaning that RC's Lane[0.1.2.3] correspond to EP's Lane[3.2.1.0], and all other scenarios are not supported.

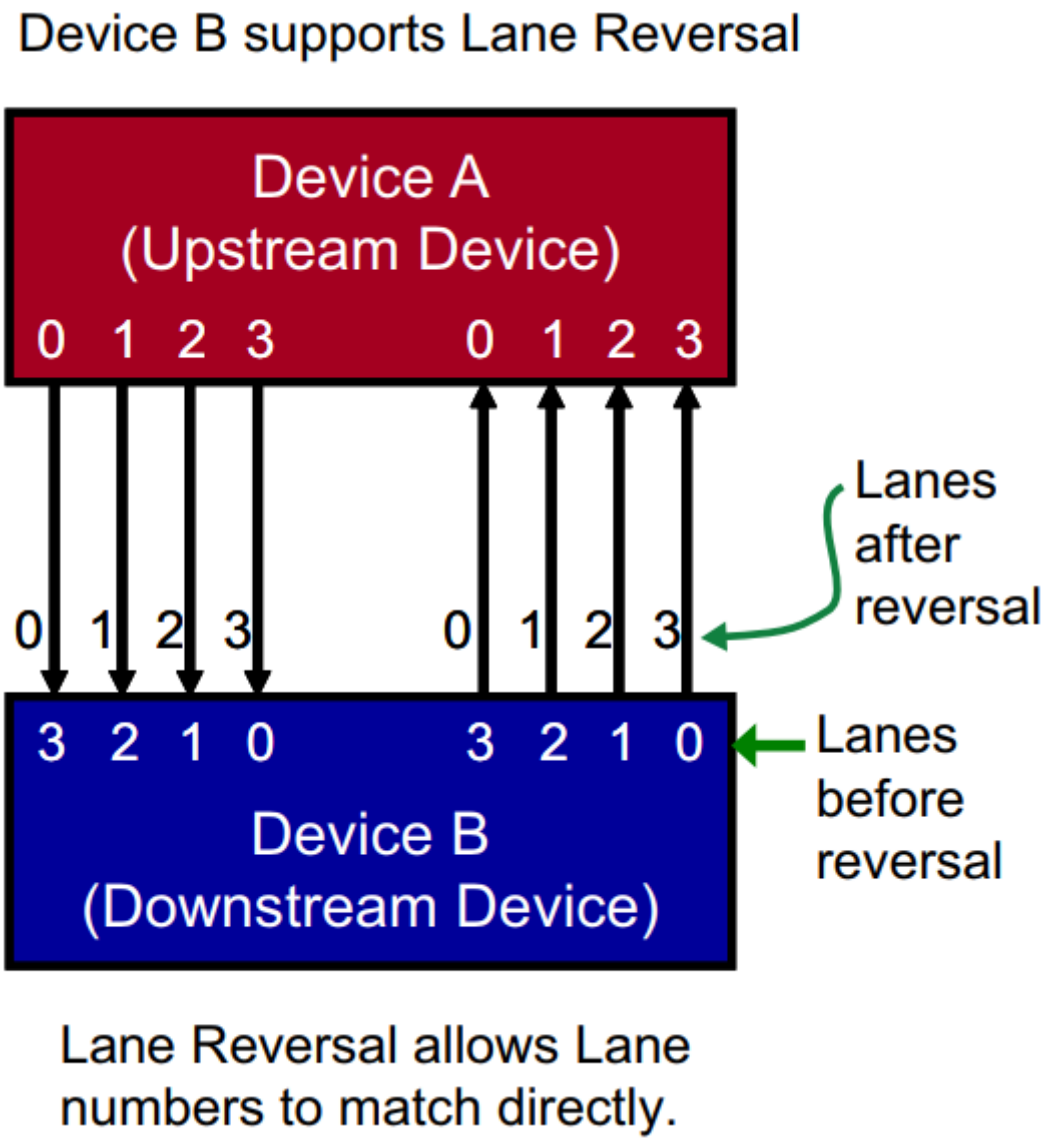

- In the case of 2 lanes, similarly, RC's Lane[0.1] correspond to EP's Lane[1.0].

2. It is not supported to combine signals from different groups of lanes on the same side, such as RC lane0 TX and lane1 RX cannot be combined into a group of lanes to connect external devices.

1.1.1 Can Differential Signals on the Same Lane be Intertwined?

Supports PN inversion (Lane polarity), typically RC TX+ connects to EP RX+, RC TX- connects to EP RX-, supports PN inversion wiring such as RC TX+ connecting to EP RX-, and no additional software processing is required, as the PCIe controller automatically detects it.

Does not support TX/RX intertwining, for example, RC's lane1 TX cannot be connected to EP's lane1TX.

1.1.2 Can a Single PCIe Interface Support Splitting or Merging?

Some PCIe ports on RK chips can support the functions of splitting and merging. Please refer to the "Chip Resources Introduction" section for details, and refer to the example and dts explanation for specific methods.

1.1.3 What Clock Input Modes Does PCIe 3.0 Interface Support?

The input clock modes for the PHY of PCIe 3.0 can be HCSL, LPHCSL, or other differential signals, such as LVDS with additional level conversion circuit implementations, all of which are designed to meet the PHY specifications.

Power Supplies:

vph Min = 1.8 V-10%; Typ = 1.8 V; Max = 1.8 V+10% or
vph Min = 1.5 V-5%; Typ = 1.5 V; Max = 1.5 V+10% or
vph Min = 1.2 V-5%; Typ = 1.2 V; Max = 1.2 V+10%
Note: 1.2 V support is pending silicon characterization and validation

vp/vpdig/vptxX Min = 0.9 V-7%; Typ = 0.9 V; Max = 0.9 V+10%

Symbol	Parameter	Min	Max	Units	Conditions
FREF_CLK	Reference clock frequency	19.2	200	MHz	Not continuous; per protocol as noted in the databook
FREF_OFFSET	Reference clock frequency offset	-100	100	ppm	All protocols except for SATA
RMSJREF_CLK <= 8 Gbps	Reference clock Random Jitter		1.6	ps_{rms}	Integrated RJ from 12 kHz to 20 MHz
			1.2		Integrated Rj from 2 MHz to 20 MHz
DJREF_CLK <= 8 Gbps	Reference clock deterministic jitter		2.8	ps, pp	0.75-10 MHz (offset)[a]
			5.6		0.2-50 MHz (offset)[a]
DCREF_CLK	Duty cycle	40	60	%	

Symbol	Parameter	Min	Max	Units	Conditions
VCMREF_CLk	Common mode input level	0	vp	V	Differential inputs
VDREF_CLK	Differential input swing	300	2*vp	mVppd	Differential input must meet both VDREF_CLK and VDSEREF_CLK
VDSEREF_CLK	Differential clock single ended voltage	0	vp		Differential input must meet both VDREF_CLK and VDSEREF_CLK
SKEWDIF_CLK	Differential clock input skew		100	ps	
SWREF_CLK	Differential clock input slew rate	0.1		V/ns	20 – 80%

Note:
For PCIe, follow the CEM specification requirements

a. DJ noise limits are for noise within an offset from the divided reference clock and harmonics of the divided reference clock

1.1.4 Does PCIe switch support exist? Are there any recommendations from your company?

1.2 Software related issues

1.2.1 How to Determine the Correspondence Between Controllers and Devices in the System?

Taking the RK3568 chip as an example:

The PCIe2x1 controller allocates Bus addresses for peripherals between 0x0~0xf, the PCIe3x1 controller allocates bus addresses between 0x10~0x1f, and the PCIe3x2 controller allocates bus addresses between 0x20~0x2f. From the output of lspci, you can see the bus addresses (high bits) allocated to each device, which allows you to determine the correspondence. The second column Class is the device type, and the third column VID:PID.
Class types can be referenced at https://pci-ids.ucw.cz/read/PD/, and vendor VID and product PID can be referenced at http://pci-ids.ucw.cz/v2.2/pci.ids

```
console:/ # lspci
21:00.0 Class 0108: 144d:a808
20:00.0 Class 0604: 1d87:3566
11:00.0 Class 0c03: 1912:0014
10:00.0 Class 0604: 1d87:3566
01:00.0 Class 0c03: 1912:0014
00:00.0 Class 0604: 1d87:3566
```

We can see that each controller reserves 16 levels of bus downstream to connect devices, which means each controller can connect 16 devices downstream (including switches), generally meeting the requirements. Readers can skip the following explanation if not necessary. If adjustments are indeed required, please adjust the bus-range allocation of the three controllers in rk3568.dtsi, and ensure that there is no overlap. Additionally, adjusting the bus-range will cause changes in the MSI(-X) RID intervals of devices, so please adjust the msi-map accordingly.

```
bus-range = <start address   end address>

msi-map = < start address in bus-range << 8
            &its
            start address in bus-range << 8
            total number of buses allocated in bus-range << 8>
```

For example, if the bus-range is adjusted to 0x30 ~ 0x5f, meaning devices downstream of this controller are allocated bus addresses from 0x30 to 0x5f, with a total of 0x30 buses,

then you can configure msi-map = <0x3000 &its 0x3000 0x3000>

And so on, and it is essential to ensure that the bus-range and msi-map of the three controllers do not overlap with each other, and that the bus-range and msi-map are compatible with each other.

1.2.2 How to Determine the Link Status of a PCIe Device?

Use the lspci tool published by the server to execute `lspci -vvv` to find the corresponding device's linkStat to view it; where Speed indicates the speed, and Width refers to the number of lanes. If you need to parse other information, please search the internet for reference.

1.2.3 Does it support Legacy INT mode? How to force the use of Legacy INTA to INTD interrupts?

It supports the legacy INT mode. However, the default priority of the Linux PCIe protocol stack is MSI-X, MSI, Legacy INT, so conventionally available devices will not request Legacy INT. If debugging and testing are required, please refer to the Documentation/admin-guide/kernel-parameters.txt document in the kernel, where "pci=option[,option...] [PCI] various PCI subsystem options." describes that MSI can be disabled in the cmdline, and the system will default to forcing the use of the Legacy INT allocation mechanism. Taking the RK356X Android platform as an example, an additional item pci=nomsi can be added to the cmdline parameters in arch/arm64/boot/dts/rockchip/rk3568-android.dtsi, noting that there should be a space before and after the item:

```
bootargs = "...... pci=nomsi ......";
```

If added successfully, lspci -vvv will show that the MSI and MSI-X for this device are both disabled (Enable-), and INT A interrupt is allocated, with the interrupt number being 80. cat /proc/interrupts can be used to view the status of the 80 interrupt.

```
01:00.0 Class 0108: Device 14a4:22f1 (rev 01) (prog-if 02)
        Subsystem: Device 1b4b:1093
...
        Interrupt: pin A routed to IRQ 80
...
        Capabilities: [50] MSI: Enable- Count=1/1 Maskable+ 64bit+
                Address: 0000000000000000  Data: 0000
                Masking: 00000000  Pending: 00000000
...
        Capabilities: [b0] MSI-X: Enable- Count=19 Masked-
                Vector table: BAR=0 offset=00002000
                PBA: BAR=0 offset=00003000
```

1.2.4 How to Access BAR Space if the CPU Runs in 32-bit Address Mode?

By default, the chip allocates BAR space for the PCIe controller, which is located beyond the 32-bit addressing range. However, our chip has reserved a BAR address below 32 bits, with different limitations for each controller. For instance, the RK3568 chip has only 32MB of low-position BAR address for each controller. When the RK3568 CPU operates in 32-bit address mode, we should enable the low address space to reallocate the ranges for each PCIe node. The following example has been modified to configure a 1MB configuration space, 1MB IO space, and 30MB 32-bit MEM space:

```
&pcie2x1 {
        ranges = <0x00000800 0x0 0xF4000000 0x0 0xF4000000 0x0 0x100000
                  0x81000000 0x0 0xF4100000 0x0 0xF4100000 0x0 0x100000
                  0x82000000 0x0 0xF4200000 0x0 0xF4200000 0x0 0x1e00000>;
}

&pcie3x1 {
        ranges = <0x00000800 0x0 0xF2000000 0x0 0xF2000000 0x0 0x100000
                  0x81000000 0x0 0xF2100000 0x0 0xF2100000 0x0 0x100000
                  0x82000000 0x0 0xF2200000 0x0 0xF2200000 0x0 0x1e00000>;
}

&pcie3x2 {
        ranges = <0x00000800 0x0 0xF0000000 0x0 0xF0000000 0x0 0x100000
                  0x81000000 0x0 0xF0100000 0x0 0xF0100000 0x0 0x100000
                  0x82000000 0x0 0xF0200000 0x0 0xF0200000 0x0 0x1e00000>;
}
```

If you need to adjust the size of each space, refer to the section "Detailed Description of PCIe Address Space Configuration" in the appendix.

1.2.5 How to View the CPU Domain Address and PCIe Bus Domain Address Allocated to Peripherals by the Chip, and How Do They Correspond?

Using the `lspci` command, you can view the CPU domain address and PCIe bus domain address of each device.

```
root@linaro-alip: /home/linaro# lspci -Vs 0002:21:00.0 -X
0002:21 :00.0 Non-Volatile memory controller: Intel Corporation SSD Pro 7600p/
760p/E 6100p Series (rev 03) (prog-if 02 [NVM Express] )
    Subsystem: Intel Corporation SSD Pro 7600p/ 760p/E 6100p Series
    Flags: bus master, fast devsel, latency 0, IRQ 114
    Memory at 380900000 (64-bit, non-prefetchable) [size=16K]
    Capabilities: [40] Power Management version 3
    ....

00: 86 80 a6 f1 06 04 10 00 03 02 08 01 00 00 00 00
10: 04 00 90 80 00 00 00 00 00 00 00 00 00 00 00 00
20: 00 00 00 00 00 00 00 00 00 00 00 00 86 80 0b 39
30: 00 00 00 00 40 00 00 00 00 00 00 00 72 01 00 00
```

We can observe that the CPU domain address allocated to the peripheral by the chip is 0x380900000; if the CPU needs to access the peripheral, it can directly use IO commands or the devmem command to read 0x380900000. The corresponding PCIe bus domain address for 0x380900000 can be read from the PCIe peripheral's BAR0 address (starting from offset 0x10 to 0x14) as "04 00 90 80", which is 0x80900000 (the lowest bit 04 indicates that the type of this BAR is 64bit MEM). Therefore, when the CPU issues an access to the CPU domain address 0x380900000, the PCIe address translation service (ATU), through the configured outbound relationship, can issue the PCIe bus domain address 0x80900000, thereby enabling the CPU to access the internal information of the PCIe peripheral.

The correspondence between the two is defined in rk3568.dtsi, taking pcie3x2 as an example:

```
ranges = <0x00000800 0x0 0x80000000 0x3 0x80000000 0x0 0x800000
          0x81000000 0x0 0x80800000 0x3 0x80800000 0x0 0x100000   IO space
          0xc3000000 0x0 0x80900000 0x3 0x80900000 0x0 0x3f700000>; Memory space
```

For example, we can view the detailed allocation of the Memory segment. The first segment 0xc3000000 indicates that this memory segment is a 64-bit prefetchable space.
0x3 0x80900000 is the CPU domain address allocated by the chip, i.e., 0x0000000380900000; 0x0 0x80900000 is the PCIe bus domain address corresponding to the allocated CPU domain address, i.e., 0x0000000080900000; 0x3f700000 is the total size of this memory segment.
Therefore, there is an offset relationship of 0x300000000 between the CPU domain access address issued by the CPU and the converted PCIe bus domain address, which is automatically converted by the ATU in hardware.

For details on address space configuration, refer to the section "Detailed Description of PCIe Address Space Configuration" in the appendix.

1.2.6 How to Rescan a Single Downstream Device or Replace a Device Online?

If there are the following two requirements, it is necessary to re-enumerate the downstream device.

1. The downstream device may experience bar space changes at different stages;
2. Online replacement of the downstream device after it is damaged;

```
(1) Identify the downstream device that needs to be replaced or rescanned.
Currently, we take the device with BDF 01:00.0 as an example.
console:/ # /data/lspci -k
00:00.0 Class 0604: Device 1d87:3566 (rev 01)
        Kernel driver in use: pcieport
01:00.0 Class 0c03: Device 1912:0014 (rev 03)

(2) Perform the remove operation on the device, and you can see the
corresponding device node and the PCIe driver it runs are uninitialized.
console:/ # echo 1 > /sys/bus/pci/devices/0000\:01\:00.0/remove
[   30.624938] xhci_hcd 0000:01:00.0: remove, state 4
[   30.624985] usb usb8: USB disconnect, device number 1
[   30.625741] xhci_hcd 0000:01:00.0: USB bus 8 deregistered
[   30.626115] xhci_hcd 0000:01:00.0: remove, state 4
[   30.626142] usb usb7: USB disconnect, device number 1
[   30.640977] xhci_hcd 0000:01:00.0: USB bus 7 deregistered
[   32.055886] vcc5v0_otg: disabling
[   32.055920] vcc3v3_lcd1_n: disabling

(3) Check again to confirm that the device is no longer detected.
console:/ # /data/lspci -k
```

```
00:00.0 Class 0604: Device 1d87:3566 (rev 01)
        Kernel driver in use: pcieport

(4) Initiate a bus rescan. You can choose either of the following two commands.
After execution, the new device will be recognized.
console:/ #  echo 1 > /sys/bus/pci/devices/0000\:00\:00.0/rescan
console:/ #  echo 1 > /sys/bus/pci/rescan
[   33.222240] pci 0000:01:00.0: BAR 0: assigned [mem 0x300900000-0x300900fff
64bit]
[   33.222606] xhci_hcd 0000:01:00.0: xHCI Host Controller
[   33.224875] xhci_hcd 0000:01:00.0: new USB bus registered, assigned bus
number 7
[   33.225468] xhci_hcd 0000:01:00.0: hcc params 0x002841eb hci version 0x100
quirks 0x0000000000000090
[   33.226318] usb usb7: New USB device found, idVendor=1d6b, idProduct=0002,
bcdDevice= 4.19
[   33.226329] usb usb7: New USB device strings: Mfr=3, Product=2,
SerialNumber=1
[   33.226345] usb usb7: Product: xHCI Host Controller
[   33.226355] usb usb7: Manufacturer: Linux 4.19.172 xhci-hcd
[   33.226364] usb usb7: SerialNumber: 0000:01:00.0
[   33.227661] hub 7-0:1.0: USB hub found
[   33.227716] hub 7-0:1.0: 1 port detected
[   33.228252] xhci_hcd 0000:01:00.0: xHCI Host Controller
[   33.228581] xhci_hcd 0000:01:00.0: new USB bus registered, assigned bus
number 8
[   33.226816] xhci_hcd 0000:01:00.0: Host supports USB 3.0 SuperSpeed
[   33.228678] usb usb8: We don't know the algorithms for LPM for this host,
disabling LPM.
[   33.228783] usb usb8: New USB device found, idVendor=1d6b, idProduct=0003,
bcdDevice= 4.19
[   33.228796] usb usb8: New USB device strings: Mfr=3, Product=2,
SerialNumber=1
[   33.228803] usb usb8: Product: xHCI Host Controller
[   33.228809] usb usb8: Manufacturer: Linux 4.19.172 xhci-hcd
[   33.228814] usb usb8: SerialNumber: 0000:01:00.0
[   33.229360] hub 8-0:1.0: USB hub found
[   33.229406] hub 8-0:1.0: 4 ports detected
[   33.556216] usb 7-1: new high-speed USB device number 2 using xhci_hcd
[   33.700886] usb 7-1: New USB device found, idVendor=2109, idProduct=3431,
bcdDevice= 4.20
[   33.700913] usb 7-1: New USB device strings: Mfr=0, Product=1, SerialNumber=0
[   33.700920] usb 7-1: Product: USB2.0 Hub
[   33.702398] hub 7-1:1.0: USB hub found
[   33.702642] hub 7-1:1.0: 4 ports detected
```

1.2.7 How to Handle Cache Coherence for PCIe Peripherals and Their Function Drivers?

According to the PCIe protocol definitions of Snoop and No Snoop, when a peripheral sends an access request to the host system, its TLP packet needs to set the No Snoop attribute bit to indicate whether the host system's hardware assistance is required to maintain cache coherence.

No Snoop Bit	Cache Coherency Type	Management Model	Remarks
0	Snoop	Hardware ensures cache coherence	Cfg packets, I/O packets, Message packets, MSI(-x) packets must be set to 0
1	No Snoop	Peripheral driver maintains cache coherence	-

When a peripheral issues a TLP packet to write to the host memory, if its No Snoop bit is 0, upon entering the host system, the RC will check whether the address being written falls within the cache of another CPU. If so, an invalidate operation must be performed on all CPUs that have this address cached after the data is written to physical memory.

When a peripheral sends a TLP packet to fetch data from the host memory and send it to the peripheral, if its No Snoop bit is 0, the RC will check all CPUs' caches to determine if the address where the data in the TLP packet is located has been cached by another CPU. If so, a flush operation must be performed before fetching the data.

Some chips in the RK platform's architecture **do not support** Snoop type and are uniformly processed with No Snoop set to 1. Therefore, the running function drivers need to maintain cache coherence themselves if the memory isn't allocated with dma coherent way. For those that support the Snoop type, the chip can ensure cache coherence.

Note that for peripherals such as compute cards, graphics cards, and other peripherals: such devices are typically used in Windows environments for extended periods and usually rely on the RC platform's Snoop mechanism by default to ensure data consistency; if porting to a platform that does not support Snoop, be sure to confirm whether cache coherence compatibility processing has been completed.

1.2.8 How to Initiate MSI Interrupts from RK PCIe EP via Command?

Pre-test confirmations:

- Both RC and EP support and enable MSI cap, RK RC and RK EP have MSI cap enabled by default
- The function driver for EP is running on RC and has requested MSI interrupts

The RK PCIe EP client register PCIE_CLIENT_MSI_GEN_CON supports triggering MSI interrupts, with a 32-bit register corresponding to 32 MSI interrupts. Taking RK3588 as an example:

```
io -4 0xFE150038 1
```

In addition to this, it is also possible through:

- Setting outbound ATU, CPU writes to initiate memory write
- Or through DMA transfer to initiate memory write

Other notes:

- Some PCs can only request one MSI interrupt, including Linux and Windows systems, mainly limited by PC BIOS configurations, such as:
  - Intel BIOS virtualization and VT-d configuration
  - Interrupt remapper support
- RK3588 RC can request up to 32 MSI interrupts

1.2.9 How to Initiate MSI-X Interrupts from RK PCIe EP via Command?

Principle

The PC configures the MSI table through the standard MSI-X cap mapping BAR4.

RK3568 Example

```
# After loading the driver, the msix configuration status can be viewed from the
device side by executing the following two commands to see the MSI-X table
io -4 0xfe280270 0x10001      # Enable Dbi writeable during testing
io -4 -l 0x100 0xf6300000
io -4 0xfe280270 0x10000

f6300000:  fee02004 00000000 00000024 00000000
f6300010:  fee08004 00000000 00000024 00000000
f6300020:  fee01004 00000000 00000024 00000000
f6300030:  fee02004 00000000 00000025 00000000
f6300040:  fee08004 00000000 00000025 00000000
f6300050:  fee01004 00000000 00000025 00000000
f6300060:  fee02004 00000000 00000026 00000000
f6300070:  fee04004 00000000 00000026 00000000
f6300080:  00000000 00000000 00000000 00000001
f6300090:  00000000 00000000 00000000 00000001
f63000a0:  00000000 00000000 00000000 00000001
f63000b0:  00000000 00000000 00000000 00000001
f63000c0:  00000000 00000000 00000000 00000001
f63000d0:  00000000 00000000 00000000 00000001
f63000e0:  00000000 00000000 00000000 00000001
f63000f0:  00000000 00000000 00000000 00000001

# Since the current business does not provide an MSI-X interface example, MSI-X
can be triggered in the following way
# Set device outbound, the default RK EP outbound configuration CPU addr is
0xf0000000, unchanged during testing, or Bar outbound configuration can be
completed through the kernel interface
io -4 0xf6300014 0xfee00000    # Points to the output address of the previous io
-4 -l 0x100 0xf6300000
io -4 0xf6300018 0x0

# Trigger MSI-X
io -4 0xf0002004 0x24
io -4 0xf0008004 0x24
io -4 0xf0001004 0x24
io -4 0xf0002004 0x25
io -4 0xf0008004 0x25
io -4 0xf0001004 0x25
io -4 0xf0002004 0x26
io -4 0xf0004004 0x26
```

RK3588 Example

```
# After loading the driver, the msix configuration status can be viewed from the
device side by executing the following two commands to see the MSI-X table
io -4 0xfe150270 0x10001       # Enable Dbi writeable during testing
io -4 -l 0x100 0xf5300000
```

```
io -4 0xfe150270 0x10000

f5300000:  fee02004 00000000 00000024 00000000
f5300010:  fee08004 00000000 00000024 00000000
f5300020:  fee01004 00000000 00000024 00000000
f5300030:  fee02004 00000000 00000025 00000000
f5300040:  fee08004 00000000 00000025 00000000
f5300050:  fee01004 00000000 00000025 00000000
f5300060:  fee02004 00000000 00000026 00000000
f5300070:  fee04004 00000000 00000026 00000000
f5300080:  00000000 00000000 00000000 00000001
f5300090:  00000000 00000000 00000000 00000001
f53000a0:  00000000 00000000 00000000 00000001
f53000b0:  00000000 00000000 00000000 00000001
f53000c0:  00000000 00000000 00000000 00000001
f53000d0:  00000000 00000000 00000000 00000001
f53000e0:  00000000 00000000 00000000 00000001
f53000f0:  00000000 00000000 00000000 00000001

# Since the current business does not provide an MSI-X interface example, MSI-X
can be triggered in the following way
# Set device outbound, the default RK EP outbound configuration CPU addr is
0xf0000000, unchanged during testing, or Bar outbound configuration can be
completed through the kernel interface
io -4 0xf5300014 0xfee00000    # Points to the output address of the previous io
-4 -l 0x100 0xf5300000
io -4 0xf5300018 0x0

# Trigger MSI-X
io -4 0xf0002004 0x24
io -4 0xf0008004 0x24
io -4 0xf0001004 0x24
io -4 0xf0002004 0x25
io -4 0xf0008004 0x25
io -4 0xf0001004 0x25
io -4 0xf0002004 0x26
io -4 0xf0004004 0x26
```

1.2.10 How to Modify and Increase the 32bits-np Mapping Address Space?

Background

The PCIe mmio space is the mapped address space for CPU-initiated PCIe transfers, with dedicated physical addresses, and Dram does not include this segment of space. Each PCIe controller has a dedicated mmio space, typically 32MB of 32bits address space and 1GB of 64bits address space.

The PCIe range is the mapping between the CPU access address and the PCI domain virtual address. The allocation principle for the PCIe range is:

- The domain address must not overlap with the Dram physical address to avoid EP end DMA address confusion leading to access errors, so:
    - The default domain address is allocated at the corresponding PCIe controller mmio physical address, corresponding one-to-one with the PCIe mmio space
    - To extend limited 32-bit-non-prefetchable (32bits-np) domain address space, share 32bits-np domain addresses *across other PCIe controllers*.

Reason: Physical MMIO addresses required for extending 32bits-np domains must be borrowed from the *64-bit physical MMIO space of the same controller*. Physical MMIO addresses from *other* PCIe controllers cannot be used.

- To further expand 32bits-np domain address space, it is recommended to first consult the TRM manual's System Map section to identify available large blocks of 32-bit physical MMIO addresses assigned to other IPs.If available, borrow such addresses to serve as 32bits-np domain addresses. If unavailable, utilize reserved memory space within the 4GB range for additional allocation.

The default configuration is confirmed, taking RK3588 as an example:

```
[    5.325570] pci_bus 0000:00: root bus resource [mem 0xf0200000-0xf0ffffff]
                      # RC 14MB 32bits-np mem
[    5.325577] pci_bus 0000:00: root bus resource [mem 0x900000000-0x93fffffff
pref]                   # RC 1GB 64bits-pref mem
```

Issue: Default Allocation of 32bits-np Space is Insufficient
log:

```
[   11.646077] pci 0000:01:00.0: reg 0x10: [mem 0x00000000-0x00ffffff 64bit]   #
Dev requires a total of 26MB 32bits-np, and will eventually align to a
requirement of 32MB space
[   11.646113] pci 0000:01:00.0: reg 0x18: [mem 0x00000000-0x007fffff 64bit]
[   11.646150] pci 0000:01:00.0: reg 0x20: [mem 0x00000000-0x001fffff 64bit]
...
[   11.971710] pci 0000:01:00.0: BAR 0: no space for [mem size 0x01000000 64bit]
[   11.971713] pci 0000:01:00.0: BAR 0: failed to assign [mem size 0x01000000
64bit]
[   11.971717] pci 0000:01:00.0: BAR 2: no space for [mem size 0x00800000 64bit]
[   11.971720] pci 0000:01:00.0: BAR 2: failed to assign [mem size 0x00800000
64bit]
[   11.971723] pci 0000:01:00.0: BAR 4: no space for [mem size 0x00200000 64bit]
[   11.971726] pci 0000:01:00.0: BAR 4: failed to assign [mem size 0x00200000
64bit]
```

Patch Solution Reference
Refer to the TRM to confirm the dedicated memory space for PCIe, and then add the missing mem range resources.

Example 1: RK3588 pcie3x4 modification of 240MB 32bits-np mapping space configuration, modify the kernel rk3588.dtsi corresponding node range attribute to:

```
                ranges = <0x00000800 0x0 0xff000000 0x0 0xf0000000 0x0 0x100000
                          0x81000000 0x0 0xff100000 0x0 0xf0100000 0x0 0x100000
                          0x82000000 0x0 0xf0000000 0x9 0x00000000 0x0
0x0f000000
                          0xc3000000 0x9 0x10000000 0x9 0x10000000 0x0
0x30000000>;
```

Example 2: RK3588s pcie2x1l2 modification of 240MB 32bits-np mapping space configuration, modify the kernel rk3588s.dtsi corresponding node range attribute to:

```
                ranges = <0x00000800 0x0 0xff000000 0x0 0xf4000000 0x0 0x100000
                          0x81000000 0x0 0xff100000 0x0 0xf4100000 0x0 0x100000
                          0x82000000 0x0 0xf0000000 0xa 0x00000000 0x0
0x0f000000
                          0xc3000000 0xa 0x10000000 0xa 0x10000000 0x0
0x30000000>;
```

Example 3: RK3588 pcie2x1l0 modification of 240MB 32bits-np mapping space configuration, modify the kernel rk3588.dtsi corresponding node range attribute to:

```
                ranges = <0x00000800 0x0 0xff000000 0x0 0xff000000 0x0 0x100000
                          0x81000000 0x0 0xff100000 0x0 0xff100000 0x0 0x100000
                          0x82000000 0x0 0xf0000000 0x9 0x80000000 0x0
0x0f000000
                          0xc3000000 0x9 0x90000000 0x9 0x90000000 0x0
0x30000000>;
```

Example 5: RK3568 pcie3x2 modification of 240MB 32bits-np mapping space configuration, modify the kernel rk356x.dtsi corresponding node range attribute to:

```
                ranges = <0x00000800 0x0 0xff000000 0x0 0xf0000000 0x0 0x100000
                          0x81000000 0x0 0xff100000 0x0 0xf0100000 0x0 0x100000
                          0x82000000 0x0 0xf0000000 0x3 0x80000000 0x0
0x0f000000
                          0xc3000000 0x3 0x90000000 0x3 0x90000000 0x0
0x30000000>;
```

Example 6: Based on Example 1, add a 256M mapping memory at 0x30000000 and reserve memory as required:

```
diff --git a/arch/arm64/boot/dts/rockchip/rk3588-evb1-lp4.dtsi
b/arch/arm64/boot/dts/rockchip/rk3588-evb1-lp4.dtsi
index a10dad37f9cf..d1b16e13c459 100644
--- a/arch/arm64/boot/dts/rockchip/rk3588-evb1-lp4.dtsi
+++ b/arch/arm64/boot/dts/rockchip/rk3588-evb1-lp4.dtsi
@@ -233,6 +233,15 @@ wireless_wlan: wireless-wlan {
                WIFI,poweren_gpio = <&gpio3 RK_PB1 GPIO_ACTIVE_HIGH>;
                status = "okay";
        };
+
+       reserved-memory {
+               #address-cells = <2>;
+               #size-cells = <2>;
+               ranges;
+               pcie3x4_range: pcie3x4-range@30000000 {
+                       reg = <0x0 0xdfe00000 0x0 0x10200000>;
+               };
+       };
 };

 &backlight {
diff --git a/arch/arm64/boot/dts/rockchip/rk3588.dtsi
b/arch/arm64/boot/dts/rockchip/rk3588.dtsi
index ad414c61fd38..096f16740e11 100644
--- a/arch/arm64/boot/dts/rockchip/rk3588.dtsi
+++ b/arch/arm64/boot/dts/rockchip/rk3588.dtsi
```

```
@@ -601,10 +601,11 @@ pcie3x4: pcie@fe150000 {
                phys = <&pcie30phy>;
                phy-names = "pcie-phy";
                power-domains = <&power RK3588_PD_PCIE>;
-               ranges = <0x00000800 0x0 0xf0000000 0x0 0xf0000000 0x0 0x100000
-                         0x81000000 0x0 0xf0100000 0x0 0xf0100000 0x0 0x100000
-                         0x82000000 0x0 0xf0200000 0x0 0xf0200000 0x0 0xe00000
-                         0xc3000000 0x9 0x00000000 0x9 0x00000000 0x0
0x40000000>;
+                ranges = <0x00000800 0x0 0xdfe00000 0x0 0xf0000000 0x0 0x100000
+                          0x81000000 0x0 0xdff00000 0x0 0xf0100000 0x0 0x100000
+                          0x82000000 0x0 0xe0000000 0x9 0x00000000 0x0
0x20000000 // Extended to 512MB
+                          0xc3000000 0x9 0x20000000 0x9 0x20000000 0x0
0x20000000>;
                reg = <0x0 0xfe150000 0x0 0x10000>,
                      <0xa 0x40000000 0x0 0x400000>;
                reg-names = "pcie-apb", "pcie-dbi";
```

1.2.11 How to Configure Maximum Payload Size?

PCIe transmits data in the form of TLPs, and the maximum payload size (referred to as MPS) determines the maximum number of bytes that a PCIe device's TLP can transfer. The size of MPS is negotiated by the devices at both ends of the PCIe link, and when a PCIe device sends a TLP, its maximum payload cannot exceed the value of MPS.

The kernel provides configuration based on DTS for "[PCI] various PCI subsystem options." For detailed reference, see the "Documentation/admin-guide/kernel-parameters.txt" document. The relevant configurations are as follows:

```
pcie_bus_tune_off  # Disable MPS adjustment, use the device's default value
pcie_bus_safe      # Enable MPS adjustment, set the maximum MPS value supported
by all devices
pcie_bus_perf      # Enable MPS adjustment, set the maximum MPS based on the
parent bus and its own capability
pcie_bus_peer2peer # Enable MPS adjustment, set all devices to have an MPS of
128B
```

Explanation:

- The kernel's default configuration mechanism for max payload size is `pcie_bus_tune_off`.
- It is usually possible to directly add the `pci=pcie_bus_safe` attribute in the dts bootargs.

1.2.12 How to Fix the ID Numbers of Enumerated Devices?

When multiple PCIe devices of the same type appear in a system, such as multiple network cards, the initialization order is not fixed, so which device eth0 represents is actually not fixed. The same situation also applies to NVMe, etc. If users want to fix the ID of the enumerated device, they need to modify the corresponding function driver. The theoretical basis for the modification is that the device's bus number is allocated by DTS. The following two examples can be referenced:

```
If RK3588 is connected to three network cards and wants to fix the order as
follows:
pcie2x1l0: pcie@fe170000 => eth1
pcie2x1l2: pcie@fe190000 => eth2
pcie2x1l1: pcie@fe180000 => eth3

By querying dtsi, it is known that:
pcie2x1l0 node: bus-range = <0x20 0x2f> -> The bus number allocated to the
network card is 0x21 -> eth1
pcie2x1l2 node: bus-range = <0x40 0x4f> -> The bus number allocated to the
network card is 0x41 -> eth2
pcie2x1l1 node: bus-range = <0x30 0x3f> -> The bus number allocated to the
network card is 0x31 -> eth3

Modify the corresponding function driver to change the name registered to the
network subsystem before the register_netdev function is called.
--- a/drivers/net/ethernet/realtek/r8168/r8168_n.c
+++ b/drivers/net/ethernet/realtek/r8168/r8168_n.c
@@ -25481,6 +25481,18 @@ static const struct net_device_ops rtl8168_netdev_ops =
{
 };
 #endif

+static void pci_bus_nr_2_id(struct pci_dev *pdev, struct net_device *ndev )
+{
+
+       dev_info(&pdev->dev, "%s pdev->bus->number = 0x%x\n",
+                __func__, pdev->bus->number);
+
+       if(pdev->bus->number == 0x21)
+               strcpy(ndev->name, "eth1");
+       if(pdev->bus->number == 0x41)
+               strcpy(ndev->name, "eth2");
+       if(pdev->bus->number == 0x31)
+               strcpy(ndev->name, "eth3");
+}
+
 static int __devinit
 rtl8168_init_one(struct pci_dev *pdev,
                  const struct pci_device_id *ent)
@@ -25624,7 +25636,7 @@ rtl8168_init_one(struct pci_dev *pdev,
                 rtl8168_set_eeprom_sel_low(tp);

         rtl8168_get_mac_address(dev);
-
+       pci_bus_nr_2_id(pdev, dev); // The modification must be before
register_netdev()
         tp->fw_name = rtl_chip_fw_infos[tp->mcfg].fw_name;

Similarly, NVMe storage can be modified in a similar way.
--- a/drivers/nvme/host/core.c
+++ b/drivers/nvme/host/core.c
@@ -5169,6 +5169,19 @@ static void nvme_free_ctrl(struct device *dev)
                 nvme_put_subsystem(subsys);
 }

+static void pci_bus_nr_2_id(struct pci_dev *pdev, struct nvme_ctrl *ctrl)
+{
```

```
+       dev_info(&pdev->dev, "%s pdev->bus->number = 0x%x\n",
+                __func__, pdev->bus->number);
+
+       if(pdev->bus->number == 0x21)
+               ctrl->instance = 1; //pcie2x1l0 -> nvme1
+       if(pdev->bus->number == 0x41)
+               ctrl->instance = 2; //pcie2x1l2 -> nvme2
+       if(pdev->bus->number == 0x31)
+               ctrl->instance = 3; //pcie2x1l1 -> nvme3
+}
+
 /*
  * Initialize a NVMe controller structures.  This needs to be called during
  * earliest initialization so that we have the initialized structured around
@@ -5178,6 +5191,7 @@ int nvme_init_ctrl(struct nvme_ctrl *ctrl, struct device
*dev,
                const struct nvme_ctrl_ops *ops, unsigned long quirks)
 {
        int ret;
+       struct pci_dev *pdev = container_of(dev, struct pci_dev, dev);

        ctrl->state = NVME_CTRL_NEW;
        clear_bit(NVME_CTRL_FAILFAST_EXPIRED, &ctrl->flags);
@@ -5214,6 +5228,8 @@ int nvme_init_ctrl(struct nvme_ctrl *ctrl, struct device
*dev,
                goto out;
        ctrl->instance = ret;

+       pci_bus_nr_2_id(pdev, ctrl);
        device_initialize(&ctrl->ctrl_device);
        ctrl->device = &ctrl->ctrl_device;
        ctrl->device->devt = MKDEV(MAJOR(nvme_ctrl_base_chr_devt),
```

1.3 Test related issues

1.3.1 How to Enter PCIe Test Mode?

Standard Test Suite

Refer to the section "Common Configurations for Controller DTS" for the explanation of the rockchip,compliance-mode property.

Peripheral TX Signal Eye Diagram

Directly wire the TX signal for measurement, and the results usually cannot be directly compared with the results from the standard test suite, but can only be used for comparison between devices of the same model. Signal metrics should refer to the PCIe standard protocol. No special software configuration is required, and bandwidth testing can be performed after device enumeration is successful, such as using the fio command for NVMe to test read and write.

PCIe 3.0 PHY Parameters Not Supported for Adjustment by Software

PCIe Gen3 uses a dedicated PHY, and the software parameters are already the best fit parameters, which are not supported for adjustment.

Most TX/RX parameters for PCIe Gen3 are the result of PHY tuning and are not supported for adjustment.

PCIe 2.0 PHY Parameters Not Recommended for Adjustment by Software

PCIe Gen1/2 PHYs typically use combophy, and the software parameters are already the best fit parameters, which usually do not allow for further adjustment.

If poor signal quality is found:

- Confirm whether the signal testing method is standardized?
- Confirm whether the PCB complies with the RK EVB drawing specifications?

If it is ultimately confirmed that there is a significant signal defect, please optimize the PCB hardware design.

1.4 Power related issues

1.4.1 Does PCIe Device Support Using Beacon Method to Wake Up the Host Controller?

The RK platform does not support waking up the host controller from the L2 state by sending a beacon from a PCIe device. If there is a need for wake-up functionality, please use the #WAKE signal as a GPIO wake-up source method to implement.

1.4.2 How to Keep PCIe Operational During Secondary Sleep State

The default sleep-wake strategy for PCIe is currently as follows:

- Send a PME_Turn_Off package to make both ends enter the L2 state.
- Stop the reference clock output, turn off the EP power, and both ends enter the D3 cold state.
- Trusted Firmware powers down the relevant bus and PLL.
- After waking up, the device is rescanned and enumerated.

Since some devices, such as Wi-Fi, need to support the wake-up-host function, they need to keep their power on during the secondary standby, so their power nodes are not configured to control the PCIe node (vpcie3v3-supply), but are controlled by the Wi-Fi function driver.

If, in addition to power, some devices do not allow the clock/link to be stopped, then it is necessary to:

1. Comment out the sleep-wake function of the PCIe driver.

```
--- a/drivers/pci/controller/dwc/pcie-dw-rockchip.c
+++ b/drivers/pci/controller/dwc/pcie-dw-rockchip.c
@@ -1902,6 +1902,8 @@ static int __maybe_unused rockchip_dw_pcie_suspend(struct
device *dev)
        struct dw_pcie *pci = rk_pcie->pci;
        u32 status;

+       return 0;
+
        /*
         * This is as per PCI Express Base r5.0 r1.0 May 22-2019,
         * 5.2 Link State Power Management (Page #440).
@@ -1997,6 +1999,8 @@ static int __maybe_unused rockchip_dw_pcie_resume(struct
device *dev)
        struct dw_pcie *pci = rk_pcie->pci;
        int ret;
```

```
+       return 0;
```

2. Keep the PCIe PD always on, and the bus power always on.

```
# 1. Query the power-domains node referenced by the PCIe controller node in the
dtsi
pcie0: pcie@2a200000 {
    ...
    power-domains = <&power RK3576_PD_PHP>;
    ...
};

# 2. Configure this power-domain node to always be on, and modify the power
control in the sleep state
--- a/arch/arm64/boot/dts/rockchip/rk3576.dtsi
+++ b/arch/arm64/boot/dts/rockchip/rk3576.dtsi
@@ -1717,11 +1717,8 @@
rockchip_suspend: rockchip-suspend {
    compatible = "rockchip,pm-config";
    status = "disabled";

    rockchip,sleep-debug-en = <0>;
    rockchip,sleep-mode-config = <
            (0
-           | RKPM_SLP_ARMOFF_LOGOFF
-           | RKPM_SLP_PMU_PMUALIVE_32K
-           | RKPM_SLP_PMU_DIS_OSC
+           | RKPM_SLP_ARMOFF_DDRPD
            | RKPM_SLP_PMIC_LP
-           | RKPM_SLP_32K_EXT
            )
    >;

@@ -2325,7 +2325,7 @@
power-domain@RK3576_PD_PHP {
    reg = <RK3576_PD_PHP>;
    #address-cells = <1>;
    #size-cells = <0>;
    pm_qos = <&qos_mmu0>,
             <&qos_mmu1>;
-
+   rockchip,always-on;
    power-domain@RK3576_PD_SUBPHP {
        reg = <RK3576_PD_SUBPHP>;
    };
```

3. Contact the technical team to get the updated bl31 firmware to keep the bus and PLL alive. Then recompile the U-boot firmware.

2. Troubleshooting Anomalies

2.1 Link setup issues

2.1.1 Driver Loading Failure

```
[    0.417008] rk-pcie 3c0000000.pcie: Linked as a consumer to regulator.14
[    0.417477] rk-pcie 3c0800000.pcie: Linked as a consumer to regulator.14
[    0.417648] rk-pcie 3c0800000.pcie: phy init failed
```

Reason for exception: The corresponding phy node for this controller is not correctly enabled in the dts.

```
[    0.195567] rochchip_p3phy_init: lock failed 0x6890000, check input refclk
and power supply
[    0.195585] phy phy-fe8c0000.phy.8: phy init failed --> -110
[    0.195599] rk-pcie 3c0800000.pcie: fail to init phy, err -110
[    0.195611] rk-pcie 3c0800000.pcie: phy init failed
```

Reason for exception: The power supply or input clock for the PCIe 3.0 PHY is abnormal, causing the phy to not function properly.

2.1.2 Training Failure

```
PCIe Link Fail logs are repeatedly showing "PCIe Linking..." and the LTSSM state
machine may differ

rk-pcie 3c0000000.pcie: PCIe Linking... LTSSM is 0x0
rk-pcie 3c0000000.pcie: PCIe Linking... LTSSM is 0x0
rk-pcie 3c0000000.pcie: PCIe Linking... LTSSM is 0x0

Alternatively, there may be a "PCIe Link up" printout, but the LTSSM state
machine's bit16 and bit17 are not equal to 0x3, and the values from bit0 to bit8
are less than 0x11
[    3.108325] rk-pcie fe150000.pcie: Looking up vpcie3v3-supply from device
tree
[    3.126926] rk-pcie fe150000.pcie: missing legacy IRQ resource
[    3.126940] rk-pcie fe150000.pcie: IRQ msi not found
[    3.126944] rk-pcie fe150000.pcie: use outband MSI support
[    3.126947] rk-pcie fe150000.pcie: Missing *config* reg space
[    3.126954] rk-pcie fe150000.pcie: host bridge /pcie@fe150000 ranges:
[    3.126965] rk-pcie fe150000.pcie:      err 0x00f0000000..0x00f00fffff ->
0x00f0000000
[    3.126972] rk-pcie fe150000.pcie:       IO 0x00f0100000..0x00f01fffff ->
0x00f0100000
[    3.126979] rk-pcie fe150000.pcie:      MEM 0x00f0200000..0x00f0ffffff ->
0x00f0200000
[    3.126984] rk-pcie fe150000.pcie:      MEM 0x0900000000..0x090fffffff ->
0x0900000000
[    3.127007] rk-pcie fe150000.pcie: Missing *config* reg space
[    3.127028] rk-pcie fe150000.pcie: invalid resource
[    3.387304] rk-pcie fe150000.pcie: PCIe Link up, LTSSM is 0x0

If the link is truly successful, logs similar to the following should be
visible, with "PCIe Link up" printout and LTSSM state machine's bit16 and bit17
equal to 0x3, and values from bit0 to bit8 greater than or equal to 0x11
[    2.410536] rk-pcie 3c0000000.pcie: PCIe Link up, LTSSM is 0x130011
```

Causes of exception: Training failure, peripheral not in working state or signal anomaly. First, check if the low-speed IO are configured correctly:

- PERSTN: corresponds to the `reset-gpios` property in DTS, level should toggle between high and low
- CLKREQN: not used by default; level is normally low
- WAKEN: not used by default; level is normally high

Secondly, inspect the following hardware signal quality (default enumeration lasts only 2 seconds; enumeration timeout will disable the controller. If you need to extend the enumeration time, add the `rockchip,wait-for-link-ms = <10000>` property in the DTS node to facilitate signal measurement):

- Whether the peripheral's 3V3 power supply is provided
- Whether the power supply capacity is sufficient, especially for FPGA/compute cards and other peripherals with high power requirements; some peripherals also require 12V power supply
- Whether the power quality is good and whether there is any abnormal noise in the power supply
- Whether the reset signal and power timing conflict with the spec of the device

If none of these solutions work, it is likely necessary to locate signal integrity issues, requiring the testing of eye diagrams and PCBs to be provided to our company's hardware, and it is best if we suggest that your company obtains a test TX/RX compatibility signal test report from a laboratory.

Additionally, it is recommended that customers enable RK_PCIE_DBG in pcie-dw-rockchip.c to capture a log for analysis. Readers should note that if multiple controllers are used simultaneously, please disable the controllers corresponding to devices that are not used or have no issues before capturing the log, as this will make the log easier to analyze. The captured log will contain information similar to "rk-pcie 3c0000000.pcie: fifo_status = 0x144001". The last two digits of fifo_status are the PCIe link's LTSSM state machine, which can be used to determine the approximate situation of the anomaly. The chip's PCIe LTSSM state machine information can be referred to in the appendix at the end of the document.

2.1.3 PCIe3.0 Controller Initialization Device System Exception

```
[   21.523506] rcu: INFO: rcu_preempt detected stalls on CPUs/tasks:
[   21.523557] rcu:     1-...0: (0 ticks this GP) idle=652/1/0x4000000000000000
softirq=30/30 fqs=2097
[   21.523579] rcu:     3-...0: (5 ticks this GP) idle=4fa/1/0x4000000000000000
softirq=35/36 fqs=2097
[   21.523590] rcu:     (detected by 2, t=6302 jiffies, g=-1151, q=98)
[   21.523610] Task dump for CPU 1:
[   21.523622] rk-pcie         R  running task        0    55      2 0x0000002a
[   21.523640] Call trace:
[   21.523666]  __switch_to+0xe0/0x128
[   21.523682]  0x43752cfcfe820900
[   21.523694] Task dump for CPU 3:
[   21.523704] kworker/u8:0    R  running task        0     7      2 0x0000002a
[   21.523737] Workqueue: events_unbound enable_ptr_key_workfn
[   21.523751] Call trace:
[   21.523767]  __switch_to+0xe0/0x128
[   21.523786]  event_xdp_redirect+0x8/0x90
[   21.523816] rcu: INFO: rcu_sched detected stalls on CPUs/tasks:
[   21.523840] rcu:     1-...0: (50 ticks this GP) idle=652/1/0x4000000000000000
softirq=7/30 fqs=2099
[   21.523859] rcu:     3-...0: (55 ticks this GP) idle=4fa/1/0x4000000000000000
softirq=5/36 fqs=2099
[   21.523870] rcu:     (detected by 2, t=6302 jiffies, g=-1183, q=1)
[   21.523887] Task dump for CPU 1:
```

```
[   21.523898] rk-pcie         R  running task        0    55      2 0x0000002a
[   21.523915] Call trace:
[   21.523931]  __switch_to+0xe0/0x128
[   21.523944]  0x43752cfcfe820900
[   21.523955] Task dump for CPU 3:
[   21.523965] kworker/u8:0    R  running task        0     7      2 0x0000002a
[   21.523990] Workqueue: events_unbound enable_ptr_key_workfn
[   21.524004] Call trace:
```

Exception Cause: If the system is stuck near this log, it indicates that the PHY of PCIe3.0 is working abnormally. Please check in sequence:

- Whether the clock input of the external crystal chip is abnormal. If there is no clock or the amplitude is abnormal, it will cause the phy to fail to lock.
- Check whether the voltages of PCIE30_AVDD_0V9 and PCIE30_AVDD_1V8 meet the requirements.
- Check if there are any low-speed IO configurations for PCIe in the board-level DTS. If there are, please remove them and test again; and refer to the 'Low-Speed IO Instructions' section to understand the specific usage of these IOs.
- For RK3588 pcie30phy, if only one port is used, the other port also needs power supply. Check if it meets the requirements.

2.1.4 PCIe2.0 Controller Initialization Device System Exception

```
[   21.523870] rcu:     (detected by 2, t=6302 jiffies, g=-1183, q=1)
[   21.523887] Task dump for CPU 1:
[   21.523898] rk-pcie         R  running task        0    55      2 0x0000002a
[   21.523915] Call trace:
[   21.523931]  __switch_to+0xe0/0x128
[   21.523944]  0x43752cfcfe820900
[   21.523955] Task dump for CPU 3:
[   21.523965] kworker/u8:0    R  running task        0     7      2 0x0000002a
[   21.523990] Workqueue: events_unbound enable_ptr_key_workfn
[   21.524004] Call trace:
```

Exception Cause: If the system hangs near this log, it indicates that the PHY of PCIe2.0 is working abnormally. Taking the combphy2_psq PHY of RK3568 as an example, please check in the following order:

- Check if the voltages of PCIE30_AVDD_0V9 and PCIE30_AVDD_1V8 meet the requirements.
- Check if there is any configuration for PCIe low-speed IO in the board-level DTS, if so, delete it and test again; and refer to the 'Low-Speed IO Instructions' section to understand the specific usage of these IOs.
- Modify the combphy2_psq driver phy-rockchip-naneng-combphy.c, add the following code at the end of the rockchip_combphy_init function to check some internal configurations of the PHY:

```
val = readl(priv->mmio + (0x27 << 2));
dev_err(priv->dev, "TXPLL_LOCK is 0x%x PWON_PLL is 0x%x\n",
val & BIT(0), val & BIT(1));
val = readl(priv->mmio + (0x28 << 2));
dev_err(priv->dev, "PWON_IREF is 0x%x\n", val & BIT(7));
```

First, check if TXPLL_LOCK is 1, if not, it indicates that the PHY has not completed locking. Secondly, check if PWON_IREF is 1, if not, it indicates that the PHY clock is abnormal. At this time, try switching the combophy clock frequency, modify the assigned-clock-rates of combphy2_psq in rk3568.dtsi, and adjust it to 25M or 100M in turn for testing.

- If the above steps are ineffective, bypass the PHY internal clock to the refclk differential signal pin for measurement. The bypass is added at the end of the rockchip_combphy_pcie_init function, and the following code is set according to the different chips:

```
/* For RK356X, RK3588 */
u32 val;
val = readl(priv->mmio + (0xd << 2));
val |= BIT(5);
writel(val,priv->mmio + (0xd << 2));

/* For RK3528 */
u32 val;
val = readl(priv->mmio + 0x108);
val |= BIT(29);
writel(val, priv->mmio + 0x108);
```

After setting, please configure the combphy2_psq clock frequency to 24M, 25M, and 100M in turn, and use an oscilloscope to measure the clock situation from the PCIe refclk differential signal pin, checking whether the frequency, amplitude, and jitter meet the requirements.

Special Attention: Since the PCIe 2.0 interface is multiplexed with the SATA or USB interface, if both are incorrectly enabled at the same time, similar logs will also appear during the boot process or the sleep wake-up process:

```
naneng-combphy 2b060000.phy: phy type select 2 overwriting type 4
rk-pcie 2a210000.pcie: PHY is reused by other controller, check the dts
```

2.2 Devices enumeration and usage issues

2.2.1 PCIe Peripheral Memory BAR Resource Allocation Anomalies

Peripheral memory resource allocation anomalies are mainly divided into three categories:

- **Address space exceeds platform limitations**. The size of the address space for each platform can be consulted in the "Common Application Issues" section under "How large is the BAR space address domain supported by the chip". The typical log for this kind of anomaly is shown below, with the characteristic keyword `no space for`, indicating that the peripheral on bus 21 requests 3GB of 64-bit memory space from the RK platform, exceeding the limit and resulting in the inability to allocate resources. If it is a commercial device, it will not be supported by the RK chip; if it is a custom device, please contact the device vendor to confirm whether the BAR space capacity encoding can be modified.

```
3.286864] pci 0002:20:00.0: bridge configuration invalid ([bus 01-ff]),
reconfiguring
3.286886] scanning [bus 00-00] behind bridge, pass 1
3.288165] pci 0002:21 :00.0: supports D1 D2
3.288170] pci 0002:21 :00.0: PME# supported from DO D1 D3hot
3.298238] pci bus 0002:21: busn res: [bus 21-2f] end is updated to 21
3.298441] pci 0002:21:00.0: BAR 1: no space for [mem size 0xe0000000 ]
3.298456] pci 0002:21:00.0: BAR 1: failed to assign [mem size 0xe0000000 ]
3.298473] pci 0002:21:00.0: BAR 2: assigned [mem 0x380900000- 0x38090ffff pref ]
3.298488] pci 0002:21:00.0: PCI bridge to [bus 21]
```

- **Illegal class type**. Its characteristic keyword is `class 0x000000`, and the lspci output shows that all its BAR resources are in an unassigned state. The correct approach to this issue is to contact the module supplier and correctly configure the class type of the module. If it cannot be modified or as a temporary solution, you can refer to the patch shown to try to software repair the class type of the module, you need to fill in the VID and PID of this exception module, and the class repair for its real type (please refer to the "Common Application Issues" section under "How to determine the correspondence between controllers and devices in the system" for the description of class types for configuration).

```
[    2.335899] pci 0000:02:04.0: [13fe:1730] type 00 class 0x000000
[    2.335986] pci 0000:02:04.0: reg 0x10: [io  0x0000-0x00ff]
[    2.336023] pci 0000:02:04.0: reg 0x14: [mem 0x00000000-0x0000007f]
[    2.336058] pci 0000:02:04.0: reg 0x18: [mem 0x00000000-0x000000ff]
[    2.342340] pci_bus 0000:02: busn_res: [bus 02-ff] end is updated to 02
[    2.342444] pci 0000:00:00.0: BAR 8: assigned [mem 0xf4200000-0xf42fffff]
[    2.342484] pci 0000:00:00.0: BAR 6: assigned [mem 0xf4300000-0xf430ffff
pref]
[    2.342496] pci 0000:00:00.0: BAR 7: assigned [io  0x1000-0x1fff]
[    2.342510] pci 0000:01:00.0: BAR 8: assigned [mem 0xf4200000-0xf42fffff]
[    2.342519] pci 0000:01:00.0: BAR 7: assigned [io  0x1000-0x1fff]
[    2.342529] pci 0000:01:00.0: PCI bridge to [bus 02]
[    2.342546] pci 0000:01:00.0:   bridge window [io  0x1000-0x1fff]
[    2.342572] pci 0000:01:00.0:   bridge window [mem 0xf4200000-0xf42fffff]
[    2.342616] pci 0000:00:00.0: PCI bridge to [bus 01-ff]
[    2.342631] pci 0000:00:00.0:   bridge window [io  0x1000-0x1fff]
[    2.342645] pci 0000:00:00.0:   bridge window [mem 0xf4200000-0xf42fffff]
[    2.344896] pcieport 0000:00:00.0: Signaling PME with IRQ 87

lspci -vvv:

0000: 02:04.0 Non-VGA unclassified device: Advantech Co. Ltd Device 1730
Subsystem: Advantech Co. Ltd Device 1730
Flags: medium devsel, IRQ 255
I/O ports at[<unassigned> _disabled] [size=256]
Memory at <unassigned> (32-bit, non-prefetchabie) [disabled] [size=128]
Memory at <unassigned> (32-bit, non-prefetchable) [disabled] [size=256]
```

```
--- a/drivers/pci/quirks.c
+++ b/drivers/pci/quirks.c
@@ -207,6 +207,13 @@ static void quirk_mmio_always_on(struct pci_dev *dev)
 DECLARE_PCI_FIXUP_CLASS_EARLY(PCI_ANY_ID, PCI_ANY_ID,
                               PCI_CLASS_BRIDGE_HOST, 8, quirk_mmio_always_on);

+static void quirk_class_id_fixup(struct pci_dev *dev)
+{
+       dev->class = 0x123456; /* Fixup your own class id ! */
+}
+
+DECLARE_PCI_FIXUP_CLASS_EARLY(PCI_VENDOR_ID_FOO, PCI_DEVICE_ID_BAR, 8,
quirk_class_id_fixup); /* Please Add Correct Vendor ID and Device ID ! */
```

- **Peripheral BAR register check anomalies**. Its characteristic keywords are `assigned [mem` and `error updating`, and the lspci output shows that all its BAR resources are in an unassigned state. The reason for this problem is that the peripheral is in an abnormal working state, causing the BAR address to be written to the peripheral and then read back and checked, which fails. The possible factors are abnormal low

power consumption support, or the peripheral may have problems with non-Gen1 RC support, or other types of module work anomalies.

```
[    2.460092] pci 0002:21:00.0: calc_l1ss_pwron: Invalid T_PwrOn scale: 3
[    2.472049] pci_bus 0002:21: busn_res: [bus 21-2f] end is updated to 21
[    2.472089] pci 0002:20:00.0: BAR 8: assigned [mem 0xf2200000-0xf23fffff]
[    2.472105] pci 0002:20:00.0: BAR 6: assigned [mem 0xf2400000-0xf240ffff
pref]
[    2.472124] pci 0002:21:00.0: BAR 0: assigned [mem 0xf2200000-0xf23fffff
64bit]
[    2.472139] pci 0002:21:00.0: BAR 0: error updating (0xf2200004 !=
0xffffffff)
[    2.472153] pci 0002:21:00.0: BAR 0: error updating (high 0x000000 !=
0xffffffff)
```

For such issues, first measure whether the control timing of the module power supply, #PERST reset signal, and 100M reference clock meet the requirements of the module manual. For example, if the QCNFA765 module uses a constant power supply method, it causes timing anomalies and leads to module work anomalies, resulting in this problem. If the hardware peripheral design and interface timing all meet the requirements of the module manual, then try the following patches in order. If it is still ineffective, contact the supplier to assist in analyzing the reasons for the module anomalies.

1. Disable the ASPM function of this module, where PID and VID need to fill in the real ID of the device.

```
--- a/drivers/pci/quirks.c
+++ b/drivers/pci/quirks.c
@ -2356,6 +2356,7 @ static void quirk_disable_aspm_l0s_l1(struct pci_dev *dev) *
disable both L0s and L1 for now to be safe.
*/
DECLARE_PCI_FIXUP_FINAL(PCI_VENDOR_ID_ASMEDIA, 0x1080,
quirk_disable_aspm_l0s_l1);
+DECLARE_PCI_FIXUP_FINAL(VID, PID, quirk_disable_aspm_l0s_l1);  /* Please Add
Correct Vendor ID and Device ID to disable L0s and L1 ASPM */
```

2. Limit the corresponding control mode to Gen1, and modify the max-link-speed of the corresponding node in dtsi, as shown in the following example:

```
--- a/arch/arm64/boot/dts/rockchip/rk3588s.dtsi
+++ b/arch/arm64/boot/dts/rockchip/rk3588s.dtsi
@@ -4552,7 +4552,7 @@
        num-ib-windows = <8>;
        num-ob-windows = <8>;
        num-viewport = <4>;
-       max-link-speed = <2>;
+       max-link-speed = <1>;
        msi-map = <0x4000 &its0 0x4000 0x1000>;
                num-lanes = <1>;
                phys = <&combphy0_ps PHY_TYPE_PCIE>;
```

3. Increase the peripheral power supply stability time and #PERST reset time, as shown in the following example:

```
--- a/arch/arm64/boot/dts/rockchip/rk3588-evb1-lp4.dtsi
+++ b/arch/arm64/boot/dts/rockchip/rk3588-evb1-lp4.dtsi
@@ -159,7 +159,7 @@
```

```
                regulator-max-microvolt = <3300000>;
                enable-active-high;
                gpios = <&gpio3 RK_PC3 GPIO_ACTIVE_HIGH>;
-               startup-delay-us = <5000>;
+               startup-delay-us = <500000>;
                vin-supply = <&vcc12v_dcin>;
        }; /* vcc3v3_pcie30 */

@@ -551,6 +551,7 @@
 &pcie3x4 {
        reset-gpios = <&gpio4 RK_PB6 GPIO_ACTIVE_HIGH>;
        vpcie3v3-supply = <&vcc3v3_pcie30>;
+       rockchip,perst-inactive-ms = <1000>;
        status = "okay";
 };
```

4. It is known that some series of Qualcomm WiFi modules have anomalies, including the affected module packages AR9xxx series and QCA9xxx series. Non-Qualcomm series modules do not need this patch.

```
--- a/drivers/pci/pcie/aspm.c
+++ b/drivers/pci/pcie/aspm.c
@@ -192,12 +192,56 @@ static void pcie_clkpm_cap_init(struct pcie_link_state
*link, int blacklist)
    link->clkpm_disable = blacklist ? 1 : 0;
 }

+static int pcie_downgrade_link_to_gen1(struct pci_dev *parent)
+{
+   u16 reg16;
+   u32 reg32;
+   int ret;
+
+   /* Check if link is capable of higher speed than 2.5 GT/s */
+   pcie_capability_read_dword(parent, PCI_EXP_LNKCAP, &reg32);
+   if ((reg32 & PCI_EXP_LNKCAP_SLS) <= PCI_EXP_LNKCAP_SLS_2_5GB)
+       return 0;
+
+   /* Check if link speed can be downgraded to 2.5 GT/s */
+   pcie_capability_read_dword(parent, PCI_EXP_LNKCAP2, &reg32);
+   if (!(reg32 & PCI_EXP_LNKCAP2_SLS_2_5GB)) {
+       pci_err(parent, "ASPM: Bridge does not support changing Link Speed to
2.5 GT/s\n");
+       return -EOPNOTSUPP;
+   }
+
+   /* Force link speed to 2.5 GT/s */
+   ret = pcie_capability_clear_and_set_word(parent, PCI_EXP_LNKCTL2,
+                         PCI_EXP_LNKCTL2_TLS,
+                         PCI_EXP_LNKCTL2_TLS_2_5GT);
+   if (!ret) {
+       /* Verify that new value was really set */
+       pcie_capability_read_word(parent, PCI_EXP_LNKCTL2, &reg16);
+       if ((reg16 & PCI_EXP_LNKCTL2_TLS) != PCI_EXP_LNKCTL2_TLS_2_5GT)
+           ret = -EINVAL;
+   }
+
+   if (ret) {
```

```
+       pci_err(parent, "ASPM: Changing Target Link Speed to 2.5 GT/s failed:
%d\n", ret);
+       return ret;
+   }
+
+   pci_info(parent, "ASPM: Target Link Speed changed to 2.5 GT/s due to
quirk\n");
+   return 0;
+}
+
 static bool pcie_retrain_link(struct pcie_link_state *link)
 {
    struct pci_dev *parent = link->pdev;
    unsigned long end_jiffies;
    u16 reg16;

+   if ((link->downstream->dev_flags &
PCI_DEV_FLAGS_NO_RETRAIN_LINK_WHEN_NOT_GEN1) &&
+       pcie_downgrade_link_to_gen1(parent)) {
+       pci_err(parent, "ASPM: Retrain Link at higher speed is disallowed by
quirk\n");
+       return false;
+   }
+
    pcie_capability_read_word(parent, PCI_EXP_LNKCTL, &reg16);
    reg16 |= PCI_EXP_LNKCTL_RL;
    pcie_capability_write_word(parent, PCI_EXP_LNKCTL, reg16);
diff --git a/drivers/pci/quirks.c b/drivers/pci/quirks.c
index 653660e3ba9e..4999ad9d08b8 100644
--- a/drivers/pci/quirks.c
+++ b/drivers/pci/quirks.c
@@ -3553,23 +3553,46 @@ static void mellanox_check_broken_intx_masking(struct
pci_dev *pdev)
 DECLARE_PCI_FIXUP_FINAL(PCI_VENDOR_ID_MELLANOX, PCI_ANY_ID,
            mellanox_check_broken_intx_masking);

-static void quirk_no_bus_reset(struct pci_dev *dev)
+static void quirk_no_bus_reset_and_no_retrain_link(struct pci_dev *dev)
 {
-   dev->dev_flags |= PCI_DEV_FLAGS_NO_BUS_RESET;
+   dev->dev_flags |= PCI_DEV_FLAGS_NO_BUS_RESET |
+             PCI_DEV_FLAGS_NO_RETRAIN_LINK_WHEN_NOT_GEN1;
 }

 /*
- * Some Atheros AR9xxx and QCA988x chips do not behave after a bus reset.
+ * Atheros AR9xxx and QCA9xxx chips do not behave after a bus reset and also
+ * after retrain link when PCIe bridge is not in GEN1 mode at 2.5 GT/s speed.
  * The device will throw a Link Down error on AER-capable systems and
  * regardless of AER, config space of the device is never accessible again
  * and typically causes the system to hang or reset when access is attempted.
+ * Or if config space is accessible again then it contains only dummy values
+ * like fixed PCI device ID 0xABCD or values not initialized at all.
+ * Retrain link can be called only when using GEN1 PCIe bridge or when
+ * PCIe bridge has forced link speed to 2.5 GT/s via PCI_EXP_LNKCTL2 register.
+ * To reset these cards it is required to do PCIe Warm Reset via PERST# pin.
  * https://lore.kernel.org/r/20140923210318.498dacbd@dualc.maya.org/
+ * https://lore.kernel.org/r/87h7l8axqp.fsf@toke.dk/
```

```
+ * https://www.mail-archive.com/ath9k-devel@lists.ath9k.org/msg07529.html
  */
-DECLARE_PCI_FIXUP_HEADER(PCI_VENDOR_ID_ATHEROS, 0x0030, quirk_no_bus_reset);
-DECLARE_PCI_FIXUP_HEADER(PCI_VENDOR_ID_ATHEROS, 0x0032, quirk_no_bus_reset);
-DECLARE_PCI_FIXUP_HEADER(PCI_VENDOR_ID_ATHEROS, 0x003c, quirk_no_bus_reset);
-DECLARE_PCI_FIXUP_HEADER(PCI_VENDOR_ID_ATHEROS, 0x0033, quirk_no_bus_reset);
-DECLARE_PCI_FIXUP_HEADER(PCI_VENDOR_ID_ATHEROS, 0x0034, quirk_no_bus_reset);
+DECLARE_PCI_FIXUP_HEADER(PCI_VENDOR_ID_ATHEROS, 0x002e,
+            quirk_no_bus_reset_and_no_retrain_link);
+DECLARE_PCI_FIXUP_HEADER(PCI_VENDOR_ID_ATHEROS, 0x0030,
+            quirk_no_bus_reset_and_no_retrain_link);
+DECLARE_PCI_FIXUP_HEADER(PCI_VENDOR_ID_ATHEROS, 0x0032,
+            quirk_no_bus_reset_and_no_retrain_link);
+DECLARE_PCI_FIXUP_HEADER(PCI_VENDOR_ID_ATHEROS, 0x0033,
+            quirk_no_bus_reset_and_no_retrain_link);
+DECLARE_PCI_FIXUP_HEADER(PCI_VENDOR_ID_ATHEROS, 0x0034,
+            quirk_no_bus_reset_and_no_retrain_link);
+DECLARE_PCI_FIXUP_HEADER(PCI_VENDOR_ID_ATHEROS, 0x003c,
+            quirk_no_bus_reset_and_no_retrain_link);
+DECLARE_PCI_FIXUP_HEADER(PCI_VENDOR_ID_ATHEROS, 0x0042,
+            quirk_no_bus_reset_and_no_retrain_link);
+
+static void quirk_no_bus_reset(struct pci_dev *dev)
+{
+   dev->dev_flags |= PCI_DEV_FLAGS_NO_BUS_RESET;
+}

 /*
  * Root port on some Cavium CN8xxx chips do not successfully complete a bus
diff --git a/include/linux/pci.h b/include/linux/pci.h
index 86c799c97b77..fdbf7254e4ab 100644
--- a/include/linux/pci.h
+++ b/include/linux/pci.h
@@ -227,6 +227,8 @@ enum pci_dev_flags {
    PCI_DEV_FLAGS_NO_FLR_RESET = (__force pci_dev_flags_t) (1 << 10),
    /* Don't use Relaxed Ordering for TLPs directed at this device */
    PCI_DEV_FLAGS_NO_RELAXED_ORDERING = (__force pci_dev_flags_t) (1 << 11),
    /* Device does honor MSI masking despite saying otherwise */
    PCI_DEV_FLAGS_HAS_MSI_MASKING = (__force pci_dev_flags_t) (1 << 12),
+   /* Don't Retrain Link for device when bridge is not in GEN1 mode */
+   PCI_DEV_FLAGS_NO_RETRAIN_LINK_WHEN_NOT_GEN1 = (__force pci_dev_flags_t) (1
<< 13),
 };
```

- **The invalid port of the switch occupies some resources**. Taking RK3588 as an example, each root port of it can only allocate 16MB of 32-bit BAR space. Some switches, such as ASM2812, will apply for 2MB of 32-bit BAR space as shown in the log below, regardless of whether there are devices downstream of the port. According to the lspci results, there are no devices under ports 2/3/a/b of the switch under bus 12, but they occupy an additional total of 8MB of 32-bit BAR space, resulting in insufficient 32-bit BAR resources for normal devices.

```
[   22.005666] pci 0001:12:00.0: BAR 8: no space for [mem size 0x00600000]
[   22.040400] pci 0001:12:00.0: BAR 8: failed to assign [mem size 0x00600000]
[   22.040402] pci 0001:12:08.0: BAR 8: no space for [mem size 0x00600000]
[   22.040406] pci 0001:12:08.0: BAR 8: failed to assign [mem size 0x00600000]
```

```
[   22.067370] pci 0001:12:00.0: BAR 9: assigned [mem 0x940000000-0x9401fffff
64bit pref]
[   22.067373] pci 0001:12:02.0: BAR 8: no space for [mem size 0x00200000]
[   22.080018] pci 0001:12:02.0: BAR 8: failed to assign [mem size 0x00200000]
[   22.080022] pci 0001:12:02.0: BAR 9: assigned [mem 0x940200000-0x9403fffff
64bit pref]
[   22.093658] pci 0001:12:03.0: BAR 8: no space for [mem size 0x00200000]
[   22.093661] pci 0001:12:03.0: BAR 8: failed to assign [mem size 0x00200000]
[   22.093663] pci 0001:12:03.0: BAR 9: assigned [mem 0x940400000-0x9405fffff
64bit pref]
[   22.106310] pci 0001:12:08.0: BAR 9: assigned [mem 0x940600000-0x9407fffff
64bit pref]
[   22.106313] pci 0001:12:0a.0: BAR 8: no space for [mem size 0x00200000]
[   22.120756] pci 0001:12:0a.0: BAR 8: failed to assign [mem size 0x00200000]
[   22.130702] pci 0001:12:0a.0: BAR 9: assigned [mem 0x940800000-0x9409fffff
64bit pref]
[   22.130705] pci 0001:12:0b.0: BAR 8: no space for [mem size 0x00200000]
[   22.144573] pci 0001:12:0b.0: BAR 8: failed to assign [mem size 0x00200000]

lspci -vvt
-+-[0003:30]---00.0-[31]----00.0  Realtek Semiconductor Co., Ltd. Device
[10ec:8125]
 +-[0001:10]---00.0-[11-18]----00.0-[12-18]--+-00.0-[13]----00.0  Aquantia Corp.
Device
 |                                          +-02.0-[14]--
 |                                          +-03.0-[15]--
 |                                          +-08.0-[16]----00.0  Aquantia Corp.
Device
 |                                          +-0a.0-[17]--
 |                                          \-0b.0-[18]--
 \-[0000:00]---00.0-[01-ff]----00.0  ASMedia Technology Inc. Device [1b21:1164]

lspci -nn
0000:00:00.0 PCI bridge [0604]: Fuzhou Rockchip Electronics Co., Ltd Device
[1d87:3588] (rev 01)
0000:01:00.0 SATA controller [0106]: ASMedia Technology Inc. Device [1b21:1164]
(rev 02)
0001:10:00.0 PCI bridge [0604]: Fuzhou Rockchip Electronics Co., Ltd Device
[1d87:3588] (rev 01)
0001:11:00.0 PCI bridge [0604]: ASMedia Technology Inc. Device [1b21:2812] (rev
01)
0001:12:00.0 PCI bridge [0604]: ASMedia Technology Inc. Device [1b21:2812] (rev
01)
0001:12:02.0 PCI bridge [0604]: ASMedia Technology Inc. Device [1b21:2812] (rev
01)
0001:12:03.0 PCI bridge [0604]: ASMedia Technology Inc. Device [1b21:2812] (rev
01)
0001:12:08.0 PCI bridge [0604]: ASMedia Technology Inc. Device [1b21:2812] (rev
01)
0001:12:0a.0 PCI bridge [0604]: ASMedia Technology Inc. Device [1b21:2812] (rev
01)
0001:12:0b.0 PCI bridge [0604]: ASMedia Technology Inc. Device [1b21:2812] (rev
01)
0001:13:00.0 Ethernet controller [0200]: Aquantia Corp. Device [1d6a:14c0] (rev
03)
0001:16:00.0 Ethernet controller [0200]: Aquantia Corp. Device [1d6a:14c0] (rev
03)
```

```
0003:30:00.0 PCI bridge [0604]: Fuzhou Rockchip Electronics Co., Ltd Device
[1d87:3588] (rev 01)
0003:31:00.0 Ethernet controller [0200]: Realtek Semiconductor Co., Ltd. Device
[10ec:8125] (rev 05)
```

To deal with such issues, it is recommended to negotiate with the switch manufacturer to see if the switch's firmware configuration can be modified to close the BAR space of the ports without downstream devices. If the switch's firmware cannot be closed, and the product's topology is relatively fixed (i.e., there is no random insertion of devices in each slot of the switch), you can try the following patches for filtering:

```
diff --git a/drivers/pci/probe.c b/drivers/pci/probe.c
index ece90a2..53bef6b 100644
--- a/drivers/pci/probe.c
+++ b/drivers/pci/probe.c
@@ -2794,6 +2794,37 @@ void __weak pcibios_fixup_bus(struct pci_bus *bus)
        /* nothing to do, expected to be removed in the future */
 }

+struct scan_blacklist_devfn {
+       u8 bus; /* bus number */
+       u8 dev; /* device number */
+       u8 func; /* function number */
+};
+
+#define ANY 0xff
+
+/* Please fill in the actual devices to be filtered in the sbl table, taking
the above log as an example, filtering ports 2/3/a/b of bus12 */
+static struct scan_blacklist_devfn sbl[] = {
+       {12, 0x2, ANY},
+       {12, 0x3, ANY},
+       {12, 0xa, ANY},
+       {12, 0xb, ANY},
+};
+
+static bool pci_scan_check_blacklist(u8 bus, unsigned int devfn)
+{
+       int i;
+
+       for (i = 0; i < ARRAY_SIZE(sbl); i++) {
+               if (bus == sbl[i].bus && PCI_SLOT(devfn) == sbl[i].dev) {
+                       if (sbl[i].func == ANY)
+                               return true;
+                       else
+                               return sbl[i].func == PCI_FUNC(devfn);
+               }
+       }
+
+       return false;
+}
+
 /**
  * pci_scan_child_bus_extend() - Scan devices below a bus
  * @bus: Bus to scan for devices
@@ -2819,6 +2850,9 @@ static unsigned int pci_scan_child_bus_extend(struct
pci_bus *bus,
```

```
        /* Go find them, Rover! */
        for (devfn = 0; devfn < 256; devfn += 8) {
+               if (pci_scan_check_blacklist(bus->number, devfn))
+                       continue;
+
                nr_devs = pci_scan_slot(bus, devfn);
```

2.2.2 PCIe Peripheral IO BAR Resource Allocation Anomaly

During enumeration, the following IO BAR address space write anomalies occur, and similar error logs are reported, with characteristic keywords such as `assigned [io` and `error updating`, or `firmware Bug`. It is recommended to check the device manual for restrictions on the IO BAR address space:

```
dmesg | grep "0002:22"
[    2.324600] pci_bus 0002:22: extended config space not accessible
[    2.324764] pci 0002:22:00.0: [13f6:0111] type 00 class 0x040100
[    2.324873] pci 0002:22:00.0: [Firmware Bug]: reg 0x10: invalid BAR (can't
size)
[    2.325445] pci 0002:22:00.0: supports D1 D2
[    2.331041] pci_bus 0002:22: busn_res: [bus 22-2f] end is updated to 22
```

or:

```
console:/ $ dmesg | grep "0002:22"
[    2.434085] [  T117] pci_bus 0002:22: extended config space not accessible
[    2.434629] [  T117] pci 0002:22:00.0: [13f6:0111] type 00 class 0x040100
[    2.434842] [  T117] pci 0002:22:00.0: reg 0x10: initial BAR value 0x0000d000
invalid
[    2.434869] [  T117] pci 0002:22:00.0: reg 0x10: [io  size 0x0100]
[    2.435536] [  T117] pci 0002:22:00.0: supports D1 D2
[    2.458229] [  T117] pci_bus 0002:22: busn_res: [bus 22-2f] end is updated to
22
[    2.458542] [  T117] pci 0002:22:00.0: BAR 0: assigned [io  0x1000-0x10ff]
[    2.458581] [  T117] pci 0002:22:00.0: BAR 0: error updating (0x80801001 !=
0x001001)
[    2.463002] [  T117] snd_cmipci 0002:22:00.0: enabling device (0080 -> 0081)
```

Comments:

- The above logs are abnormal prints when using the PCI sound card CMI8738. The native design of PCI is aimed at the X86 architecture, so the length of the IO BAR address is usually small. The CMI8738 sound card IO BAR0 address is limited to within 0xFF00, so the following patch can be referenced:

```
diff --git a/arch/arm64/boot/dts/rockchip/rk3568.dtsi
b/arch/arm64/boot/dts/rockchip/rk3568.dtsi
index 9dc057637177..a060dcbf7df5 100644
--- a/arch/arm64/boot/dts/rockchip/rk3568.dtsi
+++ b/arch/arm64/boot/dts/rockchip/rk3568.dtsi
@@ -2311,7 +2311,7 @@
                phy-names = "pcie-phy";
                power-domains = <&power RK3568_PD_PIPE>;
                ranges = <0x00000800 0x0 0x80000000 0x3 0x80000000 0x0 0x800000
-                         0x81000000 0x0 0x80800000 0x3 0x80800000 0x0 0x100000
+                         0x81000000 0x0 0x00000000 0x3 0x80800000 0x0 0x100000
                          0x83000000 0x0 0x80900000 0x3 0x80900000 0x0
0x3f700000>;
                reg = <0x3 0xc0800000 0x0 0x400000>,
                      <0x0 0xfe280000 0x0 0x10000>;
```

2.2.3 Error Reporting During Peripheral Enumeration and Communication

Below is the log of an NVMe device on RK3566-EVB2 that encountered a sudden device error during communication after normal enumeration. Regardless of the device, if it can be normally enumerated and enabled, you can see logs similar to `nvme 0000:01:00.0: enabling device (0000 -> 0002)`. After this, if the device reports an error during communication, consider the following three aspects:

- Use an oscilloscope to measure the power supply of the triggered peripheral to rule out any voltage drops.
- Use an oscilloscope to measure the #PERST signal of the triggered peripheral to rule out any device resets due to misoperation.
- Use an oscilloscope to measure the 0v9 and 1v8 power supplies of the triggered PCIe PHY to rule out any PHY power supply abnormalities.

Special reminder: RK EVB has a lot of signal multiplexing, use jumpers to multiplex the PCIe #PERST control signal with other peripheral IOs, please confirm with hardware. For example, it is known that some RK3566-EVB2 jumpers are abnormal and need to be corrected.

```
[    2.426038] pci 0000:00:00.0:   bridge window [mem 0x300900000-0x3009fffff]
[    2.426183] pcieport 0000:00:00.0: of_irq_parse_pci: failed with rc=-22
[    2.427493] pcieport 0000:00:00.0: Signaling PME with IRQ 106
[    2.427712] pcieport 0000:00:00.0: AER enabled with IRQ 115
[    2.427899] pcieport 0000:00:00.0: of_irq_parse_pci: failed with rc=-22
[    2.428202] nvme nvme0: pci function 0000:01:00.0
[    2.428259] nvme 0000:01:00.0: enabling device (0000 -> 0002)
[    2.535404] nvme nvme0: missing or invalid SUBNQN field.
[    2.535522] nvme nvme0: Shutdown timeout set to 8 seconds
...
[   48.129408] print_req_error: I/O error, dev nvme0n1, sector 0
[   48.137197] nvme 0000:01:00.0: enabling device (0000 -> 0002)
[   48.137299] nvme nvme0: Removing after probe failure status: -19
[   48.147182] Buffer I/O error on dev nvme0n1, logical block 0, async page read
[   48.162900] nvme nvme0: failed to set APST feature (-19)
```

2.2.4 Firmware Exception During Peripheral Enumeration Process

If a device reports one of the following two types of errors during the enumeration process when allocating BAR space, it is generally due to incompatibility between the device's BAR space and the protocol, requiring special handling. It is necessary to modify the `drivers/pci/quirks.c` file to add corresponding quirk processing. Specific information should be consulted with the device manufacturer. Currently, it is known that the solution provided by the JMB585 chip is to repeatedly read the BAR space to resolve their Firmware exception. This can be done by using `echo 1 > /sys/bus/pci/rescan` to rescan the bus, which can fix the issue.

```
Type 1:
[    2.379768] rk-pcie 3c0000000.pcie: PCIe Link up, LTSSM is 0x30011
[    2.380155] rk-pcie 3c0000000.pcie: PCI host bridge to bus 0000:00
[    2.380187] pci_bus 0000:00: root bus resource [bus 00-0f]
[    2.380204] pci_bus 0000:00: root bus resource [??? 0x300000000-0x3007fffff
flags 0x0] (bus address [0x00000000-0x007fffff])
[    2.380217] pci_bus 0000:00: root bus resource [io  0x0000-0xfffff] (bus
address [0x800000-0x8fffff])
[    2.380230] pci_bus 0000:00: root bus resource [mem 0x300900000-0x33fffffff]
(bus address [0x00900000-0x3fffffff])
[    2.394983] pci 0000:01:00.0: [Firmware Bug] reg 0x10: invalid BAR (can't
size)

Type 2:
[    2.548219] pci 0000:01:00.0: [10ec:b723] type 00 class 0x028000
[    2.548389] pci 0000:01:00.0: reg 0x10: initial BAR value 0x00000000 invalid
[    2.548426] pci 0000:01:00.0: reg 0x10: [io  size 0x0100]
[    2.548549] pci 0000:01:00.0: reg 0x18: [mem 0x00000000-0x00003fff 64bit]
[    2.549132] pci 0000:01:00.0: supports D1 D2
[    2.549138] pci 0000:01:00.0: PME# supported from D0 D1 D2 D3hot D3cold
```

2.2.5 Accessing PCIe Device BAR Address Space After Remapping Causes Exceptions

1. First, if the kernel uses ioremap to map the BAR address allocated to a PCIe peripheral and then uses memset or memcpy for read and write operations, it will generate an alignment fault error. Alternatively, if mmap is used to map the BAR address allocated to a PCIe peripheral into user space and memset or memcpy is used for read and write operations, it will generate a sigbug error. The reason is that memcpy has alignment optimization issues or memset uses instructions like DC ZVA on ARM64, which do not support Device memory type (nGnRE).

```
[    69.195811] Unhandled fault: alignment fault (0x96000061) at
0xffffff8009800000
[    69.195829] Internal error: : 96000061 [#1] PREEMPT SMP
[    69.363352] Modules linked in:
[    69.363655] CPU: 0 PID: 1 Comm: swapper/0 Not tainted 4.19.172 #691
[    69.364205] Hardware name: Rockchip rk3568 evb board (DT)
[    69.364688] task: ffffffc00a300000 task.stack: ffffffc00a2dc000
[    69.365227] PC is at __memset+0x16c/0x190
[    69.365593] LR is at snda_alloc_res+0xac/0xfc
[    69.366054] pc : [<ffffff800839a2ac>] lr : [<ffffff80085055b8>] pstate:
404000c5
[    69.366713] sp : ffffffc00a2df810
```

Solution: Use memset_io or memset_fromio/memset_toio APIs instead. If user space operations are required, use loop assignment to copy or clear memory. Additionally, due to the requirements for aligned access, if your program triggers the above exceptions, it is strongly recommended to enable the configuration CONFIG_ROCKCHIP_ARM64_ALIGN_FAULT_FIX in the kernel configuration.

2. Second, for RK3588, if the BAR space assignment operation triggers the following similar exceptions, it is because the compiler optimizes consecutive access to four addresses into a 16-byte access that the platform does not support.

```
[14037.477507][    C3] SError Interrupt on CPU3, code 0xbe000011 -- SError
[14037.477512][    C3] CPU: 3 PID: 2037 Comm: memtest Not tainted 5.10.110 #1690
[14037.477514][    C3] Hardware name: Rockchip RK3588 EVB1 LP4 V10 Board (DT)
[14037.477516][    C3] pstate: 00001000 (nzcv daif -PAN -UAO -TCO BTYPE=--)
[14037.477518][    C3] pc : 0000000000405d58
[14037.477519][    C3] lr : 0000000000405fb4
[14037.477521][    C3] sp : 0000007fc48effd0
[14037.477522][    C3] x29: 0000007fc48effd0 x28: 0000000000000000
[14037.477529][    C3] x27: 0000000000452000 x26: 000000000048b000
[14037.477533][    C3] x25: 000000000048b000 x24: 0000000000000018
[14037.477537][    C3] x23: 0000000000489030 x22: 0000000000400280
[14037.477541][    C3] x21: 0000000000000000 x20: 0000000000400eb8
[14037.477545][    C3] x19: 0000000000400df0 x18: 0000000000000000
[14037.477549][    C3] x17: 0000000000417e00 x16: 0000000000489030
[14037.477554][    C3] x15: 000000000572c738 x14: 0000000000000000
[14037.477558][    C3] x13: 0000000000000150 x12: 000000000048b000
[14037.477562][    C3] x11: 0000000000000000 x10: 0000200000000000
[14037.477566][    C3] x9 : 00003fffffffffff x8 : 00000000000000de
[14037.477570][    C3] x7 : 0000000000000000 x6 : 000000000048af30
[14037.477574][    C3] x5 : 00000000f0000000 x4 : 0000000000000000
[14037.477578][    C3] x3 : 0000000000000001 x2 : 0000000000000001
[14037.477582][    C3] x1 : 0000000000489058 x0 : 0000000000000000
[14037.477587][    C3] Kernel panic - not syncing: Asynchronous SError Interrupt
[14037.477589][    C3] CPU: 3 PID: 2037 Comm: memtest Not tainted 5.10.110 #1690
[14037.477590][    C3] Hardware name: Rockchip RK3588 EVB1 LP4 V10 Board (DT)
[14037.477592][    C3] Call trace:
[14037.477593][    C3]  dump_backtrace+0x0/0x1a8
[14037.477594][    C3]  show_stack+0x18/0x28
[14037.477596][    C3]  dump_stack_lvl+0xcc/0xf4
[14037.477598][    C3]  dump_stack+0x18/0x58
[14037.477600][    C3]  panic+0x170/0x36c
[14037.477602][    C3]  nmi_panic+0x8c/0x90
[14037.477603][    C3]  arm64_serror_panic+0x78/0x84
[14037.477605][    C3]  arm64_is_fatal_ras_serror+0x34/0xc8
[14037.477607][    C3]  do_serror+0x6c/0x98
[14037.477608][    C3]  el0_error_naked+0x14/0x1c
[14037.477622][    C2] CPU2: stopping
[14037.477684][    C0] CPU0: stopping
[14037.477711][    C1] CPU1: stopping
[14037.477718][    C1] CPU: 1 PID: 0 Comm: swapper/1 Not tainted 5.10.110 #1690
[14037.477720][    C1] Hardware name: Rockchip RK3588 EVB1 LP4 V10 Board (DT)
[14037.477722][    C1] Call trace:
[14037.477729][    C1]  dump_backtrace+0x0/0x1a8
[14037.477734][    C1]  show_stack+0x18/0x28
[14037.477739][    C7] CPU7: stopping
[14037.477744][    C1]  dump_stack_lvl+0xcc/0xf4
[14037.477749][    C6] CPU6: stopping
[14037.477753][    C1]  dump_stack+0x18/0x58
```

```
[14037.477760][    C1]  local_cpu_stop+0x60/0x70
[14037.477764][    C1]  ipi_handler+0x1a4/0x310
[14037.477769][    C4] CPU4: stopping
[14037.477778][    C1]  handle_percpu_devid_fasteoi_ipi+0x7c/0x1c8
```

Assuming addr is the remapped PCIe device BAR address in your program, and your program performs a four consecutive address assignment operation on this address, please add a memory barrier barrier() at any of the code points 1, 2, or 3.

```
/* If used in user space, the following implementation of barrier is required */
# define barrier() __asm__ __volatile__("": : :"memory")

*((u32 *)((void *)addr + 0x0)) = 0x11111111;
/* Code Point 1 */
*((u32 *)((void *)addr + 0x4)) = 0x44444444;
/* Code Point 2 */
*((u32 *)((void *)addr + 0x8)) = 0x88888888;
/* Code Point 3 */
*((u32 *)((void *)addr + 0xc)) = 0xcccccccc;
```

3. For accessing all PCIe device BAR addresses, it is generally necessary to strictly adhere to two conditions:

- Prohibit non-even aligned addresses
- The accessed address must be a multiple of the access length, for example, if the length is a DWord access, the address cannot be word-aligned and must be at least DWord or QWord aligned

Also, pay attention to compiler optimizations, so if user space programs require the use of -O0 compilation optimization level to avoid optimization of read and write commands. If it is a linked library, it is also required to turn off LTO (Link-Time Optimization), which is generally to look for the `-flto` flag in the Makefile.

2.2.6 PCIe to USB Device Driver (xhci) Loading Exception

Some commercially available PCIe to USB chips, such as VL805, experience driver loading exceptions after link establishment. The main exception point is the failure to complete the waiting for the xHCI chip reset, which is likely due to the need for firmware upgrade on the conversion chip. Testing can be done on a PC platform, and if a firmware upgrade is confirmed to be necessary, contact the supplier.

```
[ 6.289987] pci 0000:01:00.0: xHCI HW not ready after 5 sec (HC bug?) status =
0x811
[ 6.531098] xhci_hcd 0000:01:00.0: xHCI Host Controller
[ 6.531803] xhci_hcd 0000:01:00.0: new USB bus registered, assigned bus number 3
[ 16.532539] xhci_hcd 0000:01:00.0: can't setup: -110
[ 16.533033] xhci_hcd 0000:01:00.0: USB bus 3 deregistered
[ 16.533712] xhci_hcd 0000:01:00.0: init 0000:01:00.0 fail, -110
[ 16.534281] xhci_hcd: probe of 0000:01:00.0 failed with error -110
```

If the issue persists, you can try the following patch for drivers/usb/host/pci-quirks.c

```
diff --git a/drivers/usb/host/pci-quirks.c b/drivers/usb/host/pci-quirks.c
index 3ea435c..cca536d 100644
--- a/drivers/usb/host/pci-quirks.c
+++ b/drivers/usb/host/pci-quirks.c
@@ -1085,8 +1085,11 @@ static void quirk_usb_early_handoff(struct pci_dev *pdev)
    /* Skip Netlogic mips SoC's internal PCI USB controller.
```

```
     * This device does not need/support EHCI/OHCI handoff
     */
-    if (pdev->vendor == 0x184e) /* vendor Netlogic */
+    if ((pdev->vendor == 0x184e) ||
+        (pdev->vendor == PCI_VENDOR_ID_VIA && pdev->device == 0x3483)) {
+        /* Taking VL805 as an example, other chips should fill in the correct
vendor ID and device ID */
+        dev_warn(&pdev->dev, "bypass xhci quirk for VL805\n");
         return;
+    }
     if (pdev->class != PCI_CLASS_SERIAL_USB_UHCI &&
             pdev->class != PCI_CLASS_SERIAL_USB_OHCI &&
             pdev->class != PCI_CLASS_SERIAL_USB_EHCI &
```

2.2.7 Inability to Access the IO Address Space Allocated to Peripherals

```
0002:21:00.0 Serial controller: Device 1c00:3853 (rev 10) (prog-if 05 [16850])
        Subsystem: Device 1c00:3853
        Control: I/O- Mem- BusMaster- SpecCycle- MemWINV- VGASnoop- ParErr-
Stepping- SERR- FastB2B- DisINTx-
        Status: Cap+ 66MHz- UDF- FastB2B- ParErr- DEVSEL=fast >TAbort- <TAbort-
<MAbort- >SERR- <PERR- INTx-
        Interrupt: pin A routed to IRQ 0
        Region 0: I/O ports at 1000 [disabled] [size=256]
        Region 1: Memory at 380900000 (32-bit, prefetchable) [disabled]
[size=32K]
        Region 2: I/O ports at 100100 [disabled] [size=4]
        [virtual] Expansion ROM at 380908000 [disabled] [size=32K]
        Capabilities: [60] Power Management version 3

0002:21:00.0 Serial Controller: device 1c00:3853 (rev 10)
00: 00 1c 53 38 00 00 10 00 10 05 00 07 00 00 00 00
10: 01 00 80 80 08 00 90 80 01 01 80 80 00 00 00 00
20: 00 00 00 00 00 00 00 00 00 00 00 00 00 1c 53 38
30: 00 00 00 00 60 00 00 00 00 00 00 00 00 01 00 00

console:/ # cat /proc/ioports
00000000-000fffff : I/O
  00001000-00001fff : PCI Bus 0002:21
    00001000-00001007 : 0002:21:00.0
    00001008-0000100f : 0002:21:00.2
    00001010-00001017 : 0002:21:00.2
```

It can be observed that lspci shows the IO port allocation address for this peripheral is 0x1000, while the corresponding PCIe bus is 0x80800000. This does not match the definition in rk3568.dtsi. Taking PCIe3x2 as an example, the defined physical starting address for the IO port is 0x380800000, which corresponds to the PCIe bus starting address of 0x80800000. Therefore, it is not possible to directly use the IO command or devmem command to access the physical address 0x1000, or software to access the address after ioremap, otherwise an exception will occur.

This situation arises due to historical reasons. In x86 PCIe, the IO port address and memory port address are separate, with the address segment below 16M being the IO port address. The PCIe IO address port used on the ARM platform is simulated by the memory port. Therefore, the PCIe protocol stack, in order to limit its address to below 16M and make it more consistent in form with the x86 platform, has made a layer of conversion when

calculating the IO port address. The principle of the conversion is to use 0x1000, aligned at 4K, as the starting address of the IO port. In other words, the IO port address 0x1000 seen in lspci corresponds to the physical address 0x380800000. Therefore, if using the IO command or devmem command, you can directly access 0x380800000. Similarly, if the allocated IO port address is 0x1010, according to this principle, the required real physical address to be accessed is 0x380800010. If you are writing your own driver and want to obtain the real IO port address for access, you can refer to the serial port drivers 8250_port.c and 8250_pci.c, using the combination of pci_ioremap_bar and request_region functions to obtain the real physical address of the IO port and the CPU address after iomap.

2.2.8 PCIe Devices Can Link but Fail to Enumerate

If a device can link up but is not enumerated, for example, lspci can see the root port's bus 0 but not the next-level bus 1, etc.

```
rk-pcie fe150000.pcie: PCIe Link up, LTSSM is 0x30011
rk-pcie fe150000.pcie: PCI host bridge to bus 0000:00
pci_bus 0000:00: root bus resource [bus 00-0f]
pci_bus 0000:00: root bus resource [??? 0xf0000000-0xf00fffff flags 0x0]
pci_bus 0000:00: root bus resource [io  0x300000-0x3fffff] (bus address
[0xf0100000-0xf01fffff])
pci_bus 0000:00: root bus resource [mem 0xf0200000-0xf0ffffff]
pci_bus 0000:00: root bus resource [mem 0x900000000-0x93fffffff pref]
pci 0000:00:00.0: [1d87:3588] type 01 class 0x060400
pci 0000:00:00.0: reg 0x10: [mem 0x00000000-0x3fffffff]
pci 0000:00:00.0: reg 0x14: [mem 0x00000000-0x3fffffff]
pci 0000:00:00.0: reg 0x38: [mem 0x00000000-0x0000ffff pref]
pci 0000:00:00.0: supports D1 D2
pci 0000:00:00.0: PME# supported from D0 D1 D3hot

lspci
0000:00:00.0 PCI bridge: Fuzhou Rockchip Electronics Co., Ltd Device 3588 (rev
01) (prog-if 00 [Normal decode])
```

The reason for this is that the vendor ID of the next-level device, i.e., bus 1 device, is an illegal value. Please add a print confirmation in the pci_bus_generic_read_dev_vendor_id function of the drivers/pci/probe.c file, as the protocol stack defaults to four types of illegal ID.

```
--- a/drivers/pci/probe.c
+++ b/drivers/pci/probe.c
@@ -2314,6 +2314,8 @@ bool pci_bus_generic_read_dev_vendor_id(struct pci_bus
*bus, int devfn, u32 *l,
        if (pci_bus_read_config_dword(bus, devfn, PCI_VENDOR_ID, l))
                return false;

+       dev_info(&bus->dev, "vendor id is 0x%x\n", *l);
+
        /* Some broken boards return 0 or ~0 if a slot is empty: */
        if (*l == 0xffffffff || *l == 0x00000000 ||
            *l == 0x0000ffff || *l == 0xffff0000)
```

It is currently known that the ZX-200 switch chip requires a longer time to load and run the bin after releasing the reset, which may result in an illegal ID of 0 being read when the RC enumerates after link up, as its internal programs have not fully run. If a similar situation occurs, please try to fix it with the following patch. If the patch still cannot solve the problem, it is recommended to contact the device manufacturer to assist in investigating the specific reasons.

```
--- a/drivers/pci/controller/dwc/pcie-dw-rockchip.c
+++ b/drivers/pci/controller/dwc/pcie-dw-rockchip.c
@@ -814,7 +814,7 @@ static int rk_pcie_establish_link(struct dw_pcie *pci)
                         * that LTSSM max timeout is 24ms per period, we can
wait a bit
                         * more for Gen switch.
                         */
-                       msleep(50);
+                       msleep(1000);
                        /* In case link drop after linkup, double check it */
                        if (dw_pcie_link_up(pci)) {
                                dev_info(pci->dev, "PCIe Link up, LTSSM is
0x%x\n",
```

2.2.9 PCIe Devices Can Be Enumerated but Access Is Abnormal

Some devices may not have sufficient #PERST reset time, which could probabilistically lead to enumeration by the system but abnormal operation. For example, a customer using a PCIe switch to expand and then connect an RTL8111 network card encountered the following abnormal information. In this case, it is necessary to increase the #PERST reset time by adding the rockchip,perst-inactive-ms property in the DTS. For details, refer to the DTS property description section.

```
[    8.739794] enP4p67s0f0: 0xffffffc0127bd000, 86:41:ff:d2:48:a0, IRQ 133
[   10.178084] ------------[ cut here ]------------
[   10.178100] WARNING: CPU: 6 PID: 691 at
drivers/net/ethernet/realtek/r8168/r8168_n.c:7291
rtl8168_wait_phy_ups_resume+0x6c/0x88
[   10.178104] Modules linked in:
[   10.178112] CPU: 6 PID: 691 Comm: dhcpcd Not tainted 5.10.66 #1
[   10.178116] Hardware name: Rockchip RK3588 NVR DEMO LP4 V10 Board (DT)
[   10.178121] pstate: 60400089 (nZCv daIf +PAN -UAO -TCO BTYPE=--)
[   10.178127] pc : rtl8168_wait_phy_ups_resume+0x6c/0x88
[   10.178132] lr : rtl8168_wait_phy_ups_resume+0x54/0x88
[   10.178135] sp : ffffffc01358ba30
[   10.178139] x29: ffffffc01358ba30 x28: 0000000000001043
[   10.178145] x27: 0000000000000000 x26: 0000000000008914
[   10.178151] x25: 0000000000000000 x24: ffffff8102e10c38
[   10.178157] x23: 0000000000418958 x22: 0000000000000002
[   10.178163] x21: ffffff8102e109c0 x20: 0000000000000064
[   10.178168] x19: 0000000000000007 x18: 0000000000000000
[   10.178174] x17: 0000000000000000 x16: 0000000000000000
[   10.178179] x15: 000000000000000a x14: 00000000000b49d2
[   10.178186] x13: 0000000000000006 x12: ffffffffffffffff
[   10.178191] x11: 0000000000000010 x10: ffffffc09358b767
[   10.178197] x9 : ffffffc0104d3868 x8 : 0000000000000000
[   10.178202] x7 : 663a31343a363820 x6 : 00000000ffff0000
[   10.178208] x5 : 0000000000000004 x4 : 000000000000ffff
[   10.178213] x3 : 0000000000000006 x2 : ffffffc011dcbbb8
```

```
[   10.178219] x1 : ffffffc01358b9f0 x0 : 0000000000005dc3
[   10.178225] Call trace:
[   10.178231]  rtl8168_wait_phy_ups_resume+0x6c/0x88
[   10.178236]  rtl8168_exit_oob+0x2e8/0x36c
[   10.178241]  rtl8168_open+0x1c8/0x37c
[   10.178247]  __dev_open+0x154/0x17c
[   10.178252]  __dev_change_flags+0xfc/0x1ac
[   10.178257]  dev_change_flags+0x30/0x70
[   10.178263]  devinet_ioctl+0x288/0x51c
[   10.178268]  inet_ioctl+0x1b8/0x1e8

Output of lspci -vvv:
0003:31:00.0 Class 0108: Device 8086:f1a5 (rev ff) (prog-if ff)
        !!! Unknown header type 7f
```

2.3 Interrupt issues

2.3.1 MSI/MSI-X Unavailability

During the development process of peripheral driver porting (mainly referring to WiFi), it is believed that the host-side function driver cannot use MSI or MSI-X interrupts, leading to an abnormal process. Follow the troubleshooting process below:

- Confirm the configurations mentioned in the preceding menuconfig, especially those related to MSI, to ensure they are correctly selected.
- Confirm whether the its node in rk3568.dtsi is set to disabled.
- Execute `lspci -vvv` to check if the corresponding device supports and has enabled MSI or MSI-X. Take this device as an example, its reported capabilities show that it supports 32 64-bit MSIs, currently using only 1, but Enable- indicates it is not enabled. If correctly enabled, you should see Enable+, and the Address should show an address similar to 0x00000000fd4400XX. This situation is generally caused by the device driver not being loaded or failing to request MSI or MSI-X during loading. Please refer to other drivers, use functions such as pci_alloc_irq_vectors to request them, and details can be combined with the practices of mature PCIe peripheral drivers and refer to the kernel's Documentation/PCI/MSI-HOWTO.txt document for writing and troubleshooting exceptions.

```
Capabilities: [58] MSI: Enable- Count=1/32 Maskable- 64bit+
                Address: 0000000000000000  Data: 0000
```

- If MSI or MSI-X is correctly applied, you can use the following command to export interrupt counts and check if they are normal: `cat /proc/interrupts`. Find the corresponding driver's ITS-MSI interrupts (based on the last column's requesting driver name, for example, xhci_hcd driver requests these MSI interrupts here). In theory, each communication transmission will increase ITS. If the device has no communication or communication is abnormal, you will see the interrupt count as 0, or there is a value but the interrupt count does not increase after initiating communication.

```
229: 0 0 0 0 0 0 ITS-MSI 524288 Edge xhci_hcd
```

- If it is a probabilistic event that causes the function driver to not receive MSI or MSI-X interrupts, you can try the following. First, execute `cat /proc/interrupts` to view the corresponding interrupt number. Taking 229 as an example, migrate the interrupt to another CPU for testing. For example, switch to CPU2 by using the command `echo 2 > /proc/irq/229/smp_affinity_list`.

- Use a protocol analyzer to capture protocol signals and check whether the peripheral device probabilistically fails to send MSI or MSI-X interrupts to the host, leading to exceptions. Note that protocol analyzers generally do not support signal acquisition for soldered devices. You need to purchase a gold finger board card from the device vendor and perform testing and signal acquisition on our company's EVB. Also, note that our company's EVB only supports standard interface gold finger board cards. If the device under test is an M.2 interface device (common types include key A, key B, key M, key B+M, key E), please refer to the "M.2 Hardware Interface" section in the appendix for the appearance and size of different keys, and purchase the corresponding model of the adapter board.

2.3.2 Device Allocated to Legacy Interrupt Number 0

```
0002:21:00.0 Serial controller: Device 1c00:3853 (rev 10) (prog-if 05 [16850])
        Subsystem: Device 1c00:3853
        Control: I/O- Mem- BusMaster- SpecCycle- MemWINV- VGASnoop- ParErr-
Stepping- SERR- FastB2B- DisINTx-
        Status: Cap+ 66MHz- UDF- FastB2B- ParErr- DEVSEL=fast >TAbort- <TAbort-
<MAbort- >SERR- <PERR- INTx-
        Interrupt: pin A routed to IRQ 0
        Region 0: I/O ports at 1000 [disabled] [size=256]
        Region 1: Memory at 380900000 (32-bit, prefetchable) [disabled]
[size=32K]
        Region 2: I/O ports at 100100 [disabled] [size=4]
        [virtual] Expansion ROM at 380908000 [disabled] [size=32K]
        Capabilities: [60] Power Management version 3
```

It can be observed that pin A is allocated to the legacy interrupt number 0, which is actually the default unassigned state. In principle, regardless of whether MSI interrupts are disabled in the kernel cmdline, the PCIe protocol stack will call the pci_assign_irq function when the pci bus driver is loaded, reading the 0x3d register of the peripheral configuration space to determine the pin value. Based on the read pin value, mapping is performed and the mapped virtual interrupt number is allocated, written into the 0x3c register of the peripheral configuration space. Therefore, it is generally not expected to encounter a situation where the legacy interrupt number cannot be queried. In this case, the peripheral will not be able to normally issue legacy-type interrupts, affecting the normal execution of the device driver. Currently, it has been found that some customers have not adapted well to the pci bus driver model when porting PCIe device drivers from non-Linux platforms to Linux, resulting in the pci_assign_irq function not being called, leading to the unassignment of legacy interrupts.

2.4 Suspend resume issues

2.4.1 PCIe 3.0 Interface System Anomaly During Sleep Wake-Up

The sleep wake-up test is shown in the following log, and the reason is that the power supply to the clock crystal was abnormally affected when the 3.3v power supply was turned off during sleep. Please address the issue from three aspects:

- The power supply configuration of `vpcie3v3-supply` in the dts, whether the max and min configurations of the power supply are unreasonable, leading to abnormal power operations
- Measure the clock crystal to determine if it was turned off before sleep, or if it was not turned on again after sleep failure, or if the power drop was insufficient, causing the clock crystal chip to malfunction
- Change the power supply of the 3.3v power supply and the crystal to external power supply to eliminate anomalies

```
[   17.406781] PM: suspend entry (deep)
[   17.406839] PM: Syncing filesystems ... done.
[   17.471710] Freezing user space processes ... (elapsed 0.002 seconds) done.
[   17.474337] OOM killer disabled.
[   17.474343] Freezing remaining freezable tasks ... (elapsed 0.001 seconds)
done.
[   17.476200] Suspending console(s) (use no_console_suspend to debug)
[   17.479152] android_work: sent uevent USB_STATE=DISCONNECTED
[   17.480290] [WLAN_RFKILL]: Enter rfkill_wlan_suspend
[   17.501382] rk-pcie 3c0000000.pcie: fail to set vpcie3v3 regulator
[   17.501406] dpm_run_callback(): genpd_suspend_noirq+0x0/0x18 returns -22
[   17.501418] PM: Device 3c0000000.pcie failed to suspend noirq: error -22
[   38.506580] rcu: INFO: rcu_preempt detected stalls on CPUs/tasks:
[   38.506601] rcu:  1-...0: (1 GPs behind) idle=25a/1/0x4000000000000000
softirq=4657/4657 fqs=2100
[   38.506604] rcu:  (detected by 0, t=6302 jiffies, g=4609, q=17)
[   38.506613] Task dump for CPU 1:
[   38.506617] kworker/u8:4    R  running task        0  1380      2 0x0000002a
[   38.506642] Workqueue: events_unbound async_run_entry_fn
[   38.506647] Call trace:
[   38.506657]  __switch_to+0xe4/0x138
[   38.506667]  pci_pm_resume_noirq+0x0/0x120
[  101.523233] rcu: INFO: rcu_preempt detected stalls on CPUs/tasks:
[  101.523250] rcu:  1-...0: (1 GPs behind) idle=25a/1/0x4000000000000000
softirq=4657/4657 fqs=8402
[  101.523253] rcu:  (detected by 0, t=25207 jiffies, g=4609, q=17)
[  101.523260] Task dump for CPU 1:
[  101.523264] kworker/u8:4    R  running task        0  1380      2 0x0000002a
[  101.523284] Workqueue: events_unbound async_run_entry_fn
[  101.523288] Call trace:
[  101.523297]  __switch_to+0xe4/0x138
[  101.523307]  pci_pm_resume_noirq+0x0/0x120
```

2.4.2 PCIe Device Transition to PM Mode Causes Module Exception

It has been observed that some Wi-Fi modules fail to switch their settings from D3 hot to D0 upon waking from sleep, resulting in a failure of the sleep-wake process. Considering that the PCIe controller driver will force the link to enter L2 and reset, the link and device can return to L0 and D0 states after waking up, so whether the protocol stack can successfully set the module to D0 state does not affect the use after waking up. Therefore, the provided patch can be used to attempt repairs in sequence.

```
[ 848.869840] PM: Some devices failed to suspend, or early wake event detected
[ 848.871600] rtl88x2ce 0000:01:00.0: Refused to change power state, currently
in D3
[ 848.946128] rtl88x2ce 0000:01:00.0: Refused to change power state, currently
in D3
[ 848.962770] rtl88x2ce 0000:01:00.0: Refused to change power state, currently
in D3
```

```
--- a/drivers/pci/quirks.c
+++ b/drivers/pci/quirks.c
@@ -1859,6 +1865,15 @@ static void quirk_d3hot_delay(struct pci_dev *dev,
unsigned int delay)
                dev->d3_delay);
```

```
 }

+ /* Some devices report short delay it actually need, fix them! */
+static void quirk_wifi_pm(struct pci_dev *dev)
+{
+       /* Ask your vendor how long it takes for D3 to D0 !!! */
+       if (dev->vendor == PCI_VENDOR_ID_FOO && dev->device ==
PCI_DEVICE_ID_BAR)
+               quirk_d3hot_delay(dev, 200); /* e.g 200ms, can be more for test
*/
+}
+
+DECLARE_PCI_FIXUP_FINAL(PCI_VENDOR_ID_FOO, PCI_DEVICE_ID_BAR, quirk_wifi_pm);
+/* Please Add your own PID and VID */
```

```
--- a/drivers/pci/quirks.c
+++ b/drivers/pci/quirks.c
@@ -1334,6 +1334,12 @@ DECLARE_PCI_FIXUP_CLASS_EARLY(PCI_VENDOR_ID_AL,
PCI_ANY_ID,
 DECLARE_PCI_FIXUP_CLASS_EARLY(PCI_VENDOR_ID_VIA, PCI_ANY_ID,
                               PCI_CLASS_STORAGE_IDE, 8, quirk_no_ata_d3);

+/* Some Wireless devices cannot transit from D3 to D0 by writing PCI_PM_CTRL */
+DECLARE_PCI_FIXUP_CLASS_EARLY(PCI_VENDOR_ID_FOO, PCI_DEVICE_ID_BAR,
+                             PCI_CLASS_NOT_DEFINED, 8, quirk_no_ata_d3);
+/* Please Add your own PID and VID */
```

```
--- a/drivers/pci/pci.c
+++ b/drivers/pci/pci.c
@@ -818,7 +818,7 @@ static int pci_raw_set_power_state(struct pci_dev *dev,
pci_power_t state)
        if (!dev->pm_cap)
            return -EIO;
+       /* Block all requests to D3hot */
+       if (state == PCI_D3hot)
+           return 0;
```

2.4.3 PCIe Peripheral Sleep Wake-Up Failures and Connectivity Issues

In principle, PCIe peripherals should be powered off during sleep. If hardware limitations result in a slow power-down process, rapid wake-up can easily lead to insufficient power removal followed by re-energization, causing the peripheral module to malfunction. This issue is common but not limited to NVMe modules, which, to prevent abnormal power loss, have added some large coupling capacitors to the power supply, making the problem relatively prominent. The following risk test patch can be applied; if there is the aforementioned issue, it can generally be quickly reproduced.

```
--- a/kernel/cpu.c
+++ b/kernel/cpu.c
@@ -1724,11 +1724,11 @@ int freeze_secondary_cpus(int primary)
                if (cpu == primary)
                        continue;

-               if (pm_wakeup_pending()) {
```

```
+               //if (pm_wakeup_pending()) {
                        pr_info("Wakeup pending. Abort CPU freeze\n");
                        error = -EBUSY;
                        break;
-               }
+               //}

                trace_suspend_resume(TPS("CPU_OFF"), cpu, true);
                error = _cpu_down(cpu, 1, CPUHP_OFFLINE);
```

Addressing such issues requires a two-pronged approach:

- Modify the PCIe module's discharge circuit on the hardware side to ensure a reasonable discharge duration, providing the optimized maximum discharge duration t.
- On the software side, add a delay for the power-up and power-down of peripherals to ensure that t has passed before re-energizing the system upon wake-up, as shown in the example below:

```
--- a/arch/arm64/boot/dts/rockchip/rk3568-evb1-ddr4-v10.dtsi
+++ b/arch/arm64/boot/dts/rockchip/rk3568-evb1-ddr4-v10.dtsi
@@ -63,6 +63,7 @@
                enable-active-high;
                gpio = <&gpio0 RK_PD4 GPIO_ACTIVE_HIGH>;
                startup-delay-us = <5000>;
+               off-on-delay-us = <500000>; //The maximum duration t provided by
hardware
                vin-supply = <&dc_12v>;
        };
```

2.5 Stability issues

2.5.1 NVMe Device Exhibits Anomalies Under Long-Term Operation

```
[186825.261896] nvme nvme0: Abort status: 0x0
[187047.435152] nvme nvme0: Abort status: 0x0
[187052.740828] nvme nvme0: I/O 256 QID 1 timeout, aborting
[187082.743811] nvme nvme0: I/O 256 QID 1 timeout, reset controller
[187092.649150] nvme nvme0: Abort status: 0x0
[187389.590726] nvme nvme0: I/O 709 QID 2 timeout, aborting
[187396.088472] nvme nvme0: Abort status: 0x0
[187419.670448] nvme nvme0: I/O 736 QID 2 timeout, aborting
[187430.034886] nvme nvme0: Abort status: 0x0
[187449.750258] nvme nvme0: I/O 736 QID 2 timeout, reset controller
```

Commercial NVMe devices vary in quality. To troubleshoot related issues, it is recommended to first rule out the possibility of a defective individual NVMe drive:

- Compare test results of multiple NVMe devices from different brands
- Compare stress test performance after connecting to a PC

During the stress test, anomalies in the NVMe device are observed. From the above logs, it can be seen that the device status returned by the NVMe device is 0, which would be 0xf if there was a link anomaly, thus excluding link issues at this time. In this case, consider the device's operating temperature as a priority.

- First, enable the kernel NVMe temperature control configuration CONFIG_NVME_HWMON.
- Secondly, iterate through the hwmon IDs to find the temperature control node registered by NVMe, using 8 as an example `cat /sys/class/hwmon/hwmon8/name`, and if it returns nvme, it is the temperature control node for the NVMe device.
- Read the temperature count of each NVMe device `cat /sys/class/hwmon/hwmon8/*input`, observe the temperature changes during the stress test, and check if it exceeds the rated operating temperature of the device.
- If it is determined that the operating temperature exceeds the limit, improve the cooling conditions or execute corresponding hard disk temperature control strategies in user space.

```
[ 3836.614828] sysrq: Show Blocked State
[ 3836.614921] task:binder:306_2    state:D stack:    0 pid:  329 ppid:     1
flags:0x04000009
[ 3836.614925] Call trace:
[ 3836.614932] __switch_to+0x118/0x148
[ 3836.614936] __schedule+0x538/0x7a4
[ 3836.614938] schedule+0x9c/0xe0
[ 3836.614940] schedule_timeout+0x8c/0xf4
[ 3836.614942] io_schedule_timeout+0x48/0x6c
[ 3836.614944] wait_for_common_io+0x7c/0x100
[ 3836.614945] wait_for_completion_io_timeout+0x10/0x1c
[ 3836.614949] submit_bio_wait+0x70/0xb4
[ 3836.614952] blkdev_issue_discard+0x88/0xd8
[ 3836.614954] blk_ioctl_discard+0x100/0x108
[ 3836.614955] blkdev_common_ioctl+0x388/0x664
[ 3836.614957] blkdev_ioctl+0x16c/0x20c
[ 3836.614959] block_ioctl+0x34/0x44
[ 3836.614962] __arm64_sys_ioctl+0x90/0xc8
[ 3836.614964] el0_svc_common+0xac/0x1ac
[ 3836.614965] do_el0_svc+0x1c/0x28
[ 3836.614968] el0_svc+0x10/0x1c
[ 3836.614970] el0_sync_handler+0x68/0xac
[ 3836.614972] el0_sync+0x160/0x180
```

Apart from `nvme nvme0: I/O 736 QID 2 timeout, aborting`, if the above print is also triggered. At this time, it should be analyzed whether a full disk format or synchronous batch deletion and other operations were performed before the anomaly, especially large-capacity NVMe is more likely to trigger when it is fuller. The solution is as follows:

```
(1) Set the CONFIG_DEFAULT_HUNG_TASK_TIMEOUT to a slightly larger number of
seconds, for example, 120, to avoid the block-mq blockage detection
(2) Adjust the software timeout times for the admin queue and io queue in the
NVMe protocol stack
--- a/drivers/nvme/host/core.c
+++ b/drivers/nvme/host/core.c
@@ -41,12 +41,12 @@ struct nvme_ns_info {
        bool is_removed;
 };

-unsigned int admin_timeout = 60;
+unsigned int admin_timeout = 120;
 module_param(admin_timeout, uint, 0644);
 MODULE_PARM_DESC(admin_timeout, "timeout in seconds for admin commands");
 EXPORT_SYMBOL_GPL(admin_timeout);
```

```
-unsigned int nvme_io_timeout = 30;
+unsigned int nvme_io_timeout = 120;
 module_param_named(io_timeout, nvme_io_timeout, uint, 0644);
```

If logs similar to the following appear, it indicates an abnormality in the NVMe device. If the root cause cannot be identified and resolved, a reset procedure can be attempted.

```
nvme nvme0: I/O 528 QID 10 timeout, reset controller
nvme nvme0: controller is down; will reset: CSTS=0xffffffff, PCI_STATUS=0x10
```

```
--- a/drivers/nvme/host/pci.c
+++ b/drivers/nvme/host/pci.c
@@ -11,6 +11,9 @@
 #include <linux/blk-mq.h>
 #include <linux/blk-mq-pci.h>
 #include <linux/blk-integrity.h>
+#ifdef CONFIG_ARCH_ROCKCHIP
+#include <linux/aspm_ext.h>
+#endif
 #include <linux/dmi.h>
 #include <linux/init.h>
 #include <linux/interrupt.h>
@@ -132,6 +135,7 @@ struct nvme_dev {
        void __iomem *bar;
        unsigned long bar_mapped_size;
        struct work_struct remove_work;
+       struct pci_saved_state *state;
        struct mutex shutdown_lock;
        bool subsystem;
        u64 cmb_size;
@@ -1324,6 +1328,21 @@ static void nvme_warn_reset(struct nvme_dev *dev, u32
csts)
                  "Try \"nvme_core.default_ps_max_latency_us=0 pcie_aspm=off
pcie_port_pm=off\" and report a bug\n");
 }
+
+static struct pci_dev *nvme_get_rc(struct pci_dev *pdev)
+{
+       struct pci_dev *rc;
+
+       /* Walk bus to get root port */
+       rc = pdev;
+       while (rc->bus->parent) {
+               rc = rc->bus->self;
+               if (!rc)
+                       break;
+       }
+
+       return rc;
+}
+
 static enum blk_eh_timer_return nvme_timeout(struct request *req)
 {
        struct nvme_iod *iod = blk_mq_rq_to_pdu(req);
@@ -1344,6 +1363,9 @@ static enum blk_eh_timer_return nvme_timeout(struct
request *req)
```

```
         * Reset immediately if the controller is failed
         */
        if (nvme_should_reset(dev, csts)) {
+               rockchip_dw_pcie_pm_ctrl_for_user(nvme_get_rc(to_pci_dev(dev-
>dev)),
+                                                 ROCKCHIP_PCIE_PM_CTRL_RESET);
+               pci_restore_state(to_pci_dev(dev->dev));
                nvme_warn_reset(dev, csts);
                nvme_dev_disable(dev, false);
                nvme_reset_ctrl(&dev->ctrl);
@@ -1839,9 +1861,18 @@ static int nvme_pci_configure_admin_queue(struct nvme_dev
*dev)
        lo_hi_writeq(nvmeq->sq_dma_addr, dev->bar + NVME_REG_ASQ);
        lo_hi_writeq(nvmeq->cq_dma_addr, dev->bar + NVME_REG_ACQ);

+       pci_save_state(to_pci_dev(dev->dev));
+
        result = nvme_enable_ctrl(&dev->ctrl);
-       if (result)
-               return result;
+       if (result) {
+               rockchip_dw_pcie_pm_ctrl_for_user(nvme_get_rc(to_pci_dev(dev-
>dev)),
+                                                 ROCKCHIP_PCIE_PM_CTRL_RESET);
+               pci_restore_state(to_pci_dev(dev->dev));
+               /* Try again */
+               result = nvme_enable_ctrl(&dev->ctrl);
+               if (result)
+                       return result;
+       }

        nvmeq->cq_vector = 0;
        nvme_init_queue(nvmeq, 0);
@@ -3135,10 +3166,12 @@ static unsigned long check_vendor_combination_bug(struct
pci_dev *pdev)
 static void nvme_async_probe(void *data, async_cookie_t cookie)
 {
        struct nvme_dev *dev = data;
+       struct pci_dev *pdev = to_pci_dev(dev->dev);

        flush_work(&dev->ctrl.reset_work);
        flush_work(&dev->ctrl.scan_work);
        nvme_put_ctrl(&dev->ctrl);
+       dev->state = pci_store_saved_state(pdev);
 }
```

2.6 Other issues

2.6.1 PCIe to SATA Device Disk Numbers Are Not Fixed

Due to the initialization of the driver being thread-based, the initialization order of the external SATA chips connected to multiple PCIe controllers is not fixed. In fact, the multiple hard disk identifiers under each SATA chip are fixed, but the hard disk identifiers between multiple SATA chips are not fixed. For example, during one boot, the four hard disks under the first SATA chip may be sda~sdd, and the four hard disks under the second

SATA chip may be sde~sdh; the next boot might change to the four hard disks under the first SATA chip being sde~sdh, and the four hard disks under the second SATA chip being sda~sdd. To completely fix the order of these hard disks, one can traverse the hard disk paths at the application layer and fix the SATA chips according to the controller address (e.g., fe160000.pcie), thereby creating symbolic links to fix the order. If you want to simplify the application layer, you can also disable thread initialization by removing CONFIG_PCIE_RK_THREADED_INIT.

```
ls -al /sys/block/sd*

rwxrwxrwx    1 root     root             0 Jan  1 00:00 /sys/block/sda ->
../devices/platform/fe160000.pcie/pci0001:10/0001:10:00.0/0001:11:00.0/ata2/host
1/target1:0:0/1:0:0:0/block/sda

lrwxrwxrwx    1 root     root             0 Jan  1 00:00 /sys/block/sdb ->
../devices/platform/fe160000.pcie/pci0001:10/0001:10:00.0/0001:11:00.0/ata3/host
2/target2:0:0/2:0:0:0/block/sdb

lrwxrwxrwx    1 root     root             0 Jan  1 00:03 /sys/block/sdc ->
../devices/platform/fe160000.pcie/pci0001:10/0001:10:00.0/0001:11:00.0/ata4/host
3/target3:0:0/3:0:0:0/block/sdc

lrwxrwxrwx    1 root     root             0 Jan  1 00:00 /sys/block/sdd ->
../devices/platform/fe160000.pcie/pci0001:10/0001:10:00.0/0001:11:00.0/ata5/host
4/target4:0:0/4:0:0:0/block/sdd
```

2.6.2 PCIe peripheral malfunctions in GKI mode

In GKI versions up to and including 6.1, PCIe peripherals can only use Legacy interrupts. Please execute `cat /proc/cmdline` to check if the `nomsi` flag has been set. Additionally, since the PCIe 2.0 interface is multiplexed with either USB3 or SATA, if the kernel objects (KO) for both are enabled and loaded simultaneously, it will cause an exception. You can search for keywords similar to `naneng-combphy fee20000.phy: phy type select 2 overwriting type 4` in the log.

3. Appendix

3.1 LTSSM State Machine

State Descriptor	State Code (6'h)	Remarks
S_DETECT_QUIET	0x00	Peripheral RX termination resistor not detected, device not operating normally
S_DETECT_ACTIVE	0x01	-
S_POLL_ACTIVE	0x02	-
S_POLL_COMPLIANCE	0x03	Compliance test mode. Entered erroneously due to signal anomalies in non-test mode
S_POLL_CONFIG	0x04	-
S_PRE_DETECT_QUIET	0x05	-
S_DETECT_WAIT	0x06	-
S_CFG_LINKWD_START	0x07	-
S_CFG_LINKWD_ACEPT	0x08	Lane sequence detection process
S_CFG_LANENUM_WAIT	0x09	-
S_CFG_LANENUM_ACEPT	0x0a	-
S_CFG_COMPLETE	0x0b	Physical layer detection complete
S_CFG_IDLE	0x0c	-
S_RCVRY_LOCK	0x0d	Rate switching process
S_RCVRY_SPEED	0x0e	-
S_RCVRY_RCVRCFG	0x0f	-
S_RCVRY_IDLE	0x10	-
S_RCVRY_EQ0	0x20	-
S_RCVRY_EQ1	0x21	-
S_RCVRY_EQ2	0x22	-
S_RCVRY_EQ3	0x23	-
S_L0	0x11	Link working state L0
S_L0S	0x12	-
S_L123_SEND_EIDLE	0x13	-
S_L1_IDLE	0x14	-
S_L2_IDLE	0x15	-
S_L2_WAKE	0x16	-
S_DISABLED_ENTRY	0x17	-


State Descriptor	State Code (6'h)	Remarks
S_DISABLED_IDLE	0x18	-
S_DISABLED	0x19	-
S_LPBK_ENTRY	0x1a	-
S_LPBK_ACTIVE	0x1b	Loopback test mode, generally entered in test environments
S_LPBK_EXIT	0x1c	-
S_LPBK_EXIT_TIMEOUT	0x1d	-
S_HOT_RESET_ENTRY	0x1e	Peripheral initiates hot reset process
S_HOT_RESET	0x1f	-

3.2 Detailed Explanation of PCIe Address Space Configuration

For detailed configuration of the PCIe address space in DTS, please refer to the following link for interpretation or modification: https://elinux.org/Device_Tree_Usage#PCI_Host_Bridge

3.3 M.2 Interface Hardware

The gold fingers of Key B+M can utilize the slot of the Key B or Key M adapter board, and the gold fingers of Key A+E can utilize the slot of the Key A or Key E adapter board. For other types of gold finger boards, please strictly select the corresponding model adapter board slot according to the interface.

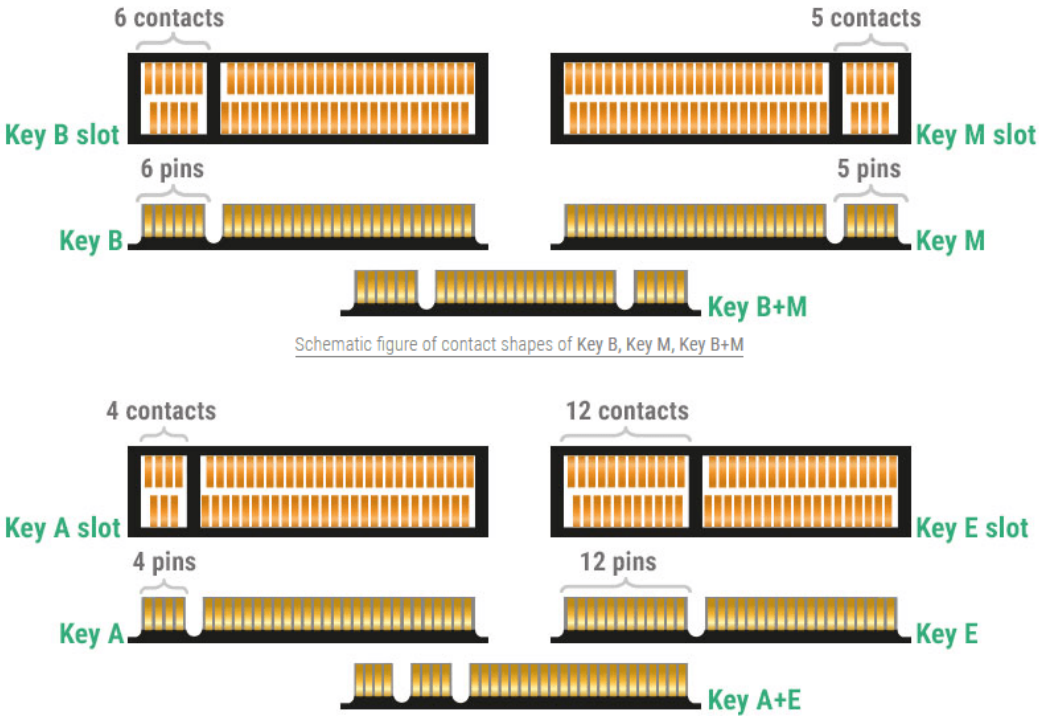

Schematic figure of contact shapes of Key B, Key M, Key B+M