7360 INTELLIGENT SERVICES ACCESS MANAGER FX RELEASE 6.2.04

Alarms Guide

3HH-13538-AAAA-TCZZA

Issue: 19

September 2020

Nokia — Proprietary and confidential
Use pursuant to applicable agreements

Nokia is a registered trademark of Nokia Corporation. Other products and company names mentioned herein may be trademarks or tradenames of their respective owners.

The information presented is subject to change without notice. No responsibility is assumed for inaccuracies contained herein.

© 2016-2020 Nokia.

Contains proprietary/trade secret information which is the property of Nokia and must not be made available to, or copied or used by anyone outside Nokia without its written authorization. Not to be used or disclosed except in accordance with applicable agreements.

Table of contents

1 Introduction 5
1.1 Scope 5
1.2 Alarm information 5
1.3 How to troubleshoot in case of alarms 6

2 7360 ISAM FX 9
2.1 7360 ISAM FX 9

Appendixes

3 Additional information syntax 221
3.1 Additional information syntax 221

1 Introduction

1.1 Scope

1.2 Alarm information

1.3 How to troubleshoot in case of alarms

1.1 Scope

This document describes CLI and TL1 alarms for the following ISAM products:

- FD 100Gbps/320Gbps NT and FX NT:
  - 7360 ISAM FX

Note — This document includes CLI and TL1 alarms for a wide range of products, including products not listed above.

1.2 Alarm information

This document sorts alarms according to the following categories:

- IACM alarms
- IHub alarms

Table 1 indicates the alarm categories supported by the ISAM products.

Table 1 **Alarm categories supported by the ISAM products**

ISAM product	IACM alarms	SHub alarms	IHub alarms
7360 ISAM FX	✓		✓

Within each alarm category, alarms are identified by alarm type and within each alarm type, by alarm number. Examples of alarm types in the IACM alarms category are Equip (1), EquipHolder (2), and PlugInUnit (3). Examples of alarm types in the IHub alarms category are IHUB ISS (141) and IHUB L2FWD (142).

Table 2 describes the information provided in this document for each alarm.

Table 2 **Alarm information provided in this document**

Item	Description	Possible values
No.	The alarm number that serves as the unique identification number of the alarm within the alarm type	—
Class	The category to which the alarm belongs	• communication (Com) • processing error (Proc) • quality of service (QoS) • environmental (Env) • equipment (Eqp)
Sev.	The initial severity level assigned to the alarm	• Indeterminate • Warning (Warn) • Minor (Min) • Major (Maj) • Critical (Crit)
SA	Specifies whether the alarm is service affecting or not	• Y • N
DL	Specifies default logging	• Y • N
DR	Specifies default reporting	• Y • N
CLI Alarm	The alarm name as it appears in the CLI	—
TL1 Alarm	The alarm name as it appears in the TL1	—
Description	Description of the alarm	—
Troubleshooting recommendations	Describes the recommended actions to be taken when the alarm appears	—

1.3 How to troubleshoot in case of alarms

Resolve alarms that affect service before alarms that do not affect service.

Use local procedures to correct problems associated with customized alarms.

Use the alarm information obtained from the EMS Event Viewer during analysis. Use the CLI or TL1 autonomous messages generated during trouble locating and additional data, such as visual or audible alarms, when available. Service states should also be considered.

Caution — When an alarm has been disabled, it is not generated or displayed in the EMS Event Viewer.

Some of the troubleshooting recommendations in this guide might require the assistance of someone familiar with UNIX systems and commands. Many of the UNIX troubleshooting recommendations and most of the UNIX commands require root access. In these cases, Nokia recommends that a UNIX system administrator perform the troubleshooting.

Procedure 1 To troubleshoot alarms

Use this procedure to troubleshoot alarms.

1 To access alarms on your ISAM product:

a To access the alarms using CLI, see the Operations and Maintenance Using CLI guide for your ISAM product.

b To access the alarms using TL1, see the Operations and Maintenance Using TL1 guide for your ISAM product.

2 Look up the alarm type and alarm number in one of the following chapters in this guide to help you determine the cause of the alarm and the appropriate action for resolving the alarm:

- IACM alarms
- IHub alarms

See section 1.2 if you do not know if your ISAM product supports alarms for the alarm categories listed above.

Note 1 — If multiple alarms are present on your ISAM product, resolve the alarms in the following order: Critical, Major, Minor.

Note 2 — Note that the term “board” as it appears in the alarm names is referred to as either “unit” or “card” throughout the ISAM product documentation. For example, the NANT-A card is a type of NT unit and the NVLT-G card is a type of LT unit.

3 STOP. This procedure is complete.

2 7360 ISAM FX

2.1 7360 ISAM FX

Table 3 **7360 ISAM FX alarms**

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
Alarm type: 1 Alarm type = Equip (1) - Index1 = eqptHolderId (Index in equipment holder Table), Index2 = see specific alarm number.							
1	Equ	Crit	Y, Y, Y	persist-data-loss (unsigned long)65537	INIT 0x00010001	ISAM has lost all persistent data after RESTART. System is not configured. Index 2 = not used.	Reconfigure ISAM.
2	Equ	Maj	N, Y, Y	sntp-comm-lost (unsigned long)65538	SNTPCOM 0x00010002	The SNTP server does not respond to the requested messages. Index 2 = not used.	Check SNTP server.
4	Equ	Maj	N, Y, Y	nt-disk-95%full (unsigned long)65540	DISKSPACE 0x00010004	The NT disk has reached a 95% filling level. Index 2 = partition (0 is ISAM SW, 1 is ONT SW)	Clean up disk space.
5	Comm	Maj	Y, Y, Y	preferred-mode (unsigned long)65541	PREFREFFAIL 0x00010005	System has been configured to work in autonomous mode with both timing modes allowed and is not using the preferred timing mode since all timing references corresponding to the preferred timing mode are in failure. This alarm is only applicable for Basic Clock Management. Index 2 = not used.	Check the peer equipment and link between peer equipment and the ISAM for all the timing references that correspond to the preferred timing mode. If the BITS mode is E1 or DS1, check that there is no Alarm Indication Signal (AIS) on the BITS inputs to the system.
6	Comm	Crit	Y, Y, Y	timing-reference (unsigned long)65542	ALLREFFAIL 0x00010006	System has been configured to work in autonomous mode and is either in holdover mode or in free-run mode since all timing references for all preferred timing modes are in failure. In Enhanced Clock mgmt, this alarm applies to the state of the external clock sources (see alarm type Sync [134]) independently of the manual clock selection configuration (FORCE). Index 2 = not used.	Check peer equipment and link between the peer equipment and the ISAM for all timing references. If BITS is used as external source for network timing reference, check that the signals at the BITS inputs to the system are within specification and that there is no Alarm Indication Signal (AIS) on these inputs.

(1 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
8	Equ	Crit	Y, Y, Y	shub-loc (unsigned long)65544	LANXOOS 0x00010008	Loss of Contact with SHUB or IHUB. NT cannot communicate with SHUB or IHUB. Index 2 = not used.	The SHUB or IHUB has reset. Wait until it has restarted.
10	Equ	Crit	Y, Y, Y	cf-error (unsigned long)65546	CFACCERR 0x0001000A	An error occurred while accessing the Compact Flash card. Index 2 = eqptSlotId of the NT that has the compact flash access error.	Replace the Compact Flash card of the concerned NT (index2 of the alarm).
25	Equ	Maj	N, Y, Y	back-pnl-inv (unsigned long)65561	BCKPNLINV 0x00010019	The Back Panel type read from the SMAS is of an unknown type (only NEP). Index 2 = not used.	System will startup with default Back Panel type (NEP). Check Back Panel type configuration when system is running.
28	Equ	Crit	Y, Y, Y	shub-conf-loss (unsigned long)65564	SHUBCONFLOSS 0x0001001c	Notification alarm raised by the NT in order to inform the operator that the SHUB/IHUB configuration saved on NT differs from the actual SHUB/IHUB configuration, the last changes onto SHUB/IHUB database in between two configuration save actions are lost due to NT and/or SHUB/IHUB reset. Index 2 = not used.	Check SHUB/IHUB configuration with respect to database (last database changes may be lost).
Alarm type: 2 Alarm type = EquipHolder (2) - Index1 = eqptHolderId (Index in equipment holder Table), Index2 = not used.							
1	Equ	Min	N, Y, Y	rack-power (unsigned long)131073	FUSEALM 0x00020001	Power fuse broken.	Check power supplies.
2	Equ	Maj	N, Y, Y	rack-fan-unit1 (unsigned long)131074	FANALM1 0x00020002	Fan Unit 1 in rack failing. This alarm is raised when one or more fans in the fan tray failed or the fan tray is removed.	Check fan.
3	Equ	Maj	N, Y, Y	rack-fan-unit2 (unsigned long)131075	FANALM2 0x00020003	Fan Unit 2 in rack failing. This alarm is raised when one or more fans in the fan tray failed or the fan tray is removed.	Check fan.
7	Equ	Min	N, Y, Y	shelf-mismatch (unsigned long)131079	MEMDIFEH 0x00020007	Shelf detected, but its actual shelf-type is either unknown or it differs from the planned shelf-type.	Check equipment. Check configuration.

(2 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
9	Equ	Maj	Y, Y, Y	shelf-missing (unsigned long)131081	SHMISSING 0x00020009	Shelf is planned, no shelf is detected, but a shelf has been detected at least once since it is planned.	In case of extension via the IQ bus: check presence of extension board. Check cabling of the extension chain. In case of extension/expansion via optical fibre and SFP: check presence of shelf-expander unit on Host shelf. Check cabling to expansion shelf. Check presence of slave expander card on expansion shelf. Check presence of lineboard on expansion shelf. Check presence of general facilities card on expansion shelf. Check fan on expansion shelf. Check power cable on expansion shelf.
10	Equ	Min	N, Y, Y	shelf-install-missing (unsigned long)131082	SHNOTINST 0x0002000A	Shelf is planned, no shelf is detected, and no shelf has been detected since it is planned.	Check presence of extension board. Check cabling of the extension chain.
15	Env	Min	N, Y, Y	door (unsigned long)131087	DOORALM 0x0002000F	Open cabinet door on NEP. Supported on ARAM-D prior to R3.0 (see HECustomizableAlarm 6). Also used for opening AUX on CDES-C of 7367 SX VP (ANSI).	Close the door.
20	Env	Crit	Y, Y, Y	ac-power-fail (unsigned long)131092	ACALM 0x00020014	Externally provided power alarm. As a result, the shelf that raises the alarm will shut down in 15 minutes.	Check power installation.
Alarm type: 3 Alarm type = PlugInUnit (3) - Index1 = eqptSlotId (Index in equipment Board Table), Index2 = not used.							
3	Equ	Min	N, Y, Y	board-mismatch (unsigned long)196611	MEMDIF 0x00030003	Board detected, but its actual board-type is either unknown or it differs from the planned board-type. This alarm is applicable for all board-types: NT, NTIO, LSM, ACU board.	

(3 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
4	Equ	Maj	N, Y, Y	waiting-for-sw (unsigned long)196612	PROGVER 0x00030004	This alarm will be raised when the system is not able to download all the applicable SW files (supported by the active OSWP) towards the board. This alarm is applicable to LSM, NTIO and ITSC boards. The following situations can be distinguished. 1. The board belongs to a board type that is not supported by the active OSWP. 2. The detected board belongs to a board type that is supported by the active OSWP but one or more of the applicable SW files are not available anymore on the file disk of the NT.	Check configuration. Download software. Wait for the SW download from the server to be completed.
8	Equ	Maj	N, Y, Y	temp-exceeded (unsigned long)196616	HITEMP 0x00030008	Temperature threshold on board exceeded. This alarm is applicable for NT, LSM and NTIO (NCNC-G/F, FNIO-D) boards. In remote boxes, the cause might be a dirty fan dust filter.	Check fans and restart board. In remote boxes, check the fan dust filter as well.
10	Equ	Crit	Y, Y, Y	backplane-data-failure (unsigned long)196618	BDPORTFAIL 0x0003000A	Applicable to FD/FX products with multiple datalinks between one LT and an NT (IHUB). Mostly due to incorrectly inserted board, this alarm notifying failure on one (or more) LT backplane datalinks, while operational board status is up. If all datalinks between LT and NT fail together, then board-missing alarm is raised, and not this alarm.	Extract the LT card, and then plug it in again.
12	Equ	Maj	Y, Y, Y	temp-shutdown (unsigned long)196620	SHUTDOWN 0x0003000c	Board has powered itself off due to too high temperature. This alarm is applicable for LSMs and NTIO (NCNC-G/F, FNIO-D).	Check ambient temperature. Check operation of fans. Check board.

(4 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
14	Equ	Maj	Y, Y, Y	board-missing (unsigned long)196622	BDMISSING 0x0003000e	Board is planned, no board is detected, but a board has been detected at least once since it is planned. This alarm is applicable for all board types: NT, NTIO, LSM, ACU board, EDSE, SATU.	Check board presence.
15	Equ	Min	N, Y, Y	board-instl-missing (unsigned long)196623	BDNOTINST 0x0003000f	Board is planned, no board is detected, and no board has been detected since it is planned. This alarm is applicable for all board types: NT, LSM, ACU board.	Insert board.
16	Equ	Maj	Y, Y, Y	board-init (unsigned long)196624	BDINIT 0x00030010	A board initialization failure has been detected. This alarm is applicable for LSM and ITSC boards.	Force Cold reset of the board and if this fails again, repair the board
17	Equ	Crit	Y, Y, Y	board-reset-prot (unsigned long)196625	BDRESET 0x00030011	The number of board resets within a certain timeframe exceeded the threshold.	Force Cold reset of the board and if this fails again, repair the board
28	Equ	Crit	Y, Y, Y	sem-power-fail (unsigned long)196636	SEM_PWR_FAIL 0x0003001C	Applicable for SEM only. Power to the external power source failed. SEM is running battery powered. Applicable to -48V powered variants of SEMS only.	Check power to the external power supply.
29	Equ	Crit	Y, Y, Y	sem-ups-fail (unsigned long)196637	SEM_UPS_FAIL 0x0003001D	Applicable for SEMs only. External power supply voltage has fallen to a dangerously low level.	Check for excessive voltage drop on RFT-V power feed.
30	Equ	Maj	Y, Y, Y	board-reset-cf (unsigned long)196638	BDRESETCF 0x0003001e	The LT board or NTIO (FNIO-D) board has reset (Alarm ON followed by an Alarm OFF) or there is a communication failure (Alarm ON).	Check cabling if alarm is persistent. If alarm toggles frequently the board will go in Board Reset Protection mode (alarm 3,17) and will be powered down.
31	Equ	Crit	Y, Y, Y	shub-uplink (unsigned long)196639	LANXUPBRKDWN 0x0003001f	This alarm is generated when the SHUB uplink is broken, and it will be forwarded to the NT and further to the ACU.	Check SHUB uplink cable for any removal or for any loose contacts.
Alarm type: 8 Alarm type = ATM (8) - Index1 = IfIndex of ATM physical port, Index2 = see specific alarm number.							
2	QOS	Min	Y, N, N	cell-discard-up (unsigned long)524290	ATM_CDU 0x00080002	ATM cell discarded in the upstream direction. Remark: index2 = VPI/VCI.	No local repair action. Sender must lower shaping rate.

(5 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
3	QOS	Min	Y, N, N	cell-discard-down (unsigned long)524291	ATM_CDD 0x00080003	ATM cell discarded in the downstream direction. Remark: index2 = VPI/VCI.	No local repair action. Sender must lower shaping rate.
Alarm type: 10 Alarm type = CustomizableAlarm (10) - Index1 = Rack_ID (position of the rack), Index2 = not used. (1..5) Alarm type = CustomizableAlarm (10) - Index1 = eqptHolderId (Index in equipment holder table to identify a shelf, applicable to ARAM-/D/E, XD-REM (ASAM-R), ERAM-A, 7330 ISAM FTTN ANSI), Index2 = not used.(11..16) Alarm type = CustomizableAlarm (10) - Index1 = Rack_ID (position of the rack), Index2 = not used.(17..28)							
1	Env	Ind	N, Y, Y	custom1 (unsigned long)655361	CUSTALRM1 0x000A0001	-	-
2	Env	Ind	N, Y, Y	custom2 (unsigned long)655362	CUSTALRM2 0x000A0002	-	-
3	Env	Ind	N, Y, Y	custom3 (unsigned long)655363	CUSTALRM3 0x000A0003	-	-
4	Env	Ind	N, Y, Y	custom4 (unsigned long)655364	CUSTALRM4 0x000A0004	-	-
5	Env	Ind	N, Y, Y	custom5 (unsigned long)655365	CUSTALRM5 0x000A0005	-	-
11	Env	Ind	N, Y, Y	he-custom1 (unsigned long)655371	MISC 0x000A000B	-	-
12	Env	Ind	N, Y, Y	he-custom2 (unsigned long)655372	MISC 0x000A000C	-	-
13	Env	Ind	N, Y, Y	he-custom3 (unsigned long)655373	MISC 0x000A000D	-	-
14	Env	Ind	N, Y, Y	he-custom4 (unsigned long)655374	MISC 0x000A000E	-	-
15	Env	Ind	N, Y, Y	he-custom5 (unsigned long)655375	MISC 0x000A000F	Not applicable to ERAM-A.	-

(6 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
16	Env	Ind	N, Y, Y	he-custom6 (unsigned long)655376	MISC 0x000A0010	On ARAM-D, raised by a transition on pins 7 and 15 on the PWIO-B external alarm input connector. Prior to R3.0, pins 7 and 15 raised Door Alarm . Not applicable to ERAM-A or when using an AACU-C.	-
17	Env	Ind	N, Y, Y	custom6 (unsigned long)655377	MISC 0x000A0011	Only applicable to ANSI version of FX equipment practice.	-
18	Env	Ind	N, Y, Y	custom7 (unsigned long)655378	MISC 0x000A0012	Only applicable to ANSI version of FX equipment practice.	-
19	Env	Ind	N, Y, Y	custom8 (unsigned long)655379	MISC 0x000A0013	Only applicable to ANSI version of FX equipment practice.	-
20	Env	Ind	N, Y, Y	custom9 (unsigned long)655380	MISC 0x000A0014	Only applicable to ANSI version of FX equipment practice.	-
21	Env	Ind	N, Y, Y	custom10 (unsigned long)655381	MISC 0x000A0015	Only applicable to ANSI version of FX equipment practice.	-
22	Env	Ind	N, Y, Y	custom11 (unsigned long)655382	MISC 0x000A0016	Only applicable to ANSI version of FX equipment practice.	-
23	Env	Ind	N, Y, Y	custom12 (unsigned long)655383	MISC 0x000A0017	Only applicable to ANSI version of FX equipment practice.	-
24	Env	Ind	N, Y, Y	custom13 (unsigned long)655384	MISC 0x000A0018	Only applicable to ANSI version of FX equipment practice.	-
25	Env	Ind	N, Y, Y	custom14 (unsigned long)655385	MISC 0x000A0019	Only applicable to ANSI version of FX equipment practice.	-
26	Env	Ind	N, Y, Y	custom15 (unsigned long)655386	MISC 0x000A001A	Only applicable to ANSI version of FX equipment practice.	-
27	Env	Ind	N, Y, Y	custom16 (unsigned long)655387	MISC 0x000A001B	Only applicable to ANSI version of FX equipment practice.	-
28	Env	Ind	N, Y, Y	custom17 (unsigned long)655388	MISC 0x000A001C	Only applicable to ANSI version of FX equipment practice.	-

(7 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
Alarm type: 12 Alarm type = DS1/E1 (12) Index1 = ifIndex (of E1 physical port), Index2 = not used.							
3	Comm	Min	Y, Y, Y	e1-fe-rai (long)786435	E1RXRAI 0x000C0003	Receiving RAI.	Check receive signal at Far-end.
4	Comm	Min	Y, Y, Y	e1-ne-rai (long)786436	E1TXRAI 0x000C0004	Transmitting RAI.	Check receive signal at Near-end.
5	Comm	Min	Y, Y, Y	e1-fe-ais (long)786437	E1RXAIS 0x000C0005	Receiving AIS.	Check transmit signal at Far-end.
6	Comm	Min	Y, Y, Y	e1-ne-ais (long)786438	E1TXAIS 0x000C0006	Transmitting AIS.	Check transmit signal at Near-end.
7	Comm	Min	Y, Y, Y	e1-lof (long)786439	E1LOF 0x000C0007	Loss Of Frame.	Check receive signal at Near-end.
8	Comm	Maj	Y, Y, Y	e1-los (long)786440	E1LOS 0x000C0008	Loss Of Signal.	Check receive signal at Near-end.
9	Comm	Min	Y, Y, Y	e1-loopback (long)786441	E1LOOPBACK 0x000C0009	Facility in Loopback.	None: facility under test.
Alarm type: 13 Alarm type = IMA-group (13) Index1 = IfIndex (of IMA-Group), Index2 = not used							
1	Comm	Min	Y, Y, Y	ima-grp-fe-su (long)851969	STARTUP 0x000D0001	Far-end starting up.	Check Far-end IMA group configuration.
2	Comm	Min	Y, Y, Y	ima-grp-fe-cfg (long)851970	CFGABORT 0x000D0002	Far-end failed configuration.	Check configurations supported on Near-end and Far-end.
3	Comm	Min	Y, Y, Y	ima-grp-ne-cfg (long)851971	CFGABORT 0x000D0003	Near-end failed configuration.	Check configurations supported on Near-end and Far-end.
4	Comm	Min	Y, Y, Y	ima-grp-fe-nl (long)851972	INSUFLNKS 0x000D0004	Insufficient number of links at Far-end.	Check status of links at Far-end.
5	Comm	Min	Y, Y, Y	ima-grp-ne-nl (long)851973	INSUFLNKS 0x000D0005	Insufficient number of links at Near-end.	Check status of links at Near-end.
6	Comm	Min	Y, Y, Y	ima-grp-fe-blk (long)851974	BLOCKED 0x000D0006	Far-end is blocked.	Check status of Far-end IMA Group.
Alarm type: 14 Alarm type = IMA-link (14) Index1 = IfIndex (of IMA-Link), Index2 = not used.							
2	Comm	Min	Y, Y, Y	ima-lnk-lif (long)917506	LIF 0x000E0002	Loss of IMA Frame.	Check clock associated with this link.
3	Comm	Min	Y, Y, Y	ima-lnk-lods (long)917507	LODS 0x000E0003	Link Out of Delay Synchronization.	Check clock configuration for the associated Group.

(8 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
4	Comm	Min	Y, Y, Y	ima-lnk-misc (long)917508	MISCONN 0x000E0004	Link Misconnect.	Check link configuration at Far-end.
5	Comm	Min	Y, Y, Y	ima-lnk-rfi (long)917509	RFI_IMA 0x000E0005	Link Remote Failure Indication.	Check state of associated facility.
6	Comm	Min	Y, Y, Y	ima-lnk-fault (long)917510	FAULT_IMA 0x000E0006	Fault in Link Facility.	Check problems with associated facility.
7	Comm	Min	Y, Y, Y	ima-lnk-txblk (long)917511	UNUSABLE_IMA 0x000E0007	Transmit blocked due to Far-End.	Check link configuration at Far-end.
8	Comm	Min	Y, Y, Y	ima-lnk-rxblk (long)917512	UNUSABLE_IMA 0x000E0008	Receive blocked due to Far-End.	Check link configuration at Far-end.
Alarm type: 20 Alarm type = Redundancy (20) - Index1 = not used, Index2 = not used.							
1	Equ	Maj	N, Y, Y	loss-over-cap (unsigned long)1310721	SWCAP 0x00140001	Switchover capability in a redundant system has been lost.	Check link on standby NT. Check standby boards. Wait for Quench time-out.
3	Equ	Maj	Y, Y, Y	ping-check-fail (unsigned long)1310723	PINGFAIL 0x00140003	Notification alarm raised by NT in order to inform the operator that the ping connectivity check to the specific destination IP address has failed.	Check the Tx fiber. Check the default Gateway configuration. Check if the configured IP address of ping connectivity check is correct.
Alarm type: 23 Alarm type = SHDSL (23) Index1 = ifIndex (of SHDSL physical port), Index2 = device id.							
11	Comm	Min	Y, Y, Y	shdsl-n-loopback (long)1507339	SHDSL_N_LOOPBACK 0x0017000B	Loopback active at the network side.	Remove the loopback.
12	Comm	Min	Y, Y, Y	shdsl-c-loopback (long)1507340	SHDSL_C_LOOPBACK 0x0017000C	Loopback active at the customer side.	Remove the loopback.
13	Comm	Min	Y, Y, Y	shdsl-conferr (long)1507341	SHDSL_CONFERR 0x0017000D	Configuration Error.	Check configuration parameters supported by device.
14	Comm	Min	Y, Y, Y	shdsl-atm-lcd (long)1507342	SHDSL_ATM_LCD 0x0017000E	Loss of ATM cell delineation.	Check clock subsystem or ATM configuration.
15	Comm	Min	Y, Y, Y	shdsl-lpr (long)1507343	SHDSL_LPR 0x0017000F	Loss of Power at STU-R.	Check power supply at STU-R.
16	Comm	Min	Y, Y, Y	shdsl-secu-err (long)1507344	SHDSL_SECU_ERR 0x00170010	Unable to disable STU-R access.	Check devices that do not support disabling STU-R access.
17	Equ	Min	Y, Y, Y	shdsl-dev-fault (long)1507345	SHDSL_DEV_FAULT 0x00170011	Device Fault.	Check equipment.

(9 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
18	Comm	Min	Y, Y, Y	shdsl-atm-ncd (long)1507346	SHDSL_ATM_NCD 0x00170012	No ATM cell delineation.	Check clock subsystem or ATM configuration.
Alarm type: 24 Alarm type = EthIf (24) - Index1 = ifIndex of Ethernet interface, Index2 = see specific alarm number.							
2	Comm	Crit	Y, Y, Y	eth-link-down (long)1572866	ETHLINKDOWN 0x00180002	Ethernet Link Down alarm. Index2 = not used.	Check the Ethernet link.
Alarm type: 29 Alarm type = SwMgnt (29) - Index1 = eqptSlotId (Index in equipment Board Table), Index2 = not used.							
1	Proc	Maj	Y, Y, Y	sw-rollback (unsigned long)1900545	SWROLLBK 0x001D0001	The system is not able to make the NotActive OSWP and linked database operational (although no error in database is detected). The system performs an implicit rollback to the previous active OSWP (and linked database). Index1 = eqptSlotId of the NT.	Remove the corrupted OSWP (ABORT operation). Download the desired OSWP again. Activate the downloaded OSWP.
2	Proc	Maj	Y, Y, Y	db-rollback (unsigned long)1900546	DBROLLBK 0x001D0002	The system is not able to make the selected OSWP and linked database operational (error detected in the linked database). The system comes up with the selected OSWP and the previous linked database (if possible). Index1 = eqptSlotId of the NT.	Download the desired database again.
4	Proc	Maj	Y, Y, Y	xvps-inv-dbase (unsigned long)1900548	XVPS_INVDB 0x001D0004	Alarm raised by NT in case of a Xvps experiences a database corruption, the Xvps board starts with a default database. Index1 = lowest eqptSlotId of the Xvps pair.	Download the desired database again. Restore the desired database.
5	Proc	Maj	Y, Y, Y	inv-cde-file (unsigned long)1900549	XVPS_INVCDE 0x001D0005	Alarm raised by NT in case of an Xvps experiences a Customer Dependent Engineering file corruption, the Xvps board will start with default CDE values. Index1 = lowest eqptSlotId of the Xvps pair.	Download the desired CDE file again. Activate the downloaded CDE file.
6	Proc	Maj	Y, Y, Y	miss-cde-file (unsigned long)1900550	MISSCDE 0x001D0006	When a LSM request to download a CDE file from the NT, but the NT does not find this type of CDE file, the NT shall raise this alarm.	Download the desired CDE file again. Activate the downloaded CDE file.

(10 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
8	Proc	Maj	Y, Y, Y	cde-hash-error (unsigned long)1900552	CDEHASHERR 0x001D0008	Alarm raised by NT when activation of a new CDE profile failed because the CDE profile hash key is wrong.	Download a new CDE profile with valid hash key. Activate the downloaded CDE profile.
9	Proc	Maj	N, Y, Y	low-disk-space (unsigned long)1900553	OSWPDLDNOSPACE 0x001D0009	Alarm raised by NT when there is insufficient space for Sw download. A cleanup and re-download is required.	Cleanup the software storage and re-download.
Alarm type: 34 TmpFilter (34) - Index1 = 0, Index2 = 0 Remark: These values will be inherited from related basic alarm.							
1	Der	Ind	N, N, N	der-temp1 (unsigned long)2228225	FILTER 0x00220001	Derived Alarm for Temporal Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related temporal filter.
2	Der	Ind	N, N, N	der-temp2 (unsigned long)2228226	FILTER 0x00220002	Derived Alarm for Temporal Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related temporal filter.
3	Der	Ind	N, N, N	der-temp3 (unsigned long)2228227	FILTER 0x00220003	Derived Alarm for Temporal Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related temporal filter.
4	Der	Ind	N, N, N	der-temp4 (unsigned long)2228228	FILTER 0x00220004	Derived Alarm for Temporal Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related temporal filter.
5	Der	Ind	N, N, N	der-temp5 (unsigned long)2228229	FILTER 0x00220005	Derived Alarm for Temporal Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related temporal filter.
6	Der	Ind	N, N, N	der-temp6 (unsigned long)2228230	FILTER 0x00220006	Derived Alarm for Temporal Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related temporal filter.
7	Der	Ind	N, N, N	der-temp7 (unsigned long)2228231	FILTER 0x00220007	Derived Alarm for Temporal Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related temporal filter.
8	Der	Ind	N, N, N	der-temp8 (unsigned long)2228232	FILTER 0x00220008	Derived Alarm for Temporal Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related temporal filter.
9	Der	Ind	N, N, N	der-temp9 (unsigned long)2228233	FILTER 0x00220009	Derived Alarm for Temporal Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related temporal filter.

(11 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
10	Der	Ind	N, N, N	der-temp10 (unsigned long)2228234	FILTER 0x0022000A	Derived Alarm for Temporal Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related temporal filter.
11	Der	Ind	N, N, N	der-temp11 (unsigned long)2228235	FILTER 0x0022000B	Derived Alarm for Temporal Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related temporal filter.
12	Der	Ind	N, N, N	der-temp12 (unsigned long)2228236	FILTER 0x0022000C	Derived Alarm for Temporal Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related temporal filter.
13	Der	Ind	N, N, N	der-temp13 (unsigned long)2228237	FILTER 0x0022000D	Derived Alarm for Temporal Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related temporal filter.
14	Der	Ind	N, N, N	der-temp14 (unsigned long)2228238	FILTER 0x0022000E	Derived Alarm for Temporal Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related temporal filter.
15	Der	Ind	N, N, N	der-temp15 (unsigned long)2228239	FILTER 0x0022000F	Derived Alarm for Temporal Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related temporal filter.
16	Der	Ind	N, N, N	der-temp16 (unsigned long)2228240	FILTER 0x00220010	Derived Alarm for Temporal Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related temporal filter.
17	Der	Ind	N, N, N	der-temp17 (unsigned long)2228241	FILTER 0x00220011	Derived Alarm for Temporal Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related temporal filter.
18	Der	Ind	N, N, N	der-temp18 (unsigned long)2228242	FILTER 0x00220012	Derived Alarm for Temporal Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related temporal filter.
19	Der	Ind	N, N, N	der-temp19 (unsigned long)2228243	FILTER 0x00220013	Derived Alarm for Temporal Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related temporal filter.
20	Der	Ind	N, N, N	der-temp20 (unsigned long)2228244	FILTER 0x00220014	Derived Alarm for Temporal Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related temporal filter.
21	Der	Ind	N, N, N	der-temp21 (unsigned long)2228245	FILTER 0x00220015	Derived Alarm for Temporal Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related temporal filter.

(12 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
22	Der	Ind	N, N, N	der-temp22 (unsigned long)2228246	FILTER 0x00220016	Derived Alarm for Temporal Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related temporal filter.
23	Der	Ind	N, N, N	der-temp23 (unsigned long)2228247	FILTER 0x00220017	Derived Alarm for Temporal Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related temporal filter.
24	Der	Ind	N, N, N	der-temp24 (unsigned long)2228248	FILTER 0x00220018	Derived Alarm for Temporal Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related temporal filter.
25	Der	Ind	N, N, N	der-temp25 (unsigned long)2228249	FILTER 0x00220019	Derived Alarm for Temporal Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related temporal filter.
26	Der	Ind	N, N, N	der-temp26 (unsigned long)2228250	FILTER 0x0022001a	Derived Alarm for Temporal Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related temporal filter.
27	Der	Ind	N, N, N	der-temp27 (unsigned long)2228251	FILTER 0x0022001b	Derived Alarm for Temporal Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related temporal filter.
28	Der	Ind	N, N, N	der-temp28 (unsigned long)2228252	FILTER 0x0022001c	Derived Alarm for Temporal Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related temporal filter.
29	Der	Ind	N, N, N	der-temp29 (unsigned long)2228253	FILTER 0x0022001d	Derived Alarm for Temporal Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related temporal filter.
30	Der	Ind	N, N, N	der-temp30 (unsigned long)2228254	FILTER 0x0022001e	Derived Alarm for Temporal Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related temporal filter.
31	Der	Ind	N, N, N	der-temp31 (unsigned long)2228255	FILTER 0x0022001f	Derived Alarm for Temporal Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related temporal filter.
Alarm type: 35 spaFilter (35)- Index1 = 1, Index2 = not used.							
1	Der	Ind	N, N, N	der-spa1 (unsigned long)2293761	FILTER 0x00230001	Derived Alarm for Spatial Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related spatial filter.

(13 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
2	Der	Ind	N, N, N	der-spa2 (unsigned long)2293762	FILTER 0x00230002	Derived Alarm for Spatial Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related spatial filter.
3	Der	Ind	N, N, N	der-spa3 (unsigned long)2293763	FILTER 0x00230003	Derived Alarm for Spatial Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related spatial filter.
4	Der	Ind	N, N, N	der-spa4 (unsigned long)2293764	FILTER 0x00230004	Derived Alarm for Spatial Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related spatial filter.
5	Der	Ind	N, N, N	der-spa5 (unsigned long)2293765	FILTER 0x00230005	Derived Alarm for Spatial Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related spatial filter.
6	Der	Ind	N, N, N	der-spa6 (unsigned long)2293766	FILTER 0x00230006	Derived Alarm for Spatial Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related spatial filter.
7	Der	Ind	N, N, N	der-spa7 (unsigned long)2293767	FILTER 0x00230007	Derived Alarm for Spatial Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related spatial filter.
8	Der	Ind	N, N, N	der-spa8 (unsigned long)2293768	FILTER 0x00230008	Derived Alarm for Spatial Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related spatial filter.
9	Der	Ind	N, N, N	der-spa9 (unsigned long)2293769	FILTER 0x00230009	Derived Alarm for Spatial Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related spatial filter.
10	Der	Ind	N, N, N	der-spa10 (unsigned long)2293770	FILTER 0x0023000a	Derived Alarm for Spatial Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related spatial filter.
11	Der	Ind	N, N, N	der-spa11 (unsigned long)2293771	FILTER 0x0023000b	Derived Alarm for Spatial Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related spatial filter.
12	Der	Ind	N, N, N	der-spa12 (unsigned long)2293772	FILTER 0x0023000c	Derived Alarm for Spatial Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related spatial filter.
13	Der	Ind	N, N, N	der-spa13 (unsigned long)2293773	FILTER 0x0023000d	Derived Alarm for Spatial Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related spatial filter.

(14 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
14	Der	Ind	N, N, N	der-spa14 (unsigned long)2293774	FILTER 0x0023000e	Derived Alarm for Spatial Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related spatial filter.
15	Der	Ind	N, N, N	der-spa15 (unsigned long)2293775	FILTER 0x0023000f	Derived Alarm for Spatial Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related spatial filter.
16	Der	Ind	N, N, N	der-spa16 (unsigned long)2293776	FILTER 0x00230010	Derived Alarm for Spatial Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related spatial filter.
17	Der	Ind	N, N, N	der-spa17 (unsigned long)2293777	FILTER 0x00230011	Derived Alarm for Spatial Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related spatial filter.
18	Der	Ind	N, N, N	der-spa18 (unsigned long)2293778	FILTER 0x00230012	Derived Alarm for Spatial Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related spatial filter.
19	Der	Ind	N, N, N	der-spa19 (unsigned long)2293779	FILTER 0x00230013	Derived Alarm for Spatial Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related spatial filter.
20	Der	Ind	N, N, N	der-spa20 (unsigned long)2293780	FILTER 0x00230014	Derived Alarm for Spatial Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related spatial filter.
21	Der	Ind	N, N, N	der-spa21 (unsigned long)2293781	FILTER 0x00230015	Derived Alarm for Spatial Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related spatial filter.
22	Der	Ind	N, N, N	der-spa22 (unsigned long)2293782	FILTER 0x00230016	Derived Alarm for Spatial Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related spatial filter.
23	Der	Ind	N, N, N	der-spa23 (unsigned long)2293783	FILTER 0x00230017	Derived Alarm for Spatial Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related spatial filter.
24	Der	Ind	N, N, N	der-spa24 (unsigned long)2293784	FILTER 0x00230018	Derived Alarm for Spatial Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related spatial filter.
25	Der	Ind	N, N, N	der-spa25 (unsigned long)2293785	FILTER 0x00230019	Derived Alarm for Spatial Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related spatial filter.

(15 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
26	Der	Ind	N, N, N	der-spa26 (unsigned long)2293786	FILTER 0x0023001a	Derived Alarm for Spatial Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related spatial filter.
27	Der	Ind	N, N, N	der-spa27 (unsigned long)2293787	FILTER 0x0023001b	Derived Alarm for Spatial Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related spatial filter.
28	Der	Ind	N, N, N	der-spa28 (unsigned long)2293788	FILTER 0x0023001c	Derived Alarm for Spatial Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related spatial filter.
29	Der	Ind	N, N, N	der-spa29 (unsigned long)2293789	FILTER 0x0023001d	Derived Alarm for Spatial Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related spatial filter.
30	Der	Ind	N, N, N	der-spa30 (unsigned long)2293790	FILTER 0x0023001e	Derived Alarm for Spatial Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related spatial filter.
31	Der	Ind	N, N, N	der-spa31 (unsigned long)2293791	FILTER 0x0023001f	Derived Alarm for Spatial Filter.	1. Check the cause of related basic alarm. 2. Check the setting of related spatial filter.
Alarm type: 38 Alarm type = Xdsl (38) - Index1 = ifIndex of Xdsl physical port, Index2 = not used.							
1	Comm	Min	Y, Y, Y	xdsl-ne-los (long)2490369	LOS_O 0x00260001	Near End Loss of Signal.	Check physical line.
2	Comm	Min	Y, Y, Y	xdsl-ne-lof (long)2490370	LOF_O 0x00260002	Near End Loss of Frame.	Check modem equipment.
3	Comm	Min	Y, Y, Y	xdsl-ne-lom (long)2490371	LOM 0x00260003	Near End Loss of Margin.	Check physical line (new disturbers, ...).
4	Comm	Min	Y, Y, Y	xdsl-ne-ese (long)2490372	ESE 0x00260004	Near End Excessive Severe Errors.	Check physical communication medium.
5	Comm	Crit	Y, Y, Y	xdsl-act-cfg-error (long)2490373	BADPROF 0x00260005	Line configuration data cannot be used.	Update profile parameters. Assure that the pilot tones are not masked. In case G.lite is used, assure that the bit rates fit within the standard.
6	Comm	Maj	Y, Y, Y	xdsl-act-not-feas (long)2490374	CAPINSU 0x00260006	Line capacity not high enough to set up requested profile.	Check configuration data. Check physical line (length, noise, ...).
7	Comm	Min	Y, Y, Y	xdsl-up-br-reach (long)2490375	LORATE 0x00260007	Upstream Planned Bitrate not reached after initialization.	Lower planned upstream bitrate.

(16 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
8	Comm	Min	Y, Y, Y	xdsl-ne-ncd (long)2490376	NCD 0x00260008	Near End No Cell Delineation.	Check quality of the line.
9	Comm	Min	Y, Y, Y	xdsl-ne-lcd (long)2490377	LCD 0x00260009	Near End Loss Of Cell Delineation.	Check quality of the line.
10	Comm	Min	Y, Y, Y	xdsl-fe-los (long)2490378	LOS_O 0x0026000A	Far End Loss of Signal.	Check physical line.
11	Comm	Min	Y, Y, Y	xdsl-fe-lof (long)2490379	LOF_O 0x0026000B	Far End Loss of Frame.	Check modem equipment.
12	Comm	Min	Y, Y, Y	xdsl-fe-lpr (long)2490380	LPR 0x0026000C	Far End Loss of Power (dying gasp detected).	None (normal power-down of CPE).
13	Comm	Min	Y, Y, Y	xdsl-fe-lol (long)2490381	LOL 0x0026000D	Far End Loss of Link (no dying gasp detected).	Check physical line.
14	Comm	Min	Y, Y, Y	xdsl-fe-lom (long)2490382	LOM 0x0026000E	Far End Loss of Margin.	Check physical line (new disturbers).
15	Comm	Min	Y, Y, Y	xdsl-fe-ese (long)2490383	ESE 0x0026000F	Far End Excessive Severe Errors.	Check physical line.
16	Comm	Maj	Y, Y, Y	xdsl-act-comm (long)2490384	INICOMM 0x00260010	No successful initialization due to communication problems.	Check peer modem type. Check physical line.
17	Comm	Min	Y, N, Y	xdsl-act-modem (long)2490385	NOPEER 0x00260011	No peer modem detected.	Wait till modem connected. Check physical line.
18	Comm	Min	Y, Y, Y	xdsl-do-br-reach (long)2490386	LORATE 0x00260012	Downstream Planned Bitrate not reached after initialization.	Lower planned downstream bitrate.
19	Comm	Min	Y, Y, Y	xdsl-fe-ncd (long)2490387	NCD 0x00260013	Far End No Cell Delineation.	Check quality of the line.
20	Comm	Min	Y, Y, Y	xdsl-fe-lcd (long)2490388	LCD 0x00260014	Far End Loss Of Cell Delineation.	Check quality of the line.
23	Comm	Min	Y, Y, Y	xdsl-fe-upbo-vio (long)2490391	UPBOVIOLATION 0x00260017	Far End UPBO Violation.	Check peer modem type.
24	Comm	Maj	Y, Y, Y	xdsl-fe-cpe-pol (long)2490392	CPEPOLICING 0x00260018	Activation Failure CPE Policing.	Check peer modem type.
25	Comm	Maj	Y, N, N	xdsl-tpstc-mis (long)2490393	TPSTCMIS 0x00260019	A mismatch is detected between the configured TPS-TC mode and the mode supported by the connected CPE.	Check peer modem type or change the TPS-TC mode of the line.

(17 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
26	Comm	Maj	Y, Y, Y	xdsl-frtx-init-fail (long)2490394	FRTXINITF 0x0026001A	No successful initialization due to forced RTX while RTX is not supported at one or both ends.	Ensure that Standard ARQ (ITU-T G.998.4) is supported at both ends (LT, CPE) or modify/unconfigure the retransmission (RTX) profile.
27	Comm	Min	Y, Y, Y	xdsl-vect-dle (long)2490395	DLE 0x0026001B	Loss of upstream signal due to disorderly leaving event.	Check physical line.
29	Comm	Min	N, N, N	xdsl-fe-mis-peer-35b (long)2490397	MISPEER35B 0x0026001D	Mismatch between the configured op-mode and the op-mode supported by the connected CPE.	Check for CPE type.
Alarm type: 39 Alarm type = xDSLTca (39) - Index1 = ifIndex of Xdsl physical port, Index2 = not used.							
1	QOS	Min	N, Y, Y	xtca-ne-es (long)2555905	T_ES 0x00270001	The number of errored seconds encountered by the ADSL line in the current 15 minutes interval has reached its threshold value.	Check physical line. Check modem equipment.
2	QOS	Min	N, Y, Y	xtca-ne-ses (long)2555906	T_SES 0x00270002	The number of severely errored seconds encountered by the ADSL line in the current 15 minutes interval has reached its threshold value.	Check physical line. Check modem equipment.
3	QOS	Min	N, Y, Y	xtca-ne-uas (long)2555907	T_UAS 0x00270003	The number of unavailable seconds encountered by the ADSL line in the current 15 minutes interval has reached its threshold value.	Check physical line. Check modem equipment.
4	QOS	Min	N, Y, Y	xtca-ne-day-es (long)2555908	T_ES 0x00270004	The number of errored seconds encountered by the ADSL line in the current one-day interval has reached its threshold value.	Check physical line. Check modem equipment.
5	QOS	Min	N, Y, Y	xtca-ne-day-ses (long)2555909	T_SES 0x00270005	The number of severely errored seconds encountered by the ADSL line in the current one-day interval has reached its threshold value.	Check physical line. Check modem equipment.

(18 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
6	QOS	Min	N, Y, Y	xtca-ne-day-uas (long)2555910	T_UAS 0x00270006	The number of unavailable seconds encountered by the ADSL line in the current one-day interval has reached its threshold value.	Check physical line. Check modem equipment.
7	QOS	Min	N, Y, Y	xtca-fe-es (long)2555911	T_ES 0x00270007	The number of errored seconds encountered by the ADSL far end line in the current 15 minutes interval has reached its threshold value.	Check physical line. Check modem equipment.
8	QOS	Min	N, Y, Y	xtca-fe-ses (long)2555912	T_SES 0x00270008	The number of severely errored seconds encountered by the ADSL far end line in the current 15 minutes interval has reached its threshold value.	Check physical line. Check modem equipment.
9	QOS	Min	N, Y, Y	xtca-fe-uas (long)2555913	T_UAS 0x00270009	The number of unavailable seconds encountered by the ADSL far end line in the current 15 minutes interval has reached its threshold value.	Check physical line. Check modem equipment.
10	QOS	Min	N, Y, Y	xtca-fe-day-es (long)2555914	T_ES 0x0027000A	The number of errored seconds encountered by the ADSL far end line in the current one-day interval has reached its threshold value.	Check physical line. Check modem equipment.
11	QOS	Min	N, Y, Y	xtca-fe-day-ses (long)2555915	T_SES 0x0027000B	The number of severely errored seconds encountered by the ADSL far end line in the current one-day interval has reached its threshold value.	Check physical line. Check modem equipment.
12	QOS	Min	N, Y, Y	xtca-fe-day-uas (long)2555916	T_UAS 0x0027000C	The number of unavailable seconds encountered by the ADSL far end line in the current one-day interval has reached its threshold value.	Check physical line. Check modem equipment.

(19 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
13	QOS	Min	N, Y, Y	xtca-leftrs (long)2555917	T_LEFTRS 0x0027000D	The number of low error free throughput seconds encountered by the Xdsl line in the current 15 minutes interval has reached its threshold value.	1. Check physical line. 2. Check modem equipment. 3. If 1. and 2. didn't solve the problem, check whether the RTX configuration is in accordance with the noise conditions expected/observed on the line.
14	QOS	Min	N, Y, Y	xtca-day-leftrs (long)2555918	T_LEFTRS 0x0027000E	The number of low error free throughput seconds encountered by the Xdsl line in the current one-day interval has reached its threshold value.	1. Check physical line. 2. Check modem equipment. 3. If 1. and 2. didn't solve the problem, check whether the RTX configuration is in accordance with the noise conditions expected/observed on the line.
15	QOS	Min	N, Y, Y	xtca-fe-leftrs (long)2555919	T_LEFTRS 0x0027000F	The number of low error free throughput seconds encountered by the Xdsl far end line in the current 15 minutes interval has reached its threshold value.	1. Check physical line. 2. Check modem equipment. 3. If 1. and 2. didn't solve the problem, check whether the RTX configuration is in accordance with the noise conditions expected/observed on the line.
16	QOS	Min	N, Y, Y	xtca-fe-day-leftrs (long)2555920	T_LEFTRS 0x00270010	The number of low error free throughput seconds encountered by the Xdsl far end line in the current one-day interval has reached its threshold value.	1. Check physical line. 2. Check modem equipment. 3. If 1. and 2. didn't solve the problem, check whether the RTX configuration is in accordance with the noise conditions expected/observed on the line.
17	QOS	Min	N, Y, Y	xtca-auto-port-reset (long)2555921	T_AUTOPORTRESET 0x00270011	The total number of automatic port reset attempts has reached its threshold value (within the 1 week sliding window).	Check physical line. Check modem equipment.
18	QOS	Min	N, Y, Y	xtca-reinit (long)2555922	T_REINIT 0x00270012	The number of reinitialization encountered by the Xdsl near end line in the curren+t 15min interval has reached its threshold value.	Check physical line. Check modem equipment.

(20 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
19	QOS	Min	N, Y, Y	xtca-day-reinit (long)2555923	T_REINIT 0x00270013	The number of reinitialization encountered by the Xdsl near end line in the current 1 Day interval has reached its threshold value.	Check physical line. Check modem equipment.
20	QOS	Min	N, Y, Y	xtca-spontintrpt (long)2555924	T_SPONTANEOUSINTERRUPT 0x00270014	The number of Spontaneous Interrupt encountered by the Xdsl near end line in the current 15min interval has reached its threshold value.	Check physical line. Check modem equipment.
21	QOS	Min	N, Y, Y	xtca-day-spontintrpt (long)2555925	T_SPONTANEOUSINTERRUPT 0x00270015	The number of Spontaneous Interrupt encountered by the Xdsl near end line in the current 1 Day interval has reached its threshold value.	Check physical line. Check modem equipment.
Alarm type: 40 Alarm type = ONT PLOAM (40) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponOntEquipIfIndex (IfIndex of ONT), Index2 = not used.							
1	Comm	Maj	Y, Y, Y	ont-ploam-loss-sig (long)2621441	LOS_O 0x00280001	Loss of Signal at ONT (2nd highest priority for any type of ONT alarm, following INACT alarm).	Check receive signal at ONT.
2	Comm	Maj	Y, Y, Y	ont-ploam-loss-ack (long)2621442	LOA 0x00280002	Loss of Acknowledge from ONT.	See if isolated for specific ONT (if not, likely a software error).
4	Comm	Maj	Y, Y, Y	ont-ploam-loss-cd (long)2621444	LCD 0x00280004	Loss of GEM/ATM Channel Delineation of ONT. Only supported for GPON.	Check quality of line from ONT.
6	Comm	Maj	Y, Y, Y	ont-ploam-phy-eqpt-err (long)2621446	PEE 0x00280006	Physical Equipment Error of ONT. Only supported for GPON.	Perform loop back tests.
7	Comm	Maj	Y, Y, Y	ont-ploam-startup-fail (long)2621447	SUF 0x00280007	Startup Failure in Ranging of ONT.	Re-range the ONT.
9	Comm	Maj	Y, Y, Y	ont-ploam-sig-degrade (long)2621449	SD 0x00280009	Signal Degrade BER threshold exceeded from ONT.	Check quality of line from ONT. Signal Degrade BER exceeded.
12	Comm	Maj	Y, Y, Y	ont-ploam-disabled (long)2621452	ONTDISABLED 0x0028000C	ONT has been autonomously disabled because of misbehaving transmissions. This is actually a defense alarm so that the ONT doesn't affect the entire PON. This is also declared for ROGUE ONT detection.	Reset ONT by administratively putting it OOS and then IS. If alarm occurs again, then ONT must likely be physically repaired or swapped. Note: this can occur due to detection of a ROGUE ONT.

(21 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
13	Comm	Maj	Y, Y, Y	ont-ploam-err-msg (long)2621453	MEM 0x0028000D	Message Error Message from ONT. Only supported for GPON.	See if isolated for specific ONT (if not, likely a software error).
15	Comm	Maj	Y, Y, Y	ont-ploam-inactive (long)2621455	INACT 0x0028000F	ONT is Inactive (1st highest priority of any type of ONT alarm).	ONT needs to be ranged (made active).
17	Comm	Maj	Y, Y, Y	ont-ploam-sig-fail (long)2621457	SF 0x00280011	Signal Fail BER threshold exceeded from ONT.	Check quality of line from ONT. Signal Fail BER exceeded.
18	Comm	Min	Y, Y, Y	ont-ploam-dying-gasp (long)2621458	DG 0x00280012	Received Dying Gasp indication from ONT.	Restore power to ONT. Dying gasp indication is due to loss of power input to ONT.
19	Comm	Maj	Y, Y, Y	ont-ploam-deact-fail (long)2621459	DF 0x00280013	Deactivate Failure of ONT.	1. Reset ONT. 2. Replace ONT if Deactivate failure persists.
20	Comm	Maj	Y, Y, Y	ont-ploam-oam (long)2621460	LOAM 0x00280014	Loss of PLOAM for ONT.	1. Check receive signal at ONT. 2. Reset ONT. 3. If Loss of PLOAM alarm persists, replace ONT.
21	Comm	Maj	Y, Y, Y	ont-ploam-win-drift (long)2621461	DOW 0x00280015	Drift of Window. Indicates that the OLT received shifted upstream bursts from that ONU.	None. While the condition indicates a deviation in the ONU's upstream transmission, it is still within the acceptable tolerance and it remains correctable by the OLT via EqD update. Alarm will be cleared when the OLT receives the ONU's upstream transmission in the correct position. If the deviation continues and worsens beyond the OLT's acceptable tolerance, the OLT will automatically deactivate the offending ONU to protect other ONUs on the PON.
22	Comm	Maj	Y, Y, Y	ont-ploam-rdi (long)2621462	RDI 0x00280016	Remote Defect Indication from ONT. Only supported for GPON.	Check receive signal at ONT. The OLT transmission was received with errors at the ONT.
24	Comm	Maj	Y, Y, Y	ont-ploam-loss-ks (long)2621464	LOKS 0x00280018	Loss of Key synchronization between OLT and ONT. This key is used for the AES encryption algorithm between OLT and ONT. Only supported for GPON.	1. Check connectivity between OLT and ONT resulting in loss of key exchange PLOAM message between OLT and ONT. 2. Reset ONT. If condition persists, replace ONT.

(22 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
25	Comm	Min	N, Y, Y	ont-ploam-pwr-burst (long)2621465	ONTPWRERR 0x00280019	ONT Power up error. Extraneous power bursts have been detected for this ONT. Only supported for GPON.	ONT power up error. Extraneous power bursts have been detected for this ONT. ONT Power Up Error alarm clears automatically within 15 minutes. If issue persists, either replace ONT, or disable feature via SET-NE-ALL to Normal Soak Mode.
26	Comm	Maj	Y, Y, Y	ont-ploam-rog-disa (long)2621466	ROGUEONTDIS 0x0028001A	ONT has been autonomously disabled because of misbehaving transmissions and is thought to be a ROGUE ONT. This is actually a defense alarm so that the ONT doesn't affect the entire PON.	1. Reset ONT by administratively putting it OOS and then IS. If alarm occurs again, then ONT must likely be physically repaired or swapped.
27	Comm	Maj	N, Y, Y	ont-ploam-diff-reach (long)2621467	DIFREACH 0x0028001B	ONT has been deactivated because its location on the PON has exceeded its differential reach capability.	ONT has been deactivated because its location on the PON has exceeded its differential reach capability. Alarm clears when ONT is disconnected from PON.
28	Comm	Maj	Y, Y, Y	ont-ploam-looc (long)2621468	LOOC 0x0028001C	Loss of OMCI Channel due to persistent MIC failure.	1. Power Cycle the ONT unit. 2. If problem persists after a power cycle of the ONT unit, re-program registration ID into ONT unit. 3. If problem persists after registration ID re-programming, replace the ONT unit.
Alarm type: 41 Alarm type = ONT General (41) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponOntEquipIfIndex (IfIndex of ONT), Index2 = not used.							
1	Comm	Maj	Y, Y, Y	ont-gen-omci-fail (long)2686977	OMCICOMM 0x00290001	ONT fails to respond to OMCI message requests (Loss of communications).	1. Attempt to restart the ONT.
2	Equ	Maj	Y, Y, Y	ont-gen-eqpt-selftest (long)2686978	EQPT_ONT 0x00290002	ONT has failed a self-test (either autonomous or operator commanded).	Command another ONT self-test. If Pass, OK. If Fail, implement creative diagnostics.
3	Env	Min	N, Y, Y	ont-gen-ac-pwr-fail (long)2686979	ACFAIL_ONT 0x00290003	Loss of external AC power to the ONT.	Wait for or repair AC power to ONT.
4	Equ	Min	N, Y, Y	ont-gen-bat-missing (long)2686980	BATTMISS 0x00290004	Battery is provisioned for ONT, but is missing.	Change provisioning or determine why battery is missing.

(23 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
5	Equ	Min	N, Y, Y	ont-gen-bat-low (long)2686981	BATTLOW 0x00290005	Battery charge is low.	If power is present, determine why battery won't charge, or why its low.
6	Equ	Min	N, Y, Y	ont-gen-bat-fail (long)2686982	BATTFAIL 0x00290006	Battery is provisioned and present, but cannot recharge.	Customer needs to replace.
7	Comm	Maj	N, Y, Y	ont-gen-phys-intrusion (long)2686983	INTRUDER 0x00290007	Unauthorized access to ONT(MDU). Door or box is open.	Investigate ONT for possible illegal physical access to ONT (MDU).
8	Equ	Min	N, Y, Y	ont-gen-sw-dnload-f (long)2686984	SWDLFAIL 0x00290008	Download of software to ONT has failed.	1. Retry the download again. 2. If it fails again, manually clear the alarm (e.g. changed Planned version). Call Nokia customer service.
9	Equ	Maj	Y, Y, Y	ont-gen-sw-act-fail (long)2686985	SWACTFAIL 0x00290009	ONT failed to activate the passive image designated by the OLT.	1. Retry another activation (e.g. changed Planned version to Current Passive version). 2. If it fails again, manually clear the alarm (e.g. changed Planned version). Call Nokia customer service.
11	Equ	Min	N, Y, Y	ont-gen-sw-dnload-p (long)2686987	SWDLIP 0x0029000B	A condition meaning that a transfer of ONT software from the OLT to the ONT is pending or is actually being transmitted.	Not a problem. This is a transient condition that self clears once download activity ceases.
12	Equ	Maj	Y, Y, Y	ont-gen-eqpt-vers-mis (long)2686988	ONTEQVM 0x0029000C	A condition meaning the provisioned ONT equipment part number does not match the version reported by the ONT.	1. Change the provisioned Version ID to match the reported Version ID, or 2. change the physical ONT so that the reported Version ID will match the provisioned Version ID.
16	Equ	Min	N, Y, Y	ont-gen-sw-vers-mis (long)2686992	SWVER 0x00290010	A condition meaning that the Planned software version does not equal the Active software version.	1. Make the Active version equal Planned version via successful activation or 2. make the Planned version equal Active version via operator update.
17	Equ	Maj	Y, Y, Y	ont-gen-us-rate-mis (long)2686993	ONTUSRATE 0x00290011	ONT Mismatch detected between actual and planned upstream rate.	Correct the ONT configuration for the uptream rate.
23	Equ	Maj	Y, Y, Y	ont-gen-eqpt-prov-sa (long)2686999	ONTMEA 0x00290017	ONT failed to be provisioned. Mismatch between ONT Equipment and ONT provisioning attributes.	Provisioned attributes failed to be provisioned in ONT. Check ONTs supported features. Delete the ONT and reprovision.

(24 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
24	Env	Ind	N, Y, Y	ont-gen-mdu-env1 (long)2687000	ENV1_ONT 0x00290018	MDU Environmental Alarm #1.	Check external equipment connected to MDU Alarm Input #1.
25	Env	Ind	N, Y, Y	ont-gen-mdu-env2 (long)2687001	ENV2_ONT 0x00290019	MDU Environmental Alarm #2.	Check external equipment connected to MDU Alarm Input #2.
26	Env	Ind	N, Y, Y	ont-gen-mdu-env3 (long)2687002	ENV3_ONT 0x0029001A	MDU Environmental Alarm #3.	Check external equipment connected to MDU Alarm Input #3.
28	Comm	Min	N, Y, Y	ont-gen-nw-time-err (long)2687004	NTPERR 0x0029001C	A condition meaning the ONT is unable to establish timing from the NTP server(s).	This alarm indicates the ONT has never been able to reach and get time from a NTP server. A 30 minute alarm declaration interval is started when the NTP and VoIP clients are both enabled, and ends as soon as the ONT syncs with the NTP server. Note: if the ONT successfully gets time from an NTP server and then loses contact with it, the alarm is not raised. To troubleshoot. 1. Check NTP server accessibility and ONT provisioning configuration. 2. Restart the ONT to see if alarm returns.
29	Comm	Maj	Y, Y, Y	ont-gen-opt-sig-high (long)2687005	LEVELHI 0x0029001D	Received Optical signal level is too HIGH.	Check Received Optical signal and decrease signal level.
30	Comm	Maj	Y, Y, Y	ont-gen-opt-sig-low (long)2687006	LEVELLO 0x0029001E	Received Optical signal level is too LOW.	Check Received Optical signal and increase signal level.
31	Equ	Min	N, Y, Y	ont-gen-eqpt-prov-nsa (long)2687007	ONTNSAMEA 0x0029001F	ONT failed to be provisioned. Mismatch between ONT Equipment and ONT provisioning attributes. Non Service Affecting.	Non service affecting provisioned attributes failed to be provisioned in ONT. Check supported capabilites of ONT and deprovision unsupported features.
Alarm type: 42 Alarm type = ONT TCA (42) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponOntEquipIfIndex (IfIndex of ONT), Index2 = not used.							

(25 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
1	Env	Min	N, Y, Y	ont-cpu-util-tca (long)2752513	CPUUTIL_TCA 0x002A0001	CPU Average Utilization of ONT reaches the threshold value.	1. Check Receive PON signal at ONT. 2. Check Transmit PON signal at OLT. 3. Reset ONT. 4. Replace ONT if PM counts persist. 5. Replace associated LT at OLT if PM counts persist.
2	Env	Min	N, Y, Y	ont-mem-util-tca (long)2752514	MEMUTIL_TCA 0x002A0002	Memory Utilization of ONT reaches the threshold value.	1. Check Receive PON signal at ONT. 2. Check Transmit PON signal at OLT. 3. Reset ONT. 4. Replace ONT if PM counts persist. 5. Replace associated LT at OLT if PM counts persist.
Alarm type: 45 Alarm type = OLT General (45) - For GPON and XGS-PON dual-rate Index1 = gponPonConfigIfIndex (IfIndex of PON), Index2 = See Specific Alarm. For NG-PON2 - Not Supported							
1	Equ	Crit	Y, Y, Y	olt-gen-pon-com-fail (long)2949121	PONCOMMFAIL 0x002D0001	PON Communication Failure on OLT Port. Index2 not used.	Suggest to put the PON interface administratively down then up again. Alternatively, try to pull out then plug back the OLT optical module in the cage..
2	Equ	Crit	Y, Y, Y	olt-gen-tx-fail (long)2949122	TXFAIL 0x002D0002	Transmitter Failure on OLT Port. Index2 not used.	Laser of OLT optical module could be damaged. Consider replacing the module.

(26 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
7	Equ	Min	N, Y, Y	olt-gen-unprov-ont (long)2949127	NEWONT 0x002D0007	An unprovisioned ONT has been discovered on the PON. (Index 2 = 1 to 128). This Index 2 points to a SNMP table (bponPonDiscovOntTable) entry that contains the Serial Number, SLID, LOID and UsRate of the discovered ONT. SNMP table also contains additional appended text. DISABLED meaning ONT has been told via a PLOAM message to turn off its laser. PWRERR meaning extraneous power bursts have been detected for this ONT. DIFREACH meaning ONT has been deactivated because its location on the PON has exceeded its differential reach capability. 'Null string' (i.e. no text) meaning none of the above are true. Additional Info contains the values for Serial Number, SLID, LOID of the discovered ONT. E.G. SERNUM=ALCL00000001 , SLID=SLIDabcd0001, LOID=admin1. In case of XGSPON the additional info also contains the Upstream Rate (USRATE). E.G. SERNUM=ALCL00000001 , SLID=SLIDabcd0001, LOID=admin1, USRATE=10g.	No repair necessary, indication to operator that further provisioning should commence newly installed ONT/MDU on PON.
8	Equ	Maj	Y, Y, Y	olt-gen-pon-eqpt-prov (long)2949128	PONMEA 0x002D0008	PON failed to be provisioned. Mismatch between PON Equipment and PON provisioning attributes. Index2 not used.	Provisioned attributes failed to be provisioned for PON. Reprovision the PON.

(27 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
9	Comm	Maj	Y, Y, Y	olt-gen-pon-loss-sig (long)2949129	PONLOS 0x002D0009	PON Loss of Signal. OLT is not receiving any upstream transmissions. Index2 not used.	The fiber connected to the corresponding OLT optical module could be damaged or broken. Check that there is no fiber cut on the feeder section. Check that the fiber connector is correctly inserted in the OLT optical module. Alternatively, the Loss of Signal could be caused by the presence of a rogue ONU connected to the PON. Consider running a Rogue Test. Please note that a Loss of Signal alarm is also raised when none of the provisioned ONUs are connected on the PON.
10	Equ	Maj	N, Y, Y	olt-gen-pon-diagnostic (long)2949130	PONROGUETEST 0x002D000A	Indicates that a Rogue ONU detection test (part of PON diagnostics) is currently running on the PON. Index 2 not used.	Wait for test to complete or abort/stop current test. Once test completes, look for any ONTs diagnosed as misbehaving (INACT alarm) and resolve.
13	Equ	Min	N, Y, Y	olt-gen-loid-conflict (long)2949133	LOIDCONFLICT 0x002D000D	An ONT has been discovered on the PON (Index 2 = 1 to 128). But it's LOID is already in use. This Index 2 points to a SNMP table (bponPonDiscovOntTable) entry that contains the Serial Number, SLID and LOID of the discovered ONT.	No repair necessary, indication to operator that there is a Loid Conflict ONT/MDU on the PON.
14	Equ	Min	N, Y, Y	olt-gen-loid-pwderr (long)2949134	LOIDPWDERR 0x002D000E	An ONT has been discovered on the PON (Index 2 = 1 to 128). But its LOID Password is not correct. This Index 2 points to a SNMP table (bponPonDiscovOntTable) entry that contains the Serial Number, SLID and LOID of the discovered ONT.	No repair necessary, indication to operator that there is a Loid Password Error ONT/MDU on the PON.

(28 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
15	Comm	Min	Y, Y, Y	none	PONSTKLASERDIS 0x002D000F	This alarm Indicates that due to 'rogue ONT testing' an 'unranged ONT' on the PON may have been DISABLED via OLT broadcast 'disable laser' command. Index 2 = not used.	Indicates that due to rogue ONT testing an unranged ONT on the PON may have been DISABLED via OLT broadcast disable laser command. This alarm clears automatically after 12 hours. If such an ONT was disabled, the only way to re-range it is to plan it via direct provisioning of its Serial Number. But prior to doing that, the physical ONT should be examined to determine if it has a stuck laser.
16	Equ	Maj	N, Y, Y	olt-gen-pon-alien-test (long)2949136	ALIENTEST 0x002D0010	Indicates that an Alien Detection Test (part of PON diagnostics) is currently running on the PON. Index 2 not used.	Wait for test to complete or abort/stop current test. Once test completes, look for PONALIENDETECTED alarm to resolve the problem.
17	Equ	Maj	N, Y, Y	olt-gen-alien-detect (long)2949137	PONALIENDETECTED 0x002D0011	Indicates that the OLT suspects the presence of an Alien end-user device on the PON, as a result of an Alien Detection Test. Index 2 not used.	A symptom of the presence of such Alien device on the PON can be that new ONUs are not able to range correctly. Check the last devices connected to the PON at the subscriber premises, as one of those is likely to dazzle the PON by continuously sending light in the upstream direction.
18	Equ	Maj	N, Y, Y	olt-gen-rng-mism (long)2949138	RNGMISMATCH 0x002D0012	Indicates that there are more ONUs physically connected on the PON than what is allowed by configuration (max-ranging-ont parameter). Index 2 not used.	Disconnect some ONUs from the PON or increase the parameter that is limiting the maximum number of ONUs allowed to be connected. The alarm is cleared after 12 hours or if the operator clears the alarm manually. The alarm will be raised again when the condition still exists.
19	Equ	Maj	N, Y, Y	olt-gen-sfp-mism (long)2949139	PONSFPMISMATCH 0x002D0013	This alarm indicates that there is a mismatch between the PON provisioned SFP laser characteristics and actual SFP laser transceiver that is plugged in.	This alarm indicates that there is a mismatch between the PON provisioned SFP laser characteristics and actual SFP laser transceiver that is plugged in. Either re-provision the PON to match the SFP. Or plug in a new SFP that matches the provisioning, or do both.

(29 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
20	Equ	Crit	N, Y, Y	olt-gen-deact-hightca (long)2949140	DEACTHIGHTCA 0x002D0014	Deactivated ONU (refers to ONU that is admin up and oper status down) amount has crossed the high threshold. Additional info : percent/number mode, # and % of adminup ONU, # and % of active ONU, # and % of deactivated ONU, # and % of dying gasp ONU (# is the number,% is the percent).	Check the reason that the ONUs under the PON are deactivated.
21	Equ	Warn	N, Y, Y	olt-gen-deact-lowtca (long)2949141	DEACTLOWTCA 0x002D0015	Deactivated ONU (refers to ONU that is admin up and oper status down) amount has crossed the low threshold. Additional info : percent/number mode, # and % of adminup ONU, # and % of active ONU, # and % of deactivated ONU, # and % of dying gasp ONU (# is the number,i % is the percent).	Check the reason that the ONUs under the PON are deactivated.
22	Equ	Maj	Y, Y, Y	olt-gen-dp-integ (long)2949142	PONDPINTEG 0x002D0016	This alarm is raised when the number of SIP configured and ranged ONTs in the PON having SIPREGTO alarm has crossed the data path integrity threshold OR this alarm is raised when the number of configured and ranged ONTs in the PON having OMCICOMM alarm has crossed the data path integrity threshold.	Check the reason for SIP Registration Timeout alarms on POTS lines associated with this PON or Check the reason for OMCICOMM alarms associated with this PON.
23	Equ	Crit	Y, Y, Y	olt-gen-ddr-fault (long)2949143	PONFAILDDR 0x002D0017	This alarm is raise when DDR Fault is detected in PONMAC chip.	Plug out/in the board or send board to repair.
Alarm type: 54 Alarm type = bonding (54) - Index1 = IfIndex (of Bonding-Group), Index2 = not used.							
1	Comm	Min	Y, Y, Y	up-plan-bitrate (unsigned long)3538945	BELOWPLANRATE 0x00360001	Group upstream actual bit rate is above the group upstream minimum bit rate but below the group upstream planned bit rate.	Lower Group Upstream Planned Bit Rate.
2	Comm	Min	Y, Y, Y	up-min-bitrate (unsigned long)3538946	BELOWMINRATE 0x00360002	Group upstream actual bit rate drops below the group upstream minimum bit rate.	Check physical line. Check line state.

(30 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
3	Comm	Maj	Y, Y, Y	up-config-not-feas (unsigned long)3538947	BELOWCONFRATE 0x00360003	Group upstream actual bit rate is not high enough to set up the configured group upstream minimum bit rate.	Check configuration data. Check physical line.
4	Comm	Min	Y, Y, Y	down-plan-bitrate (unsigned long)3538948	BELOWPLANRATE 0x00360004	Group downstream actual bit rate is above the group downstream minimum bit rate but below the group downstream planned bit rate.	Lower Group Downstream Planned Bit Rate.
5	Comm	Min	Y, Y, Y	down-min-bitrate (unsigned long)3538949	BELOWMINRATE 0x00360005	Group downstream actual bit rate drops below the group downstream minimum bit rate.	Check physical line. Check line state.
6	Comm	Maj	Y, Y, Y	down-config-not-feas (unsigned long)3538950	BELOWCONFRATE 0x00360006	Group downstream actual bit rate is not high enough to set up the configured group downstream minimum bit rate.	Check configuration data. Check physical line.
8	Comm	Min	Y, Y, Y	non-bonding-cpe (unsigned long)3538952	NOBONDCPE 0x00360008	Non bonding CPE modem is connected .	Check modem. Check physical line.
9	Comm	Maj	Y, Y, Y	multiple-cpes (unsigned long)3538953	BGMORECPE 0x00360009	The lines of the bonding group are connected multiple CPEs.	Check DSL wiring configuration. Check CPE.
10	Comm	Maj	Y, Y, Y	register (unsigned long)3538954	REGFAIL 0x0036000A	A discovery or aggregation register failure is detected.	Check CPE.
11	Comm	Min	N, Y, Y	group-incomplete (unsigned long)3538955	BGCOMPL 0x0036000B	Not all configured lines of the bonding group are part of the bonding group.	Check DSL wiring configuration. Check CPE.
Alarm type: 55 Alarm type = authentication (55) - Index1 = ifIndex of interface on which authentication takes place (i.e. the bridge port interface for 802.1x, the PPPoE interface for PPPoE, Index2 = not used.							
2	Proc	Maj	Y, Y, Y	vlan-assign-fail (unsigned long)3604482	AUTH_VLAN 0x00370002	Failure to assign a VLAN for a user session: unknown VLAN: VLAN returned by RADIUS server is not locally configured in the system; or no VLAN: RADIUS server did not return a VLAN while no default VLAN is locally configured for the domain.	Check configuration of system. Check configuration of RADIUS server.

(31 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
7	Proc	Maj	Y, Y, Y	vsa-info-invalid (unsigned long)3604487	VSAINVALID 0x00370007	This alarm is raised when server distribute vlanID or QoS profile ID mismatch before and after re-authenticaton, or distribute un-preconfigured vlanID or QoS profile ID, or distributed dynamic vlan has been attached static mac @ on by VSA, tunnel or other ways. Cleared when new authentication process on this port start.	Check configuration of RADIUS server.
8	Proc	Maj	Y, Y, Y	auth-mac-conflict (unsigned long)3604488	MACCONFLICT 0x00370008	This alarm is raised when current MAC address has established a session already or when the authentication process failed for client's MAC address since it conflicted with configured static MAC address, cleared when a new authentication process on this port start or the old session is cleared.	No repair necessary, indication that more than one device use same mac to authenticate.
9	Proc	Maj	Y, Y, Y	user-pwd-fault (unsigned long)3604489	USRPWDFAULT 0x00370009	This alarm is raised when client's username or password is invalid, or current username has established a session already. Cleared when a new authentication process on this port start or the old session is cleared.	Check configuration of RADIUS server.
Alarm type: 60 Alarm type = ONT Subscriber Card (60) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponOntEquipIfIndex (IfIndex of ONT), Index2 = bponOntPlanCardSpIndex.							
1	Equ	Maj	Y, Y, Y	ont-sbscr-lim-missing (long)3932161	LIMMISSING 0x003C0001	Provisioned ONT Card Missing. (Non-integrated).	1. Install Missing ONT card. 2. Or deprovision ONT card and services if no longer supported.
2	Equ	Maj	Y, Y, Y	ont-sbscr-lim-type-mis (long)3932162	LIMMEA 0x003C0002	Plug-In ONT Card is wrong type. (Non-integrated and integrated).	Install correct type ONT card.
3	Equ	Maj	Y, Y, Y	ont-sbscr-lim-removal (long)3932163	LIMIMPROPRMVL 0x003C0003	ONT Card removed without being deprovisioned. (Improper Removal). (Non-integrated).	1. Install Missing ONT card. 2. Or deprovision ONT card and services if no longer supported.
4	Equ	Maj	Y, Y, Y	ont-sbscr-lim-fail (long)3932164	LIMFAIL 0x003C0004	ONT Card failure detected or failed self test. (Non-integrated).	Replace Failed ONT card.

(32 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
6	Equ	Maj	Y, Y, Y	ont-sbscr-lim-svc-mis (long)3932166	LIMSVCMIS 0x003C0006	A condition meaning that the ONT did not accept the OMCI configuration requests for the provisioned ONU card.	The provisioned card was rejected by the ONT during OMCI configuration requests. Restart ONT to see if problem persists or delete unsupported card.
7	Equ	Maj	Y, Y, Y	ont-sbscr-lim-port-mis (long)3932167	LIMNUMPORTSMIS 0x003C0007	The actual number of ports of a plug-in ONT Card is different then the planned number of ports. (Non-integrated and integrated).	1. Install ONT card with correct number of ports. 2. Reprovision the ONT card with the correct number of ports.
Alarm type: 61 Alarm type = ONT Services Video (61) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponOntEquipIfIndex (IfIndex of ONT), Index2 = bponVideoPortSpIndex. For XGS-PON, XG-PON and NG-PON2, not supported as of ISAM5.2 release.							
1	Equ	Min	Y, Y, Y	ont-svc-video-conf-mis (long)3997697	COND_VIDEOSVCMIS 0x003D0001	A condition meaning that the ONT did not accept the OMCI configuration requests for the Video service.	The provisioned VIDEO Service was rejected by the ONT during OMCI configuration requests. Verify RF Video Overlay service capability of ONT. Restart ONT to see if problem persists, or delete unsupported Video port. (Note: This service is for Video Overlay).
3	Equ	Maj	Y, Y, Y	ont-svc-video-pw-high (long)3997699	RFOUTHIGH 0x003D0003	A condition meaning the RF Video signal being generated out the ONT has a high power level.	1. Check RF Video output level for being too high. 2. If Level too high, replace failed ONT. 3. Else RESET ONT. 4. Replace ONT if failure persists.
4	Equ	Maj	Y, Y, Y	ont-svc-video-pw-low (long)3997700	RFOUTLOW 0x003D0004	A condition meaning the RF Video signal being generated out the ONT has a low power level.	1. Check RF Video output level for being too low. 2. If Level too low, replace failed ONT. 3. Else RESET ONT. 4. Replace ONT if failure persists.
Alarm type: 62 Alarm type = ONT Services POTS (62) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponOntEquipIfIndex (IfIndex of ONT), Index2 = bponPotsPortSpIndex. For XGS-PON, XG-PON and NG-PON2, NOT SUPPORTED as of ISAM5.2 release.							

(33 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
1	Equ	Min	Y, Y, Y	ont-svc-pots-svc-mis (long)4063233	COND_POTSSVCMIS 0x003E0001	A condition meaning that the ONT did not accept the OMCI configuration requests for the provisioned POTS service. One possible reason is that the POTS service is not physically supported by the ONT (e.g. POTS provisioned for port that does not support POTS, special version of 2GONT).	The provisioned POTS Service was rejected by the ONT during OMCI configuration requests. Verify POTS service capability of ONT. Restart ONT to see if problem persists, or deprovision unsupported POTS service port.
2	Comm	Min	N, Y, Y	ont-svc-pots-rtcp-lost (long)4063234	COND_RTCPSTREAMLOSS 0x003E0002	A condition meaning that the POTS Realtime Transport Control Protocol packet stream was lost during an active voice call The RTCP stream is used for collecting statistics and quality data on a voice call.	An active Voice call RTCP packets stream was lost. 1. Check connectivity with remote POTS interface (statistics and QOS data for a call). 2. Check network configuration.
3	Comm	Min	Y, Y, Y	ont-svc-pots-icnf-subs (long)4063235	COND_PICONFIGSUBFAIL 0x003E0003	A condition meaning iConfig subscription of the POTS line failed.	The provisioned POTS service cannot establish iConfig subscription. 1. Check network connectivity and configuration. 2. Verify domain name. 3. Verify security authentication credentials. 4. Check iConfig configuration. 5. Deprovision service if no longer required.
4	Comm	Min	Y, Y, Y	ont-svc-pots-icnf-ntfy (long)4063236	COND_PICONFIGNOTIFYFAIL 0x003E0004	A condition meaning iConfig NOTIFY failed for a POTS line.	The provisioned POTS service NOTIFY request failed. This request is sent after the subscription SUBSCRIBE request. 1. Check network connectivity and configuration. 2. Check iConfig configuration. 3. Deprovision service if no longer required.
5	Comm	Min	Y, Y, Y	ont-svc-pots-icnf-http (long)4063237	COND_PICONFIGHTTPFAIL 0x003E0005	A condition meaning iConfig HTTP redirect failed for a POTS line.	The provisioned POTS service HTTP redirect failed. 1. Check network connectivity and configuration 2. Verify domain name 3. Verify security authentication credentials. 4. Check HTTP server configuration. 5. Verify configuration document data is correct. 6. Deprovision service if no longer required.

(34 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
6	Comm	Min	Y, Y, Y	ont-svc-pots-sip-reg (long)4063238	COND_SIPREGFAIL 0x003E0006	A condition meaning that the ONT did not accept the OMCI configuration requests for the provisioned POTS service. One possible reason is that the POTS service is not physically supported by the ONT (e.g. POTS provisioned for port that does not support POTS, special version of 2GONT).	The provisioned POTS Service was rejected by the ONT during OMCI configuration requests. Verify POTS service capability of ONT. Restart ONT to see if problem persists, or deprovision unsupported POTS service port.
7	Comm	Min	Y, Y, Y	ont-svc-pots-sip-inv (long)4063239	COND_SIPINVITEFAIL 0x003E0007	A condition meaning SIP INVITE request for the POTS line failed.	The provisioned POTS service SIP invite failed. 1. Check network connectivity and configuration 2. Verify domain name. 3. Verify security authentication credentials. 4. Check SIP server configuration. (Note: 480 and 486 responses are not considered failures for this alarm.) 5. Deprovision service if no longer required.
8	Comm	Warn	N, Y, Y	ont-svc-pots-sip-subsc (long)4063240	COND_SIPSUBFAIL 0x003E0008	A condition meaning SIP SUBSCRIBE failed for the POTS line.	The provisioned POTS service SIP subscribe failed. 1. Check network connectivity and configuration. 2. Verify domain name. 3. Verify security authentication credentials. 4. Check SIP server configuration. 5. Deprovision service if no longer required.
9	QOS	Warn	N, Y, Y	ont-svc-pots-sip-mt-tc (long)4063241	COND_SIPMSGTMOUTTCA 0x003E0009	A condition meaning number of SIP Message timeouts threshold has crossed for the POTS line.	The provisioned POTS SIP message timeout TCA crossed during a 15 minute interval. 1. Check network connectivity and configuration. 2. Check SIP server configuration. 3. Deprovision service if no longer required.
10	QOS	Warn	N, Y, Y	ont-svc-pots-pk-los-tc (long)4063242	COND_RTPPKTLOSSTCA 0x003E000A	A condition meaning the number of RTP bearer packets loss on a POTS line has been crossed.	The POTS service RTP Bearer packet threshold crossed. 1. Check network connectivity and configuration. 2. Check connectivity with remote POTS interface.

(35 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
11	QOS	Warn	N, Y, Y	ont-svc-pots-jitter-tc (long)4063243	COND_JITTERTCA 0x003E000B	A condition meaning RTP Jitter Threshold has been crossed on a POTS line.	The POTS service Jitter threshold crossed. 1. Check network connectivity and configuration. 2. Check connectivity with remote POTS interface.
12	Comm	Min	Y, Y, Y	ont-svc-pots-subs-dns (long)4063244	COND_PICNFSUBDNS 0x003E000C	iConfig subscription could not be sent to the configuration server for VOIP profile because the domain name could not be resolved.	Domain name is resolved, or SIPPING address reconfigured to not use a Domain name.
13	Comm	Min	Y, Y, Y	ont-svc-pots-subs-tcp (long)4063245	COND_PICNFSUBTCP 0x003E000D	iConfig subscription could not be sent to the configuration server for VOIP profile because a TCP socket could not be opened.	To clear, TCP socket must open successfully. Check network connectivity and configuration. Check POTS configuration.
14	Comm	Min	Y, Y, Y	ont-svc-pots-subs-tls (long)4063246	COND_PICNFSUBTLS 0x003E000E	iConfig subscription could not be sent to the configuration server for VOIP profile because a TLS session could not be established.	To clear, TLS session must be established successfully. Check network connectivity and configuration. Check POTS configuration.
15	Comm	Min	Y, Y, Y	ont-svc-pots-subs-auth (long)4063247	COND_PICNFSUBAUTH 0x003E000F	iConfig subscription could not be sent to the configuration server for VOIP profile because authentication failed between the ONT and the configuration server.	To clear, Subscription must be successful or a non-401/407 error response is received. Check network connectivity and configuration. Check POTS configuration.
16	Comm	Min	Y, Y, Y	ont-svc-pots-subs-to (long)4063248	COND_PICNFSUBTO 0x003E0010	iConfig subscription could not be sent to the configuration server for VOIP profile because all attempted retransmissions timed out.	To clear, Subscribe responses must be received. Check network connectivity and configuration. Check POTS configuration.
17	Comm	Min	Y, Y, Y	ont-svc-pots-subs-err (long)4063249	COND_PICNFSUBERR 0x003E0011	iConfig subscription could not be sent to the configuration server for VOIP profile because there was an error response from the configuration server.	To clear, Subscription must be successful. Check network connectivity and configuration. Check POTS configuration.
18	Comm	Min	Y, Y, Y	ont-svc-pots-not-to (long)4063250	COND_PICNFNOTTO 0x003E0012	iConfig Notify response for a new subscription failed for VOIP profile because it was not received prior to timeout.	To clear, Any Notify must be received for Subscription. Check network connectivity and configuration. Check POTS configuration.

(36 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
19	Comm	Warn	N, Y, Y	ont-svc-pots-notref-to (long)4063251	COND_PICNFNOTREFTO 0x003E0013	iConfig Notify response failed for a subscription refresh for VOIP profile because it was not received prior to timeout.	To clear, Any Notify must be received for Subscription. Check network connectivity and configuration. Check POTS configuration.
20	Comm	Min	Y, Y, Y	ont-svc-pots-not-mal (long)4063252	COND_PICNFNOTMAL 0x003E0014	iConfig Notify response failed for VOIP profile because the Notify was malformed.	To clear, A valid Notify must be received. Check network connectivity and configuration. Check POTS configuration.
21	Comm	Min	Y, Y, Y	ont-svc-pots-not-rej (long)4063253	COND_PICNFNOTREJ 0x003E0015	iConfig Notify response failed for VOIP profile because the subscription request was rejected by the configuration server.	To clear, A valid Notify must be received. Check network connectivity and configuration. Check POTS configuration.
22	Comm	Min	Y, Y, Y	ont-svc-pots-http-dns (long)4063254	COND_PICNFHTTPDNS 0x003E0016	VOIP client cannot retrieve configuration document for VOIP profile because the domain name could not be resolved.	To clear, Domain name must be resolved or not used in a subsequent document retrieval attempt. Check network connectivity and configuration. Check POTS configuration.
23	Comm	Min	Y, Y, Y	ont-svc-pots-http-tcp (long)4063255	COND_PICNFHTTPTCP 0x003E0017	VOIP client cannot retrieve configuration document for VOIP profile because a TCP socket could be opened.	To clear, a TCP socket must be opened on a subsequent document retrieval attempt. Check network connectivity and configuration. Check POTS configuration.
24	Comm	Min	Y, Y, Y	ont-svc-pots-http-tls (long)4063256	COND_PICNFHTTPTLS 0x003E0018	VOIP client cannot retrieve configuration document for VOIP profile because a TLS session could not be established.	To clear, a TLS session must be established on a subsequent document retrieval attempt. Check network connectivity and configuration. Check POTS configuration.
25	Comm	Min	Y, Y, Y	ont-svc-pots-http-auth (long)4063257	COND_PICNFHTTPAUTH 0x003E0019	VOIP client cannot retrieve configuration document for VOIP profile because authentication failed between the ONT and the configuration server.	To clear, an Authentication must be successful on a subsequent document retrieval attempt. Check network connectivity and configuration. Check POTS configuration.
26	Comm	Min	Y, Y, Y	ont-svc-pots-http-to (long)4063258	COND_PICNFHTTPTO 0x003E001A	VOIP client cannot retrieve configuration document for VOIP profile because all attempted retransmissions timed out.	To clear, a Subsequent document retrieval attempt must be successful. Check network connectivity and configuration. Check POTS configuration.

(37 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
27	Comm	Min	Y, Y, Y	ont-svc-pots-http-err (long)4063259	COND_PICNFHTTPERR 0x003E001B	VOIP client cannot retrieve configuration document for VOIP profile because there was a failure response from the configuration server.	To clear, a Subsequent document retrieval attempt must be successful. Check network connectivity and configuration. Check POTS configuration.
28	Comm	Min	Y, Y, Y	ont-svc-pots-http-mal (long)4063260	COND_PICNFHTTPMAL 0x003E001C	VOIP client cannot use configuration document for VOIP profile because the configuration document is malformed.	To clear, a Subsequent document retrieval attempt must be successful. Check POTS configuration document.
29	Comm	Min	Y, Y, Y	ont-svc-pots-insuff (long)4063261	COND_PICNFINSUFF 0x003E001D	VOIP service cannot not be provided because insufficient configuration data was received. More or more of these parameters has not been configured: registrar_uri, registrar_route, outbound_proxy, address_of_record, contact_uri_user, or digit_map.	To clear, a Subsequent document retrieval which provides sufficient data must occur. Check POTS configuration document.
30	Equ	Min	Y, Y, Y	ont-svc-pots-poos (long)4063262	COND_POTSPOOS 0x003E001E	The UNI is out of service because the planned number of POTS ports is more than the actual number of POTS ports of a plug-in ONT Card.	To clear, reduce the planned number of POTS ports.
Alarm type: 63 Alarm type = ONT Services LAN (63) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponOntEquipIfIndex (IfIndex of ONT), Index2 = bponLanEtherPortSpIndex.							
1	Equ	Min	Y, Y, Y	ont-svc-lan-mismatch (long)4128769	COND_LANSVCMIS 0x003F0001	A condition meaning that the ONT did not accept the OMCI configuration requests for the LAN service.	The provisioned LAN Service was rejected by the ONT during OMCI configuration requests. Verify LAN service capability of ONT. Restart ONT to see if problem persists, or delete unsupported LAN service port.
2	Comm	Ind	Y, Y, Y	ont-svc-lan-loss-sig (long)4128770	COND_LANLOS 0x003F0002	Loss of signal on an Ethernet port interface (i.e no carrier). This is actually the OMCI LAN-LOS alarm on the PPTP Ethernet UNI Managed Entity. It is directly related to the LAN Link LED on the ONT.	Determine why no Ethernet signal on Ethernet port.

(38 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
4	Equ	Min	Y, Y, Y	ont-svc-enet-poos (long)4128772	COND_ENETPOOS 0x003F0004	The UNI is out of service because the planned number of ethernet ports is more than the actual number of ethernet ports of a plug-in ONT Card.	To clear, reduce the planned number of Ethernet ports.
Alarm type: 64 Alarm type = ONT Services CES (DS1) (64) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponOntEquipIfIndex (IfIndex of ONT), Index2 = bponCesPortSpIndex. For XGS-PON, XG-PON and NG-PON2, NOT SUPPORTED as of ISAM5.2 release.							
1	Equ	Min	Y, Y, Y	ont-svc-ces-ds1-mis (long)4194305	DS1CESSVCMIS 0x00400001	A condition meaning that the ONT did not accept the OMCI configuration requests for the provisioned CES DS1 service. One possible reason is that the provisioned CES service is not supported physically by the ONT (e.g. unsupported CES DS1 provisioned for an ONT).	The provisioned CES DS1 Service was rejected by the ONT during OMCI configuration requests. 1. Verify DS1 port service capability of ONT. 2. Restart ONT to see if problem persists, or delete unsupported DS1 service port.
2	Comm	Maj	Y, Y, Y	ont-svc-ces-ds1-los (long)4194306	DS1CESLOS 0x00400002	Loss of Signal at DS1 Interface.	1. Determine whether problem is due to physical interface cabling or due to actual failure of signal from far end DS1 equipment. 2. If no physical cabling problem exists, check far-end DS1 transmit capabilities.
3	Comm	Maj	Y, Y, Y	ont-svc-ces-ds1-lof (long)4194307	DS1CESLOF 0x00400003	Loss of Frame at DS1 Interface.	1. Determine whether problem is due to physical interface cabling, misprovisioning, or signal from far end DS1 equipment. 2. If no physical cabling problem exists, check for misprovisioning of framing format between equipment. Also check far-end DS1 transmit capabilities.

(39 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
6	Comm	Maj	Y, Y, Y	ont-svc-ces-ds1-rair (long)4194310	DS1CESRAIR 0x00400006	Receiving RAI at DS1 Interface.	1. Determine whether problem is due to physical interface cabling, or ONT bad transmit signal. RAI is the result of the far end DS1 equipment detecting a problem with its receive signal and indicating a remote alarm indication back. 2. If no physical cabling problem exists, check far-end DS1 equipment for alarms and resolve.
8	Comm	Maj	Y, Y, Y	ont-svc-ces-ds1-ais (long)4194312	DS1CESAISR 0x00400008	Receiving AIS at DS1 Interface.	1. Determine whether problem is due to DS1 network/equipment problem or misprovisioning. AIS represents a failure upstream in the network where AIS is inserted downstream toward the downstream equipment to indicate that a failure exists upstream. 2. If no DS1 network/equipment problem, check DS1 provisioning on the far-end for valid traffic path configuration.
10	Comm	Maj	Y, Y, Y	ont-svc-ces-ds1-lnlpbk (long)4194314	DS1CESLINLPBK 0x0040000A	The Line Loopback alarm is raised if the line loopback is configured by the local operator. This loopback is for subscriber side. The Line Loopback alarm is cleared when the subscriber side loopback is removed by the operator. This alarm can also automatically be cleared after 120 min by the ONT.	CESDS1 line loopback enabled. To remove the loopback, perform a manual command RLS-LPBK-ONTCESUNI to release the loopback.

(40 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
11	Comm	Maj	Y, Y, Y	ont-svc-ces-ds1-tmlpbk (long)4194315	DS1CESTERLPBK 0x0040000B	The Terminal Loopback alarm is raised if the terminal loopback is configured either by the local operator or configured by some DS1 line code from Network equipment by the operator. This loopback is for network side. Alarm raised as a result of operator triggered loopback is cleared when the loopback is removed by the operator or by in-band clear. Alarm raised as a result of in-band loopback is cleared by inband clear. This alarm can also automatically be cleared after 120 min by the ONT.	CESDS1 terminal loopback enabled. To remove the loopback, either generate a CESDS1 UNLOOP code on the CESDS1 interface, or perform a manual command RLS-LPBK-ONTCESUNI to release the loopback.
Alarm type: 67 Alarm type = ONT Services VoIP (67) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponVoipServiceUniIfIndex (IfIndex of UNI), Index2 = VoIP client number (=1).							
1	Comm	Maj	Y, Y, Y	ont-svc-voip-cnf-file (long)4390913	VOIPCNFG_ONT 0x00430001	A condition meaning, voice configuration file error.	The Voice provisioning file failed to be downloaded to the ONT. 1. Check connection to FTP server. 2. Check format of file. 3. Check (verify) the specified filename.
2	Equ	Min	Y, Y, Y	ont-svc-voip-svc-mis (long)4390914	VCLIENTSVCMIS 0x00430002	A condition meaning that either the LT or ONT did not accept the configuration requests for the provisioned Voice Client service.	A condition meaning that either the ONT or LT did not accept the configuration requests for the provisioned Voice Client service. Possible reasons are: 1. the service is not supported by the ONT or 2. LT configuration or setup problem. Possible solutions are to restart ONT, restart LT, or to deprovision the Voice Client service since not supported.
3	Comm	Maj	Y, Y, Y	ont-svc-voip-gw-comm (long)4390915	VGATEWAYCOMM 0x00430003	A condition meaning the voice gateway is unreachable for this Voice Client. For FGU4.2, this alarm shall also include HTTP Digest Failure.	The Voice Gateway can not be reached by the ONT Voice Client Software or there is a registration problem. Check network connectivity and configuration. Note: for FGU4.2, this alarm shall also include HTTP Digest Failure.

(41 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
4	Comm	Maj	Y, Y, Y	ont-svc-voip-dhcp-fail (long)4390916	VNTWKERR 0x00430004	A condition meaning a PPPoE Session/PPP/IPCP failure occurred when configured for PPPoE mode. As a result, the Voice Client failed to obtain its required IP addresses from the server.	The Voice DHCP Server can not be reached by the ONT Voice Client Software, or there is a problem with the Server. Check network connectivity and server configuration. Note: for FGU4.2, this alarm shall also include DHCP Option 90 Failure to authenticate.
5	Comm	Maj	Y, Y, Y	ont-svc-voip-icnf-subs (long)4390917	VICONFIGSUBFAIL 0x00430005	A condition meaning that the VOIP Client iConfig Subscription request failed.	The provisioned voice client cannot establish iConfig subscription. 1. Check network connectivity and configuration. 2. Verify domain name. 3. Verify security authentication credentials. 4. Check iConfig configuration. 5. Deprovision service if no longer required.
6	Comm	Maj	Y, Y, Y	ont-svc-voip-icnf-ntfy (long)4390918	VICONFIGNOTIFYFAIL 0x00430006	A condition meaning that the VOIP Client iConfig NOTIFY request failed.	The provisioned voice client NOTIFY request failed. This request is sent after the subscription SUBSCRIBE request. 1. Check network connectivity and configuration. 2. Check iConfig configuration. 3. Deprovision service if no longer required.
7	Comm	Maj	Y, Y, Y	ont-svc-voip-icnf-http (long)4390919	VICONFIGHTTPFAIL 0x00430007	A condition meaning that the VOIP Client iConfig HTTP redirect request failed.	The provisioned voice client HTTP redirect failed. 1. Check network connectivity and configuration. 2. Verify domain name. 3. Verify security authentication credentials. 4. Check HTTP server configuration. 5. Verify configuration document data is correct. 6. Deprovision service if no longer required.
8	Comm	Maj	Y, Y, Y	ont-svc-voip-dhcp-to (long)4390920	VDHCPTO 0x00430008	Unable to obtain address from DHCP Server because all attempted retransmissions timed out. This is declared when supporting IPoE.	This alarm indicates misprovisioning, a network connectivity issue, or there is a problem with the Server. Check provisioning, network connectivity, and server configuration.

(42 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
9	Comm	Maj	Y, Y, Y	ont-svc-voip-dhcp-mal (long)4390921	VDHCPMAL 0x00430009	Unable to obtain address from DHCP Server because DHCP response was malformed.	This alarm indicates misprovisioning, a network connectivity issue, or there is a problem with the Server. Check provisioning, network connectivity, and server configuration.
10	Comm	Maj	Y, Y, Y	ont-svc-voip-dhcp-noad (long)4390922	VDHCPNOADD 0x0043000A	Unable to obtain address from DHCP Server because the DHCP server failed to issue the required parameters to support IP connectivity. This alarm will occur for the following failures: - DHCP server returned an error response, - addresses received conflict with ONT reserved addresses, - an expected address needed for Voice is not received. This includes voice gateway softswitch address (when expected), Default Gateway and IP Subnet mask. Missing FT server and DNS server addresses are not alarmed here.	This alarm indicates misprovisioning, a network connectivity issue, or there is a problem with the Server. Check provisioning, network connectivity, and server configuration.
11	Comm	Min	N, Y, Y	ont-svc-voip-dhcp-leas (long)4390923	VDHCPLEASE 0x0043000B	Unable to renew lease with DHCP Server because the server did not respond. (Note: Service is not lost when this occurs).	This alarm indicates misprovisioning, a network connectivity issue, or there is a problem with the Server. Check provisioning, network connectivity, and server configuration.
12	Comm	Maj	Y, Y, Y	ont-svc-voip-subs-dns (long)4390924	VICNFSUBDNS 0x0043000C	iConfig subscription could not be sent to the configuration server for VOIP profile because the domain name could not be resolved.	1. Domain name is resolved, or SIPPING address reconfigured to not use a Domain name.
13	Comm	Maj	Y, Y, Y	ont-svc-voip-subs-tcp (long)4390925	VICNFSUBTCP 0x0043000D	iConfig subscription could not be sent to the configuration server for VOIP profile because a TCP socket could not be opened.	To clear, TCP socket must open successfully. Check network connectivity and configuration. Check Voice Client configuration.
14	Comm	Maj	Y, Y, Y	ont-svc-voip-subs-tls (long)4390926	VICNFSUBTLS 0x0043000E	iConfig subscription could not be sent to the configuration server for VOIP profile because a TLS session could not be established.	To clear, TLS session must be established successfully. Check network connectivity and configuration. Check Voice Client configuration.

(43 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
15	Comm	Maj	Y, Y, Y	ont-svc-voip-subs-auth (long)4390927	VICNFSUBAUTH 0x0043000F	iConfig subscription could not be sent to the configuration server for VOIP profile because authentication failed between the ONT and the configuration server.	To clear, Subscription must be successful or a non-401/407 error response is received. Check network connectivity and configuration. Check Voice Client configuration.
16	Comm	Maj	Y, Y, Y	ont-svc-voip-subs-to (long)4390928	VICNFSUBTO 0x00430010	iConfig subscription could not be sent to the configuration server for VOIP profile because all attempted retransmissions timed out.	To clear, Subscription responses must be received. Check network connectivity and configuration. Check Voice Client configuration.
17	Comm	Maj	Y, Y, Y	ont-svc-voip-subs-err (long)4390929	VICNFSUBERR 0x00430011	iConfig subscription could not be sent to the configuration server for VOIP profile because there was an error response from the configuration server.	To clear, Subscription must be successful. Check network connectivity and configuration. Check Voice Client configuration.
18	Comm	Maj	Y, Y, Y	ont-svc-voip-not-to (long)4390930	VICNFNOTTO 0x00430012	iConfig Notify response for a new subscription failed for VOIP profile because it was not received prior to timeout.	To clear, any Notify must be received for Subscription. Check network connectivity and configuration. Check Voice Client configuration.
19	Comm	Warn	N, Y, Y	ont-svc-voip-notref-to (long)4390931	VICNFNOTREFTO 0x00430013	iConfig Notify response failed for a subscription refresh for VOIP profile because it was not received prior to timeout.	To clear, any Notify must be received for Subscription. Check network connectivity and configuration. Check Voice Client configuration.
20	Comm	Maj	Y, Y, Y	ont-svc-voip-not-mal (long)4390932	VICNFNOTMAL 0x00430014	iConfig Notify response failed for VOIP profile because the Notify was malformed.	To clear, a valid Notify must be received. Check network connectivity and configuration. Check Voice Client configuration.
21	Comm	Maj	Y, Y, Y	ont-svc-voip-not-rej (long)4390933	VICNFNOTREJ 0x00430015	iConfig Notify response failed for VOIP profile because the subscription request was rejected by the configuration server.	To clear, a valid Notify must be received. Check network connectivity and configuration. Check Voice Client configuration.
22	Comm	Maj	Y, Y, Y	ont-svc-voip-http-dns (long)4390934	VICNFHTTPDNS 0x00430016	VOIP client cannot retrieve configuration document for VOIP profile because the domain name could not be resolved.	To clear, domain name must be resolved or not used in a subsequent document retrieval attempt. Check network connectivity and configuration. Check Voice Client configuration.

(44 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
23	Comm	Maj	Y, Y, Y	ont-svc-voip-http-tcp (long)4390935	VICNFHTTPTCP 0x00430017	VOIP client cannot retrieve configuration document for VOIP profile because a TCP socket could be opened.	To clear, a TCP socket must be opened on a subsequent document retrieval attempt. Check network connectivity and configuration. Check Voice Client configuration.
24	Comm	Maj	Y, Y, Y	ont-svc-voip-http-tls (long)4390936	VICNFHTTPTLS 0x00430018	VOIP client cannot retrieve configuration document for VOIP profile because a TLS session could not be established.	To clear, a TLS session must be established on a subsequent document retrieval attempt. Check network connectivity and configuration. Check Voice Client configuration.
25	Comm	Maj	Y, Y, Y	ont-svc-voip-http-auth (long)4390937	VICNFHTTPAUTH 0x00430019	VOIP client cannot retrieve configuration document for VOIP profile because authentication failed between the ONT and the configuration server.	To clear, an authentication must be successful on a subsequent document retrieval attempt. Check network connectivity and configuration. Check Voice Client configuration.
26	Comm	Maj	Y, Y, Y	ont-svc-voip-http-to (long)4390938	VICNFHTTPTO 0x0043001A	VOIP client cannot retrieve configuration document for VOIP profile because all attempted retransmissions timed out.	To clear, a subsequent document retrieval attempt must be successful. Check network connectivity and configuration. Check Voice Client configuration.
27	Comm	Maj	Y, Y, Y	ont-svc-voip-http-err (long)4390939	VICNFHTTPERR 0x0043001B	VOIP client cannot retrieve configuration document for VOIP profile because there was a failure response from the configuration server.	To clear, a subsequent document retrieval attempt must be successful. Check network connectivity and configuration. Check Voice Client configuration.
28	Comm	Maj	Y, Y, Y	ont-svc-voip-http-mal (long)4390940	VICNFHTTPMAL 0x0043001C	VOIP client cannot use configuration document for VOIP profile because the configuration document is malformed.	To clear, a subsequent document retrieval attempt must be successful. Check Voice Client configuration document.

(45 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
29	Comm	Warn	N, Y, Y	ont-svc-voip-subs-refr (long)4390941	VICNFSUBREFERR 0x0043001D	iConfig subscription could not refreshed because of one of the following conditions: refresh subscribe could not be sent to the configuration server for VOIP profile because domain name could not be resolved; refresh subscribe could not be sent to the configuration server for VOIP profile because authentication failed between the ONT and the configuration server; refresh subscribe could not be sent to the configuration server for VOIP profile because all attempted retransmissions timed out; refresh subscribe could not be sent to the configuration server for VOIP profile because there was an error response from the configuration server.	To clear, any refresh must be received for subscription. Check network connectivity and configuration. Check Voice Client configuration.
30	Comm	Warn	N, Y, Y	ont-svc-voip-not-refr (long)4390942	VICNFNOTREFERR 0x0043001E	iConfig Notify response for refresh subscribe failed for VOIP profile because of one of the following conditions: iConfig Notify response for refresh subscribe failed for VOIP profile because the Notify was malformed or refresh subscription request was rejected by the configuration server.	To clear, a valid Notify response for receive must be received for subscription. Check network connectivity and configuration. Check Voice Client configuration.
31	Comm	Maj	Y, Y, Y	ont-svc-voip-icfg-err (long)4390943	VICNFERR 0x0043001F	iConfig VOIP service can not be provided because there was a configuration error that does not map to any specific iConfig VOIP service alarms.	To clear, an iConfig configuration must complete successfully. Check network connectivity and configuration. Check Voice Client configuration.
Alarm type: 76 Alarm type = SFP (76) - Index1 = hostSfpFaceplateNumber, Index2 = lanxPortNumber in case of SHUB, Ethernet Port in case of IHUB, eqptSlotId in case of alarm raised from Host LTs.(1..8) Alarm type = SFP (76) - Index1 = eqptSlotId of the corresponding LSM in the expansion shelf, Index2 = not used.(11..17)							
1	Comm	Crit	Y, Y, Y	host-sfp-los (long)4980737	HSFPLOS 0x004C0001	Host downlink SFP Loss Of Signal.	Check physical line.
2	Comm	Crit	Y, Y, Y	host-sfp-tx-fail (long)4980738	HSFPTXF 0x004C0002	Host downlink SFP Tx failure.	Check Host-side SFP module.

(46 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
3	Comm	Crit	Y, Y, Y	host-sfp-not-prst (long)4980739	HSFPNP 0x004C0003	Host downlink SFP is not detected.	Check Host-side SFP presence.
4	Comm	Crit	Y, Y, Y	host-sfp-inv-id (long)4980740	HSFPINVID 0x004C0004	Host downlink SFP does not have valid Nokia ID.	Check Host-side SFP module ID.
5	Comm	Crit	Y, Y, Y	host-sfp-ctrl-fail (long)4980741	HSFPCTRF 0x004C0005	Host downlink SFP control failure.	Check Host-side SFP module or I2C bus. If control of all host-side SFPs fails, check the GENC board.
6	Equ	Min	N, Y, Y	host-sfp-rmtlt (long)4980742	HSFPUEXPP 0x004C0006	The Host-side SFP module is not assigned with any remote LT but a remote LT is detected to be cabled to it.	Check for missing Host-side SFP assignment configuration or whether the remote LT is cabled to the wrong Host-side SFP module.
7	Equ	Maj	Y, Y, Y	host-sfp-mismatch (long)4980743	HSFPRASGM 0x004C0007	The detected slot ID of the remote LT that is cabled to the Host-side SFP module does not match the assigned remote LT slot ID that is configured for the Host-side SFP module.	Check for cabling error or Host-side SFP assignment configuration error.
8	Equ	Min	N, Y, Y	host-sfp-incompt (long)4980744	HSFPINCOMPS 0x004C0008	The actual shelf type of the remote LT that is cabled to the Host-side SFP module does not match the planned shelf type of the assigned remote LT configured for the Host-side SFP module.	Check for cabling error, shelf type planning error or assignment configuration error.
11	Comm	Crit	Y, Y, Y	exp-sfp-los (long)4980747	ESFPLOS 0x004C000B	Expansion shelf SFP Loss Of Signal.	Check physical line.
12	Comm	Crit	Y, Y, Y	exp-sfp-tx-fail (long)4980748	ESFPTXF 0x004C000C	Expansion shelf SFP Tx failure.	Check the expansion-side SFP module.
13	Comm	Crit	Y, Y, Y	exp-sfp-not-prst (long)4980749	ESFPNP 0x004C000D	Expansion shelf SFP is not detected.	Check expansion-side SFP presence.
14	Comm	Crit	Y, Y, Y	exp-sfp-inv-id (long)4980750	ESFPINVID 0x004C000E	Expansion shelf SFP does not have valid Nokia ID.	Check expansion-side SFP module ID.
15	Comm	Crit	Y, Y, Y	exp-sfp-ctrl-fail (long)4980751	ESFPCTRF 0x004C000F	Expansion shelf SFP control failure.	Check expansion-side module or I2C bus.
16	Comm	Crit	Y, Y, Y	exp-sfp-1-los (long)4980752	ESFP1LOS 0x004C0010	Expansion shelf SFP1 Loss Of Signal (for FD REM and FD SEM).	Check physical line (is optical link from host to remote unit too highly attenuated, is SFP still OK in the host/remote, is optical cable properly connected).

(47 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
17	Comm	Crit	Y, Y, Y	exp-sfp-2-los (long)4980753	ESFP2LOS 0x004C0011	Expansion shelf SFP2 Loss Of Signal (for FD REM).	Check physical line (is optical link from host to remote unit too highly attenuated, is SFP still OK in the host/remote, is optical cable properly connected).
Alarm type: 82 Alarm type = SHDSL_ISAM (82) Index1 = ifIndex (of SHDSL physical port), Index2 = linkId + device ID(the higher 16 bits are for linkId, which start at 1 for 1 pair, the 16 lower bits are for device ID).							
3	Comm	Min	Y, Y, Y	shdsl-n-losw (long)5373955	SHDSL_N_LOSW 0x00520003	Loss of sync word at the network side on each pair.	Check signal at network side.
4	Comm	Min	Y, Y, Y	shdsl-c-losw (long)5373956	SHDSL_C_LOSW 0x00520004	Loss of sync word at the customer side on each pair.	Check signal at customer side.
5	Comm	Min	Y, Y, Y	shdsl-n-aten (long)5373957	SHDSL_N_ATEN 0x00520005	Loop attenuation alarm at the network side on each pair.	Check signal at network side.
6	Comm	Min	Y, Y, Y	shdsl-c-aten (long)5373958	SHDSL_C_ATEN 0x00520006	Loop attenuation alarm at the customer side on the each pair.	Check signal at customer side.
7	Comm	Min	Y, Y, Y	shdsl-n-snr (long)5373959	SHDSL_N_SNR 0x00520007	SNR margin alarm at the network side each pair.	Check signal at network side.
8	Comm	Min	Y, Y, Y	shdsl-c-snr (long)5373960	SHDSL_C_SNR 0x00520008	SNR margin alarm at the customer side on each pair.	Check signal at customer side.
9	Comm	Min	Y, Y, Y	shdsl-n-dccont (long)5373961	SHDSL_N_DCCONT 0x00520009	DC continuity fault at the network side on each pair.	Check network side equipment and wiring.
10	Comm	Min	Y, Y, Y	shdsl-c-dccont (long)5373962	SHDSL_C_DCCONT 0x0052000A	DC continuity fault at the customer side on each pair.	Check customer side equipment and wiring.
19	Comm	Min	Y, Y, Y	shdsl-c-actfail (long)5373971	SHDSL_C_ACTFAIL 0x00520013	Activation failed at a customer segment termination.	Check the CO wiring of the different segments.
Alarm type: 83 Alarm type = CustomExternalAlarms (83) - Index1 = eqptSlotId (Index in equipment Board Table) , Index2 = not used.							
1	Equ	Maj	N, Y, Y	custextalarm1 (unsigned long)5439489	CUSTALRM1 0x00530001	Customizable External Alarm nbr. 1.	-
2	Equ	Maj	N, Y, Y	custextalarm2 (unsigned long)5439490	CUSTALRM2 0x00530002	Customizable External Alarm nbr. 2.	-
3	Equ	Maj	N, Y, Y	custextalarm3 (unsigned long)5439491	CUSTALRM3 0x00530003	Customizable External Alarm nbr. 3.	-

(48 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
4	Equ	Maj	N, Y, Y	custextalarm4 (unsigned long)5439492	CUSTALRM4 0x00530004	Customizable External Alarm nbr. 4.	-
5	Equ	Maj	N, Y, Y	custextalarm5 (unsigned long)5439493	CUSTALRM5 0x00530005	Customizable External Alarm nbr. 5.	-
Alarm type: 84 Alarm type = PlugInUnit2 (84) - Index1 = eqptSlotId (Index in equipment Board Table), Index2 = not used.							
1	Equ	Maj	N, Y, Y	pluginfan (unsigned long)5505025	FANALM 0x00540001	Applicable to REM only : REM Fan Power Alarm.	Check REM fan.
2	Equ	Maj	N, Y, Y	plugin-dc-a (unsigned long)5505026	DCA 0x00540002	Applicable to REM only (note that this alarm is not applicable to the XD-REM): REM DC A voltage low Alarm. No impact on functionality; DC B takes over.	Check cabling, fuse.
3	Equ	Maj	N, Y, Y	plugin-dc-b (unsigned long)5505027	DCB 0x00540003	Applicable to REM only (note that this alarm is not applicable to the XD-REM): REM DC B voltage low Alarm. No impact on functionality; DC A takes over.	Check cabling, fuse.
4	Equ	Crit	Y, Y, Y	plugin-dg (unsigned long)5505028	DG 0x00540004	Applicable to REM only (note that this alarm is not applicable to the XD-REM): Dying Gasp, going out of service because of power shutdown (reason can be power failure, mains switch-off, excessive overtemperature).	Check cabling, fuse, convertor, temperature, on/off-switch at REM or cabinet level.
5	Equ	Crit	Y, Y, Y	apsf-alarm (unsigned long)5505029	APSF 0x00540005	Applique power supply malfunction. If applicable, relays are no longer configurable and are switched to the hardware default position.	Check applique power supply.
6	Equ	Maj	Y, Y, Y	ntr-a-loss (long)5505030	NTR_A_LOSS 0x00540006	LT report NTR loss event when the NTR signal is not available. NTR-A loss will be reported even if NT A are not inserted on system.	Check NTA NTR status.
7	Equ	Maj	Y, Y, Y	ntr-b-loss (long)5505031	NTR_B_LOSS 0x00540007	LT report NTR loss event when the NTR signal is not available. NTR-B loss will be reported even if NT B are not inserted on system.	Check NTB NTR status.

(49 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
11	Equ	Crit	Y, Y, Y	xvps-conf-loss (unsigned long)5505035	XVPS_CONFLOSS 0x0054000B	Notification alarm raised by the NT in order to inform the operator that the xVPS configuration saved on NT differs from the actual xVPS configuration, t.i. the last changes onto xVPS database in between two configuration save actions are lost due to NT and/or xVPS reset. Index1 = lowest equipSlotId of the xVPS pair.	Check xVPS configuration with respect to database (last database changes may be lost).
12	Equ	Min	N, Y, Y	mac-entry-nofree (unsigned long)5505036	FREE_MACENTRY 0x0054000C	There is no free MAC entry in the MAC table on the LT board.	No special repair action. Only notification of no more free MAC entry in MAC table on LT board.
17	Equ	Maj	Y, Y, Y	fibre-conn-mismatch (unsigned long)5505041	FCMALM 0x00540011	The detected FD-REM CTRL card serial number doesn't match the configured value. Note: alarm is only supported for certain customers (based on the operator id).	Check the physical connection of the FD-REM. Check the configuration of the CTRL card identification of the FD-REM.
18	Equ	Maj	N, Y, Y	link-cap-mismatch (unsigned long)5505042	LINKCAPMISMATCH 0x00540012	The actual link speed is not in line with the end-to-end link capability between NT and remote LT. The end-to-end link capability takes into account the speed capability of equipment between (and including) NT and LT (i.e. speed capability of NT, NTIO, host SFP, remote SFP, CTRL board, Hi-Cap License and LT). Index1 = eqptSlotId of the LT.	Check for faulty fiber link, NTIO, host SFP, remote SFP and CTRL board (on FD-REM).
19	Equ	Min	N, Y, Y	eqpt-cap-mismatch (unsigned long)5505043	EQPTCAPMISMATCH 0x00540013	HighCap key is enabled. NT and LT are both HighCap capable but at least one piece of equipment between NT and LT is not HighCap capable. The equipment between NT and LT may include NTIO, host SFP, remote SFP and CTRL board (on FD-REM). Index1 = eqptSlotId of the LT.	Check the speed capability of NTIO, host SFP, remote SFP and CTRL board (on FD-REM).

(50 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
20	Equ	Maj	N, Y, Y	ctrl-dnld-failure (unsigned long)5505044	SWDNLDCCFLD 0x00540014	The downloading of the software image to the controller card failed. Additional Info contains: current running Firmware Version of the Controller Card.	Check the firmware version in the alarm. Restart the first LT plugged in the expansion shelf.
21	Equ	Maj	N, Y, Y	board-hw-issue (unsigned long)5505045	BOARDHWISSUE 0x00540015	MELT Self Diagnostic test fails, one or more SLIC is not-operational. MELT SLIC test service is impacted due to a MELT HW issue even though the board can startup and other services could be provided successful. See repair actions.	There is a hardware issue with the board. Check the ltHwStatusTable. If this table indicates there is a problem with one of the SLIC components used for the MELT functionality, then one knows that this MELT functionality is affected for the set of lines served by this SLIC component. Other services for these lines are not affected. The repair action is to replace the board. If this data does not reveal errors then there is another hardware issue and the service impact is not defined. Then the repair action is to replace the board.
24	Equ	Maj	N, Y, Y	single-fan-fail (unsigned long)5505048	SINGLEFANFAILURE 0x00540018	The alarm is raised when one of the fan unit fails in the fan tray. The alarm is cleared as soon as the fan tray is replaced with working fan unit.	Replace the failing fan unit.
25	Equ	Crit	Y, Y, Y	multi-fan-fail (unsigned long)5505049	MULTIFANFAILURE 0x00540019	The alarm is raised when multiple fan units in the fan tray are failing. The alarm is cleared as soon as the fan tray is replaced with working fan units.	Replace the failing fan units.
26	Equ	Crit	Y, Y, Y	fan-tray-missing (unsigned long)5505050	FANTRAYMISSING 0x0054001A	The alarm is raised when the fan tray is plugged out. The alarm is cleared as soon as the fan tray is reinserted.	Reinsert the fan tray.
29	Equ	Maj	N, Y, Y	mgnt-type-mismatch (unsigned long)5505053	MGNTTYPEMISMATCH 0x0054001D	Alarm is raised when LT Fails to come up with the NCY software after planning the board with ncy-managed-board profile. Alarm is cleared after successful activation of LT with NCY software or after unplanning the LT.	Unplan the LT, plan with legacy profile to roll back or retry the action and plan LT with ncy-managed-board profile.

(51 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
30	Equ	Maj	N, Y, Y	melt-board-reset (unsigned long)5505054	MELTBOARDRESET 0x0054001E	MELT board reset alarm will be triggered when a MELT board goes for a reset and the alarm is cleared as soon as the MELT board got initialized successfully.	No special repair action required. It is an indication that melt board has gone for reset, the alarm will be cleared when it completes its intialisation.
Alarm type: 86 Alarm type = ONT Services Video Ani (86) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponOntEquipIfIndex (IfIndex of ONT), Index2 = 1 For XGS-PON, XG-PON and NG-PON2, NOT SUPPORTED as of ISAM5.2 release.							
1	Equ	Min	Y, Y, Y	ont-svc-v-ani-conf-mis (long)5636097	VIDEOANISVCMIS 0x00560001	A condition meaning that the ONT did not accept the OMCI configuration requests for the Video ANI service.	The provisioned VIDEO ANI Service was rejected by the ONT during OMCI configuration requests. Verify RF Video Overlay service capability of ONT. Restart ONT to see if problem persists, or delete unsupported Video port.
2	Comm	Maj	Y, Y, Y	ont-svc-v-ani-loss-sig (long)5636098	COND_VIDEOLOSS 0x00560002	Loss of signal on the RF Video overlay port interface. This is actually the OMCI Video loss of signal alarm on the PPTP Video ANI Managed Entity.	1. Determine why ONT has lost RF video input signal. 2. Check video signal.
3	Comm	Maj	Y, Y, Y	ont-svc-v-ani-lv-high (long)5636099	LEVELHIGH 0x00560003	1550nm Video Optical signal level is too HIGH.	Check RF video signal (1550nm) and decrease signal level.
4	Comm	Maj	Y, Y, Y	ont-svc-v-ani-lv-low (long)5636100	LEVELLOW 0x00560004	1550nm Video Optical signal level is too LOW.	Check RF video signal (1550nm) and increase signal level.
Alarm type: 89 Alarm type = ONT Services MoCA (89) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponOntEquipIfIndex (Index of ONT), Index2 = SpIndex For XGS-PON and NG-PON2, SUPPORTED as of ISAM6.2.04 release.							
1	Equ	Min	Y, Y, Y	none	MOCASVCMIS 0x00590001	A condition meaning that the ONT did not accept the OMCI configuration requests for the MoCA service.	The provisioned MoCA Uni Service was rejected by the ONT during OMCI configuration requests. Verify MoCA service capability of ONT. Restart ONT to see if problem persists, or delete unsupported MoCA port.
2	Comm	Maj	Y, Y, Y	none	MOCALOL 0x00590002	Loss of Link on the MoCA physical interface.	Determine why ONT has lost MocA COAX input signal. Check signal.

(52 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
3	Comm	Maj	Y, Y, Y	none	MOCALIMLINK 0x00590003	MoCA bandwidth between nodes is less than minimum bandwidth threshold.	Determine why MoCA coaxial interface is degraded. Check coaxial interface and signal. Adjust minimum bandwidth threshold is lower threshold acceptable.
Alarm type: 90 Alarm type = ONT TC TCA (90) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponOntEquipIfIndex (IfIndex of ONT), Index2 = not used							
1	QOS	Warn	N, Y, Y	ont-tc-rx-los-frag-tc (long)5898241	T_LOSTFRAGS 0x005A0001	ONT Near End (receive at ONT) Lost GEM Fragment Threshold Crossing Alert. Note: aggregate ONT count across all GEM ports, except OMCI and Multicast GEM ports.	1. Check Receive PON signal at ONT. 2. Check Transmit PON signal at OLT. 3. Reset ONT. 4. Replace ONT if PM counts persist. 5. Replace associated LT at OLT if PM counts persist.
2	QOS	Warn	N, Y, Y	ont-tc-tx-los-frag-tc (long)5898242	T_LOSTFRAGS 0x005A0002	ONT Near End (transmit at ONT) Lost GEM Fragment Threshold Crossing Alert. Note: aggregate ONT count across all GEM ports, except OMCI and Multicast GEM ports.	1. Check PON signal at ONT. 2. Reset ONT. 3. If PM counts persist, replace ONT.
3	QOS	Warn	N, Y, Y	ont-tc-bad-gem-hd-tc (long)5898243	T_BADGEMHDRS 0x005A0003	ONT Near End (receive at ONT) BAD GEM Headers Threshold Crossing Alert. Note: aggregate ONT count across all GEM ports, except OMCI and Multicast GEM ports.	1. Check Receive PON signal at ONT. 2. Check Transmit PON signal at OLT. 3. Reset ONT. 4. Replace ONT if PM counts persist. 5. Replace associated LT at OLT if PM counts persist.
Alarm type: 91 Alarm type = ONT L2 UNI Ethernet TCA (91) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponOntEquipIfIndex (IfIndex of ONT), Index2 = gponEtherTrafficTCAThresholdSpIndex. For XGS-PON, XG-PON and NG-PON2, as of ISAM5.2, SUPPORTED only for Ethernet UNI type.							
1	QOS	Warn	N, Y, Y	ont-uni-ds-drpd-fr-tc (long)5963777	T_DSDRPDFRMS 0x005B0001	Downstream (from PON, out physical service interface) Layer 2 dropped frames. The supported interfaces currently include: - ontServicesLAN, - ontServicesVDSL, and - ontServicesMoCA.	1. Check Receive PON signal at ONT. 2. Check Transmit PON signal at OLT. 3. Reset ONT. 4. Replace ONT if PM counts persist. 5. Replace associated LT at OLT if PM counts persist.

(53 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
2	QOS	Warn	N, Y, Y	ont-uni-up-drpd-fr-tc (long)5963778	T_USDRPDFRMS 0x005B0002	Upstream (from physical interface toward PON) Layer 2 dropped frames. The supported interfaces currently include: - ontServicesLAN, - ontServicesVDSL, and - ontServicesMoCA.	1. Check PON signal at ONT. 2. Check UNI interface physical signal. 3. Reset ONT. 4. If PM counts persist, replace ONT.
3	QOS	Warn	N, Y, Y	ont-uni-ds-crc-fr-tc (long)5963779	T_DSCRCERRFRMS 0x005B0003	Downstream (from PON, out physical service interface) dropped CRC frames. The supported interfaces currently include: ontServicesLAN, ontServicesVDSL and ontServicesMoCA.	1. Check Receive PON signal at ONT. 2. Check Transmit PON signal at OLT. 3. Reset ONT. 4. Replace ONT if PM counts persist. 5. Replace associated LT at OLT if PM counts persist.
4	QOS	Warn	N, Y, Y	ont-uni-up-crc-fr-tc (long)5963780	T_USCRCERRFRMS 0x005B0004	Upstream (to PON, out physical service interface) dropped CRC frames. The supported interfaces currently include: ontServicesLAN, ontServicesVDSL and ontServicesMoCA.	1. Check Transmit PON signal at ONT. 2. Check Receive PON signal at OLT. 3. Reset ONT. 4. Replace ONT if PM counts persist. 5. Replace associated LT at OLT if PM counts persist.
Alarm type: 93 Alarm type = ONT Services MoCA TCA (93) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponOntEquipIfIndex (Index of ONT), Index2 = SpIndex. For XGS-PON, XG-PON and NG-PON2, SUPPORTED as of ISAM6.2.04 release.							
1	QOS	Warn	N, Y, Y	none	T_RXERRFRMS 0x005D0001	The number of near end MoCA Physical interface received Errored Frames threshold has been crossed.	1. Check MoCA UNI Physical interface receive signal. 2. Check MoCA CPE equipment and CPE signal for problems.
Alarm type: 94 Alarm type = OLT PON TC TCA (94) - For GPON and XGS-PON dual-rate Index1 = gponPonConfigIfIndex (IfIndex of PON), Index2 = not used.							
1	QOS	Warn	N, Y, Y	olt-pon-tc-err-frag-tc (long)6160385	T_ERRFRAGSPON 0x005E0001	OLT Near End (receive at OLT) number of a PON's unforwarded GEM Fragments due to Header Errors or Unavailable Resources Threshold Crossing Alert.	1. Check Receive PON signal at OLT. 2. Check Transmit PON signal at ONT. 3. Check ONT for ONT TC ERRFRAGS and isolate at ONT level if ONT counts exist. 4. Reset LT. 5. Replace associated LT at OLT if PM counts persist.

(54 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
2	Comm	Maj	Y, Y, Y	olt-pon-up-bw-tca (long)6160386	T_BWTCA 0x005E0002	The alarm is raised when upstream traffic rate exceed the configured threshold in one interval. The alarm is cleared when the upstream traffic rate go below the configured threshold in another interval.	1 Check ONT upstream bandwidth configurations. 2 Reassign some subscribers to other PON ports.
3	Comm	Maj	Y, Y, Y	olt-pon-down-bw-tca (long)6160387	T_BWTCA 0x005E0003	The alarm is raised when downstream traffic rate exceed the configured threshold in one interval. The alarm is cleared when the downstream traffic rate go below the configured threshold in another interval.	1. Check ONT downstream bandwidth configurations. 2. Reassign some subscribers to other PON ports.
Alarm type: 95 Alarm type = OLT ONT TC TCA (95) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponOntEquipIfIndex (IfIndex of ONT), Index2 = not used							
1	QOS	Warn	N, Y, Y	olt-ont-tc-err-frag-tc (long)6225921	T_ERRFRAGSONT 0x005F0001	OLT Near End (receive at OLT) number of an ONT's unforwarded GEM Fragments due to Header Errors or Unavailable Resources Threshold Crossing Alert.	1. Check Receive PON signal at OLT. 2. Check Transmit PON signal at ONT. 3. Reset ONT. 4. Replace ONT if PM counts persist. 5. Replace associated LT at OLT if PM counts persist.
Alarm type: 98 Alarm type = SIP User Agent (98) - Index1 = sipUaId (Index in SIP user agent Table), Index2 = eqptSlotId (index in equipment Board Table).							
5	Comm	Crit	Y, Y, Y	dhcp-unreach (long)6422533	DHCPUNRCH 0x00620005	The DHCP server is unreachable on this board.	Check the link between ISAM and the DHCP server.
6	Comm	Crit	Y, Y, Y	dhcp-no-srv (long)6422534	NOSPSRVDHCP 0x00620006	The address in DHCP reply is NULL for the SIP user agent.	Check the configuration of the DHCP server.
7	Comm	Crit	Y, Y, Y	dhcp-inv-srv (long)6422535	INVSPSRVDHCP 0x00620007	The address in DHCP reply is invalid for the SIP user agent.	Check the configuration of the DHCP server.
Alarm type: 99 Alarm type = SIP PlugInUnit (99) - Index1 = eqptSlotId (Index in equipment Board Table), Index2 = not used.							
3	Comm	Crit	Y, Y, Y	dhcp-unreach (long)6488067	DHCPUNRCH 0x00630003	The DHCP server is unreachable on this board.	Check the link between ISAM and the DHCP server.
Alarm type: 100 Alarm type = SIP Termination (100) - Index1 = IfIndex of PSTN physical port, Index2 = not used.							

(55 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
1	Comm	Maj	Y, Y, Y	unknown-sub (long)6553601	UNKNSIPS 0x00640001	The SIP subscriber information configured in the SIP termination doesn't exist in the SIP application server.	Check if the directory number, user name or uri of the SIP termination is valid.
2	Equ	Maj	Y, Y, Y	ground-key (long)6553602	GRDKEY 0x00640002	The current threshold of the physical line of the port exceeded. The usual root causes are as following: the tip is connected to AC source. The ring is connected to the source of high voltage or AC.	Check the cabling of the port.
3	Equ	Maj	Y, Y, Y	port-hightemp (long)6553603	SIPHITEMP 0x00640003	Temperature threshold on the physical PSTN port exceeded, the port will be automatically shutdown.	Check ambient temperature. Check operation of FANs. Check port.
6	QOS	Min	N, Y, Y	port-jbfltca (long)6553606	SIPJBFLTCA 0x00640006	The Jitter Buffer fill level threshold on this physical PSTN port exceed.	Check JB fill level of the port.
7	Comm	Maj	Y, Y, Y	reg-domainname (long)6553607	SIPREGDN 0x00640007	SIP registration failure, because of resolve domain name failure.	Check domain name.
8	Comm	Maj	Y, Y, Y	reg-auth (long)6553608	SIPREGAUTH 0x00640008	SIP registration failure, because of authenticate failure.	Check auth element.
9	Comm	Maj	Y, Y, Y	reg-timeout (long)6553609	SIPREGTO 0x00640009	SIP registration failure, because of message timeout.	Check network.
10	Comm	Maj	Y, Y, Y	reg-srvfailresp (long)6553610	SIPREGFRSP 0x0064000A	SIP registration failure, because of failure response from server. Additional Info contains a SIP error response from the registrar server such as: 403 Forbidden.	Check SIP server.
11	Comm	Maj	Y, Y, Y	inv-domainname (long)6553611	SIPINVDN 0x0064000B	SIP invite failure, because of resolve domain name failure.	Check domain name.
12	Comm	Maj	Y, Y, Y	inv-auth (long)6553612	SIPINVAUTH 0x0064000C	SIP invite failure, because of authenticate failure.	Check auth element.
13	Comm	Maj	Y, Y, Y	inv-timeout (long)6553613	SIPINVTO 0x0064000D	SIP invite failure, because of message timeout.	Check network.
14	Comm	Maj	Y, Y, Y	inv-srvfailresp (long)6553614	SIPINVFRSP 0x0064000E	SIP invite failure, because of failure response from server.	Check SIP server.
15	Comm	Maj	Y, Y, Y	subs-srvfailresp (long)6553615	SIPSUBSFRSP 0x0064000F	SIP subscribe failure, because of failure response from server.	Check SIP server.

(56 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
16	Comm	Maj	Y, Y, Y	subs-domainname (long)6553616	SIPSUBSDN 0x00640010	SIP subscribe failure, because of resolve domain name failure.	Check domain name.
17	Comm	Maj	Y, Y, Y	subs-auth (long)6553617	SIPSUBSAUTH 0x00640011	SIP subscribe failure, because of authenticate failure.	Check authenticate element.
18	Comm	Maj	Y, Y, Y	subs-refreshfail (long)6553618	SIPSUBSRF 0x00640012	SIP subscribe refresh failure, because of message timeout.	Check network.
19	Comm	Maj	Y, Y, Y	subs-inittimeout (long)6553619	SIPSUBSTO 0x00640013	SIP subscribe initial failure, because of message timeout.	Check network.
20	Comm	Min	N, Y, Y	emergency-call (long)6553620	SIPEMERGCALL 0x00640014	Emergency call is ongoing.	When emergency call finish, it will be cleared.
Alarm type: 101 Alarm type = ONT Services PWE (101) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponCesServiceUniIndex (IfIndex of the ONT CES UNI), Index2 = gponCesServiceServiceNumber (Service ID) For XGS-PON, XG-PON and NG-PON2 - Index1 = ifIndex (of CES UNI) , Index2 = gponCesServiceServiceNumber (Service ID) Additional info contains AID of CES UNI in comma delineated decimal format (ChannelGroup, SubChannelGroup, ONT #, ONT Slot #, ONT Port #) - e.g. "1,1,1,1,1" For XGS-PON, XG-PON and NG-PON2, NOT SUPPORTED as of ISAM5.2 release.							
1	Equ	Min	Y, Y, Y	ont-svc-pwe-mismatch (long)6619137	PWESVCMIS 0x00650001	A condition meaning that the ONT did not accept the OMCI configuration requests for the provisioned pseudowire service. One possible reason is that the pseudowire service is not supported by the ONT.	The provisioned Pseudowire Service was rejected by the ONT during OMCI configuration requests. 1. Verify Pseudowire (CES) service capability of ONT. 2. Restart ONT to see if problem persists, or delete unsupported PWE service.
2	Comm	Maj	Y, Y, Y	ont-svc-pwe-reordr-lof (long)6619138	PWELOSSREORDER 0x00650002	The rate for CESoETH frames reordered and frames loss exceeded.	1. Assess whether problem is due to network problem or misconfiguration. 2. If no network path problem exists, check for misconfiguration of the pseudowire service between endpoints.
3	Comm	Maj	Y, Y, Y	ont-svc-pwe-jitt-buf-o (long)6619139	PWEJBOVRRUN 0x00650003	The rate of CESoETH packets arrival exceeds the jitter buffer storage space.	1. Assess whether problem is due to network problem or misconfiguration. 2. If no network path problem exists, check for misconfiguration of the pseudowire service between endpoints.

(57 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
4	Comm	Maj	Y, Y, Y	ont-svc-pwe-jitt-buf-u (long)6619140	PWEJBUNDRRUN 0x00650004	The rate of received CESoETH packets is too low resulting in replacement data being played out.	1. Assess whether problem is due to network problem or misconfiguration. 2. If no network path problem exists, check for misconfiguration of the pseudowire service between endpoints.
5	Comm	Maj	Y, Y, Y	ont-svc-pwe-malf-frm s (long)6619141	PWEMALFORM 0x00650005	Excessive Malformed CESoETH Frames received.	
6	Comm	Maj	Y, Y, Y	ont-svc-pwe-late-frms (long)6619142	PWELATEFRMS 0x00650006	CESoETH Frames arriving after the scheduled playout time alarm.	1. Assess whether problem is due to network problem or misconfiguration. 2. If no network path problem exists, check for misconfiguration of the pseudowire service between endpoints.
7	Comm	Maj	Y, Y, Y	ont-svc-pwe-link-loss (long)6619143	PWELINKLOSS 0x00650007	A condition indicating 15% of packets received are in error. This encompasses lost, malformed, underrun, overrun, late, stray, and invalid sequences, ie. all possible error reasons.	1. Assess whether problem is due to network problem or misconfiguration. 2. If no network path problem exists, check for misconfiguration of the pseudowire service between endpoints.
8	Comm	Maj	Y, Y, Y	ont-svc-pwe-arp-fail (long)6619144	PWEARPFAIL 0x00650008	When the IP address of the DS1 PW peer is configured at the ONT, the ONT will try to determine the MAC address of the peer using the well-known ARP protocol. If after a few re-tries, the peer does not respond to the ARP Request from the ONT, the ONT shall report an ARP Failure alarm for the corresponding DS1 interface. The ONT will periodically re-try the ARP request messages, and when the ARP Response message is eventually received the ARP Failure alarm will be cleared.	1. Check the static IP configuration at ONT. 2. Check DS1 PW peer connectivity.
Alarm type: 102 Alarm type = ONT Services CESE1 (102) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponOntEquipIfIndex (IfIndex of ONT), Index2 = bponCesPortSpIndex. For XGS-PON, XG-PON and NG-PON2, NOT SUPPORTED as of ISAM5.2 release.							

(58 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
1	Equ	Min	Y, Y, Y	ont-svc-ces-e1-mis (long)6684673	CESE1SVCMIS 0x00660001	A condition meaning that the ONT did not accept the OMCI configuration requests for the provisioned CES E1 service. One possible reason is that the provisioned CES service is not supported physically by the ONT (e.g. unsupported CES E1 provisioned for an ONT).	The provisioned CES E1 Service was rejected by the ONT during OMCI configuration requests. 1. Verify E1 port service capability of ONT. 2. Restart ONT to see if problem persists, or delete unsupported E1 service port.
2	Comm	Maj	Y, Y, Y	ont-svc-ces-e1-los (long)6684674	CESE1LOS 0x00660002	Loss of Signal at E1 Interface.	1. Determine whether problem is due to physical interface cabling or due to actual failure of signal from far end E1 equipment. 2. If no physical cabling problem exists, check far-end E1 transmit capabilities.
3	Comm	Maj	Y, Y, Y	ont-svc-ces-e1-lof (long)6684675	CESE1LOF 0x00660003	Loss of Frame at E1 Interface.	1. Determine whether problem is due to physical interface cabling, misprovisioning, or signal from far end E1 equipment. 2. If no physical cabling problem exists, check for misprovisioning of framing format between equipment. Also check far-end E1 transmit capabilities.
6	Comm	Maj	Y, Y, Y	ont-svc-ces-e1-rair (long)6684678	CESE1RAIR 0x00660006	Receiving RAI at E1 Interface.	1. Determine whether problem is due to physical interface cabling, or ONT bad transmit signal. RAI is the result of the far end E1 equipment detecting a problem with its receive signal and indicating a remote alarm indication back. 2. If no physical cabling problem exists, check far-end E1 equipment for alarms and resolve.

(59 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
8	Comm	Maj	Y, Y, Y	ont-svc-ces-e1-ais (long)6684680	CESE1AISR 0x00660008	Receiving AIS at E1 Interface.	1. Determine whether problem is due to E1 network/equipment problem or misprovisioning. AIS represents a failure upstream in the network where AIS is inserted downstream toward the downstream equipment to indicate that a failure exists upstream. 2. If no E1 network/equipment problem, check E1 provisioning on the far-end for valid traffic path configuration.
Alarm type: 103 Alarm type = SIP E1SIPTermination (103) - Index1 = IfIndex of E1 physical port, Index2 = not used.							
1	Comm	Maj	Y, Y, Y	e1sip-reg-domainname (long)6750209	SIPREGDN 0x00670001	SIP registration failure, because of resolve domain name failure. Additional Info: 'directory number'.	Check domain name.
2	Comm	Maj	Y, Y, Y	e1sip-reg-auth (long)6750210	SIPREGAUTH 0x00670002	SIP registration failure, because of authenticate failure. Additional Info: 'directory number'.	Check authenticate element.
3	Comm	Maj	Y, Y, Y	e1sip-reg-timeout (long)6750211	SIPREGTO 0x00670003	SIP registration failure, because of message timeout. Additional Info: 'directory number'.	Check network.
4	Comm	Maj	Y, Y, Y	e1sip-reg-srvfailresp (long)6750212	SIPREGFRSP 0x00670004	SIP registration failure, because of failure response from server. Additional Info contains: a SIP error response from the registrar server and the directory number '403 Forbidden 'directory number''.	Check SIP server.
5	Comm	Maj	Y, Y, Y	e1sip-inv-domainname (long)6750213	SIPINVDN 0x00670005	SIP invite failure, because of resolve domain name failure. Additional Info: 'directory number'.	Check domain name.
6	Comm	Maj	Y, Y, Y	e1sip-inv-auth (long)6750214	SIPINVAUTH 0x00670006	SIP invite failure, because of authenticate failure. Additional Info: 'directory number'.	Check authenticate element.
7	Comm	Maj	Y, Y, Y	e1sip-inv-timeout (long)6750215	SIPINVTO 0x00670007	SIP invite failure, because of message timeout. Additional Info: 'directory number'.	Check network.

(60 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
8	Comm	Maj	Y, Y, Y	e1sip-inv-srvfailresp (long)6750216	SIPINVFRSP 0x00670008	SIP invite failure, because of failure response from server. Additional Info: 'directory number'.	Check SIP server.
9	Comm	Min	N, Y, Y	e1sip-emergency-call (long)6750217	SIPEMERGCALL 0x00670009	Emergency call is ongoing. Additional Info: 'directory number'.	When emergency call finish, it will be cleared.
10	Comm	Maj	Y, Y, Y	e1itf-ais-signal (long)6750218	SIPE1ITFAIS 0x0067000A	Alarm Indication Signal detected at E1 interface.	1. Determine whether problem is due to E1 network/equipment problem or misprovisioning. AIS indicates loss of layer 1 capability in the ET to TE direction on the network side of the user-network interface. 2. If no E1 network/equipment problem, check E1 provisioning on the far-end for valid traffic path configuration.
11	Comm	Maj	Y, Y, Y	e1itf-los-signal (long)6750219	SIPE1ITFLOS 0x0067000B	Loss Of Signal detected at E1 interface.	1. Determine whether problem is due to physical interface cabling or due to actual failure of signal from far end E1 equipment. 2. If no physical cabling problem exists, check far-end E1 transmit capabilities.
12	Comm	Maj	Y, Y, Y	e1itf-rai-signal (long)6750220	SIPE1ITFRAI 0x0067000C	Remote Alarm Indication detected at E1 interface.	1. Determine whether problem is due to physical interface cabling, or NIAT-A bad transmit signal. RAI is the result of the far end E1 equipment detecting a problem with its receive signal and indicating a remote alarm indication back. 2. If no physical cabling problem exists, check far-end E1 equipment for alarms and resolve.
13	Comm	Maj	Y, Y, Y	e1sip-misconfig-mgc10 (long)6750221	SIPMISCFGMGC10 0x0067000D	This alarm is raise when configuration error when connect to MGC10.	Check ISDN Term Configuration.
14	Comm	Maj	Y, Y, Y	e1sip-nsmprf-missed (long)6750222	SIPNSMPROFMIS 0x0067000E	This alarm is raise when The SIP termination requires a NSM profile.	Modify ISDN Term with a NSM profile, it will be cleared.
Alarm type: 104 Alarm type = Externaldev (104) - Index1 = not used, Index2 = not used.							

(61 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
1	Equ	Crit	N, Y, Y	loss-env-mon (long)6815745	LOSS_ENV_MON 0x00680001	The environment box doesn't exist or is not alive.	Check existence of Environment Box.
Alarm type: 105 Alarm type = FileTransfer (105) - Index1 = [File Server ID (IP@) for IPv4 / 0xFFFFFFFF for IPv6], Index2 = Not used. In case of IPv6 host, additional information contains the IPv6 address of the File Transfer Server.							
1	Comm	Maj	N, Y, Y	fileserv-unavail (long)6881281	FTPSRV_UNAVAIL 0x00690001	The system is not able to connect to the file server for file transfer or the file transfer has failed. This alarm is raised when this event occurs. The alarm is cleared when a successful file transfer has been completed.	Check whether the file transfer server has been correctly configured, check the network to file transfer server. Check if the file to be transferred exists.
Alarm type: 106 Alarm type = TrafficOverflow(106) - Index1 = eqptSlotId (Index in equipment Board Table for the NT), Index2 = not used.							
1	QOS	Min	Y, Y, Y	fanout (long)6946817	FANOUT 0x006A0001	LT load overflow.	Check LT Load.
2	QOS	Min	Y, Y, Y	up-overflow (long)6946818	UPOVERFLOW 0x006A0002	Upstream load overflow.	Check LT load in upstream.
3	QOS	Min	Y, Y, Y	upobc-overflow (long)6946819	UPOBCFLOW 0x006A0003	Upstream load to OBC overflow.	Check LT load to OBC in upstream.
4	QOS	Min	Y, Y, Y	dwobc-overflow (long)6946820	DWOBCFLOW 0x006A0004	Downstream load to OBC overflow.	Check LT load to OBC in downstream.
5	QOS	Min	Y, Y, Y	dw-overflow (long)6946821	DWOVERFLOW 0x006A0005	Downstream load overflow.	Check LT load in downstream.
6	QOS	Min	Y, Y, Y	lwpri-overflow (long)6946822	LPDRFLOW 0x006A0006	The number of BE and CF packets dropped exceed threshold.	Check Voice and Video load.
Alarm type: 107 Alarm type = EthTca (107) - Index1 = ifIndex of Ethernet interface, Index2 = not used.							
1	QOS	Min	N, Y, Y	etca-los (long)7012353	ETHPORT_ETHLOS 15 0x006B0001	The number of Loss Of Signal errors encountered by the Ethernet interface in the current 15 minutes interval has reached its threshold value.	Check physical line. Check modem equipment.
2	QOS	Min	N, Y, Y	etca-fcs (long)7012354	ETHPORT_ETHFCS 15 0x006B0002	The number of Frame Check Sequence errors encountered by the Ethernet interface in the current 15 minutes interval has reached its threshold value.	Check physical line. Check modem equipment.

(62 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
3	QOS	Min	N, Y, Y	etca-day-los (long)7012355	ETHPORT_ETHLOS DAY 0x006B0003	The number of Loss Of Signal errors encountered by the Ethernet interface in the current one-day interval has reached its threshold value.	Check physical line. Check modem equipment.
4	QOS	Min	N, Y, Y	etca-day-fcs (long)7012356	ETHPORT_ETHFCS DAY 0x006B0004	The number of Frame Check Sequence errors encountered by the Ethernet interface in the current one-day interval has reached its threshold value.	Check physical line. Check modem equipment.
5	QOS	Min	N, Y, Y	etca-rx-octets (long)7012357	ETHPORT_ETHRXB 15 0x006B0005	The number of received octets by the Ethernet interface in the current 15 minutes interval has reached its threshold value.	Add extra lines in the LAG.
6	QOS	Min	N, Y, Y	etca-tx-octets (long)7012358	ETHPORT_ETHTXB 15 0x006B0006	The number of transmitted octets by the Ethernet interface in the current 15 minutes interval has reached its threshold value.	Add extra lines in the LAG.
7	QOS	Min	N, Y, Y	etca-day-rx-octets (long)7012359	ETHPORT_ETHRXB DAY 0x006B0007	The number of received octets by the Ethernet interface in the current one-day interval has reached its threshold value.	Add extra lines in the LAG.
8	QOS	Min	N, Y, Y	etca-day-tx-octets (long)7012360	ETHPORT_ETHTXB DAY 0x006B0008	The number of transmitted octets by the Ethernet interface in the current one-day interval has reached its threshold value.	Add extra lines in the LAG.
Alarm type: 108 Alarm type = EthSFP (108) - Index1 = ifIndex of Ethernet interface, Index2 = not used.							
1	Comm	Min	Y, Y, Y	user-sfp-los (long)7077889	LTSFPLOS 0x006C0001	User SFP loss-of-signal.	Check physical line.
2	Comm	Min	Y, Y, Y	user-sfp-tx-fail (long)7077890	LTSFPTXF 0x006C0002	User SFP Tx failure.	Check SFP module.
3	Comm	Min	Y, Y, Y	user-sfp-not-prst (long)7077891	LTSFPNP 0x006C0003	User SFP is not detected.	Check SFP present.
4	Comm	Min	Y, Y, Y	user-sfp-inv-id (long)7077892	LTSFPINVID 0x006C0004	User SFP does not have valid Nokia ID.	Check SFP module ID.

(63 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
5	Comm	Crit	Y, Y, Y	user-sfp-t-exceed (long)7077893	LTSFPTEMP 0x006C0005	User SFP temperature exceeds the threshold which is same as the temperature to cause board in thermal major alarm.	Check SFP temperature.
6	Comm	Min	Y, Y, Y	user-sfp-mismatch (long)7077894	SFPMISMATCH 0x006C0006	User SFP mismatches the configured speed rate (100Mbps / 1Gbps).	Check SFP type.
Alarm type: 109 Alarm type = L2Forward (109) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = ifIndex of bridgeport, Index2 = see specific alarm number. For XGS-PON, XG-PON and NG-PON2 Additional info contains comma delineated AID of bridgeport in decimal format (ChannelGroup, SubChannelGroup, ONT #, ONT Slot #, ONT Port #) - e.g. "1,1,1,1,1"							
1	Comm	Min	Y, Y, Y	mac-conflict (unsigned long)7143425	ATM_MAC_CONFLICT 0x006d0001	The number of packets dropped by queue exceed threshold.	Check the corresponding queue Load.
2	Comm	Min	Y, Y, Y	vmac-full (unsigned long)7143426	ATM_VMAC_FULL 0x006d0002	The queue load exceed threshold.	Check the corresponding queue Load.
Alarm type: 112 Alarm type = QueueCounter (112) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = ifIndex of the physical line, Index2 = Queue Index For XGS-PON, XG-PON and NG-PON2 Additional info contains comma delineated AID of ONT UNI in decimal format (ChannelGroup, SubChannelGroup, ONT #, ONT Slot #, ONT Port #) - e.g. "1,1,1,1,1" or AID of ONT in decimal format (ChannelGroup, SubChannelGroup, ONT #) - e.g. "1,1,1"							
1	QOS	Min	Y, Y, Y	queue-drop (long)7340033	QUEUEDRFLOW 0x00700001		
2	QOS	Min	Y, Y, Y	queue-load (long)7340034	QUEUELD 0x00700002		
3	QOS	Min	Y, Y, Y	queue-peak-usage (long)7340035	QUEUEPEAKUSAGE 0x00700003		
Alarm type: 113 Alarm type = MEGACOMediaGateway (113) - Index1 = Voice signaling board slot id ,Index2 = mediaGatewayId (identifier of the affected media gateway).							
1	Comm	Crit	Y, Y, Y	mgc-unreachable (long)7405569	MGWCLOSS 0x00710001	Loss of contact with the media gateway controller. Additional Info contains: switch to Local ESA MGC status, where status specifies successfully or failed. Additional info is only used when switch to local ESA mgc autonomously.	Check network connections.

(64 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
2	Comm	Crit	Y, Y, Y	failover-to-esamgc (long)7405570	FAILOVERtoESAMGC 0x00710002	The MG made a fail-over to the Emergency StandAlone Media Gateway Controller.	The alarm is raised in the following situations. 1. The operator did manually trigger a failover: this may have several reasons and it was finally decided by the operator to perform a failover. The operator is thus very well aware of the reason why a failover has been manually triggered. Thus the repair action is under full control of the operator. 2. The system did autonomously trigger a failover: this means that none of the non-ESA MGCs are still available. In this case the proposed repair action is to make sure that at least one of the non-ESA MGCs come back in service.
Alarm type: 114 Alarm type = MEGACOSignalingGateway (114) - Index1 = Voice signaling board slot id, Index2 = signallingGatewayId(identifier of the affected signalling gateway)							
1	Comm	Crit	Y, Y, Y	sgc-unreachable (long)7471105	SGWCLOSS 0x00720001	Loss of contact with the signalling gateway controller.	Check network connections.
Alarm type: 115 Alarm type = MEGACOPlugInUnit (115) - Index1 = Voice signaling board slot id /EquipmentId(The format is like Rack_Id/Shelf_Id/Slot_Id/EquipmentId, EquipmentId is a identifier of the NE holding the board in voice signaling board), Index2 = accessBoardId (identifier of the slot holding the line card).							
1	Comm	Crit	Y, Y, Y	lcard-unreach-srvcard (long)7536641	LCARDLOSSWSVCARD 0x00730001	Line card not reachable.	Check interface between IVPS and POLT.
5	Equ	Maj	Y, Y, Y	lcard-type-mismatch (long)7536645	LCARDMISMATCH 0x00730005	Associate board of wrong type.	Compare the provisioned card with the equipped card.
Alarm type: 116 Alarm type = MEGACOTermination(116) -Index1 = Voice signaling board slot id /EquipmentId(The format is like Rack_Id/Shelf_Id/Slot_Id/EquipmentId, EquipmentId is a identifier of the NE holding the board in voice signaling board), Index2 = accTerminationUserPortId (identifier of the user port)							
1	Comm	Maj	Y, Y, Y	meg-unknown-sub (long)7602177	UNSUB 0x00740001	The Megaco subscriber exists in voice signaling board but not in media gateway controller.	Check user port identification.

(65 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
2	Equ	Maj	Y, Y, Y	meg-ground-key (long)7602178	GRDKEY 0x00740002	The current threshold of the physical line of the port exceeded. The usual root causes are as following: the tip is connected to AC source; the ring is connected to the source of high voltage or AC. Note: alarm is only applicable and supported for POTS.	Perform a line test.
3	Equ	Maj	Y, Y, Y	meg-high-temp (long)7602179	HIGHTEM 0x00740003	Temperature threshold on the physical PSTN port exceeded, the port will be automatically shutdown. Note: alarm is only applicable and supported for POTS.	Perform a line test.
4	Equ	Maj	Y, Y, Y	meg-act-fail (long)7602180	L1ACTF 0x00740004	The first link layer for ISDN subscriber Activation Failure.	Perform a line test.
5	Equ	Maj	Y, Y, Y	meg-over-current (long)7602181	OVCU 0x00740005	The physical ISDN port is Over Current. This alarm happens when line current is over 40mA. Normally over-current is caused by short circuit or inconsistent NT device.	Perform a line test.
6	Comm	Maj	Y, Y, Y	line-showering (long)7602182	LNESHOWER 0x00740006	One of lines for a subscriber is connected to another subscriber. Note: alarm is only applicable and supported for POTS.	Check the subscriber line, find the confused lines.
7	QOS	Maj	Y, Y, Y	low-qos-packetloss (long)7602183	LQOSPKTLOSS 0x00740007	The Packet Loss threshold is exceeded. Note: alarm is only applicable and supported for H248 POTS.	Check the RTP packet loss.
8	QOS	Min	Y, Y, Y	low-qos-jitter (long)7602184	LQOSJITTER 0x00740008	The Inter Arrival Jitter threshold is exceeded. Note: alarm is only applicable and supported for H248 POTS.	Check the RTP jitter.
9	QOS	Min	Y, Y, Y	low-qos-delay (long)7602185	LQOSDELAY 0x00740009	The Round Trip Delay threshold is exceeded. Note: alarm is only applicable and supported for H248 POTS.	Check the RTP delay.
Alarm type: 117 Alarm type = MEGACOSignalingLt (117) - Index1 = voice signaling board slot id, Index2 = not used.							
2	Equ	Crit	Y, Y, Y	sig-brd-persist-loss (long)7667714	SCARDPDLOSS 0x00750002	Voice signaling board has lost all persistent data after restart. This board is not configured.	Reconfigure ISAM-V.

(66 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
3	Equ	Maj	Y, Y, Y	sig-brd-disk-full (long)7667715	SCARDBROLLBK 0x00750003	Voice signaling board Disk has been used 90%.	Check IVPS disk and delete the unused data.
4	Proc	Maj	Y, Y, Y	sig-brd-db-rollback (long)7667716	SCARDDSKFUL 0x00750004	Voice signaling board is not able to make the last downloaded data base active.	Download proper database again.
5	Equ	Crit	Y, Y, Y	mg-overload (long)7667717	MGOVERLOAD 0x00750005	Voice signaling board resource is overloaded.	Restrain the rate that MG admit calls.
Alarm type: 118 Alarm type = ONT Services XDSL (118) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponOntEquipIfIndex (IfIndex of ONT), Index2 = gxdslLineSpIndex. For XGS-PON, XG-PON and NG-PON2 ' NOT SUPPORTED as of ISAM5.2 release.							
1	Equ	Min	Y, Y, Y	ont-svc-xdsl-mismatch (long)7733249	XDSLSVCMIS 0x00760001	A condition meaning that the ONT did not accept the OMCI configuration requests for the provisioned VDSL2 service. One possible reason is that the VDSL2 service is not physically supported by the ONT (e.g. VDSL2 port provisioned on slot that has POTS only card equipped).	The provisioned VDSL2 Service was rejected by the ONT during OMCI configuration requests. 1. Verify XDSL service capability of ONT. 2. Restart ONT to see if problem persists, or delete unsupported XDSL service port.
2	Comm	Min	Y, Y, Y	ont-svc-xdsl-ne-lof (long)7733250	XLOF 0x00760002	Near End Loss of Frame (VTU-O).	Check ONT/MDU XDSL receive signal and CPE equipment for problems.
3	Comm	Min	Y, Y, Y	ont-svc-xdsl-ne-los (long)7733251	XLOS 0x00760003	Near End Loss of Signal (VTU-O).	Check ONT/MDU XDSL receive signal and CPE equipment for problems.
4	Comm	Min	Y, Y, Y	ont-svc-xdsl-ne-line (long)7733252	LINEINIT 0x00760004	Near End LINEINT (VTU-O).	Check ONT/MDU XDSL receive signal and CPE equipment for problems.
5	Comm	Min	Y, Y, Y	ont-svc-xdsl-ne-lol (long)7733253	XLOL 0x00760005	Near End Loss of Link (VTU-O).	Check ONT/MDU XDSL receive signal and CPE equipment for problems.
6	Comm	Min	Y, Y, Y	ont-svc-xdsl-fe-lof (long)7733254	XLOF 0x00760006	Far End Loss of Frame (VTU-R).	Check CPE equipment and CPE receive signal for problems.
7	Comm	Min	Y, Y, Y	ont-svc-xdsl-fe-los (long)7733255	XLOS 0x00760007	Far End Loss of Signal (VTU-R).	Check CPE equipment and CPE receive signal for problems.
8	Comm	Min	Y, Y, Y	ont-svc-xdsl-fe-lop (long)7733256	XLOP 0x00760008	Far End Loss of Power (VTU-R).	Check CPE equipment and CPE receive signal for problems.

(67 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
9	Equ	Min	Y, Y, Y	ont-svc-xdsl-cnf-err (long)7733257	XDSLCNFG 0x00760009	XDSL Provisioning Error detected during post OMCI processing.	The provisioned VDSL2 Service was rejected by the ONT during post OMCI processing. Verify XDSL service capability of ONT, CPE Modem and consistency of the provisioning parameters.
Alarm type: 119 Alarm type = ONT Services XDSL TCA (119) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponOntEquipIfIndex (IfIndex of ONT), Index2 = gxdslLineSpIndex. For XGS-PON, XG-PON and NG-PON2 ' NOT SUPPORTED as of ISAM5.2 release.							
1	QOS	Warn	N, Y, Y	ont-svc-xdsl-ne-es-tc (long)7798785	T_ES 0x00770001	The number of near end VDSL2 errored seconds threshold has been crossed.	1. Check XDSL UNI Physical interface receive signal. 2. Check CPE equipmennt and CPE signal for problems.
2	QOS	Warn	N, Y, Y	ont-svc-xdsl-ne-ses-tc (long)7798786	T_SES 0x00770002	The number of near end VDSL2 severe errored seconds threshold has been crossed.	1. Check XDSL UNI Physical interface receive signal. 2. Check CPE equipment and CPE signal for problems.
3	QOS	Warn	N, Y, Y	ont-svc-xdsl-ne-uas-tc (long)7798787	T_UAS 0x00770003	The number of near end VDSL2 unavailable seconds threshold has been crossed.	1. Check XDSL UNI Physical interface receive signal. 2. Check CPE equipment and CPE signal for problems.
4	QOS	Warn	N, Y, Y	ont-svc-xdsl-fe-es-tc (long)7798788	T_ES 0x00770004	The number of far end VDSL2 errored seconds threshold has been crossed.	1. Check XDSL UNI Physical interface receive signal. 2. Check CPE equipment and CPE signal for problems.
5	QOS	Warn	N, Y, Y	ont-svc-xdsl-fe-ses-tc (long)7798789	T_SES 0x00770005	The number of far end VDSL2 severe errored seconds threshold has been crossed.	1. Check XDSL UNI Physical interface receive signal. 2. Check CPE equipment and CPE signal for problems.
6	QOS	Warn	N, Y, Y	ont-svc-xdsl-fe-uas-tc (long)7798790	T_UAS 0x00770006	The number of far end VDSL2 unavailable seconds threshold has been crossed.	1. Check XDSL UNI Physical interface receive signal. 2. Check CPE equipment and CPE signal for problems.
Alarm type: 120 Alarm type = MCSRC (120) - Index1 = multicastgroupAddr, Index2 = eqptSlotId							

(68 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
1	Comm	Maj	Y, Y, Y	mcsrc-stream-lost (long)7864321	MCASTLOSS 0x00780001	Multicast Video Stream lost. This alarm is generated at LT.	1. Check receive signal at NT and connectivity to video source. 2. If alarm at LT MCSRC, verify provisioning and LT equipment operational state. 3. If Multicast Source no longer in use, deprovision MCAST service.
Alarm type: 121 Alarm type = equipSupplemental (121) - Index1 = eqptHolderId (Index in equipment holder Table), Index2 = not used.							
7	Comm	Min	N, Y, Y	eqptsupl-syslog-upload (long)7929863	ULFAILED 0x00790007	Upload of the NE s system log file to system log server failed.	
14	Equ	Min	N, Y, Y	eqptsupl-ontsw-dnload (long)7929870	AUTOONTSWDLIP 0x0079000E	Downloading of ONT software stemming from Version Control (VERCTL) table to an ONT is in progress.	1. This is a normal alarm indicating a download is in progess to one or more ONTs. Wait for alarm to clear. This alarm is activated when the ONT VERCTL Table has been updated requiring 1 or more ONTs to have their software downloaded. The system shall clear the alarm when no further download/activations are pending. 2. Contact Nokia customer service if alarm fails to ever clear.
20	Comm	Maj	N, Y, Y	cf-75%used (long)7929876	CF75PERCENT 0x00790014	Compact flash has exceeded 75% life expectancy.	Order new compact flash to replace the aging compact flash device.
21	Comm	Crit	N, Y, Y	cf-90%used (long)7929877	CF90PERCENT 0x00790015	Compact flash has exceeded 90% life expectancy.	Backup the node and replace the compact flash device.
Alarm type: 129 Alarm type = ONT General Supplemental (129) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponOntEquipIfIndex (IfIndex of ONT), Index2 = not used.							
1	Equ	Min	N, Y, Y	ont-gen-sw-dnload-file (long)8454145	SWDLFILE 0x00810001	Download of software to ONT has failed because the image file is missing or has an error.	1. Ensure that planned ONT software version is physically present on the OLT. 2. Retry the download again. 3. Reload the ONT image on the OLT. Call Nokia customer service.
2	Equ	Maj	N, Y, Y	ont-gen-fan-fail (long)8454146	FANALM 0x00810002	Fan Failure at the ONT/ONU.	1. Check Fan. 2. Check Ambient Temperature.

(69 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
3	Equ	Maj	N, Y, Y	ont-gen-high-temp (long)8454147	HITEMPWARN 0x00810003	Abnormally high temperature at the ONT/ONU.	1. Check Fan. 2. Check Ambient Temperature.
4	Equ	Maj	Y, Y, Y	ont-gen-high-temp-ex (long)8454148	HITEMPSHUTOFF 0x00810004	Services disabled to prevent ONT/ONU HW damage due to excessively high temperature.	1. Check Fan. 2. Check Ambient Temperature.
5	Comm	Min	N, Y, Y	ont-gen-emergency-call (long)8454149	ECALLACT 0x00810005	Emergency Call active on ONT.	Indication that an emergency phone call is active. Wait for the call to terminate. Note: during an emergency call, no upgrade or modification to the system should be performed which could cause call termination.
7	Equ	Min	N, Y, Y	ont-gen-sw-version (long)8454151	SWVERCTLERR 0x00810007	ONT Software version control error. Occurs when no ONT software match found in ONT SW version control table. Note: only valid when ENT-ONT PLANVER or DLVER is provisioned as AUTO .	A condition meaning no ONT software match found in ONT SW version control table. Note: only valid when either ENT-ONT PLANVER or DLVER is provisioned as AUTO. Possible reasons for alarm are: 1. if PLANVER attribute on ONT is AUTO, check ACTHWVER/PLANSWVAR for match of provisioned AUTOHWVER/AUTOSWVAR values in the ONT SW version control table; 2. if DLVER attribute on ONT is AUTO, check ACTHWVER/PLANSWVAR for match of provisioned AUTOHWVER/AUTOSWVAR values in the ONT SW version control table. If no match exists in ONT SW version control table, either update PLANSWVAR and/or add a new entry to the ONT SW version control table in a manner that causes the AUTO setting to have a match. Otherwise disable feature by changing PLANVER and DLVER to not be AUTO.
8	Equ	Crit	N, Y, Y	ont-poe-exceed-max (long)8454152	POE_EXCEED 0x00810008	Configured PoE feeding exceed the maximum output power of ONU.	Adjust the feeding of each configured port to fit the ONT output.

(70 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
9	Comm	Maj	Y, Y, Y	ont-gen-cfgdld-fail (long)8454153	CFGDLDFAIL 0x00810009	Download of voice xml file to ONT failed (for OMCI download method).	1. Ensure the voice configuration file is physically present on the OLT. If not, ensure the voice configuration file is on the ftp server and the ftp server is available. 2. Ensure the OMCI between OLT and ONT is ok. 3. Retry the download again.
10	Equ	Min	N, Y, Y	ont-gen-rssi-mis (long)8454154	PRFMIS 0x0081000A	ONT RSSI configuration mismatch.	Check ONT capability and whether support this function or parameter.
11	Equ	Min	N, Y, Y	ont-gen-tx-pwr-low (long)8454155	TXPWL 0x0081000B	ONT SFP Tx Power is lower than configured Alarm low threshold.	Check and increase ONT Tx power.
12	Equ	Min	N, Y, Y	ont-gen-temp-high (long)8454156	TMPH 0x0081000C	ONT SFP Temperature is higher than configured Alarm high threshold.	Check and decrease ONT SFP temperature.
13	Equ	Min	N, Y, Y	ont-gen-volt-high (long)8454157	VOLTH 0x0081000D	ONT SFP Voltage is higher than configured Alarm high threshold.	Check and decrease ONT SFP voltage.
14	Equ	Min	N, Y, Y	ont-gen-bias-high (long)8454158	BIASH 0x0081000E	ONT SFP Bias is higher than configured Alarm high threshold.	Check and decrease ONT SFP bias current.
15	Equ	Min	N, Y, Y	ont-loopdetect-mis (long)8454159	ONTLOOPDETECTMIS 0x0081000F	ONT loop detection configuration mismatch.	Check ONT capability and whether support loop detection.
16	Comm	Maj	Y, Y, Y	ont-olt-rx-pw-lo (long)8454160	GOLTRXPWLO 0x00810010	Receive power from ONT at OLT side is lower than the sensor sensitivity lower limit (decrease the number of ONT or remove optical attenuator).	1. Check optical attenuator or the line problem. 2. Check SFP module,
17	Comm	Maj	Y, Y, Y	ont-olt-rx-pw-hig (long)8454161	GOLTRXPWHI 0x00810011	Receive power from ONT at OLT side is higher than the sensor sensitivity upper limit.	1. Check optical attenuator or the line problem. 2. Check SFP module.
18	Comm	Warn	N, Y, Y	ont-olt-rx-pw-warnlo (long)8454162	GOLTRXPWLOWARN 0x00810012	Receive power from ONT at OLT side is lower than the sensor sensitivity lower WARNING limit.	1. Check optical attenuator or the line problem. 2. Check SFP module.
19	Comm	Warn	N, Y, Y	ont-olt-rx-pw-warnhig (long)8454163	GOLTRXPWHIWARN 0x00810013	Receive power from ONT at OLT side is higher than the sensor sensitivity upper WARNING limit.	1. Check optical attenuator or the line problem. 2. Check SFP module.
20	Equ	Maj	Y, Y, Y	ont-gen-tod-out-sync (long)8454164	TODOUTSYNC 0x00810014	ONU lost the TOD sync from OLT.	-

(71 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
21	Comm	Maj	Y, Y, Y	ont-gen-tune-fail (long)8454165	TUNEFAIL 0x00810015	ONT failed to tune to wavelength commanded by OLT. Additional info contains 2 comma delineated decimal format AIDs of Target Channel Pair and Parked Channel Pair (TargetRack, TargetShelf, TargetLTSlot, TargetChannelPair, ParkedRack, ParkedShelf, ParkedLTSlot, ParkedChannelPair) e.g. 1,1,1,1,2,2,2,2. Note: this alarm is only relevant for NG-PON2 (i.e. not GPON or XG-PON1).	Check OLT and/or ONT to see why failed to tune.
22	Equ	Min	N, Y, Y	hgu-tr069-parm-fail (long)8454166	HGUTR069MEA 0x00810016	ONT did not accept the configuration for HGU TR069 parameters.	Check HGU TR069 parameters to see why failed to be provisioned.
23	Equ	Min	N, Y, Y	ont-gen-tod-mismatch (long)8454167	TODMISMATCH 0x00810017	ONT did not accept the configuration of multiple PTP Port Profiles.	Check whether multiple PTP Port Profiles are supported by ONT.
24	Equ	Min	N, Y, Y	ont-poe-overload-yell (long)8454168	POE_YELLOWEXCEED 0x00810018	ONU is nearing its maximum ability to supply the known PoE demand of the attached PDs.	Check the Power of PDs under the ONT.
25	Equ	Maj	N, Y, Y	ont-opti-malfunc (long)8454169	OPTICAL_MALFUNC 0x00810019	ONT detects the malfunction of its optical transceiver.	Check the ONT's optical transceiver.
Alarm type: 130 Alarm type = EquipHolder_2 (130) - Index1 = eqptHolderId (Index in equipment holder Table to identify a shelf), Index2 = not used.							
2	Env	Maj	Y, Y, Y	network-power-loss (long)8519682	NETWORKPWRLOSS 0x00820002	Applicable for network-powered variant of the 7330 ISAM FTTN ANSI (+-190VDC RFT-V). One or both of the +- 190VDC power feeds is missing. The 7330 ISAM FTTN ANSI variant has a hold-up module that allows at least 2 seconds operation without power. Applied as EquipHolder, so Alarm is not cleared when unit resets. Also applicable for a few other boards.	Check that both RFT-V power sources are sourcing power.
3	Env	Maj	Y, Y, Y	hw-fault (long)8519683	HWFAULT 0x00820003	Monitoring circuits have detected a hardware fault internal to the unit. The fault cannot be repaired in the field (non-FRU section of unit).	Replace the failed unit.

(72 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
6	Equ	Maj	Y, Y, Y	bat-missing (long)8519686	BATMISS 0x00820006	Applicable for AC module of 7362 ISAM DF/SF. Battery is provisioned for AC module, but is missing.	Connect battery unit.
7	Equ	Maj	Y, Y, Y	bat-fail (long)8519687	BATFAIL 0x00820007	Applicable for AC module of 7362 ISAM DF/SF. Battery is provisioned and present, but cannot recharge.	Replace the battery unit.
8	Equ	Maj	Y, Y, Y	bat-low (long)8519688	BATLOW 0x00820008	Applicable for AC module of 7362 ISAM DF/SF. Battery charge is low.	Charge the battery unit.
9	Equ	Maj	N, Y, Y	bat-a-fail (long)8519689	BATAFAILALM 0x00820009	Applicable to FX only : power source BAT-A not available Alarm. No impact on functionality, BAT-B takes over.	-
10	Equ	Maj	N, Y, Y	bat-b-fail (long)8519690	BATBFAILALM 0x0082000A	Applicable to FX only : power source BAT-B not available alarm. No impact on functionality, BAT-A takes over.	-
12	Equ	Maj	Y, Y, Y	ac-vol-out-range (long)8519692	ACVOLOUTRANGEALM 0x0082000C	AC over-voltage or under-voltage.	Check AC supply.
13	Env	Maj	Y, Y, Y	network-power-loss-b (long)8519693	LOSSNETPOWERBALM 0x0082000D	Applicable for network-powered variant of the 7330 ISAM FTTN ANSI / 7360 ISAM SX-48V ANSI (190VDC RFT-V). One of the 190VDC power feeds is missing or failing (power feed B). The 7330 ISAM FTTN ANSI / 7360 ISAM SX-48V ANSI variant has a hold-up module that allows at least 2 seconds operation without power. Applied as EquipHolder, so Alarm is not cleared when unit resets.	Check that both RFT-V power sources are sourcing power (chain B).
15	Equ	Crit	Y, Y, Y	sem-ac-power-fail (long)8519695	SEM_PWR_FAIL 0x0082000F	Applicable to 7360 ISAM SX-48V ANSI / 7363 ISAM MX : AC variants of SEMS. For 7360 ISAM SX-48V ANSI / 7363 ISAM MX the AC power input has failed and the 7360 ISAM SX-48V ANSI / 7363 ISAM MX is running on hold-up power or local -48V power or Battery.	Check that the AC power source is sourcing power.

(73 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
16	Equ	Maj	Y, Y, Y	sem-ups-fail (long)8519696	SEM_UPS_FAIL 0x00820010	Applicable to 7360 ISAM SX-48V ANSI/ 7363 ISAM MX. External power supply (190VDC RFT-V) voltage has fallen to a dangerously low level.	Check that the RFT-V power source has correct voltage.
17	Equ	Maj	N, Y, Y	dc-a-fail (long)8519697	DCAALM 0x00820011	Applicable to 7360 ISAM SX-48V ANSI / 7363 ISAM MX. Local DC A power failure. 7363 ISAM MX : no impact on functionality, local DC B takes over (if installed). If 7363-MX is intentionally powered from a single DC power feed, then this alarm will be raised when DC A is missing. 7360 ISAM SX-48V ANSI : no impact on functionality, AC or NetworkPower takes over (if installed).	Check that the DC A power source, is sourcing power.
18	Equ	Maj	N, Y, Y	dc-b-fail (long)8519698	DCBALM 0x00820012	Applicable to 7363 ISAM MX. Local DC B power failure. 7363 ISAM MX : no impact on functionality, local DC A takes over (if installed). If 7363-MX is intentionally powered from a single DC power feed, then this alarm will be raised when DC B is missing.	Check that the DC B power source, is sourcing power.
19	Equ	Min	N, Y, Y	plan-power-mismatch (long)8519699	PLANPWRMISMALM 0x00820013	Inform the operator if the detected power mode is different from the planned power mode.	Adapt the planned powerMode, or replace the power supply.
20	Equ	Crit	N, Y, Y	water-seepage-in-box (long)8519700	WATERSEEPAGEIN BOXALM 0x00820014	Detecting water seepage i.e. water seeping/ingressing into the box.	Check the environmental conditions of the box, if water has entered the box, consider replacing the box.
21	Equ	Maj	N, Y, Y	sealed-box-open (long)8519701	SEALEDBOXOPEN 0x00820015	The sealed box is open.	Close the box asap, as to avoid permanent damage because of weather influence.
22	Equ	Maj	N, Y, Y	dc-a-vol-outrange (long)8519702	DCAVOLOUTRANG E 0x00820016	Applicable for DC module of 7362 ISAM DF/SF. When DC A power input voltage is lower than default low threshold or input voltage is higher than default high threshold, alarm is raised.	Check the input voltage of the concerned power unit.

(74 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
23	Equ	Maj	N, Y, Y	dc-b-vol-outrange (long)8519703	DCBVOLOUTRANGE 0x00820017	Applicable for DC module of 7362 ISAM DF/SF. When DC B power input voltage is lower than default low threshold or input voltage is higher than default high threshold, alarm is raised.	Check the input voltage of the concerned power unit.
24	Equ	Maj	N, Y, Y	inlet-temp-major (long)8519704	INLETWARNING 0x00820018	This alarm will be raised, when the ambient inlet temperature exceeds 65C. Applicable for 7363 ISAM MX equipment.	Check the FAN and check the dust filter of the FAN if any.
25	Equ	Crit	N, Y, Y	inlet-temp-critical (long)8519705	INLETCRITICAL 0x00820019	This alarm will be raised, when the ambient inlet temperature exceeds 70C. Applicable for 7363 ISAM MX equipment.	Check the FAN and check the dust filter of the FAN if any.
26	Equ	Crit	Y, Y, Y	low-pwr-all-lt-down (long)8519706	LOWPWRALLLTDOWN 0x0082001A	Alarm notifying all LTs are powered down/powered up due to swithover of power supply from main power to backup battery and vice-versa. Alarm raised when all LTs are powered down due to swithover of power supply from main power to backup battery. Alarm gets cleared, when all LTs are powered up after switchover of power supply from backup battery to main power. Applicable for 7363 MX equipment.	Check the power supply.
Alarm type: 131 Alarm type = LSM Redundancy (131) - Index1 = eqptSlotId, Index2 = not used.							
1	Equ	Maj	N, Y, Y	loss-lsmswp-cap (long)8585217	LSMSWCAP 0x00830001	LSM Group Switchover capability in a redundant system has been lost. Index1 = actual slotId of the LSM pair (i.e. the slotId of the preferred active LSM).	Check link on standby LSM. Check standby boards. Wait for Quench time-out.
2	Equ	Maj	N, Y, Y	inv-xvps-pair-data (long)8585218	XVPS_INVDATA 0x00830002	When xVPS pair is configured in redundant operation, the data of the active board is different from the standby board. Index1 = actual slotId of the LSM pair (i.e. the slotId of the preferred active LSM).	Check the xVPS pair Data

(75 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
Alarm type: 134 Alarm type = Sync (134) - Index1 =eqptSlotId, Index2 = portType [upper 16 bits: BITS(0), SFP(1), XFP(2), IEEE(3), IEEE1588-Hybrid(4), GNSS(5), HoldOver(6), EthPort(7)] + faceplatePort number [lower 16 bits: BITS-A (0), BITS-B(1), BITSOUT(2), IEEEFAIL-A(3), IEEEFAIL-B(4), IEEE1588-HyBrid-A(5), IEEE1588-HyBrid-B(6), GNSS-SMA-A(7), GNSS-SMA-B(8), GNSS-RJ45-A(9), GNSS-RJ45-B(10)SFP (0..n), XFP (1..n)] Note: When SyncE alarm is from FELT-B (Uplink) board, Index1 identifies LT slot and lower 16 bits of Index2 identifies ethernet port							
1	Equ	Maj	Y, Y, Y	bits-fail (long)8781825	BITSFAIL 0x00860001	Failure or unavailability of the BITS timing source. This alarm is only applicable for Enhanced Clock management.	Check the peer equipment and connection between the equipment and the ISAM for the corresponding BITS timing reference. Check that there is no Alarm Indication Signal (AIS) on the corresponding BITS input.
2	Equ	Maj	Y, Y, Y	synce-fail (long)8781826	SYNCEFAIL 0x00860002	Failure or unavailability of the SyncE timing source. This alarm is only applicable for Enhanced Clock management.	Check the peer equipment and connection between the equipment and the ISAM for the timing reference for the specified synchronous Ethernet port. This could be due to a Loss Of Signal, or the Frequency has deviated beyond the capture range of 4.7 ppm or the received SSM-QL value is below the minimum value that has been configured by the operator for allowing this source.
3	Equ	Crit	Y, Y, Y	bits-output-shutoff (long)8781827	BITSSHUTOFF 0x00860003	System QL is lower than the configuration of the QL threshold for BITS-out, resulting in the shutoff of the BITS output. This alarm is only applicable for Enhanced Clock management.	The configuration implies that the BITS output has been shutoff because the overall System QL has become worse than the configured mimimum QL for BITS output. Note that when the system clock is in free-running (i.e. has never been locked on any external clock source since the last reset), the BITS output signal is shut down and this alarm will also be raised. To get it cleared, the system must have been locked on a valid external clock source, at least once since the last system reset.
4	Equ	Maj	Y, Y, Y	ieee1588-fail (long)8781828	IEEE1588FAIL 0x00860004	Failure or unavailability of the IEEE1588 timing source. This alarm is only applicable for Enhanced Clock management.	Check the peer equipment and connection between the equipment and the ISAM for the corresponding IEEE1588 timing reference.

(76 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
5	Equ	Maj	Y, Y, Y	gnss-fail (long)8781829	GNSSFAIL 0x00860005	Failure or unavailability of the GNSS ToD source. This alarm is only applicable for Enhanced Clock management.	Check the peer equipment and connection between the alarming equipment and the ISAM for the corresponding GNSS timing reference interface. If the peer equipment is right connected, then the alarm is removed.
6	Equ	Maj	Y, Y, Y	ieee1588-hybrid-fail (long)8781830	1588HYBRIDFAIL 0x00860006	Failure or unavailability of the IEEE1588 hybrid mode ToD source. This alarm is only applicable for Enhanced Clock management.	Connect 1588 resource and try to sync with hybrid mode.
7	Equ	Maj	Y, Y, Y	pon-8k-fail (long)8781831	GPON8KFAIL 0x00860007	Failure or unavailability of the PON 8K source. This alarm is only applicable for Enhanced Clock management of 7363 MX / 7367 SX.	Check the peer equipment and connection between the equipment and the ISAM for PON 8K timing reference. This could be due to a Loss of Signal. Note: this alarm is used for 7363 MX / 7367 SX.
8	Equ	Maj	Y, Y, Y	signal-loss (long)8781832	LOSTIMING 0x00860008	Loss of clock signal.	Check whether clock signal is connected or not.
9	Equ	Maj	Y, Y, Y	signal-efd (long)8781833	EFDTIMING 0x00860009	Frequency deviation of input clock signal exceed the threshold of frequency monitoring.	Frequency deviation of input clock signal exceed the threshold of frequency monitoring.
10	Equ	Maj	Y, Y, Y	esmc-loss (long)8781834	LOSESMC 0x0086000A	SSM of syncE timing source is lost.	SSM of syncE timing source is lost.
11	Equ	Maj	Y, Y, Y	bits-output-exceed (long)8781835	MINQLT4FAIL 0x0086000B	System QL of clock system is lower than QL threshold of T4 out (QL is lower, clock quality is worse).	System QL of clock system is lower than QL threshold of T4 out.
12	Equ	Maj	Y, Y, Y	ql-input-exceed (long)8781836	MINQLTI 0x0086000C	Input timing clock QL is lower than QL threshold of input SyncE clock (when SSM enable, QL threshold is available, BITS not support).	Input timing clock QL is higher than QL threshold of input SyncE clock.
13	Equ	Maj	Y, Y, Y	holdover (long)8781837	HOFAIL 0x0086000E	DPLL is in the holdover mode.	DPLL is in the holdover mode.
14	Equ	Maj	Y, Y, Y	lti (long)8781838	LTIFAIL 0x0086000E	Loss timing information due to LOS and EFD.	Loss timing information due to LOS and EFD, clock system is in the holdover mode.

(77 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
15	Equ	Crit	Y, Y, Y	tod-reference-fail (long)8781839	TODFAIL 0x0086000F	System has been configured to work in autonomous mode and timing ToD is either in holdover mode or in free-run mode since all external timing ToD references are in failure.	Check all timing ToD references. If GNSS is nominated as external timing ToD input, check the signals at the GNSS inputs. If IEEE1588 is nominated as external timing ToD input, check the IEEE1588 ToD state.
16	Equ	Maj	Y, N, N	internal-clk-fail (long)8781840	INTERNALCLKFAIL 0x00860010	Internal clock (OCXO) abnormal, Si5345 component IN1 input from DPLL is shutdown. and Si5345 component is in holdover. Note: The alarm is applicable for FANT-G NT board.	Internal CLK is failing, replace board if Network Timing Synchronization function is needed.
Alarm type: 139 Alarm type =VoicePluginUnit (139) Index1 =eqptSlotId, Index2 = not used							
2	Comm	Crit	Y, Y, Y	meg-dhcp-unreach (long)9109506	DHCPUNRCH 0x008B0002	The DHCP server is unreachable on this board	1. Manually Configure the MGC with a static IP address. Or 2. Successfully get an IP address from DHCP server.
3	Comm	Crit	Y, Y, Y	meg-dhcp-rtpunreach (long)9109507	DHCPUNRCH_RTP 0x008B0003	The DHCP server is unreachable for RTP on this board	1. Manually Configure the RTP with a static IP address. Or. 2. Successfully get an IP address from DHCP server.
4	Comm	Crit	Y, Y, Y	meg-dhcp-rtpipclash (long)9109508	DHCPIPINFOCOLLISIONRTP 0x008B0004	The IVPS IP info retrieved by DHCP is collided with MGI IP info.	Check the collision between IVPS IP info retrieved by DHCP and MGI IP info.
5	Comm	Crit	Y, Y, Y	meg-dhcp-signalipclash (long)9109509	DHCPIPINFOCOLLISIONSIGNAL 0x008B0005	The MGI IP info retrieved by DHCP is collided with IVPS IP info.	Check the collision between MGI IP info retrieved by DHCP and IVPS IP info.
Alarm type: 141 Alarm type = IHUB ISIS (141) - Index1 = VPRN Service Identifier (svcId in the svcBaseInfoTable) or Base Router (value 0 indicates Base Router), Index2 = see specific alarm number							

(78 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
1	Comm	Min	N, Y, Y	isis-adjacency-down (long)9240577	ADJACENCYDOWN 0x008D0001	The alarm is raised when the ISIS state with the adjacency (isisISAdjState) is failed or down. It is cleared when the ISIS state with the adjacency is up or when the ISIS protocol or the ISIS interface or the ISIS interface for a level or the IP interface is shutdown or when the ISIS configuration is deleted. Otherwise it needs manual clearing by the operator. Index2 = ISIS Adjacency Index (non zero value in which the Virtual Index can not overlap between the Adjacency Down and the Adjacency Reject alarms; to be used as Index2 when manually clearing the alarm) Additional Info contains: ifName,NeighborSystemID isisCircIndex,isisISAdjIndex Note: May require MANUAL clearing.	Check operational status of any interfaces needed for peer connections. If operational states are up, then ISIS config commands must be reviewed for misconfiguration, e.g. verify autonomous system ids of peers are correct.
2	Comm	Min	N, Y, Y	isis-adjacency-reject (long)9240578	ADJACENCYREJECT 0x008D0002	The alarm is raised when connection to peer router is rejected. The alarm is cleared when the ISIS protocol or the ISIS interface or the ISIS interface for a level or the IP interface is shutdown or when the ISIS configuration is deleted. Otherwise it needs manual clearing by the operator. Index2 = ISIS Adjacency Index (non zero value in which the Virtual Index can not overlap between the Adjacency Down and the Adjacency Reject alarms; to be used as Index2 when manually clearing the alarm) Additional Info contains: ifName Note: May require MANUAL clearing.	Check ISIS level-capability configuration.

(79 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
3	Comm	Crit	Y, Y, Y	isis-instance-down (long)9240579	ISISDOWN 0x008D0003	The alarm is raised when ISIS is down. The alarm is cleared when the ISIS instance is restarted or when the ISIS configuration is deleted. Index2 = 0	Check ISIS configuration.
Alarm type: 142 Alarm type = IHUB L2FWD (142) - Index1 = Ethernet Port (tmnxPortPortID in the tmnxPortTable), Index2 = M-VPLS Service Identifier (svcId in the svcBaseInfoTable)							
1	Comm	Maj	Y, Y, Y	l2fw-stp-exception (long)9306113	STPEXCEPTION 0x008E0001	The alarm is raised when an STP exception condition is present. It is cleared when the STP exception condition no longer exists or when the m-VPLS service or the STP or the STP SAP or the port/lag is shutdown. A condition detected by STP on a port/lag. Possible reasons:detection of a topology loop.	A condition detected by STP on a port. Possible reasons: detection of a topology loop. Possible solutions: Check STP Peer to see if misconfigured to flood BPDUs, and its Ethernet ports are cabled together.
2	Comm	Min	Y, Y, Y	l2fw-stp-root-guard (long)9306114	STPROOTGUARDV 0x008E0002	The alarm is raised when there is an STP root-guard violation. This can occur only when root guard is enabled for the access interface. It happens when a port/lag has STP enabled and is attempting to become root (has a better STP priority vector). The alarm is cleared when the m-VPLS service or the STP or the STP SAP or the port/lag is shutdown. Otherwise it needs manual clearing by the operator. Possible reasons: 1. STP Peers are indicating they have higher Bridge address or priority Note: May require MANUAL clearing.	A condition whereby the system has detected a STP root-guard violation. When root guard is enabled for the access interface, this condition can occur when a port that has STP enabled is attempting to become root (has a better STP priority vector).Possible reasons: 1, STP Peers are indicating they have higher Bridge address or priority.Possible Solutions: 1. Configure STP Peers to have a lower Bridge Priority. 2. Check for possible spoofing by untrusted equipment that is attempting to become Root via the alarmed port.
Alarm type: 143 Alarm type = IHUB VPRN (143) - Index1 = VPRN Service Identifier (svcId in the svcBaseInfoTable) or Base Router (value 0 indicates Base Router), Index2 = see specific alarm number							

(80 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
1	Comm	Maj	Y, Y, Y	vprn-routes-limit (long)9371649	MAXIPROUTES 0x008F0001	The alarm is raised when the number of dynamic routes for this virtual router has reached or exceeded the high threshold. The alarm is cleared when the number of dynamic routes for this virtual router has dropped below the mid threshold or when the VPRN service is shutdown.. Mid threshold when configured at CLI = Max Routes * Max Routes Threshold Percentage. High threshold when configured at CLI = (Max Routes + Mid threshold)/2. Mid threshold when using SNMP is set directly using vRtrMidRouteThreshold. High Threshold when using SNMP is set directly using vRtrHighRouteThreshold. Index2 = 0Additional Info contains: vRtrId	Redimensioning of the network is required. In case of wholesale, administrative actions with the customer of the VPRN is required.
2	Comm	Maj	Y, Y, Y	vprn-ipv6-routes-limit (long)9371650	MAXIPV6ROUTES 0x008F0002	The alarm is raised when the number of dynamic ipv6 routes for this virtual router has reached or exceeded the high threshold. The alarm is cleared when the number of dynamic ipv6 routes for this virtual router has dropped below the mid threshold or when the VPRN service is shutdown. Mid threshold when configured at CLI = Max IPv6 Routes * Max IPv6 Routes Threshold Percentage. High threshold when configured at CLI = (Max IPv6 Routes + Mid IPv6 threshold)/2. Mid threshold when using SNMP is set directly using vRtrIPv6MidRouteThreshold. High Threshold when using SNMP is set directly using vRtrIPv6HighRouteThreshold. Index2 = 0 Additional Info contains: vRtrId	Redimensioning of the network is required. In case of wholesale, administrative actions with the customer of the VPRN is required.

(81 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
3	Comm	Maj	Y, Y, Y	dhcpv6-lease-limit (long)9371651	MAXDHCPV6LEASES 0x008F0003	The alarm is raised when the amount of DHCP6 relay lease states on an Interface has reached 95% of its upper limit. The alarm is cleared under these conditions: the system autonomously clear this alarm when the number of leases drops below a fixed threshold (90%) of the maximum number at the interface the system clears the alarm when the operator: o disables dhcpv6 on the interface (this event will clear the lease database), o disables Ipv6 on the interface (this event will clear the lease database), o increases the max number of leases such that the filling level drops below the fixed threshold Note: shutting down the VPRN service or the IP interface will not clear the alarm, the lease database is left untouched. Index2 = vRtrIfIndex Additional Info contains: vRtrIfName vRtrId	The operator can reduce the filling of the lease database in either way: trigger clearing (specific entries or all) of the lease database for this interface; disable dhcpv6 on the interface disable Ipv6 on the interface. Alternatively, increases the max number of leases such that the filling level drops below the fixed threshold. Note: shutting down the VPRN service or the IP interface does leave the lease database untouched.
4	Comm	Maj	Y, Y, Y	dhcpv4-lease-limit (long)9371652	MAXDHCPV4LEASES 0x008F0004	The alarm is raised when the amount of DHCP4 relay lease states on an Interface has reached 95% of its upper limit. The alarm is cleared under these conditions: the system autonomously clear this alarm when the number of leases drops below a fixed threshold (90%) of the maximum number at the interface the system clears the alarm when the operator: o disables dhcpv4 on the interface (this event will clear the lease database), Note: shutting down the VPRN/IES service or the IP interface will not clear the alarm, the lease database is left untouched. Index2 = vRtrIfIndex Additional Info contains: vRtrIfName vRtrId	The operator can reduce the filling of the lease database in either way: trigger clearing (specific entries or all) of the lease database for this interface; disable dhcpv4 on the interface Note: shutting down the VPRN/IES service or the IP interface does leave the lease database untouched.

(82 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
Alarm type: 144 Alarm type = IHUB OSPF (144) - Index1 = VPRN Service Identifier (svcId in the svcBaseInfoTable) or Base Router (value 0 indicates Base Router), Index2 = see specific alarm number							
1	Comm	Maj	Y, Y, Y	ospf-lsa-limit (long)9437185	MAXLIMLSDB 0x00900001	The alarm is raised when the number of received external LSAs exceeds the configured number of allowed external LSAs (by default there is no limit). The alarm is cleared when the overload timer expires, this timer is configured along with the Lsdb limit for external LSA's. The alarm is also cleared when the VPRN service or the OSPF protocol is shutdown or when the OSPF configuration is deleted. Index2 = 0 Additional Info contains: vRtrId	Redimensioning of the network is required.
2	Comm	Min	N, Y, Y	ospf-lsa-mid-limit (long)9437186	MIDLIMLSDB 0x00900002	The alarm is raised when the number of received external LSAs approaches 90% of the configured number of allowed external LSAs (by default there is no limit). The alarm is cleared when the number of received external LSA's drops below 80% or when the VPRN service or the OSPF protocol is shutdown or when the OSPF configuration is deleted. Index2 = 0 Additional Info contains: vRtrId	Redimensioning of the network is required.

(83 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
3	Comm	Min	N, Y, Y	ospf-neighbor-down (long)9437187	NEIGHBORDOWN 0x00900003	The alarm is raised when the OSPF Neighbor state is not FULL or 2way. It is cleared when neighbor state is 2way or FULL (up). The alarm is also cleared when VPRN service or the OSPF protocol or the OSPF interface or the IP interface is shutdown or when the OSPF configuration is deleted. Otherwise it needs manual clearing by the operator. Index2 = Neighbor Index (non zero value in which the Virtual Index can not overlap between alarms; to be used as Index2 when manually clearing the alarm) Additional Info contains: IPInterfaceName,Neighbor RouterID vRtrId,tmnxOspfNbrIfIndex ,tmnxOspfNbrIfInstId Note: May require MANUAL clearing.	Check status of peer nodes, if belonging to same operator domain. Then do corrective actions on peer node. Change network topology if peer nodes can not be corrected. Check OSPF configurations to see if there is any mismatch (e.g. area type, id, link type, timer intervals,)
4	Comm	Crit	Y, Y, Y	ospf-instance-down (long)9437188	OSPFDOWN 0x00900004	The alarm is raised when the OSPF protocol goes down, possible reason is IHUB learns more routes than the maximum amount that it can handle or a memory allocation failure occurred for any of the OSPF objects. The alarm is cleared when the OSPF protocol is restarted or when the VPRN service is shutdown or when the OSPF configuration is deleted. Index2 = 0 Additional Info contains: vRtrId	Check OSPF configuration.

(84 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
5	Comm	Maj	Y, Y, Y	ospf3-lsa-limit (long)9437189	V3MAXLIMLSDB 0x00900005	The alarm is raised when the number of received external LSAs exceeds the configured number of allowed external LSAs (by default there is no limit). The alarm is cleared when the overload timer expires, this timer is configured along with the Lsdb limit for external LSA's. The alarm is also cleared when the OSPFv3 protocol is shutdown or when the OSPFv3 configuration is deleted. Index2 = 0 Additional Info contains: vRtrId,tmnxOspfVersion	Redimensioning of the network is required.
6	Comm	Min	N, Y, Y	ospf3-lsa-mid-limit (long)9437190	V3MIDLIMLSDB 0x00900006	The alarm is raised when the number of received external LSAs approaches 90% of the configured number of allowed external LSAs (by default there is no limit). The alarm is cleared when the number of received external LSA's drops below 80% or when the OSPFv3 protocol is shutdown or when the OSPFv3 configuration is deleted. Index2 = 0 Additional Info contains: vRtrId,tmnxOspfVersion	Redimensioning of the network is required.

(85 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
7	Comm	Min	N, Y, Y	ospf3-neighbor-down (long)9437191	V3NEIGHBORDOWN 0x00900007	The alarm is raised when the OSPFv3 Neighbor state is not FULL or 2way. It is cleared when neighbor state is 2way or FULL (up). The alarm is also cleared when the OSPFv3 protocol or the OSPFv3 interface or the IP interface is shutdown or when the OSPFv3 configuration is deleted. Otherwise it needs manual clearing by the operator. Index2 = Neighbor Index (non zero value in which the Virtual Index can not overlap between alarms; to be used as Index2 when manually clearing the alarm) Additional Info contains: IPInterfaceName,NeighborRouterID vRtrId,tmnxOspfNbrIfIndex,tmnxOspfNbrIfInstId,tmnxOspfVersion Note: May require MANUAL clearing.	Check status of peer nodes, if belonging to same operator domain. Then do corrective actions on peer node. Change network topology if peer nodes can not be corrected. Check OSPFv3 configurations to see if there is any mismatch (e.g. area type, id, link type, timer intervals,)
8	Comm	Crit	Y, Y, Y	ospf3-instance-down (long)9437192	V3OSPFDOWN 0x00900008	The alarm is raised when the OSPFv3 protocol goes down. The alarm is cleared when the OSPF protocol is restarted or when the OSPFv3 configuration is deleted. Index2 = 0 Additional Info contains: vRtrId,tmnxOspfVersion	Check OSPFv3 configuration.
Alarm type: 145 Alarm type = IHUB RIP (145) - Index1 = VPRN Service Identifier (svcId in the svcBaseInfoTable) or Base Router (value 0 indicates Base Router), Index2 = 0							
1	Comm	Crit	Y, Y, Y	rip-instance-down (long)9502721	RIPDOWN 0x00910001	The alarm is raised when RIP is down. The RIP protocol instance has been shut down by the node. The reason for this can be: - RIP interface creation failed, - RIP protocol running out of memory, or - major software failure affecting the protocol instance. The alarm is cleared when the RIP instance is restarted or when the VPRN service or the RIP protocol is shutdown. Additional Info contains: vRtrId	1. Verify RIP interface configurations, 2. Check the memory consumed by the RIP protocol, 3. Check the number of routes learned via RIP, i.e. RIP RIB Note: The RIP protocol instance will attempt to restart within 30 seconds.

(86 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
Alarm type: 146 Alarm type = IHUB VPLS (146) - Index1 = VPLS Service Identifier (svcId in the svcBaseInfoTable), Index2 = see specific alarm number, Additional Info layout: MAC,DupPort,DupVlan,Port,Vlan, CVlan,SDPBindId, DupSDPBindId							
1	Comm	Min	N, Y, Y	vpls-mfib-limit (long)9568257	MAXLIMFIBTABLE 0x00920001	The alarm is raised for a VPLS service when the size of the Multicast FIB Table has reached the high watermark. This alarm is cleared when the size of the Multicast FIB Table drops below the low watermark. The alarm is also cleared when the VPLS service or igmp-snooping is shutdown. Index2 = 0	Redimensioning of the node required; In case of wholesale, administrative actions with the customer of the VPLS required.
2	Comm	Min	Y, Y, Y	vpls-duplicate-mac (long)9568258	VPLSDUPADDR 0x00920002	- The alarm is raised when on a residential SAP of a VPLS service a MAC is detected which is already learned or statically configured on a regular SAP or SDP binding. The alarm is cleared after expiry of the 5 minutes ageing timer or when the VPLS service or the residential SAP or the residential port/lag where the MAC was owned is shutdown. On clearance of the alarm after the expiry of ageing timer, the alarm will be raised again, if the duplicate MAC continues to be detected. Index2 = Duplicate MAC index (fadDupMacIndex: non zero value in which the index can not overlap between VPLS (Self) Dup Mac alarms)) Additional Info contains: Content when Port field is present MAC,DupPort,DupVlan,Port,Vlan,[CVlan],, Content when Port field is not present MAC,DupPort,DupVlan,,,, SDPBindId,	Disable responsible user-side ports involved in the Duplicate MAC alarm in this network element or in the surrounding network elements. Use IACM Forwarding Data Base of these network elements to identify responsible user-side ports. Re-enable port when alarm is cleared after a timeout. Try to identify the source of DOS attack, and remove from the network.

(87 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
3	Comm	Maj	Y, Y, Y	vpls-fdb-limit (long)9568259	MAXLIMFWDMAC 0x00920003	The alarm is raised when the number of MAC address entries in the FIB reaches or exceeds the high watermark specified for the service site (i.e. number of MAC addresses being learned for a v-VPLS service instance is nearing or has exceeded a configured table size limit). Possible reasons: Too many subscriber MACs for configured service. The alarm clears when the number of MAC addresses entries in the FIB drops below the low watermark specified for the service site or when the VPLS service is shutdown. Index 2 = 0	A condition meaning the number of MAC addresses being learned for a vVPLS service instance is nearing or has exceeded a configured table size limit. Possible reasons: Too many subscriber MACs for the configured service. Possible Solutions: 1. Increase the v-VPLS FDB Table size, 2. Check Subscriber's Gateway to see if in Bridge mode when it should be in router mode, 3. Check Subscriber's port to see if too many MACs are being learned, and if so put learning limit on that subscriber port (if feature supported) , 4. Check Aggregation Network that connects multiple Access Nodes together is operating in split horizon L2 forwarding. If not, then the Access Node may also be learning subscriber MACs from another Access Node, 5. If subtending off of a Hub Access node, make sure the Hub node's port connected to the subtended Access Node is configured as Residential. If not, then the subtended Access Node may also be learning subscriber MACs from the Hub Access node.

(88 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
4	Comm	Min	Y, Y, Y	vpls-self-duplic-mac (long)9568260	DUPADDRSELFSAP 0x00920004	The alarm is raised when on a SAP of a VPLS service a Self Duplicate MAC is detected. The alarm is cleared when no Self Duplicate MAC is present after expiry of the 5 minutes ageing timer. Index2 = Duplicate MAC index (fadDupMacIndex: non zero value in which the index can not overlap between VPLS (Self) Dup Mac alarms) Additional Info contains: MAC,DupPort,DupVlan,Port,Vlan, [CVlan],, Note: Port and Vlan value is not relevant (void) and will not be provided.	Disable responsible user-side ports involved in the Duplicate MAC alarm in this network element or in the surrounding network elements. Use IACM Forwarding Data Base of these network elements to identify responsible user-side ports. Re-enable port when alarm is cleared after a timeout. Try to identify the source of DOS attack, and remove from the network.
5	Comm	Min	Y, Y, Y	vpls-sdp-self-dup-mac (long)9568261	DUPADDRSELFSDP 0x00920005	The alarm is raised when on a SDPbinding of a VPLS service a Self Duplicate MAC is detected. The alarm is cleared when no Self Duplicate MAC is present after expiry of the 5 minutes ageing timer. Index2 = Duplicate MAC index (fadDupMacIndex: non zero value in which the index can not overlap between VPLS (Self) Dup Mac alarms) Additional Info contains: \"MAC,,,,,,DupSDPbindId\"	Disable responsible user-side ports involved in the Duplicate MAC alarm in this network element or in the surrounding network elements. Use IACM Forwarding Data Base of these network elements to identify responsible user-side ports. Re-enable port when alarm is cleared after a timeout. Try to identify the source of DOS attack, and remove from the network.
Alarm type: 150 Alarm type = IHUB EthPort (150) - Index1 = Ethernet Port (tmnxPortPortID in the tmnxPortTable), Index2 = not used							
1	Comm	Crit	Y, Y, Y	link-down (long)9830401	LINKDOWN 0x00960001	The alarm is raised when the ethernet link is down. The alarm is cleared when the ethernet link is up again. Note: Associated equipment bus link failures are integrated into Alarmtype IHUB Equipment (151). For 10G faceplate ports, additional Info may contain one of the strings given below: 1. Local Fault, 2. Remote Fault 3. Local and Remote Fault.	Check the physical Ethernet link.

(89 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
2	Comm	Min	Y, Y, Y	link-lagport-add-fail (long)9830402	LAGPORTADDFAIL 0x00960002	Failure to add a port to the Link Aggregation group. The alarm is cleared when the port is successfully added to the Link Aggregation group or when the LAG is shutdown or when the port is unconfigured from the LAG. Additional Info contains: Reason Possible reason strings are: - unknown - adminkey-mismatch - sysid-mismatch - lacp-passive-both-ends - link-down	1. Retrieve alarms additional info to see failure reason string and correct. Possible reasons are: Adminkey-mismatch Sysid-mismatch Lacp-passive-both-ends Link-down - Check links Unknown - Contact Nokia Technical Assistance.
3	Comm	Maj	Y, Y, Y	link-conf-mismatch (long)9830403	PORTCONFMM 0x00960003	The inserted SFP or SFP+ type does not match the planned speed and/or auto-negotiation for the port. The alarm is cleared when the planned speed and auto-negotiation matches the inserted SFP or SFP+ type or when the administrative state of the port is down or when the SFP or SFP+ is extracted.	Indicates SFP or SFP+ type does not match the planned speed and/or auto-negotiation for the port. Either reconfigure the planned speed and/or the auto-negotiation to match the current speed and auto-negotiation, or reconfigure external device to match current configured speed and auto-negotiation.
Alarm type: 151 Alarm type = IHUB Equipment (151) - Index1 = eqptSlotId (Index in eqptBoardTable), Index2 = not used Note: All equipment alarms are reported against the eqptSlotId where the alarm is being detected.							
1	Equ	Maj	Y, Y, Y	ihub-peer-comm (long)9895937	IHUBPEERCOMM 0x00970001	The IHUB (Core1-to-Core1) peer-to-peer communications (between NTs) has failed. This is across the peer-to-peer Hi-Gig (XAUI) bus.	Check status of both NTs for normal operation. Perform board reboot or replace board if failure persists.
2	Equ	Maj	Y, Y, Y	ihub-sw-fail (long)9895938	IHUBSWERR 0x00970002	An IHUB software application/driver exception, software bulksync error, or a discovery (ping) failure has occurred. The alarm clears when the associated fault is no longer active.	If failure persists, inform Nokia.

(90 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
3	Equ	Maj	Y, Y, Y	ihub-hw-fail (long)9895939	IHUBHWERR 0x00970003	The IHUB hardware has hardware failures detected by the IHUB software. Such failures include Broadcom switch chip errors such as SDK failure or Broadcom failure.	If failure persists, replace NT board.
6	Equ	Maj	Y, Y, Y	ihub-link-fail (long)9895942	IHUBLINKFAIL 0x00970006	The IHUB peer-to-peer Hi-Gig Data link bus has a failure (near end and/or far end). This fault is declared when a IHUB LOL near end or far end failure can not be isolated.	Check status of both NTs for normal operation. Replace Peer NT. If fault persists, replace this NT.
9	Equ	Min	N, Y, Y	ihub-proc-overload (long)9895945	IHUBPROCROVLD 0x00970009	The alarm is raised when the IHUB processor has exceeded its processing limits. The alarm is cleared when the IHUB processor load drops below the processing limits.	Check for possible network, equipment and facility alarms and clear. If problem persists, reset NT card. Replace NT card.
10	Equ	Crit	Y, Y, Y	ihub-out-of-mem (long)9895946	IHUBOUTOFMEM 0x0097000A	The alarm is raised from the moment the available NE memory is insufficient for allocation to a task. The alarm can only be raised again when such condition occurs, after it has been cleared manually by the operator. Additional Info contains: Module The Software Module name string includes various protocol modules. Max string length is 33 characters. Note: Requires MANUAL clearing.	Try reset of NT to clean up memory depletion. If fault persists, contact Nokia Technical Assistance Center.
11	Equ	Maj	N, Y, Y	ntp-comm-lost (long)9895947	NTPCOMM 0x0097000B	No response is received from the NTP servers.	Check if the NTP servers are operational and reachable.
Alarm type: 152 Alarm type = IHUB LAG (152) - Index1 = LAG Identifier (tLagIndex in tLagConfigTable), Index2 = See specific alarm number							

(91 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
1	Comm	Maj	Y, Y, Y	lag-down (long)9961473	LAGDOWN 0x00980001	The alarm is raised when the ethernet LAG is down. Declared when all the ports in a LAG are operationally down or when the number of operational ports in a LAG drops below the configured port threshold. Cleared when one or more ports of a LAG are operationally up or when the number of operational ports in a LAG is equal or exceeds the configured port threshold. The alarm is also cleared when the LAG is shutdown.	Check the physical Ethernet links associated for LAG negotiation or timeout problems.
2	Comm	Maj	Y, Y, Y	lagsubgrp-thresh-reach (long)9961474	SUBGRPTHRESHREACHED 0x00980002	Raise Conditions For Static LAG and Dynamic LAG When the number of operational ports in a subgroup falls and reaches the configured subgroup threshold Clear Conditions For Static LAG and Dynamic LAG When Lag is made admin down When the operator re-configures the threshold of the subgroup to a value below the number of operational ports in that subgroup When the number of operational ports in a subgroup goes above the configured subgroup threshold When there are no ports in a subgroup AND if the threshold for the subgroup is zero then subgroup threshold reached alarm for that subgroup should be cleared When the preference for a subgroup is set to zero Index2-Subgroup identifier	Check the number of physical links that are up in the lag subgroup for which the alarm has occurred. It should be made greater than the configured threshold value for the subgroup

(92 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
3	Comm	Maj	Y, Y, Y	lagsubgrp-switch-fail (long)9961475	SUBGRPSWITCHFAIL 0x00980003	Raise Conditions For Static LAG and Dynamic LAG The alarm will be raised, when switchover cannot happen to a subgroup because there are no ports available in the candidate subgroup (not configured) The alarm will be raised, when switchover cannot happen because there are no operational ports available in the candidate subgroup For Dynamic LAG When switchover cannot happen because the number of operational ports in the candidate subgroup is below threshold (peer LACP sync bit FALSE) Clear Conditions For static LAG and Dynamic LAG When Lag is made admin down When force-switchover is done to a subgroup in which the alarm is currently present. When a subgroup becomes the active sub-group For Dynamic LAG When the number of operational ports in the subgroup to which switchover was attempted becomes more than its sub-group threshold and the subgroup is made as the active subgroup Index2-Subgroup identifier	Check the number of physical links that are up in the lag subgroup to which switchover failed. It should be made greater than the configured threshold value for the subgroup. Once it is done, the switchover will happen and the alarm will be cleared

(93 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
4	Comm	Maj	Y, Y, Y	no-unpinned-free-ports (long)9961476	SVLANPINFREEPORTNOTAVBL 0x00980004	Raise Conditions: For Static LAG and Dynamic LAG - The alarm will be raised, when all ports in the lag are used by the link-map-profile and if any of them have failure mode set to per-link-hash and there is a parent lag sap or per-link-hash-lmp sap present in the system - This would be considered as mis-configuration and might result in packet discards when failure-mode is in effect. And alarm will be raised when No free ports in parent lag and one of the link map profile's failure mode is configured as per-link-hash. - If any v-vpls service is mapped to parent LAG directly and if the LAG is having link-map-profiles, the service can use only the free ports in the parent LAG that is not part of any link-map-profile. If there are no free ports in that lag, the v-vpls lag sap configuration will be allowed and alarm will be raised. - If any v-vpls service is mapped to parent LAG directly and if the LAG is having link-map-profiles, the service can use only the free ports in the parent LAG that is not part of any link-map-profile. When configuring of any new link-map-profile creation in the lag will use all the free port in that lag, then the link-map-profile configuration will be allowed and an alarm will be raised. - If a lag sap is having pinning and non-pinned port configuration. If the non-pinned port is going down or removed from lag then there is no free port available in parent lag to carry the non-pinned traffic, then an alarm will be raised.	For Static LAG and Dynamic LAG: - The alarm will be raised, when all ports in the lag are used by the link-map-profile and if any of them have failure mode set to per-link-hash - This would be considered as mis-configuration and might result in packet discards when failure-mode is in effect. And alarm will be raised when No free ports in parent lag and one of the link map profile's failure mode is configured as per-link-hash : Configuration needs to be changed by adding free port in parent lag to resume traffic. - If any v-vpls service is mapped to parent LAG directly and if the LAG is having link-map-profiles, the service can use only the free ports in the parent LAG that is not part of any link-map-profile. If there are no free ports in that lag, the v-vpls lag sap configuration will be allowed and alarm will be raised : Configuration needs to be changed by either adding free port in parent lag or remove existing link-map-profile to resume traffic. - If any v-vpls service is mapped to parent LAG directly and if the LAG is having link-map-profiles, the service can use only the free ports in the parent LAG that is not part of any link-map-profile.

(94 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
						Clear Conditions: For Static LAG and Dynamic LAG - The alarm will be cleared, when Failure mode is set to discard or on removing the per-link-map profile configuration and When new lag port is configured/available for non pinned traffic. - The alarm will be cleared, when new lag port is configured/available for non pinned traffic and when the mapped LAG sap is removed from that service. - The alarm will be cleared, when new lag port is configured/available for non pinned traffic and On removing the new link-map-profile creation in the lag. - The alarm will be cleared, when new lag port is configured/available for non pinned traffic and On non-pinned port is operationally up.	When configuring of any new link-map-profile creation in the lag will use all the free port in that lag, then the link-map-profile configuration will be allowed and an alarm will be raised : Configuration needs to be changed by either adding free port in parent lag or remove newly created link-map-profile. - If a lag sap is having pinning and non-pinned port configuration. If the non-pinned port is going down or removed from lag then there is no free port available in parent lag to carry the non-pinned traffic, then an alarm will be raised : Either the down port should become UP or configuration needs to be changed by adding free port in parent lag.
Alarm type: 153 Alarm type = IHUB General (153) - Index1 = not used, Index2 = not used							
1	Comm	Maj	N, Y, Y	general-arp-limit (long)10027009	MAXARPUPTH 0x00990001	The number of ARP entries has reached the maximum threshold. This alarm clears, when number of ARP entries drops below the threshold.	Condition occurs when number of ARP entries in the system's ARP cache has exceeded its resource limits. Possible Reasons: Too many subscriber Host Devices are using L3 Services on the NT. Possible Solutions: 1. Check and reduce the number of directly attached hosts to local subnets in the instance, 2. Check Subscribers' Residential Gateway to see if in Bridge mode when it should be in Router mode, 3. Check Subscriber's port to see if too many MACs are being learned, and if so put learning limit on that subscriber port and enable anti-spoofing (if feature supported).

(95 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
2	Comm	Maj	N, Y, Y	gen-switch-out-of-res (long)10027010	SWITCHOOR 0x00990002	Switch-Out of Resources. The alarm is raised from the moment the Hardware is out of resources, i.e. to accommodate the current configuration or the current network topology (e.g. the learned dynamic routes) or the learned multicast forwarding entries. Other reasons for raising this alarm (non-exhaustive): - a DHCPv6 managed route could not be installed - a v6 Neighbor Cache entry (host address) could not be installed: either a managed Neighbor Cache entry snooped from Dhcpv6 or a dynamically learned Neighbor Cache entry - Self LinkLocal IPv6 address could not be installed - a configured self Ipv6 address could not be installed. - Static MAC entries for a MEP/MIP created cannot be installed. The alarm can only be raised again when such condition occurs, after it has been cleared manually by the operator. Note: Requires MANUAL clearing.	The alarm can be raised as result of a recent configuration change. If this is the case then check most recent new configuration for: i) IP Interface If no shutdown but operationally is Down check for underlying failure. If none, then Make I/F Down, clear alarm, then I/F back UP. Check Alarm again. If alarm present, then 1. Make I/F Down and try back later, 2. Remove Static MAC addresses, 3. Reduce number of subnets, 4. Clear IPv6 Neighbor cache entries. ii) Static-MAC Remove Static-MAC. Manually Clear Alarm. Add Static-MAC back. Check for Alarm again. If present, then remove other Static MACs. iii) Static IP Multicast Group Remove Static-Group. Manually Clear Alarm. Add Static-Group back. Check for Alarm again. If present then reduce size of various subnets. iiii) SAP Remove SAP of VPLS. Manually Clear Alarm. Try using a SAP with different encapsulation value. If no recent configuration change was done, then check the current network topology.

(96 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
3	Comm	Maj	N, Y, Y	ipv6-nc-limit (long)10027011	IPV6NEIGHCACHEUPTH 0x00990003	The alarm is raised when the filling level of the Systems IPv6 Neighbor Cache entry reaches the high watermark (95%). The alarm is cleared when the filling level of the Systems IPv6 Neighbor Cache drops below the low watermark (90%).	Condition occurs when number of NC entries (IPv6) in the system's Neighbor Cache is about to exceed its resource limits. Possible Reasons: Too many 1. Check and reduce the number of directly attached hosts to localPossible Solutions:subscriber Host Devices are using L3 Services on the NT. subnets in the instance, 2. Check Subscribers' Residential Gateway to see if in Bridge mode when it should be in Router mode, 3. Check Subscriber's port to see if too many MACs are being learned, and if so put learning limit on that subscriber port and enable anti-spoofing (if feature supported).
4	Comm	Maj	Y, Y, Y	dhcp-session-oor (long)10027012	DHCPSESSIONOOR 0x00990004	The alarm is raised when the sum of all DHCPv4 and DHCPv6 L3 relay sessions (for all VRFS) is above 95 % of the maximum. This maximum is currently set to 24K (a SW limit). The alarm is cleared when the actual value goes below 90 % of the maximum.	System is almost used above it's capacity, it cannot store that many DHCP sessions in the system. Consider reducing DHCP lease time or reducing the allowed DHCP sessions for that ISAM in DHCP server

(97 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
5	Comm	Maj	N, Y, Y	ihub-fdb-limit (long)10027013	MACLIMNODE 0x00990005	The alarm is raised when the filling level of the iHUB Layer 2 FDB table for the node has reached an upper threshold (95%). This alarm acts as a warning. Once the L2 FDB table is full the system will not be able to learn any new mac address on interfaces of the NT board. The alarm is cleared when the filling level of the iHUB Layer 2 FDB table for the drops below the low watermark (90%).	The alarm informs about the fact that the amount of MAC addresses being learned for all layer 2 services is nearing the node's limit. Possible Solutions: 1. Check Subscriber's Gateway to see if in Bridge mode when it should be in router mode, 2. Check Subscriber's port to see if too many MACs are being learned, and if so put learning limit on that subscriber port (if feature supported), 3. Check Aggregation Network that connects multiple Access Nodes together is operating in split horizon L2 forwarding. If not, then the Access Node may also be learning subscriber MACs from another Access Node, 4. If subtending off of a Hub Access node, make sure the Hub node's port connected to the subtended Access Node is configured as Residential. If not, then the subtended Access Node may also be learning subscriber MACs from the Hub Access node.
6	Comm	Maj	N, Y, Y	ihub-mac-limit (long)10027014	IHUBINTMACTHRESHREACH 0x00990006	Internal MAC entries are used by L3 interfaces, interfaces in a true VPLS and CFM end points. Hence when the internal mac entries corss a limit this alarm will be raised .Hardware MAC table sizes are different for NANT-E and NANT-D. NANT-E = Raise = 23% and Clear = 18 % of the hardware MAC table size NANT-D = Raise = 33 % and Clear = 28 % of the hardware MAC table size. Higher the level of a MEP more is the number of internal MACs used Possible Reasons: Too many CFM MEPs have been configured. Reduce the number of MEPs	Condition occurs when number of of internal MAC entries used by IHUB has reached 20% of the hardware MAC table size.Internal MAC entries are used by L3 interfaces, interfaces in a true VPLS and CFM end points. Higher the level of a MEP more is the number of internal MACs used Possible Reasons: Too many CFM MEPs have been configured. Reduce the number of MEPs

(98 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
Alarm type: 154 Alarm type =EPON Logical link (154) - Index1 = eponlogicallinkindex (index for logical linkI) Index2 = not used							
1	Comm	Maj	Y, Y, Y	key-fail-one-churn (long)10092545	KEYFAIL1CHTIME 0x009A0001	Key exchange failure between OLT and one logical link at ONT during one churning time.	Check whether ONT receive key exchange request or not Check whether ONT send key response or not
2	Comm	Maj	Y, Y, Y	key-fail-three-churn (long)10092546	KEYFAIL3CHTIME 0x009A0002	Key exchange failure between OLT and one logical link at ONT during one churning time.	Check whether ONT receive key exchange request or not Check whether ONT send key response or not
3	Comm	Crit	Y, Y, Y	oam-discov-fail (long)10092547	EXOAFAL 0x009A0003	Extend OAM discovery failure.	Check OAM extension supported version between OLT and ONT.
4	Comm	Crit	Y, Y, Y	report-timeout (long)10092548	REPORTTIMEOUT 0x009A0004	When the ONU does not respond to grants from OLT and the interval exceeds the threshold of report, then OLT will generate Report Timerout Detected alarm.	Check whether ONT receive Gate or not. Check whether ONT send report or not.
5	Comm	Maj	Y, Y, Y	total-packets-exceed (long)10092549	TOTALPTEXDTHD 0x009A0005	Total amount of protocol packets Exceed Threshold	Check whether ONU is in attack or has virus. Check whether the threshold set too small.
6	Comm	Min	N, Y, Y	arp-packets-exceed (long)10092550	ARPPTEXDTHD 0x009A0006	Protocol ARP packets Exceed Threshold	Check whether ONU is in attack or has virus. Check whether the threshold set too small.
7	Comm	Min	N, Y, Y	dhcp-packets-exceed (long)10092551	DHCPPTEXDTHD 0x009A0007	Protocol DHCP packets Exceed Threshold	Check whether ONU is in attack or has virus. Check whether the threshold set too small.
8	Comm	Min	N, Y, Y	igmp-packets-exceed (long)10092552	IGMPPTEXDTHD 0x009A0008	Protocol IGMP packets Exceed Threshold	Check whether ONU is in attack or has virus. Check whether the threshold set too small.
9	Comm	Min	N, Y, Y	pppoe-packets-excee d (long)10092553	PPPOEPTEXDTHD 0x009A0009	Protocol PPPOE packets Exceed Threshold	Check whether ONU is in attack or has virus. Check whether the threshold set too small.
10	Comm	Min	N, Y, Y	nd-packets-exceed (long)10092554	NDPTEXDTHD 0x009A000a	Protocol ND packets Exceed Threshold	Check whether ONU is in attack or has virus. Check whether the threshold set too small.
11	Comm	Min	N, Y, Y	icmpv6-packets-exce ed (long)10092555	ICMPV6PTEXDTHD 0x009A000b	Protocol ND packets Exceed Threshold	Check whether ONU is in attack or has virus. Check whether the threshold set too small.

(99 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
12	Comm	Min	N, Y, Y	mld-packets-exceed (long)10092556	MLDPTEXDTHD 0x009A000c	Protocol MLD packets Exceed Threshold	Check whether ONU is in attack or has virus. Check whether the threshold set too small.
13	Comm	Min	N, Y, Y	dhcpv6-packets-exceed (long)10092557	DHCPV6PTEXDTHD 0x009A000d	Protocol DHCPV6 packets Exceed Threshold	Check whether ONU is in attack or has virus. Check whether the threshold set too small.
14	Comm	Min	N, Y, Y	cfm-packets-exceed (long)10092558	CFMPTEXDTHD 0x009A000e	Protocol CFM packets Exceed Threshold	Check whether ONU is in attack or has virus. Check whether the threshold set too small.
Alarm type: 155 Alarm type = Logical link TCA(155) - Index1 = eponlogicallinkindex (index for logical linkI) Index2 = not used(see each alarm number below)							
1	QOS	Warn	N, Y, Y	none	SYMBOLIERRPR 0x009B0001	The Errored Symbol Period Event TLV counts the number of symbol errors that occurred during thespecified period. The period is specified by the number of symbols that can be received in a time interval on the underlying physical layer. This event is generated if the symbol error count is equal to or greater than the specified threshold for that period.	Check physical line
2	QOS	Warn	N, Y, Y	none	FRAMEERR 0x009B0002	The Errored Frame Event TLV counts the number of errored frames detected during the specified period.The period is specified by a time interval. This event is generated if the errored frame count is equal to or greater than the specified threshold for that period.	Check physical line

(100 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
3	QOS	Warn	N, Y, Y	none	FRAMEERRPR 0x009B0003	The Errored Frame Period Event TLV counts the number of errored frames detected during the specified period. The period is specified by a number of received frames. This event is generated if the errored framecount is greater than or equal to the specified threshold for that period (for example, if the errored frame count is greater than or equal to 10 for the last 1,000,000 frames received).	Check physical line
4	QOS	Warn	N, Y, Y	none	FRAMEERRSEC 0x009B0004	The Errored Frame Seconds Summary Event TLV counts the number of errored frame seconds that occurred during the specified period. The period is specified by a time interval. This event is generated if the number of errored frame seconds is equal to or greater than the specified threshold for that period. An errored frame second is a one second interval wherein at least one frame error was detected.	Check physical line
Alarm type: 156 Alarm type = EONT PHYOAM (156) - Index1 = eponOntIfIndex (Index of ONT), Index2 = not used.							
1	Comm	Maj	Y, Y, Y	none	ELINKFAULT 0x009C0001	Link fault at ONT	Check link
2	Comm	Min	Y, Y, Y	none	EEDG 0x009C0002	Received Dying Gasp indication from ONT.	Restore power to ONT. Dying gasp indication is due to loss of power input to ONT
3	Comm	Maj	Y, Y, Y	none	ECREVT 0x009C0003	Receive Critical event indication from ONT.	Check ONT.
4	Comm	Maj	Y, Y, Y	none	EOAMFAIL 0x009C0004	ONT fails to respond to OAM message requests (Loss of communications)	Check OAM version for OLT and ONT
Alarm type: 157 Alarm type = EONT General (157) - Index1 = eponOntIfIndex (Index of ONT), Index2 = not used.							

(101 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
1	Comm	Maj	Y, Y, Y	none	ERXPWHI 0x009D0001	recieve Optical signal level is too HIGH. than alarm thresholdIt happens when receive power is higher than the configured alarm threshold for this ONT.	Check Rx Optical signal and decrease signal level.
2	Comm	Maj	Y, Y, Y	none	ERXPWLO 0x009D0002	receive Optical signal level is too LOW. than alarm thresholdIt happens when receive power is lower than the configured alarm threshold for this ONT.	Check Rx Optical signal and increase signal level.
3	Comm	Maj	Y, Y, Y	none	ETXPWHI 0x009D0003	transmit Optical signal is too HIGH. than alarm thresholdIt happens when transmit power is higher than the configured alarm threshold for this ONT.	Check Tx power and decrease singal level
4	Comm	Maj	Y, Y, Y	none	ETXPWLO 0x009D0004	transmit Optical signal is too LOW. than alarm threshold It happens when transmit power is lower than the configured alarm threshold for this ONT.	Check Tx pwer and increase signal level
5	Equ	Maj	Y, Y, Y	none	ETXBIASHI 0x009D0005	transmit bias is too HIGH. than alarm thresholdIt happens when transmit bias is higher than the configured alarm threshold for this ONT.	Check Tx bias and decrease Bias
6	Equ	Maj	Y, Y, Y	none	ETXBIASLO 0x009D0006	transmit bias is too LOW. than alarm thresholdIt happens when transmit bias is lower than the configured alarm threshold for this ONT.	Check Tx bias and increase Bias
7	Equ	Maj	Y, Y, Y	none	EVOLHI 0x009D0007	voltage is too HIGH. than alarm thresholdIt happens when voltage is higher than the configured alarm threshold for this ONT.	Check voltage and decrease voltage
8	Equ	Maj	Y, Y, Y	none	EVOLLO 0x009D0008	voltage is too LOW. than alarm thresholdIt happens when voltage is lower than the configured alarm threshold for this ONT.	Check voltage and increase voltage
9	Equ	Maj	Y, Y, Y	none	ETEMPEHI 0x009D0009	Temperature is too HIGH. than alarm thresholdIt happens when Temperature is higher than the configured alarm threshold for this ONT.	Check temperature and decrease temperature

(102 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
10	Equ	Maj	Y, Y, Y	none	TEMPELO 0x009D000A	Temperature is too LOW. than alarm thresholdIt happens when Temperature is lower than the configured alarm threshold for this ONT.	Check temperature and increase temperature
11	Comm	Warn	N, Y, Y	none	ERXLEVELHIWARN 0x009D000B	recieve Optical signal level is too HIGH. than warning thresholdIt happens when receive power is higher than the configured warning threshold for this ONT.	Check Rx power and decrease power
12	Comm	Warn	N, Y, Y	none	ERXLEVELLOWARN 0x009D000C	receive Optical signal level is too LOW. than warning threshold It happens when receive power is lower than the configured warning threshold for this ONT.	Check Rx power and increase power
13	Comm	Warn	N, Y, Y	none	ETXPWHIWARN 0x009D000D	transmit Optical signal is too HIGH. than warning thresholdIt happens when transmit power is higher than the configured warning threshold for this ONT.	Check Tx power and decrease power
14	Comm	Warn	N, Y, Y	none	ETXPWLOWARN 0x009D000E	transmit Optical signal is too LOW. than warning thresholdIt happens when transmit power is lower than the configured warning threshold for this ONT.	Check Tx power and incease power
15	Equ	Warn	N, Y, Y	none	ETXBIASHIWARN 0x009D000F	transmit bias is too HIGH. than warning thresholdIt happens when transmit bias is higher than the configured warning threshold for this ONT.	Check Tx bias and decrease Bias
16	Equ	Warn	N, Y, Y	none	ETXBIASLOWARN 0x009D0010	transmit bias is too LOW. than warning thresholdIt happens when transmit bias is lower than the configured warning threshold for this ONT.	Check Tx bias and increase Bias
17	Equ	Warn	N, Y, Y	none	EVOLHIWARN 0x009D0011	voltage is too HIGH. than warning thresholdIt happens when voltage is higher than the configured warning threshold for this ONT.	Check voltage and decrease voltage

(103 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
18	Equ	Warn	N, Y, Y	none	EVOLLOWARN 0x009D0012	voltage is too LOW. than warning thresholdIt happens when voltage is lower than the configured warning threshold for this ONT.	Check volage and increase voltage
19	Equ	Warn	N, Y, Y	none	ETEMPEHIWARN 0x009D0013	Temperature is too HIGH than warning thresholdIt happens when Temperature is higher than the configured warning threshold for this ONT.	Check temperature and decrease temperature
20	Equ	Warn	N, Y, Y	none	TEMPELOWARN 0x009D0014	Temperature is too LOW. than warning threshold It happens when Temperature is lower than the configured warning threshold for this ONT.	Check temperature and increase temperature
Alarm type: 158 Alarm type = EOLT General (158) - Index1 = eponPonConfigIfIndex (Index of PON), Index2 = See Specific Alarm.							
1	Equ	Min	N, Y, Y	onu-unprovisioned (long)10354689	ENEWEONT 0x009E0001	An unprovisioned ONT has been discovered on the PON for MAC-based authentication or logical based authentication or mixed-based authentication. For EPON, index2 points to a SNMP table entry that contain the ONT mac of the discovered ONT in eponPonDiscovOntTable	No repair necessary\" \"indication to operator that further provisioning should commence -\" \"Newly installed ONT/MDU on PON.
2	Comm	Maj	Y, Y, Y	signal-loss (long)10354690	EEPONLOS 0x009E0002	PON Loss of Signal. OLT is not receiving any upstream transmissions. Index2 not used.	1. Check receive PON Fiber input at OLT. 2. check if ONT power on or off.
3	Comm	Maj	Y, Y, Y	bitrate-high (long)10354691	EERRBITRATEHI 0x009E0003	The error bit rate hign at PON interface.	Check the fiber or PON interface.
5	Comm	Maj	Y, Y, Y	none	EPONIDLERXPWHI 0x009E0005	Idle power at OLT side is larger than the idle power threshold. Suggest operator to trigger PON rogue ONT test	Check the idle power of the PON
6	Equ	Maj	Y, Y, Y	none	EPONROGUETEST 0x009E0006	A diagnostic test is currently active on,the PON looking for misbehavinging ONTs.	Check if rogue ONU test ongoing

(104 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
7	Comm	Maj	Y, Y, Y	none	ROGUEONT 0x009E0007	It indicates that a ONT which has misbehaving,transmission behavior during diagnostic,test. Index2= it points to a SNMP table,entry that contain the rogue ONT in eponPonRogueTestTable	Check if rogue ONU exist or not
8	Equ	Maj	Y, Y, Y	opmodule-mismatch (long)10354696	OPMODULEMISMACH 0x009E0008	The actual optical module pluged in the PON interface mismatched with configuration.	Check the actual optical module
Alarm type: 159 Alarm type = EONT Services LAN (159) - Index1 = eponOntEnetIndex (IfIndex of UNI), Index2 = not used							
1	Equ	Maj	Y, Y, Y	none	PORTLOOP 0x009F0001	Port loop happen at ONT uniport.	check why port loop at uniport at ONT side.
2	Equ	Maj	Y, Y, Y	none	PORT_NEGO_FAIL 0x009F0002	Failure of auto negotiation for specific Ethernet port	check why port auto negotiation failure at uniport at ONT side, e.g., ONT support port mode mismatch with peer side
3	Equ	Min	Y, Y, Y	none	PORT_LOSS_SIGNAL 0x009F0003	Loss of signal for specific Ethernet port	check why port loss of signal at uniport at ONT side,e.g Ethernet cable is not connected
4	Equ	Maj	Y, Y, Y	none	ETH_PORT_FAIL 0x009F0004	Failure of specific Ethernet port	check why port failure at uniport at ONT side, e.g., hardware failure for special port
5	Equ	Maj	Y, Y, Y	none	PORT_CONGESTION 0x009F0005	Congestion of Ethernet port is detected.	check why port congestion at uniport at ONT side
Alarm type: 160 Alarm type = OLT ONT TCA (160) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = ifIndex (Index of ONT), Index2 = see specific alarm number.							
1	Comm	Maj	Y, Y, Y	none	EOLTRXPWLO 0x00A00001	Receive power from ONTat OLT side is high than the sensor sensitivity upper limit. Index2 = ifType	Check why Rx power from ONT at OLT side is low
2	Comm	Maj	Y, Y, Y	none	EOLTRXPWHI 0x00A00002	Receive power from ONT at OLT side is lower than the sensor sensitivity lower limit. Index2 = ifType	Check why Rx power from ONT at OLT side is hign

(105 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
4	Comm	Warn	N, Y, Y	none	EOLTRXPWLOWARN 0x00A00003	recieve power from ONU at OLT sidel is too high. than warning thresholdIt happens when receive power is higher than the configured warning threshold for this ONT.	Check the Rx power from ONT at OLT side
Alarm type: 161 Alarm type = ONT Services POTS Supplemental (161) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponOntEquipIfIndex (Index of ONT), Index2 = SpIndex. For XGS-PON, XG-PON and NG-PON2, NOT SUPPORTED as of ISAM5.2 release							
1	Comm	Min	Y, Y, Y	ont-sip-reg-dns (long)10551297	COND_SIPREGDNS 0x00A10001	SIP Registration failed because the domain name could not be resolved.	The provisioned POTS service SIP registration failed because domain could not be resolved. 1. Check network connectivity and configuration 2. Verify domain name 3. Verify security authentication credentials 4. Check SIP server configuration 5. Deprovision service if no longer required
4	Comm	Min	Y, Y, Y	ont-sip-reg-fail (long)10551300	COND_SIPREGAUTH 0x00A10004	SIP Registration failed because authentication failed between the ONT and the registration server.	The provisioned POTS service SIP registration failed because authentication failed between the ONT and the registration server. 1. Verify security authentication credentials 2. Check SIP server configuration 3. Deprovision service if no longer required
5	Comm	Min	Y, Y, Y	ont-sip-reg-timeout (long)10551301	COND_SIPREGTO 0x00A10005	SIP Registration failed because all attempted retransmissions timed out.	The provisioned POTS service SIP registration failed because all attempted retransmissions timed out. 1. Check network connectivity and configuration 2. Verify domain name 3. Verify security authentication credentials 4. Check SIP server configuration 5. Deprovision service if no longer required

(106 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
6	Comm	Min	Y, Y, Y	ont-sip-reg-err-resps (long)10551302	COND_SIPREGERR 0x00A10006	SIP Registration failed because there was an error response from the registration server.	The provisioned POTS service SIP registration failed because there was an error response from the registration server. 1. Check network connectivity and configuration 2. Verify domain name 3. Verify security authentication credentials 4. Check SIP server configuration 5. Deprovision service if no longer required
7	Comm	Min	Y, Y, Y	ont-sip-inv-dns (long)10551303	COND_SIPINVITEDNS 0x00A10007	SIP Invite failed because the domain name could not be resolved.	The provisioned POTS service SIP INVITE failed because domain could not be resolved. 1. Check network connectivity and configuration 2. Verify domain name 3. Verify security authentication credentials 4. Check SIP server configuration 5. Deprovision service if no longer required
10	Comm	Min	Y, Y, Y	ont-sip-inv-auth (long)10551306	COND_SIPINVITEAUTH 0x00A1000A	SIP Invite failed because authentication failed between the ONT and the call server.	The provisioned POTS service SIP INVITE failed because authentication failed between the ONT and the registration server. 1. Verify security authentication credentials 2. Check SIP server configuration 3. Deprovision service if no longer required
11	Comm	Min	Y, Y, Y	ont-sip-inv-timeout (long)10551307	COND_SIPINVITETO 0x00A1000B	SIP Invite failed because all attempted retransmissions timed out.	The provisioned POTS service SIP INVITE failed because all attempted retransmissions timed out. 1. Check network connectivity and configuration 2. Verify domain name 3. Verify security authentication credentials 4. Check SIP server configuration 5. Deprovision service if no longer required

(107 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
12	Comm	Min	Y, Y, Y	ont-sip-inv-err (long)10551308	COND_SIPINVITEERR 0x00A1000C	SIP Invite failed because there was an error response from the call server.	The provisioned POTS service SIP INVITE failed because there was an error response from the registration server. 1. Check network connectivity and configuration 2. Verify domain name 3. Verify security authentication credentials 4. Check SIP server configuration 5. Deprovision service if no longer required
13	Comm	Warn	N, Y, Y	ont-svc-pots-subs-refr (long)10551309	COND_PICNFSUBREFERR 0x00A1000D	iConfig subscription could not refreshed because of one of the following conditions:Refresh subscribe could not be sent to the configuration server for VOIP profile because domain name could not be resolvedRefresh subscribe could not be sent to the configuration server for VOIP profile because authentication failed between the ONT and the configuration serverRefresh subscribe could not be sent to the configuration server for VOIP profile because all attempted retransmissions timed outRefresh subscribe could not be sent to the configuration server for VOIP profile because there was an error response from the configuration server	To clear, Any refresh must be received for Subscription. Check network connectivity and configuration. Check POTS configuration.
14	Comm	Warn	N, Y, Y	ont-svc-pots-not-refr (long)10551310	COND_PICNFNOTREFERR 0x00A1000E	iConfig Notify response for refresh subscribe failed for VOIP profile because of one of the following conditions:iConfig Notify response for refresh subscribe failed for VOIP profile because the Notify was malformedRefresh subscription request was rejected by the configuration server	To clear, A valid Notify response for refresh must be received for Subscription. Check network connectivity and configuration. Check POTS configuration.

(108 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
15	Comm	Min	Y, Y, Y	ont-svc-pots-icfg-err (long)10551311	COND_PICNFERR 0x00A1000F	iConfig VOIP service can not be provided because there was a configuration error that does not map to any specific POTS iConfig alarms.	To clear, an iConfig configuration must complete successfully. Check network connectivity and configuration. Check POTS configuration.
Alarm type: 163 Alarm type = SFU ONT PLOAM (163) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponOntEquipIfIndex (IfIndex of ONT), Index2 = not used.							
1	Comm	Maj	Y, Y, Y	sfu-ploam-loss-sig (long)10682369	LOS_O_SFU 0x00A30001	Loss of Signal at ONT (2nd highest priority for any type of ONT alarm, following INACT alarm).	Check receive signal at ONT.
2	Comm	Maj	Y, Y, Y	sfu-ploam-loss-ack (long)10682370	LOA_SFU 0x00A30002	Loss of Acknowledge from ONT	See if isolated for specific ONT (if not, likely a software error).
4	Comm	Maj	Y, Y, Y	sfu-ploam-loss-cd (long)10682372	LCD_SFU 0x00A30004	Loss of GEM/ATM Channel Delineation of ONT	Check quality of line from ONT.
6	Comm	Maj	Y, Y, Y	sfu-ploam-phy-eqpt-err (long)10682374	PEE_SFU 0x00A30006	Physical Equipment Error of ONT	Perform loop back tests.
7	Comm	Maj	Y, Y, Y	sfu-ploam-startup-fail (long)10682375	SUF_SFU 0x00A30007	Startup Failure in Ranging of ONT	Re-range the ONT.
9	Comm	Maj	Y, Y, Y	sfu-ploam-sig-degrade (long)10682377	SD_SFU 0x00A30009	Signal Degrade BER threshold exceeded from ONT.	Check quality of line from ONT. Signal Degrade BER exceeded.
12	Comm	Maj	Y, Y, Y	sfu-ploam-disabled (long)10682380	ONTDISABLED_SFU 0x00A3000C	ONT has been autonomously disabled because of misbehaving transmissions. This is actually a defense alarm so that the ONT doesn t affect the entire PON. This is also declared for ROGUE ONT detection.	Reset ONT by administratively putting it OOS and then IS. If alarm occurs again, then ONT must likely be physically repaired or swapped. Note: This can occur due to detection of a ROGUE ONT.
13	Comm	Maj	Y, Y, Y	sfu-ploam-err-msg (long)10682381	MEM_SFU 0x00A3000D	Message Error Message from ONT	See if isolated for specific ONT (if not, likely a software error).
15	Comm	Maj	Y, Y, Y	sfu-ploam-inactive (long)10682383	INACT_SFU 0x00A3000F	ONT is Inactive (1st highest priority of any type of ONT alarm).	ONT needs to be ranged (made active).
17	Comm	Maj	Y, Y, Y	sfu-ploam-sig-fail (long)10682385	SF_SFU 0x00A30011	Signal Fail BER threshold exceeded from ONT	Check quality of line from ONT. Signal Fail BER exceeded.
18	Comm	Min	Y, Y, Y	sfu-ploam-dying-gasp (long)10682386	DG_SFU 0x00A30012	Received Dying Gasp indication from ONT.	Restore power to ONT. Dying gasp indication is due to loss of power input to ONT

(109 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
19	Comm	Maj	Y, Y, Y	sfu-ploam-deact-fail (long)10682387	DF_SFU 0x00A30013	Deactivate Failure of ONT.	1. Reset ONT. 2. Replace ONT if Deactivate failure persists.
20	Comm	Maj	Y, Y, Y	sfu-ploam-oam (long)10682388	LOAM_SFU 0x00A30014	Loss of PLOAM for ONT.	1. Check receive signal at ONT. 2. Reset ONT. 3. If Loss of PLOAM alarm persists, replace ONT.
21	Comm	Maj	Y, Y, Y	sfu-ploam-win-drift (long)10682389	DOW_SFU 0x00A30015	Drift of Window. (GPON only)	Check quality of line from ONT if condition persists. OLT received a transmission from the ONT at an unexpected place within the upstream virtual frame.
22	Comm	Maj	Y, Y, Y	sfu-ploam-rdi (long)10682390	RDI_SFU 0x00A30016	Remote Defect Indication from ONT.	Check receive signal at ONT. The OLT transmission was received with errors at the ONT.
24	Comm	Maj	Y, Y, Y	sfu-ploam-loss-ks (long)10682392	LOKS_SFU 0x00A30018	Loss of Key synchronization between OLT and ONT. This key is used for the AES encryption algorithm between OLT and ONT.	1. Check connectivity between OLT and ONT resulting in loss of key exchange PLOAM message between OLT and ONT. 2. Reset ONT. If condition persists, replace ONT.
25	Comm	Min	N, Y, Y	sfu-ploam-pwr-burst (long)10682393	ONTPWRERR_SFU 0x00A30019	ONT Power up error. Extraneous power bursts have been detected for this ONT.	ONT power up error. Extraneous power bursts have been detected for this ONT. ONT Power Up Error alarm clears automatically within 15 minutes. If issue, either replace ONT, or disable feature via SET-NE-ALL to Normal Soak Mode
26	Comm	Maj	Y, Y, Y	sfu-ploam-rog-disa (long)10682394	ROGUEONTDIS_SFU 0x00A3001A	ONT has been autonomously disabled because of misbehaving transmissions and is thought to be a ROGUE ONT. This is actually a defense alarm so that the ONT doesn t affect the entire PON.	Reset ONT by administratively putting it OOS and then IS. If alarm occurs again, then ONT must likely be physically repaired or swapped.
27	Comm	Maj	N, Y, Y	sfu-ploam-diff-reach (long)10682395	DIFREACH_SFU 0x00A3001B	ONT has been deactivated because its location on the PON has exceeded its differential reach capability.	ONT has been deactivated because its location on the PON has exceeded its differential reach capability. Alarm clears when ONT is disconnected from PON.

(110 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
28	Comm	Maj	Y, Y, Y	sfu-ploam-looc (long)10682396	LOOC_SFU 0x00A3001C	Loss of OMCI Channel due to persistent MIC failure	1. Power Cycle the ONT unit 2. If problem persists after a power cycle of the ONT unit, re-program registration ID into ONT unit 3. If problem persists after registration ID re-programming, replace the ONT unit.
Alarm type: 164 Alarm type = SFU ONT General (164) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponOntEquipIfIndex (IfIndex of ONT), Index2 = not used.							
1	Comm	Maj	Y, Y, Y	sfu-gen-omci-fail (long)10747905	OMCICOMM_SFU 0x00A40001	ONT fails to respond to OMCI message requests (Loss of communications)	Attempt to restart the ONT.
2	Equ	Maj	Y, Y, Y	sfu-gen-eqpt-selftest (long)10747906	EQPT_ONT_SFU 0x00A40002	ONT has failed a self-test (either autonomous or operator commanded)	Command another ONT self-test. If Pass, OK. If Fail, implement creative diagnostics.
3	Env	Min	N, Y, Y	sfu-gen-ac-pwr-fail (long)10747907	ACFAIL_ONT_SFU 0x00A40003	Loss of external AC power to the ONT	Wait for or repair AC power to ONT.
4	Equ	Min	N, Y, Y	sfu-gen-bat-missing (long)10747908	BATTMISS_SFU 0x00A40004	Battery is provisioned for ONT, but is missing	Change provisioning or determine why battery is missing.
5	Equ	Min	N, Y, Y	sfu-gen-bat-low (long)10747909	BATTLOW_SFU 0x00A40005	Battery charge is low	If power is present, determine why battery wont charge, or why its low.
6	Equ	Min	N, Y, Y	sfu-gen-bat-fail (long)10747910	BATTFAIL_SFU 0x00A40006	Battery is provisioned and present, but cannot recharge	Customer needs to replace.
8	Equ	Min	N, Y, Y	sfu-gen-sw-dnload-f (long)10747912	SWDLFAIL_SFU 0x00A40008	Download of software to ONT has failed	1. Retry the download again. 2. If it fails again, manually clear the alarm (e.g. changed Planned version). Call Nokia customer service.
9	Equ	Maj	Y, Y, Y	sfu-gen-sw-act-fail (long)10747913	SWACTFAIL_SFU 0x00A40009	ONT failed to activate the passive image designated by the OLT.	1. Retry another activation (e.g. changed Planned version to Current Passive version). 2. If it fails again, manually clear the alarm (e.g. changed Planned version). Call Nokia customer service.
11	Equ	Min	N, Y, Y	sfu-gen-sw-dnload-p (long)10747915	SWDLIP_SFU 0x00A4000B	A condition meaning that a transfer of ONT software from the OLT to the ONT is pending or is actually being transmitted.	Not a problem. This is a transient condition that self clears once download activity ceases.

(111 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
12	Equ	Maj	Y, Y, Y	sfu-gen-eqpt-vers-mis (long)10747916	ONTEQVM_SFU 0x00A4000C	A condition meaning the provisioned ONT equipment part number does not match the version reported by the ONT	1. Change the provisioned Version ID to match the reported Version ID, or 2. Change the physical ONT so that the reported Version ID will match the provisioned Version ID.
16	Equ	Min	N, Y, Y	sfu-gen-sw-vers-mis (long)10747920	SWVER_SFU 0x00A40010	A condition meaning that the Planned software version does not equal the Active software version.	1. Make the Active version equal Planned version via successful activation or 2. Make the Planned version equal Active version via operator update.
17	Equ	Maj	Y, Y, Y	sfu-gen-us-rate-mis (long)10747921	ONTUSRATE_SFU 0x00A40011	ONT Mismatch detected between actual and planned upstream rate.	Correct the ONT configuration for the uptream rate.
23	Equ	Maj	Y, Y, Y	sfu-gen-eqpt-prov-sa (long)10747927	ONTMEA_SFU 0x00A40017	ONT failed to be provisioned. Mismatch between ONT Equipment and ONT provisioning attributes	Provisioned attributes failed to be provisioned in ONT. Check ONTs supported features. Delete the ONT and reprovision.
28	Comm	Min	N, Y, Y	sfu-gen-nw-time-err (long)10747932	NTPERR_SFU 0x00A4001C	A condition meaning the ONT is unable to establish timing from the NTP server(s).	This alarm indicates the ONT has never been able to reach and get time from a NTP server. A 30 minute alarm declaration interval is started when the NTP and VoIP clients are both enabled, and ends as soon as the ONT syncs with the NTP server. Note: If the ONT successfully gets time from an NTP server and then loses contact with it, the alarm is not raised. To troubleshoot, 1. Check NTP server accessibility and ONT provisioning configuration. 2. Restart the ONT to see if alarm returns.
29	Comm	Maj	Y, Y, Y	sfu-gen-opt-sig-high (long)10747933	LEVELHI_SFU 0x00A4001D	Received Optical signal level is too HIGH	Check ReceivedOptical signal and decrease signal level.
30	Comm	Maj	Y, Y, Y	sfu-gen-opt-sig-low (long)10747934	LEVELLO_SFU 0x00A4001E	Received Optical signal level is too LOW	Check Received Optical signal and increase signal level.

(112 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
31	Equ	Min	N, Y, Y	sfu-gen-eqpt-prov-ns a (long)10747935	ONTNSAMEA_SFU 0x00A4001F	ONT failed to be provisioned. Mismatch between ONT Equipment and ONT provisioning attributes. Non Service Affecting	Non service affecting provisioned attributes failed to be provisioned in ONT. Check supported capabilites of ONT and deprovision unsupported features.
Alarm type: 165 Alarm type = SOHO ONT PLOAM (165) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponOntEquipIfIndex (IfIndex of ONT), Index2 = not used.							
1	Comm	Maj	Y, Y, Y	soho-ploam-loss-sig (long)10813441	LOS_O_SOHO 0x00A50001	Loss of Signal at ONT (2nd highest priority for any type of ONT alarm, following INACT alarm).	Check receive signal at ONT.
2	Comm	Maj	Y, Y, Y	soho-ploam-loss-ack (long)10813442	LOA_SOHO 0x00A50002	Loss of Acknowledge from ONT	See if isolated for specific ONT (if not, likely a software error).
4	Comm	Maj	Y, Y, Y	soho-ploam-loss-cd (long)10813444	LCD_SOHO 0x00A50004	Loss of GEM/ATM Channel Delineation of ONT	Check quality of line from ONT.
6	Comm	Maj	Y, Y, Y	soho-ploam-phy-eqpt -er (long)10813446	PEE_SOHO 0x00A50006	Physical Equipment Error of ONT	Perform loop back tests.
7	Comm	Maj	Y, Y, Y	soho-ploam-startup-f ai (long)10813447	SUF_SOHO 0x00A50007	Startup Failure in Ranging of ONT	Re-range the ONT.
9	Comm	Maj	Y, Y, Y	soho-ploam-sig-degra de (long)10813449	SD_SOHO 0x00A50009	Signal Degrade BER threshold exceeded from ONT.	Check quality of line from ONT. Signal Degrade BER exceeded.
12	Comm	Maj	Y, Y, Y	soho-ploam-disabled (long)10813452	ONTDISABLED_SO HO 0x00A5000C	ONT has been autonomously disabled because of misbehaving transmissions. This is actually a defense alarm so that the ONT doesn t affect the entire PON. This is also declared for ROGUE ONT detection.	Reset ONT by administratively putting it OOS and then IS. If alarm occurs again, then ONT must likely be physically repaired or swapped. Note: This can occur due to detection of a ROGUE ONT.
13	Comm	Maj	Y, Y, Y	soho-ploam-err-msg (long)10813453	MEM_SOHO 0x00A5000D	Message Error Message from ONT	See if isolated for specific ONT (if not, likely a software error).
15	Comm	Maj	Y, Y, Y	soho-ploam-inactive (long)10813455	INACT_SOHO 0x00A5000F	ONT is Inactive (1st highest priority of any type of ONT alarm).	ONT needs to be ranged (made active).
17	Comm	Maj	Y, Y, Y	soho-ploam-sig-fail (long)10813457	SF_SOHO 0x00A50011	Signal Fail BER threshold exceeded from ONT	Check quality of line from ONT. Signal Fail BER exceeded.

(113 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
18	Comm	Min	Y, Y, Y	soho-ploam-dying-gasp (long)10813458	DG_SOHO 0x00A50012	Received Dying Gasp indication from ONT.	Restore power to ONT. Dying gasp indication is due to loss of power input to ONT
19	Comm	Maj	Y, Y, Y	soho-ploam-deact-fail (long)10813459	DF_SOHO 0x00A50013	Deactivate Failure of ONT.	1. Reset ONT. 2. Replace ONT if Deactivate failure persists.
20	Comm	Maj	Y, Y, Y	soho-ploam-oam (long)10813460	LOAM_SOHO 0x00A50014	Loss of PLOAM for ONT.	1. Check receive signal at ONT. 2. Reset ONT. 3. If Loss of PLOAM alarm persists, replace ONT.
21	Comm	Maj	Y, Y, Y	soho-ploam-win-drift (long)10813461	DOW_SOHO 0x00A50015	Drift of Window. (GPON only)	Check quality of line from ONT if condition persists. OLT received a transmission from the ONT at an unexpected place within the upstream virtual frame.
22	Comm	Maj	Y, Y, Y	soho-ploam-rdi (long)10813462	RDI_SOHO 0x00A50016	Remote Defect Indication from ONT.	Check receive signal at ONT. The OLT transmission was received with errors at the ONT.
24	Comm	Maj	Y, Y, Y	soho-ploam-loss-ks (long)10813464	LOKS_SOHO 0x00A50018	Loss of Key synchronization between OLT and ONT. This key is used for the AES encryption algorithm between OLT and ONT.	1. Check connectivity between OLT and ONT resulting in loss of key exchange PLOAM message between OLT and ONT. 2. Reset ONT. If condition persists, replace ONT.
25	Comm	Min	N, Y, Y	soho-ploam-pwr-burst (long)10813465	ONTPWRERR_SOHO 0x00A50019	ONT Power up error. Extraneous power bursts have been detected for this ONT.	ONT power up error. Extraneous power bursts have been detected for this ONT. ONT Power Up Error alarm clears automatically within 15 minutes. If issue, either replace ONT, or disable feature via SET-NE-ALL to Normal Soak Mode
26	Comm	Maj	Y, Y, Y	soho-ploam-rog-disa (long)10813466	ROGUEONTDIS_SOHO 0x00A5001A	ONT has been autonomously disabled because of misbehaving transmissions and is thought to be a ROGUE ONT. This is actually a defense alarm so that the ONT doesn t affect the entire PON.	Reset ONT by administratively putting it OOS and then IS. If alarm occurs again, then ONT must likely be physically repaired or swapped.

(114 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
27	Comm	Maj	N, Y, Y	soho-ploam-diff-reach (long)10813467	DIFREACH_SOHO 0x00A5001B	ONT has been deactivated because its location on the PON has exceeded its differential reach capability.	ONT has been deactivated because its location on the PON has exceeded its differential reach capability. Alarm clears when ONT is disconnected from PON.
28	Comm	Maj	Y, Y, Y	soho-ploam-looc (long)10813468	LOOC_SOHO 0x00A5001C	Loss of OMCI Channel due to persistent MIC failure	1. Power Cycle the ONT unit 2. If problem persists after a power cycle of the ONT unit, re-program registration ID into ONT unit 3. If problem persists after registration ID re-programming, replace the ONT unit.
Alarm type: 166 Alarm type = SOHO ONT General (166) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponOntEquipIfIndex (IfIndex of ONT), Index2 = not used.							
1	Comm	Maj	Y, Y, Y	soho-gen-omci-fail (long)10878977	OMCICOMM_SOHO 0x00A60001	ONT fails to respond to OMCI message requests (Loss of communications)	Attempt to restart the ONT.
2	Equ	Maj	Y, Y, Y	soho-gen-eqpt-selftest (long)10878978	EQPT_ONT_SOHO 0x00A60002	ONT has failed a self-test (either autonomous or operator commanded)	Command another ONT self-test. If Pass, OK. If Fail, implement creative diagnostics.
3	Env	Min	N, Y, Y	soho-gen-ac-pwr-fail (long)10878979	ACFAIL_ONT_SOHO 0x00A60003	Loss of external AC power to the ONT	Wait for or repair AC power to ONT.
4	Equ	Min	N, Y, Y	soho-gen-bat-missing (long)10878980	BATTMISS_SOHO 0x00A60004	Battery is provisioned for ONT, but is missing	Change provisioning or determine why battery is missing.
5	Equ	Min	N, Y, Y	soho-gen-bat-low (long)10878981	BATTLOW_SOHO 0x00A60005	Battery charge is low	If power is present, determine why battery wont charge, or why its low.
6	Equ	Min	N, Y, Y	soho-gen-bat-fail (long)10878982	BATTFAIL_SOHO 0x00A60006	Battery is provisioned and present, but cannot recharge	Customer needs to replace.
8	Equ	Min	N, Y, Y	soho-gen-sw-dnload-f (long)10878984	SWDLFAIL_SOHO 0x00A60008	Download of software to ONT has failed	1. Retry the download again. 2. If it fails again, manually clear the alarm (e.g. changed Planned version). Call Nokia customer service.
9	Equ	Maj	Y, Y, Y	soho-gen-sw-act-fail (long)10878985	SWACTFAIL_SOHO 0x00A60009	ONT failed to activate the passive image designated by the OLT.	1. Retry another activation (e.g. changed Planned version to Current Passive version). 2. If it fails again, manually clear the alarm (e.g. changed Planned version). Call Nokia customer service.

(115 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
11	Equ	Min	N, Y, Y	soho-gen-sw-dnload-p (long)10878987	SWDLIP_SOHO 0x00A6000B	A condition meaning that a transfer of ONT software from the OLT to the ONT is pending or is actually being transmitted.	Not a problem. This is a transient condition that self clears once download activity ceases.
12	Equ	Maj	Y, Y, Y	soho-gen-eqpt-vers-mis (long)10878988	ONTEQVM_SOHO 0x00A6000C	A condition meaning the provisioned ONT equipment part number does not match the version reported by the ONT	1. Change the provisioned Version ID to match the reported Version ID, or 2. Change the physical ONT so that the reported Version ID will match the provisioned Version ID.
16	Equ	Min	N, Y, Y	soho-gen-sw-vers-mis (long)10878992	SWVER_SOHO 0x00A60010	A condition meaning that the Planned software version does not equal the Active software version.	1. Make the Active version equal Planned version via successful activation or 2. Make the Planned version equal Active version via operator update.
17	Equ	Maj	Y, Y, Y	soho-gen-us-rate-mis (long)10878993	ONTUSRATE_SOHO 0x00A60011	ONT Mismatch detected between actual and planned upstream rate.	Correct the ONT configuration for the uptream rate.
23	Equ	Maj	Y, Y, Y	soho-gen-tune-fail (long)10878997	ONTMEA_SOHO 0x00A60017	ONT failed to be provisioned. Mismatch between ONT Equipment and ONT provisioning attributes	Provisioned attributes failed to be provisioned in ONT. Check ONTs supported features. Delete the ONT and reprovision.
28	Comm	Min	N, Y, Y	soho-gen-omci-fail (long)10878977	NTPERR_SOHO 0x00A6001C	A condition meaning the ONT is unable to establish timing from the NTP server(s).	This alarm indicates the ONT has never been able to reach and get time from a NTP server. A 30 minute alarm declaration interval is started when the NTP and VoIP clients are both enabled, and ends as soon as the ONT syncs with the NTP server. Note: If the ONT successfully gets time from an NTP server and then loses contact with it, the alarm is not raised. To troubleshoot, 1. Check NTP server accessibility and ONT provisioning configuration. 2. Restart the ONT to see if alarm returns.
29	Comm	Maj	Y, Y, Y	soho-gen-nw-time-err (long)10879004	LEVELHI_SOHO 0x00A6001D	Received Optical signal level is too HIGH.	Check ReceivedOptical signal and decrease signal level.
30	Comm	Maj	Y, Y, Y	soho-gen-opt-sig-high (long)10879005	LEVELLO_SOHO 0x00A6001E	Received Optical signal level is too LOW.	Check Received Optical signal and increase signal level.

(116 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
31	Equ	Min	N, Y, Y	soho-gen-opt-sig-low (long)10879006	ONTNSAMEA_SOHO 0x00A6001F	ONT failed to be provisioned. Mismatch between ONT Equipment and ONT provisioning attributes. Non Service Affecting	Non service affecting provisioned attributes failed to be provisioned in ONT. Check supported capabilites of ONT and deprovision unsupported features.
Alarm type: 167 Alarm type = MDU ONT PLOAM (167) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponOntEquipIfIndex (IfIndex of ONT), Index2 = not used.							
1	Comm	Maj	Y, Y, Y	mdu-ploam-loss-sig (long)10944513	LOS_O_MDU 0x00A70001	Loss of Signal at ONT (2nd highest priority for any type of ONT alarm, following INACT alarm).	Check receive signal at ONT.
2	Comm	Maj	Y, Y, Y	mdu-ploam-loss-ack (long)10944514	LOA_MDU 0x00A70002	Loss of Acknowledge from ONT	See if isolated for specific ONT (if not, likely a software error).
4	Comm	Maj	Y, Y, Y	mdu-ploam-loss-cd (long)10944516	LCD_MDU 0x00A70004	Loss of GEM/ATM Channel Delineation of ONT	Check quality of line from ONT.
6	Comm	Maj	Y, Y, Y	mdu-ploam-phy-eqpt-err (long)10944518	PEE_MDU 0x00A70006	Physical Equipment Error of ONT	Perform loop back tests.
7	Comm	Maj	Y, Y, Y	mdu-ploam-startup-fail (long)10944519	SUF_MDU 0x00A70007	Startup Failure in Ranging of ONT	Re-range the ONT.
9	Comm	Maj	Y, Y, Y	mdu-ploam-sig-degrade (long)10944521	SD_MDU 0x00A70009	Signal Degrade BER threshold exceeded from ONT.	Check quality of line from ONT. Signal Degrade BER exceeded.
12	Comm	Maj	Y, Y, Y	mdu-ploam-disabled (long)10944524	ONTDISABLED_MDU 0x00A7000C	ONT has been autonomously disabled because of misbehaving transmissions. This is actually a defense alarm so that the ONT doesn t affect the entire PON. This is also declared for ROGUE ONT detection.	Reset ONT by administratively putting it OOS and then IS. If alarm occurs again, then ONT must likely be physically repaired or swapped. Note: This can occur due to detection of a ROGUE ONT.
13	Comm	Maj	Y, Y, Y	mdu-ploam-err-msg (long)10944525	MEM_MDU 0x00A7000D	Message Error Message from ONT	See if isolated for specific ONT (if not, likely a software error).
15	Comm	Maj	Y, Y, Y	mdu-ploam-inactive (long)10944527	INACT_MDU 0x00A7000F	ONT is Inactive (1st highest priority of any type of ONT alarm).	ONT needs to be ranged (made active).
17	Comm	Maj	Y, Y, Y	mdu-ploam-sig-fail (long)10944529	SF_MDU 0x00A70011	Signal Fail BER threshold exceeded from ONT	Check quality of line from ONT. Signal Fail BER exceeded.

(117 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
18	Comm	Min	Y, Y, Y	mdu-ploam-dying-gasp (long)10944530	DG_MDU 0x00A70012	Received Dying Gasp indication from ONT.	Restore power to ONT. Dying gasp indication is due to loss of power input to ONT
19	Comm	Maj	Y, Y, Y	mdu-ploam-deact-fail (long)10944531	DF_MDU 0x00A70013	Deactivate Failure of ONT.	1. Reset ONT. 2. Replace ONT if Deactivate failure persists.
20	Comm	Maj	Y, Y, Y	mdu-ploam-oam (long)10944532	LOAM_MDU 0x00A70014	Loss of PLOAM for ONT.	1. Check receive signal at ONT. 2. Reset ONT. 3. If Loss of PLOAM alarm persists, replace ONT.
21	Comm	Maj	Y, Y, Y	mdu-ploam-win-drift (long)10944533	DOW_MDU 0x00A70015	Drift of Window. (GPON only)	Check quality of line from ONT if condition persists. OLT received a transmission from the ONT at an unexpected place within the upstream virtual frame.
22	Comm	Maj	Y, Y, Y	mdu-ploam-rdi (long)10944534	RDI_MDU 0x00A70016	Remote Defect Indication from ONT.	Check receive signal at ONT. The OLT transmission was received with errors at the ONT.
24	Comm	Maj	Y, Y, Y	mdu-ploam-loss-ks (long)10944536	LOKS_MDU 0x00A70018	Loss of Key synchronization between OLT and ONT. This key is used for the AES encryption algorithm between OLT and ONT.	1. Check connectivity between OLT and ONT resulting in loss of key exchange PLOAM message between OLT and ONT. 2. Reset ONT. If condition persists, replace ONT.
25	Comm	Min	N, Y, Y	mdu-ploam-pwr-burst (long)10944537	ONTPWRERR_MDU 0x00A70019	ONT Power up error. Extraneous power bursts have been detected for this ONT.	ONT power up error. Extraneous power bursts have been detected for this ONT. ONT Power Up Error alarm clears automatically within 15 minutes. If issue, either replace ONT, or disable feature via SET-NE-ALL to Normal Soak Mode
26	Comm	Maj	Y, Y, Y	mdu-ploam-rog-disa (long)10944538	ROGUEONTDIS_MDU 0x00A7001A	ONT has been autonomously disabled because of misbehaving transmissions and is thought to be a ROGUE ONT. This is actually a defense alarm so that the ONT doesn t affect the entire PON.	Reset ONT by administratively putting it OOS and then IS. If alarm occurs again, then ONT must likely be physically repaired or swapped.

(118 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
27	Comm	Maj	N, Y, Y	mdu-ploam-diff-reach (long)10944539	DIFREACH_MDU 0x00A7001B	ONT has been deactivated because its location on the PON has exceeded its differential reach capability.	ONT has been deactivated because its location on the PON has exceeded its differential reach capability. Alarm clears when ONT is disconnected from PON.
28	Comm	Maj	Y, Y, Y	mdu-ploam-looc (long)10944540	LOOC_MDU 0x00A7001C	Loss of OMCI Channel due to persistent MIC failure	1. Power Cycle the ONT unit 2. If problem persists after a power cycle of the ONT unit, re-program registration ID into ONT unit 3. If problem persists after registration ID re-programming, replace the ONT unit.
Alarm type: 168 Alarm type = MDU ONT General (168) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponOntEquipIfIndex (IfIndex of ONT), Index2 = not used.							
1	Comm	Maj	Y, Y, Y	mdu-gen-omci-fail (long)11010049	OMCICOMM_MDU 0x00A80001	ONT fails to respond to OMCI message requests (Loss of communications)	Attempt to restart the ONT.
2	Equ	Maj	Y, Y, Y	mdu-gen-eqpt-selftest (long)11010050	EQPT_ONT_MDU 0x00A80002	ONT has failed a self-test (either autonomous or operator commanded)	Command another ONT self-test. If Pass, OK. If Fail, implement creative diagnostics.
3	Env	Min	N, Y, Y	mdu-gen-ac-pwr-fail (long)11010051	ACFAIL_ONT_MDU 0x00A80003	Loss of external AC power to the ONT	Wait for or repair AC power to ONT.
4	Equ	Min	N, Y, Y	mdu-gen-bat-missing (long)11010052	BATTMISS_MDU 0x00A80004	Battery is provisioned for ONT, but is missing	Change provisioning or determine why battery is missing.
5	Equ	Min	N, Y, Y	mdu-gen-bat-low (long)11010053	BATTLOW_MDU 0x00A80005	Battery charge is low	If power is present, determine why battery wont charge, or why its low.
6	Equ	Min	N, Y, Y	mdu-gen-bat-fail (long)11010054	BATTFAIL_MDU 0x00A80006	Battery is provisioned and present, but cannot recharge	Customer needs to replace.
7	Comm	Maj	N, Y, Y	mdu-gen-phys-intrusion (long)11010055	INTRUDER_MDU 0x00A80007	Unauthorized access to ONT(MDU). Door or box is open.	Investigate ONT for possible illegal physical access to ONT (MDU).
8	Equ	Min	N, Y, Y	mdu-gen-sw-dnload-f (long)11010056	SWDLFAIL_MDU 0x00A80008	Download of software to ONT has failed	1. Retry the download again. 2. If it fails again, manually clear the alarm (e.g. changed Planned version). Call Nokia customer service.

(119 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
9	Equ	Maj	Y, Y, Y	mdu-gen-sw-act-fail (long)11010057	SWACTFAIL_MDU 0x00A80009	ONT failed to activate the passive image designated by the OLT.	1. Retry another activation (e.g. changed Planned version to Current Passive version). 2. If it fails again, manually clear the alarm (e.g. changed Planned version). Call Nokia customer service.
11	Equ	Min	N, Y, Y	mdu-gen-sw-dnload-p (long)11010059	SWDLIP_MDU 0x00A8000B	A condition meaning that a transfer of ONT software from the OLT to the ONT is pending or is actually being transmitted.	Not a problem. This is a transient condition that self clears once download activity ceases.
12	Equ	Maj	Y, Y, Y	mdu-gen-eqpt-vers-mis (long)11010060	ONTEQVM_MDU 0x00A8000C	A condition meaning the provisioned ONT equipment part number does not match the version reported by the ONT	1. Change the provisioned Version ID to match the reported Version ID, or 2. Change the physical ONT so that the reported Version ID will match the provisioned Version ID.
16	Equ	Min	N, Y, Y	mdu-gen-sw-vers-mis (long)11010064	SWVER_MDU 0x00A80010	A condition meaning that the Planned software version does not equal the Active software version.	1. Make the Active version equal Planned version via successful activation or 2. Make the Planned version equal Active version via operator update.
17	Equ	Maj	Y, Y, Y	mdu-gen-us-rate-mis (long)11010065	ONTUSRATE_MDU 0x00A80011	ONT Mismatch detected between actual and planned upstream rate.	Correct the ONT configuration for the uptream rate.
23	Equ	Maj	Y, Y, Y	mdu-gen-eqpt-prov-sa (long)11010071	ONTMEA_MDU 0x00A80017	ONT failed to be provisioned. Mismatch between ONT Equipment and ONT provisioning attributes	Provisioned attributes failed to be provisioned in ONT. Check ONTs supported features. Delete the ONT and reprovision.
24	Env	Ind	N, Y, Y	mdu-gen-mdu-env1 (long)11010072	ENV1_ONT_MDU 0x00A80018	ONU Environmental Alarm #1	Check external equipment connected to MDU Alarm Input #1
25	Env	Ind	N, Y, Y	mdu-gen-mdu-env2 (long)11010073	ENV2_ONT_MDU 0x00A80019	ONU Environmental Alarm #2	Check external equipment connected to MDU Alarm Input #2
26	Env	Ind	N, Y, Y	mdu-gen-mdu-env3 (long)11010074	ENV3_ONT_MDU 0x00A8001A	ONU Environmental Alarm #3	Check external equipment connected to MDU Alarm Input #3

(120 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
28	Comm	Min	N, Y, Y	mdu-gen-nw-time-err (long)11010076	NTPERR_MDU 0x00A8001C	A condition meaning the ONT is unable to establish timing from the NTP server(s).	This alarm indicates the ONT has never been able to reach and get time from a NTP server. A 30 minute alarm declaration interval is started when the NTP and VoIP clients are both enabled, and ends as soon as the ONT syncs with the NTP server. Note: If the ONT successfully gets time from an NTP server and then loses contact with it, the alarm is not raised. To troubleshoot, 1. Check NTP server accessibility and ONT provisioning configuration. 2. Restart the ONT to see if alarm returns.
29	Comm	Maj	Y, Y, Y	mdu-gen-opt-sig-high (long)11010077	LEVELHI_MDU 0x00A8001D	Received Optical signal level is too HIGH.	Check ReceivedOptical signal and decrease signal level.
30	Comm	Maj	Y, Y, Y	mdu-gen-opt-sig-low (long)11010078	LEVELLO_MDU 0x00A8001E	Received Optical signal level is too LOW.	Check Received Optical signal and increase signal level.
31	Equ	Min	N, Y, Y	mdu-gen-eqpt-prov-nsa (long)11010079	ONTNSAMEA_MDU 0x00A8001F	ONT failed to be provisioned. Mismatch between ONT Equipment and ONT provisioning attributes. Non Service Affecting	Non service affecting provisioned attributes failed to be provisioned in ONT. Check supported capabilites of ONT and deprovision unsupported features.
Alarm type: 169 Alarm type = ONTHPNA (169) For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponOntEquipIfIndex (Index of ONT), Index2 = SpIndex. For XGS-PON, XG-PON and NG-PON2, NOT SUPPORTED as of ISAM5.2 release.							
1	Equ	Min	Y, Y, Y	ont-hpna-ser-mis (long)11075585	HPNASVCMIS 0x00A90001	A condition meaning that the ONT did not accept the OMCI configuration requests for the HPNA service	The provisioned HPNA Service was rejected by the ONT during OMCI configuration requests. Verify HPNA service capability of ONT. Restart ONT to see if problem persists, or delete unsupported HPNA service port.
2	Comm	Maj	Y, Y, Y	ont-hpna-los-sig (long)11075586	HPNALOS 0x00A90002	Loss of signal on an HPNA port interface	Determine why not signal on HPNA port
Alarm type: 170 Alarm type = IHUB LDP (170) - Index1 = Base Router (value 0 indicates Base Router), Index2 = see specific alarm number							

(121 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
1	Comm	Crit	Y, Y, Y	ldp-instance-down (long)11141121	LDPDOWN 0x00AA0001	The alarm is raised when LDP is down. The alarm is cleared when the LDP instance is restarted or when the LDP configuration is deleted. Index2=0	Verify LDP status for base router, restart LDP
2	Comm	Crit	Y, Y, Y	ldp-session-down (long)11141122	LDPSESSIONDOWN 0x00AA0002	The alarm is raised when the TCP session goes down. The alarm is cleared when the connection is re-established or when the explicit configured peer is removed. The alarm is cleared when the LDP instance is stopped or when the LDP configuration is deleted. Manual clearing is needed for not explicit configured peers. Index2= IP-address	verify peer router up Verify correct far end IP address configured verify LDP interfaces up verify system IP configured verify configured authentication parameters
Alarm type: 171 Alarm type = IHUB MPLS (171) - Index1 = Base Router (value 0 indicates Base Router), Index2 = see specific alarm number. Additional Info layout: "LSPName"							
1	Comm	Crit	Y, Y, Y	mpls-instance-down (long)11206657	MPLSDOWN 0x00AB0001	The alarm is raised when MPLS is down. The alarm is cleared when the MPLS instance is restarted or when the MPLS configuration is deleted. Index2=0 Additional Info contains	Verify MPLS status for base router, restart
2	Comm	Crit	Y, Y, Y	mpls-lsp-down (long)11206658	LSPDOWN 0x00AB0002	The alarm is raised when the LSP is down. The alarm is cleared when the LSP is shutdown. The alarm is cleared when the MPLS instance is stopped or when the MPLS configuration is deleted. Index2= LspIndex (type: TmnxVRtrMplsLspID: Unsigned32 (0..65535]) Additional Info contains: LSPName Note: This alarm is reported for static LSP s as well dynamic LSP s (i.e rsvp based)	Verify nextHop IP-address, ping it

(122 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
3	Comm	Min	Y, Y, Y	mpls-lsp-path-down (long)11206659	LSPPATHDOWN 0x00AB0003	The alarm is raised when the LSP Path is down operationally, The alarm is cleared when LSP path is up LSP path is shutdown mpls-path is shutdown LSP is shutdown MPLS instance is shutdown Index2= lsp-path-Index (non zero value formed using the combination of tunnel-index lsp-index and also this index2 can not overlap between alarms of same category). Additional Info contains: lsp-index, tunnel-index, path-name tunnel-instance, tunnel-ingress-lsr-id Note: In the MPLS alarm table(s), the alarms LSPDown LSP Path Down are represented in mutually exclusive entries. The entry with lsp-path-down yes does not convey the status of the other alarm lap down though the corresponding lsp is also down. Also the value of index-2 is specific to the alarm. For LspDown alarm, the value of index-2 (lsp-id) 65536,For Lsp Path Down alarm, the value of index2 (lsp-path-index) = 65536	Check if the corresponding LSP is up If yes, check how the path is associated to the lsp. i.e primary path /secondary path in standby/secondary path in non-standby. (It is expected that the path configured as secondary in non-standby mode to have oper down (while lsp is up), until lsp switches to that secondary path). Check if the HOPs in the path are reachable (via ping).
Alarm type: 172 Alarm type = IHUB SDP (172) - Index1 = SDPid, Index2 = see specific alarm number Additional Info layout: "svcId, SDPbindId"							
1	Comm	Crit	Y, Y, Y	sdp-instance-down (long)11272193	SDPDOWN 0x00AC0001	The alarm is raised when the operational state of the SDP is down because: The underlying LSP is operationally down. The LDP sessions are down. The alarm is cleared when the SDP is shutdown. The alarm is cleared when the SDP becomes Operational up Index2=0 additional info contains: ,	Verify what the reason is to be operational down, use the given index to read sdpBindOperStatus of SDPbind table TLPD parameters mismatch: VC-TYPE , MTU ? Associated service operational down ? Associated SDP operational down No configuration at the peer for this VC-id, so no egress label received

(123 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
2	Comm	Crit	Y, Y, Y	sdp-binding-down (long)11272194	SDPBINDDOWN 0x00AC0002	The alarm is raised when the SDP binding administrative state is up and the SDP binding operational state is not up. The alarm is cleared when the SDP binding is shutdown. The alarm is cleared when the SDP is shutdown. The alarm is cleared when the service is shutdown. The alarm is cleared when the SDP binding becomes operational up. Index2=VCid (type : TmnxVcId Unsigned32 (1..4294967295)) Additional Info contains: svcId, SDPbindId Note: additional info contains data needed by AWS to access the SDP bind table that has as index svcId, sdpBindId Note: index1, index2 also uniquely identify a SDPbinding	Verify whether configured far end router is alive, ping configured far end IP address. Verify own status LDP, MPLS Verify LDP session/adjacency status Verify path towards far end ip accessible via network ports
Alarm type: 173 Alarm type = IHUB EPIPE (173) - Index1 = EPIPE Service Identifier (svcId in the svcBaseInfoTable), Index2 = not used							
1	Comm	Crit	Y, Y, Y	epipe-instance-down (long)11337729	EPIPEDOWN 0x00AD0001	The alarm is raised when the operational state of an EPIPE service is down. The alarm is cleared when the service is shutdown. The alarm is cleared when the service becomes operational up.	Verify the status of the attached SAP and the SDPbinding. Verify that the remote peer has been correctly configured or is still up.
Alarm type: 175 Alarm type = VLANPort (175) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = IfIndex of VLANPort, Index2 = Not used.							

(124 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
1	Equ	Min	Y, Y, Y	vlanport-svc-mismatch (long)11468801	VLANPORTSVCMIS 0x00AF0001	A condition meaning that the ONT did not accept the configuration requests for the provisioned VLAN port. For GPON and XG-PON1 a Additional Info contain bridgeportIfIndex,VlanId For NG-PON2 a Additional info instead contains AID of ONT UNI and VlanId in decimal format (Channel Group, SubChannel Group, ONT#, ONT Slot #, ONT Port#, VlanId) e.g. 1,1,1,1,1,VlanI NOTE: VlanId is the decimal equivalent of a 32 bit number whose construction is detailed in Appendix A.	A condition meaning that the ONT did not accept the configuration requests for the provisioned VLAN port. Possible reasons are: 1. The service is not supported by the ONT. 2. Setup problem. Possible solutions are to restart ONT or to deprovision the service since not supported
Alarm type: 176 Alarm type = IHUB PIM (176) - Index1 = VPRN Service Identifier (svcId in the svcBaseInfoTable) or Base Router (value 0 indicates Base Router) , Index2 = see specific alarm number							
1	Comm	Min	N, Y, Y	pim-neighbor-down (long)11534337	PIMDOWN 0x00B00001	The alarm is raised when: Hold timer expires Error in processing hello message The alarm is cleared when: The PIM neighbour is re-established (correct hello message received) PIM interface is admin down PIM node is admin down Interface is removed Manual Clearing must be foreseen. Index2 = neighbor idx Additional Info contains: ItfName,NeighborIpAddress vRtrId,vrtrIfIndex,vrtrPimNgIfNeighborAddressType,vrtrPimNgIfNeighborAddress	Check status of peer nodes, if belonging to same operator domain. Then do corrective actions on peer node. Change network topology if peer nodes can not be corrected. Check PIM configurations to see if there is any mismatch

(125 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
2	Comm	Maj	Y, Y, Y	pim-max-mcroutes (long)11534338	MAXMCROUTES 0x00B00002	The alarm is raised when: - the number of multicast routes for this virtual router has reached or exceeded the maximum configured number The alarm is cleared when: - the number of multicast routes for this virtual router has dropped below the mid threshold - the number of multicast routes for this virtual router has dropped below the maximum (no mid configured) - PIM service is shutdown. Mid threshold when configured at CLI = Max Routes * Max Routes Threshold Percentage. Mid threshold when using SNMP is set directly using vRtrMcastMidRouteThreshold. After clearing, the alarm can only be regenerated after a time-out. This time-out is 10 minutes (i.e. default value of vRtrRouteThresholdSoakTime). After the timeout, the alarm is raised immediately in case the condition to raise the alarm is met. Index2 = not applicable Additional Info contains: vRtrId	Check the number of (S,G),(*,G) joins received from the network and user side. Consider creating at network side a join policy to restrict accepted joins. Consider to restrict the allowed groups from the user. Increase the number of maximum routes, but take into account that replication resources are limited to 4K and shared with next L2 services: one per VPLS for flooding and one per (S,G)/(*,G) for VPLS/V-VPLS igmp snooping.
Alarm type: 177 Alarm type = IHUB BGP NG (177) - Index1 = VPRN Service Identifier (svcId in the svcBaseInfoTable) or Base Router (value 0 indicates Base Router), Index 2 = see specific alarm number							

(126 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
1	Comm	Crit	Y, Y, Y	bgp-peer-down (long)11599873	PEERDOWN 0x00B10001	The alarm is raised when the BGP peer has an operational state other than Up. It is cleared when the operational state is Up or when the VPRN service is shutdown or when the BGP protocol or BGP group or BGP peer is shutdown. It applies to v4 as well as to v6. Index2 = BGP neighbor index (non zero value, unique across all alarms within this type): it identifies a BGP neighbor; the neighbor is an IPv4 or IPv6 Peer and is identified through additional info (tBgpPeerNgAddress in the tBgpPeerNgTable). Additional Info contains: tBgpPeerNgAddress> vRtrId,tBgpPeerNgAddres sType	Check admin status of all BGP components, e.g. interfaces, group and neighbor should be 'no shutdown.' Check operational status of any interfaces needed for peer connections. If admin and operational states are up, then BGP config commands must be reviewed for misconfiguration, e.g. verify autonomous system ids of peers are correct. Check BGP prefix limit if memory resources are available. If memory is not available, modify policies to reduce BGP route importation.

(127 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
2	Comm	Maj	N, Y, Y	bgp-routes-mid-limit (long)11599874	MIDLIMPEEROUTES 0x00B10002	The prefix limit is the maximum number of routes BGP can learn from a peer. The alarm is raised when 90% of the maximum allowed peer routes are learned. The alarm is cleared when the number of peer routes learned drop to or below 80% of the maximum allowed or when the VPRN service is shutdown or when the BGP protocol or the BGP group or BGP peer is shutdown. The alarm is also cleared when the maximum number of routes for this BGP peer is reached and BGP with peer goes down. It applies to v4 as well as to v6. Index2 = BGP neighbor index (non zero value, unique across all alarms within this type): it identifies a BGP neighbor; the neighbor is an IPv4 or IPv6 Peer and is identified through additional info (tBgpPeerNgAddress in the tBgpPeerNgTable). Additional Info contains: tBgpPeerNgAddress> vRtrId,tBgpPeerNgAddres sType	Increase prefix limit if memory resources are available. If memory is not available, modify policies to reduce BGP route importation.
Alarm type: 178 Alarm type = IHUB IPv6 ADDRESS (178) - Index1 = VPRN Service Identifier (svcId in the svcBaseInfoTable) or Base Router (value 0 indicates Base Router), Index 2 = see specific alarm number Additional Info layout: "vRtrIfName, duplicateIP@, MAC@""vRtrId, vRtrIfIndex"							

(128 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
1	Comm	Maj	Y, Y, Y	ihub-ipv6-dad-own (long)11665409	IPV6DADOWN 0x00B20001	The alarm is raised when either: o a duplicate IPv6 address is detected for a Link Local assigned to one of the System's interfaces. The System has exhausted all attempts to generate a unique IPv6 link local address for the interface, all attempts were denied by the neighbor (user or node). This case will hardly ever occur. The IP interface will stay Operational Down. o a duplicate IPv6 address is detected for an operator configured IPv6@ At the point where the IPv6 address is determined to be duplicate, the operational state of that address is set to duplicate. The alarm is cleared when the operator: o requests to clear the alarm (manual clearing), o removes the configured IPv6@, o performs an IP interface shutdown, o disabling Ipv6 on the interface, o shuts down the vprn service. Index 2 for this alarm: IPv6 Address Index, unique value across all alarms in the Alarm Type Additional Info contains: vRtrIfName, duplicateIP@, MAC@ vRtrId, vRtrIfIndex Or vRtrIfName, duplicateIP@,vRtrId, vRtrIfIndex	In case the duplicate IPv6 address alarm occurs for the LL@: shutdown the interface in order to trigger the System to initiate the DAD procedure once more [and hope for successful outcome] a configured IPv6@: operator can choose a different IPv6@ for the interface

(129 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
2	Comm	Min	N, Y, Y	ihub-ipv6-dad (long)11665410	IPV6DAD 0x00B20002	The alarm is raised when either: a. a neighbor (user or node) has initiated DAD and the tentative address is already in use by the System, for one of the System's interfaces; b. a user has initiated DAD for a global IP@ and ISAM detects that the tentative address is already in use by another user; this case can occur when local proxy ND is enabled for the IP interface. The alarm is cleared when the operator: o requests to clear the alarm (manual clearing). Index 2 for this alarm: IPv6 Address Index, unique value across all alarms in the Alarm Type Additional Info contains: vRtrIfName, duplicateIP@, MAC@ vRtrId, vRtrIfIndex Or vRtrIfName, duplicateIP@, vRtrId, vRtrIfIndex	In case the duplicate IPv6 address alarm occurs for If duplicate @ is a link local address and also a duplicate MAC alarm is raised: same MAC is used at 2 ends If duplicate @ is a global address assigned via DHCP address: verify the configuration at the DHCP Server If duplicate @ is an address configured by operator and announced to the user via router advertisement: verify the configuration of the addresses for node and user If duplicate @ is an address that is already allocated to another user (case of local proxy ND): operator should verify the configuration of the addresses for the users
3	Comm	Maj	Y, Y, Y	ihub-ipv6-dup-pd-route (long)11665411	IPV6DUPPDROUTE 0x00B20003	The alarm is raised when a duplicate IPv6 prefix delegation route is detected for one of the System's interfaces. This may happen when a same PD is allocated to two clients by DHCP server or a ONU is moved from one ISAM to another ISAM and the same PD is redistributed to first ISAM. The alarm is cleared when: - IGP route already Present. Now ONU offline notification received. - DHCP PD Lease timer expired. - Operator clears DHCP PD using CLI. Index 2 for this alarm: duplicate alarm index which is unique value across all alarms in the Alarm Type. Additional Info contains: Prefix.	In case the duplicate IPv6 address alarm occurs for - If same PD is allocated to two clients by DHCP server: check DHCP server since the PD allocation configured in DHCP server is wrong. - If a ONU is moved from one ISAM to another ISAM and the same PD is redistributed to first ISAM: ONU offline notification is not received in first ISAM. Manually clear the duplicate PD from CLI.
Alarm type: 179 Alarm type = IHUB LI (179) - Index1=not used, Index2 =not used							

(130 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
1	Comm	Min	Y, Y, Y	li-traffic-disabled (long)11730945	LITRAFDISABLED 0x00B30001	The alarm is raised when interception of traffic is disabled. Operator does this to change online some system settings (e.g to modify ports used for LI, NTIO planning ,...) The alarm is cleared when: Disabling intercept session access Enabling interception of traffic	Enable traffic interception.
2	Comm	Maj	Y, Y, Y	li-bandwidth-limit (long)11730946	LIBANDWIDTH 0x00B30002	The alarm is raised when the sum of all intercepted traffic flows is above 95 % of the maximum. The maximum is 2,5 Gb/s for NANT-D and 10Gb/s for NANT-E. The alarm is cleared when the traffic flows go below 90% of the maximum. Next actions causes traffic to diminish or stop: By operator: disabling intercept session access disabling interception of traffic disabling the mediation device disabling all sessions removing a specific target disabling a specific target modifying a target key (i.e add vlan) modifying a filter attached to a target (i.e more specific) removing a filter attached to a target. By system: DHCP lease timeout Target refersh timer timeout By target: Sending/receiving less data Sending DHCP release	Lower the number of targets to be intercepted Decrement the number of sessions, traffic to be intercepted by -Attaching a filter to the target. -specifying a more specific target key (e.g use circuit-id iso remote-id , specify VRF,..)

(131 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
3	Comm	Maj	Y, Y, Y	li-out-of-res (long)11730947	LIOOR 0x00B30003	The alarm is raised from the moment the hardware is out of resources, i.e to intercept a user filter entries need to be installed for all DHCP session (attached to a given circuit-id or given remote-id) or per configured static IP. The alarm is cleared when all targets under intercept and their associated flow filters can be installed in HW. Next actions cause resources to be freed: By operator: 1. disabling lawful intercept session access 2. disabling the mediation device 3. disabling all sessions 4. removing a specific target 5. disabling a specific target 6. modifying a target key (i.e add vlan) 7. modifying a filter attached to a target.(i.e less specific) 8. removing a filter attached to a target. By system: 1. DHCP lease timeout 2. Target refersh timer timeout By target: Sending DHCP release	Lower the number of targets to be intercepted Decrement the number of used resources by -removing/simplifying filters attached to a target -making the target key more specific (e.g use circuit-id , specify VRF) so less DHCP sessions (I.e IP addresses) to be intercepted
Alarm type: 180 Alarm type = ONT Services VoIP SIP Agent Config (180) - For GPON, XGS-PON, XG-PON1 and NG-PON2 Index1 = gponIpHostOntIndex, Index2 = Not used. For XGS-PON, XG-PON and NG-PON2, NOT SUPPORTED as of ISAM5.2 release.							
1	Comm	Maj	Y, Y, Y	ont-sipa-reg-nm-fail (long)11796481	SIPAREGFAILNAME 0x00B40001	SIPUA register name - Failed to resolve the registration server name	SIPUA register name\" \"Failed to resolve the registration server name. Possible reasons are: Domain name of SIP server not resolvable. Possible solutions are: Verify registration server name. Check DNS server IP address.

(132 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
2	Comm	Maj	Y, Y, Y	ont-sipa-reg-rec-fail (long)11796482	SIPAREGREACH 0x00B40002	SIPUA register reach - Cannot reach registration server (the port cannot be reached, ICMP errors)	SIPUA register reach\" \"Cannot reach registration server (the port cannot be reached, ICMP errors). Possible reasons are: Connectivity lost. Possible solutions are: Check network connectivity and configuration. Check for network alarms. Perform PING to ONT.
3	Comm	Maj	Y, Y, Y	ont-sipa-reg-con-fail (long)11796483	SIPAREGCONNECT 0x00B40003	SIPUA register connect - Cannot connect to registration server (due to bad credentials or other fault after the port responded)	SIPUA register connect - Cannot connect to registration server (due to bad credentials or other fault after the port responded) Possible reasons are: Invalid user login and password. Possible solutions are: Verify configuration.
4	Comm	Maj	Y, Y, Y	ont-sipa-reg-val-fail (long)11796484	SIPAREGVALIDATE 0x00B40004	SIPUA register validate - Cannot validate registration server	SIPUA register validate\" \"Cannot validate registration server Possible solutions are: Verify configuration.
5	Comm	Min	Y, Y, Y	ont-sipa-reg-mis (long)11796485	SIPAREGMIS 0x00B40005	A condition meaning that either the LT or ONT did not accept the configuration requests for the provisioned SIPUA (SIP User Attribute).	A condition meaning that either the LT or ONT did not accept the configuration requests for the provisioned SIPUA (SIP User Attribute). Possible reasons are: 1. The service is not supported by the ONT. 2. Setup problem. Possible solutions are to restart ONT or to deprovision the SIPUA since not supported.
Alarm type: 181 Alarm type = ONT Services VoIP CONFIG (181) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponIpHostOntIndex, Index2 = Not used. For XGS-PON, XG-PON and NG-PON2 ' NOT SUPPORTED as of ISAM5.2 release.							

(133 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
1	Comm	Maj	Y, Y, Y	ont-vcd-cfg-nm-fail (long)11862017	VCDCFGFAILNAME 0x00B50001	VCD config server name - Failed to resolve the configuration server name.	VCD config server name\" \"Failed to resolve the configuration server name. Possible reasons are: Domain name of FTP server not resolvable. Possible solutions are: Verify config server name. Check DNS server IP address. Try FTP from a different network source, if not pass, check FTP server operation, configuration and credentials.
2	Comm	Maj	Y, Y, Y	ont-vcd-cfg-rech-fail (long)11862018	VCDCFGREACH 0x00B50002	VCD config server reach - Cannot reach configuration server (the port cannot be reached, ICMP errors)	VCD config server reach\" \"Cannot reach configuration server (the port cannot be reached, ICMP errors) Possible reasons are: Connectivity lost. Possible solutions are: Check network connectivity and configuration. Check for network alarms. Perform PING to ONT. Try FTP from a different network source, if not pass, check FTP server operation, configuration and credentials.
3	Comm	Maj	Y, Y, Y	ont-vcd-cfg-conn-fail (long)11862019	VCDCFGCONNECT 0x00B50003	VCD config server connect - Cannot connect to configuration server (due to bad credentials or other fault after the port responded)	VCD config server connect - Cannot connect to configuration server (due to bad credentials or other fault after the port responded) Possible reasons are: Invalid user login and password. Possible solutions are: Verify config server configuration. Try FTP from a different network source, if not pass, check FTP server operation, configuration and credentials.
4	Comm	Maj	Y, Y, Y	ont-vcd-cfg-vali-fail (long)11862020	VCDCFGVALIDATE 0x00B50004	VCD config server validate - Cannot validate configuration server	VCD config server validate - Cannot validate configuration server Possible solutions are: Verify config server configuration. Try FTP from a different network source, if not pass, check FTP server operation, configuration and credentials.

(134 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
5	Comm	Maj	Y, Y, Y	ont-vcd-cfg-auth-fail (long)11862021	VCDCFGAUTH 0x00B50005	VCD config server auth - Cannot authenticate configuration session (eg missing credentials)	VCD config server auth\" \"Cannot authenticate configuration session (eg missing credentials) Possible reasons are: Invalid user login and password. Possible solutions are: Verify config server configuration. Try FTP from a different network source, if not pass, check FTP server operation, configuration and credentials.
6	Comm	Maj	Y, Y, Y	ont-vcd-cfg-resp-tmout (long)11862022	VCDCFGTMOUT 0x00B50006	VCD config server timeout - Timeout waiting for response from configuration server	VCD config server timeout - Timeout waiting for response from configuration server Possible solutions are: Verify config server configuration. Check network alarms. Try FTP from a different network source, if not pass, check FTP server operation, configuration and credentials.
7	Comm	Maj	Y, Y, Y	ont-vcd-cfg-resp-err (long)11862023	VCDCFGRESPERR 0x00B50007	VCD config server fail - Failure response received from configuration server	VCD config server fail\" \"Failure response received from configuration server Possible reasons: File not found. Possible solutions are: Verify config server configuration. Check for presence of configuration file on server. Try FTP from a different network source, if not pass, check FTP server operation, configuration and credentials.
8	Comm	Maj	Y, Y, Y	ont-vcd-cfg-file-err (long)11862024	VCDCFGFILEERR 0x00B50008	VCD config file error - Configuration file received has an error	VCD config file error\" \"Configuration file received has an error Possible reasons are: XML file received but contains invalid data. Possible solutions are: Replace the XML file on the server. Correct contents of XML file.

(135 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
9	Comm	Maj	Y, Y, Y	ont-vcd-sub-nm-fail (long)11862025	VCDSUBSFAILNAME 0x00B50009	VCD subscription name - Failed to resolve the subscription server name.	VCD subscription name\" \"Failed to resolve the subscription server name. Possible reasons are: Domain name of subscription server not resolvable. Possible solutions are: Verify subscription server name. Check DNS server IP address.
10	Comm	Maj	Y, Y, Y	ont-vcd-sub-rech-fail (long)11862026	VCDSUBSREACH 0x00B5000A	VCD subscription reach - Cannot reach subscription server (the port cannot be reached, ICMP errors)	VCD subscription reach\" \"Cannot reach subscription server (the port cannot be reached, ICMP errors) Possible reasons are: Connectivity lost. Possible solutions are: Check network connectivity and configuration. Check for network alarms. Perform PING to ONT.
11	Comm	Maj	Y, Y, Y	ont-vcd-sub-conn-fail (long)11862027	VCDSUBSCONNECT 0x00B5000B	VCD subscription connect - Cannot connect to subscription server (due to bad credentials or other fault after the port responded)	VCD subscription connect\" \"Cannot connect to subscription server (due to bad credentials or other fault after the port responded) Possible reasons are: Invalid user login and password. Possible solutions are: Verify subscription server configuration.
12	Comm	Maj	Y, Y, Y	ont-vcd-sub-vali-fail (long)11862028	VCDSUBSVALIDATE 0x00B5000C	VCD subscription validate - Cannot validate subscription server	VCD subscription validate\" \"Cannot validate subscription server Possible solutions are: Verify subscription server configuration.
13	Comm	Maj	Y, Y, Y	ont-vcd-sub-auth-fail (long)11862029	VCDSUBSAUTH 0x00B5000D	VCD subscription auth - Cannot authenticate subscription session (eg missing credentials)	VCD subscription auth - Cannot authenticate subscription session (eg missing credentials) Possible reasons are: Invalid user login and password. Possible solutions are: Verify subscription server configuration.

(136 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
14	Comm	Maj	Y, Y, Y	ont-vcd-sub-resp-tmout (long)11862030	VCDSUBSTMOUT 0x00B5000E	VCD subscription timeout - Timeout waiting for response from subscription server	VCD subscription timeout - Timeout waiting for response from subscription server Possible solutions are: Verify subscription server configuration. Check network alarms.
15	Comm	Maj	Y, Y, Y	ont-vcd-sub-resp-err (long)11862031	VCDSUBSRESPERR 0x00B5000F	VCD subscription fail - Failure response received from subscription server	VCD subscription fail\" \"Failure response received from subscription server Possible solutions are: Verify subscription server configuration. Check network alarms.
16	Comm	Maj	Y, Y, Y	ont-vcd-reb-requ (long)11862032	VCDREBOOTREQ 0x00B50010	VCD reboot request - A non-OMCI management interface has requested a reboot of the ONU. Note This alarm is used only to indicate the request and not to indicate that a reboot has actually taken place.	VCD reboot request\" \"A non-OMCI management interface has requested a reboot of the ONU. Note\" \"This alarm is used only to indicate the request and not to indicate that a reboot has actually taken place. Possible solutions are: This alarm is for information only.
17	Comm	Min	Y, Y, Y	ont-vcd-mis (long)11862033	VCDMIS 0x00B50011	A condition meaning that either the LT or ONT did not accept the configuration requests for the provisioned VCD (VoIP Config Data).	A condition meaning that either the LT or ONT did not accept the configuration requests for the provisioned VCD (VoIP Config Data). Possible reasons are: 1. The service is not supported by the ONT. 2. Setup problem. Possible solutions are to restart ONT or to deprovision the VCD since not supported.
Alarm type: 182 Alarm type = EOLT ONT Services VoIP (182) - Index1 = eponOntEquipIfIndex (Index of ONT), Index2 = Not used.							
1	Comm	Min	Y, Y, Y		CONN_FAIL 0x00B60001	Failure of Connection between inner IAD and SS platform.	Check why communication with softswitch is failjure
2	Comm	Min	Y, Y, Y		VOIPDHCP_FAIL 0x00B60002	A condition meaning the voice DHCP server is unreachable by the Voice Client, or the Voice Client failed to obtain required IP addresses from the server.	Check why AG can not get IP address from DHCP server
Alarm type: 183 Alarm type = EONT Services POTS (183) - Index1 = eponOntPotsIfIndex (Index of POTS), Index2 = not used.							

(137 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
1	Equ	Min	Y, Y, Y		POTS_FAIL_TEMPERATRUE 0x00B70001	POTS port failure: over temperature	Check why the ONU POTS port temperature too high
2	Equ	Min	Y, Y, Y		POTS_FAIL_CURRENT 0x00B70002	POTS port failure: over current	Check why over current on the ONU POTS port
3	Equ	Min	Y, Y, Y		POTS_FAIL_GROUNDED 0x00B70003	POTS port failure: grounded	Check why the ONU POTS port is grounded
4	Comm	Min	Y, Y, Y		POTS_UNKNOWN_MEGACO_SUBS 0x00B70004	The Megaco subscriber exist in IAD but has not been configured in media gateway controller.	Check why the subscribe has not been configured on softswitch
Alarm type: 184 Alarm type = EOLT ONT Common (184) - Index1 = eponOntEquipIfIndex (Index of ONT), Index2 = not used							
1	Equ	Min	Y, Y, Y		EQUIPMENT 0x00B80001	ONU Equipment alarm: reset failure	Check why ONU reset failure
2	Equ	Min	Y, Y, Y		ONT_SELF_TEST_FAIL 0x00B80002	During ONU selftest, ONU switch failure is found.	Check why ONU switch selftest failure
3	Equ	Min	Y, Y, Y		ONT_VOIP_HW_FAIL 0x00B80003	During ONU selftest, ONU VoIP HW failure is found.	Check why ONU VoIP hardware selftest failure
4	Equ	Min	Y, Y, Y		ONT_E1_HW_FAIL 0x00B80004	During ONU selftest, ONU E1 HW failure is found. The alarm is not for each E1 port, but for the device. Each E1 port should have dedicated alarm.	Check why ONU E1 hardware selftest failure
5	Equ	Min	Y, Y, Y		ONT_POWER_BROKEN 0x00B80005	ONU Power broken	Check why ONU power broken
6	Equ	Min	Y, Y, Y		ONT_POWER_TOO HIGH 0x00B80006	ONU Power too high	Check why ONU power too high
7	Equ	Min	Y, Y, Y		ONT_POWER_TOOLOW 0x00B80007	ONU Power too low	Check why ONU power too low
8	Equ	Min	N, Y, Y		ONT_BATT_MISS 0x00B80008	Battery is provisioned but missing	Check why ONU Battery is provisioned but missing
9	Equ	Min	N, Y, Y		ONT_BATT_RECHARGE_FAIL 0x00B80009	Battery is provisioned and present but cannot recharge	Check why ONU Battery is provisioned and present but cannot recharge

(138 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
10	Equ	Min	N, Y, Y		ONT_BATT_TOO_LOW 0x00B8000A	Battery is provisioned and present but its voltage is too low	Check why ONU Battery is provisioned and present but its voltage is too low
11	Equ	Warn	N, Y, Y		ONT_PHY_INSTRUMENT 0x00B8000B	Applies if the ONT is supported with detection such as door or boxopen	Check if the ONT door or box open
12	Equ	Min	N, Y, Y		EXTEMPEHI 0x00B8000C	Set when ONU internal temperature exceeds high alarm level Note that the temperature value refer to table	Check why ONU internal temperature exceeds high temperature alarm warning
13	Equ	Min	N, Y, Y		EXTEMPLO 0x00B8000D	Set when ONU internal temperature is below low alarm level Note that the temperature value refer to table	Check why ONU internal temperature is below low temperature alarm warning
14	Equ	Min	N, Y, Y		PON_IF_SWITCH 0x00B8000E	When ONU detect PON link failure, or receive Active PON_IF Adminstate message, ONU switch PON interface and report alarm to OLT.	Check why ONU detect PON link failure, or receive Active PON_IF Adminstate message
15	Equ	Min	Y, Y, Y		PROVFAIL 0x00B8000F	ONT rejected provisioning request. One example would be, if the traffic descriptor provisioned can not physically be supported by the ONT.	Check why ONU rejected provisioning request
16	Equ	Min	Y, Y, Y		LLIDCAPMISMATCH 0x00B80010	ONT LLID capablility does not meet the need of configured llidpattern.One example would be, if the llidpattern is configured as 1*8 and ONT can only support single llid.	Check ONT capability and whether support multiple LLID
Alarm type: 185 Alarm type = EONT SWDLD (185) - Index1 = eponOntEquipIfIndex (Index of ONT), Index2 = not used							
1	Equ	Min	N, Y, Y	none	EPON_SWVER_VER_MISMATCH 0x00B90001	If the pre-configure ONU software type is not match the actual ONU, The upgrade shall be rejected and raise the alarm to the operator.	Check why the pre-configure ONU software type is not match the actual ONU
2	Equ	Min	N, Y, Y	none	EPON_SWVER_MODE_MISMATCH 0x00B90002	If configured software download mode is not match the actual ONU supported download mode, e.g., operator configure CTC 2.1 mode to a CTC 2.0 ONU	Check why configured software download mode is not match the actual ONU supported download mode, e.g., operator configure CTC 2.1 mode to a CTC 2.0 ONU

(139 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
3	Equ	Min	N, Y, Y	none	EPON_SWVER_NOT FOUND 0x00B90003	If no matched version is found in the ONU software mapping table, the upgrade shall be rejected and raise the alarm.	Check why no matched version is found in the ONU software mapping table
4	Equ	Min	N, Y, Y	none	EPON_SWDLFILEMI SSING 0x00B90004	If the system can not find the software version file the NT flush, or the file is too big, the upgrade shall be rejected and raise the alarm.	Check why the system can not find the software version file the NT flush
5	Equ	Min	N, Y, Y	none	EPON_SWDLIP 0x00B90005	The software version downloading to the ONU is in progress	The software version downloading to the ONU is in progress. This is not an error, just for information
6	Equ	Min	N, Y, Y	none	EPON_SWDLFAIL 0x00B90006	Fail to download a software version to the ONU	Check why failing to download a software version to the ONU
7	Equ	Min	Y, Y, Y	none	EPON_SWACTFAIL 0x00B90007	Fail to active a software version which has been downloaded to the ONU	Check why failing to active a software version which has been downloaded to the ONU
8	Equ	Min	Y, Y, Y	none	EPON_SWCMTFAIL 0x00B90008	Fail to commit a software version which has been downloaded and actived on the ONU	Check why failing to commit a software version which has been downloaded to the ONU
Alarm type: 186 Alarm type = ONT VEIP (186) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponVeipOntIndex, Index2 = gponVeipPortSpIndex							
1	Comm	Min	Y, Y, Y	ont-veip-mismatch (long)12189697	VEIPMIS 0x00BA0001	A condition meaning that either the LT or ONT did not accept the configuration requests for the provisioned VEIP (Virtual Ethernet Interface Point).	A condition meaning that either the ONT or LT did not accept the configuration requests for the provisioned VEIP. Possible reasons are: 1. The interface is not supported by the ONT. 2. LT configuration or setup problem. Possible solutions are to restart ONT, restart LT, or to deprovision the VEIP since not supported.
Alarm type: 187 Alarm type = ONT MGC (187) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponIpHostOntIndex, Index2 = Not Used For XGS-PON, XG-PON and NG-PON2 NOT SUPPORTED as of ISAM5.2 release							

(140 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
1	Comm	Min	Y, Y, Y	ont-mgc-mis (long)12255233	MGCMIS 0x00BB0001	A condition meaning that either the LT or ONT did not accept the configuration requests for the provisioned MGC (Media Gateway Controller).	A condition meaning that either the LT or ONT did not accept the configuration requests for the provisioned MGC (Media Gateway Controller). Possible reasons are: 1. The interface is not supported by the ONT. 2. LT configuration or setup problem. Possible solutions are to restart ONT, restart LT, or to deprovision the MGC since not supported.
2	Comm	Maj	Y, Y, Y	ont-mgc-timeout (long)12255234	MGCTMOUT 0x00BB0002	MGC timeout - A condition meaning that the association with the MGC timed out.	A condition meaning that the association with the MGC timed out. Possible solutions are: Check the MGC configuration at both the MGC and ONT (i.e., IP address, message ID) Verify MGC server configuration. Check network alarms.
Alarm type: 188 Alarm type = ONT IP HOST (188) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponIpHostOntIndex, Index2 = Not Used For XGS-PON, XG-PON and NG-PON2 NOT SUPPORTED as of ISAM5.2 release							
1	Comm	Min	Y, Y, Y	ont-ip-host-mismatch (long)12320769	IPHOSTMIS 0x00BC0001	A condition meaning that either the LT or ONT did not accept the configuration requests for the provisioned ONT IP host.	A condition meaning that either the LT or ONT did not accept the configuration requests for the provisioned ONT IP host. Possible reasons are: 1. The interface is not supported by the ONT. 2. LT configuration or setup problem. Possible solutions are to restart ONT, restart LT, or to deprovision the IP HOST since not supported.
2	Comm	Min	Y, Y, Y	ont-ip-host-file (long)12320770	IPHOSTFILE 0x00BC0002	The voice service profile attempted to access a network specific extensions file that is not available.	Check that network specific extensions file is available.
18	Comm	Min	Y, Y, Y	ont-ip-host-ip-alloc (long)12320786	IPHOSTIPALLOCFAIL 0x00BC0012	The voice service profile attempted to access a network specific extensions file that is not available.	Check that network specific extensions file is available.

(141 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
Alarm type: 189 Alarm type = xDSL Vect Line (189) - Index1 = ifIndex of xDSL physical port, Index2 = not used.							
1	Comm	Min	Y, Y, Y	vectline-xtc-var-vict (long)12386305	XTCVARVIC 0x00BD0001	Abnormal high amplitude variation in incoming crosstalk canceling coefficients. Note: not yet supported	Check physical line.
2	Comm	Min	Y, Y, Y	vectline-xtc-var-dist (long)12386306	XTCVARDIST 0x00BD0002	Abnormal high amplitude variation in outgoing crosstalk canceling coefficients. Note: not yet supported	Check physical line.
3	Comm	Min	Y, Y, Y	vectline-corp-errf (long)12386307	CORPERRF 0x00BD0003	Missing or corrupted error samples received on that line.	Check modem equipment.
4	Comm	Min	Y, Y, Y	vect-cpe-cap-mismatch (long)12386308	VECTCPECAPMISM 0x00BD0004	The alarm is raised when the capability of the connected CPE does not match the allowed configured CPE modes of the vectoring profile. The alarm is cleared when the connected CPE matches the allowed CPE modes. Note : the impacted line can be in service when a fallback profile was associated to the board which holds the impacted line	Connect the correct modem equipment to prevent a mismatch
5	Comm	Min	Y, Y, Y	vectline-conf_notfeas (long)12386309	VECTCONFNOTFEAS 0x00BD0005	The alarm is raised when the vectoring profile configuration settings are not supported by the selected vp/lt interface version. The alarm is cleared when all vectoring configurations are supported. Note : the impacted line can be in service when a fallback profile was associated to the board which holds the impacted line	Correct the Vect-Profile configuration settings
Alarm type: 190 Alarm type = OTDR (190) - Index1 = ifIndex of the physical PON interface, Index2 = 0 (GPON) or 1 (EPON). For XGS-PON, XG-PON and NG-PON2 NOT SUPPORTED as of ISAM5.2 release							

(142 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
1	Equ	Min	N, Y, Y	otdr-cap-mismatch (long)12451841	OTDRCAPMISMATCH 0x00BE0001	The alarm is raised when OTDR is enabled on a SFP and the currently plugged-in SFP does not support OTDR. The alarm is cleared when the SFP is plugged-out or when an OTDR capable SFP is plugged-in or when OTDR is disabled.	Replace the SFP with an OTDR capable SFP or disable OTDR on that SFP.
Alarm type: 191 Alarm type = xDSL Vect Board (191) - Index1 = eptSlotId , Index2 = see specific alarm number.							

(143 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
1	Equ	Maj	Y, Y, Y	vect-vp-lt-mismatch (long)12517377	VPLTMISM 0x00BF0001	The alarm is raised when vectoring is not feasible on the specific (VP,VP Link) and LSM. The alarm indicates a connection to the wrong VP or a mismatch in SW version between VP and SLV-LT. The alarm is cleared when vectoring is again feasible on the specific (VP, VP Link) and LSM. The VP-LT mismatch alarm is raised in case of incorrect configuration of an XDSL use case. The alarm is also raised when an unsupported LT is plugged in, the supported LTs are determined by the configured vectoring class. Index 2 = VP Link ID if alarm raised on the SLV-VP = 0 if on LT = LT LinkID if alarm is raised on SLV-LT. Range of VP LinkID: 1 .. x where x see xdslBoardActLinkNumber or xdslBoardVectGroupActLinkNumber. Range of the LT LinkID: 1..2 where 1 is used for all LT board types, including boards with softlinks and 2 is used for SLV-LT board types which have 2 frontcable connectors. Additional Info contains: '"BoardType' when Index 1 is a VP board, 'Rack/shelf/slot,ISAM-IP,ISAM-ID,QSPF-state"BoardType' when Index 1 is a SLV-LT, where thr first string contains info of the peer VP. The second string is supported on all boards. It contains info to specify the type of board of Index 1. Allowed values are '0' and '1' where 0=SLV-LT and 1=VP.	Check equipment : VP-LSM and the cabling Check configuration expected VP-LSM connectivity versus actual VP-LSM connections Check the Software Version of SLV-LT versus SW version of VP.

(144 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
2	Comm	Maj	Y, Y, Y	vect-inv-qsfp (long)12517378	VPLQSFPINVID 0x00BF0002	The alarm is raised when the QSFP is connected but it does not have a valid Nokia ID. The alarm is cleared when there is no cable connected or when the connected QSFP has a valid Nokia ID Index 2 = VP Link-ID if alarm raised on the SLV-VP = 0 if on LT = LT LinkID if alarm is raised on SLV-LT Range of VP LinkID: 1 .. x where x see xdslBoardActLinkNumber or xdslBoardVectGroupActLinkNumbe. Range of the LT LinkID: 1..2 where 1 is used for all LT board types, including boards with softlinks and 2 is used for SLV-LT board types which have 2 frontcable connectors.	Check QSFP ID. Use a cable with a valid Nokia ID

(145 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
3	Comm	Maj	Y, Y, Y	vect-vp-lt-fail (long)12517379	VPLTLINKFAIL 0x00BF0003	The alarm applies when there is no valid cable-connection between VP and SLV-LT. Note: additional failure conditions apply for QSFP-DD Y cables. More information can be found in the Hardware Installation Manual. Note : Index 1 = eptSlotId of VP or SLV--LT Index 2 = VP Link-ID if alarm raised on the SLV-VP = 0 if on LT = LT LinkID if alarm is raised on SLV-LT Range of VP LinkID: 1 .. x where x see xdslBoardActLinkNumber or xdslBoardVectGroupActLinkNumber. Range of the LT LinkID: 1..2 where 1 is used for all LT board types, including boards with softlinks and 2 is used for SLV-LT board types which have 2 frontcable connectors. Additional Info contains BoardType when Index 1 is a VP board, Rack/shelf/slot,ISAM-IP,ISAM-ID,QSFP-state BoardType when Index 1 is a SLV-LT, where the first string contains info of the peer VP. The second string is supported on all boards. It contains info to specify the type of board of Index 1. Allowed values are 0 and 1 where: 0=SLV-LT, 1=VP.	Check equipment : VP-LSM cable

(146 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
5	Comm	Maj	Y, Y, Y	vect-xdlv-conf-mism (long)12517381	XDLVCONFMISM 0x00BF0005	XDLV mode 1DD and 2DD: Alarm is raised when: Configured parameters such as XDLV mode / vectoring class / VCE profile parameters / auto-discovery of VP differs between XDLV systems. Alarm is cleared when: a) NoXdlv mode is configured. b) XDLV systems are configured with same VP parameters: XDLV mode, vectoring class, VCE profile parameters, VP auto-discovery. c) NTIO is plugged-out. d) NTIO QSFP is plugged-out. XDLV mode Master and Slave: Alarm is raised: 1. One of the MX is configured as Master and the connected peer MX is configured as Master/NoXdlv. 2. One of the MX is configured as Slave and the connected peer MX is configured as Slave/NoXdlv. Alarm is cleared when: 1. One of the MX is configured as Master and other is configured as Slave. 2. When NoXdlv mode is configured. 3. When NTIO is plugged-out/rebooted. 4. Either of the NTIO QSFPs are plugged-out i.e., one of the links is down. 5. XDLV mode configuration is appropriate.	XDLV mode 1DD and 2DD: a) Check the XDLV mode, vectoring-class, VCE profile parameters, VP auto-discovery configurations on each XDLV systems and change these VP parameters configuration appropriately for XDLV operation. b) If systems are not intended to work in XDLV operation, then configure as no-xdlv mode XDLV mode Master and Slave: Check configuration : One of the MX should be Master and the other should be configured as Slave. If it is not intended to work in XDLV mode, configure NoXdlv mode.
6	Comm	Min	N, Y, Y	vect-no-gain-at-init (long)12517382	VECTNOGAINATINIT 0x00BF0006	The alarm is raised when line is training in gain-during-showtime but vce-gain-mode is configured as gain-at-init. The alarm is cleared when gain-at-init mode is feasible (or) gain-during-showtime mode is configured.	Check total number of lines (active + joining) is below the allowed limit of (number of fdps lines / 2) + (number of non-fdps lines) is lower or equal than 500 when gain-at-init mode is configured.

(147 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
7	Comm	Maj	N, Y, Y	vect-xdlv-not-feasible (long)12517383	XDLVNOTFEASIBLE 0x00BF0007	XDLV not feasible failure alarm. XDLV mode 1DD and 2DD: This alarm is raised when any one of the following failure occurs: a) Invalid QSFP type SD (OR) b) QSFP Cross-Connect (OR) c) Cable length mismatch between QSFP-A and QSFP-B (OR) d) Mix of electrical and optical QSFPs. This alarm is cleared when: a) NoXdlv mode is configured (OR) b) External QSFPs are plugged out (OR) c) NTIO plugged out (OR) d) QSFPs are connected as per XDLV mode configuration, the QSFP cables are connected one-to-one with same type (optical or electrical), same length, and Double Density type. XDLV mode Master and Slave: This alarm is raised when any one of the following failure occurs: a) QSFP Cross-Connect. This alarm is cleared when: a) NoXdlv mode is configured (OR) b) External QSFPs are plugged out (OR) c) NTIO plugged out (OR) d) QSFPs are connected one to one.	Check whether QSFPs are connected correctly as per configured XDLV mode and no cross-connect. Check whether its valid QSFP type and length are same between QSFP-A and QSFP-B.
Alarm type: 192 Alarm type = MGMT Security Access (192) - Index1 = IpAddress of the Operator [Index 1 = 0 for LCT], Index2 =see specific alarm number.							

(148 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
1	Comm	Maj	N, Y, Y	login-successful (long)12582913	SECUMGTACCESS 0x00C00001	A user attempted successful login via Management Access. The Session Number will have the range of 1 13 for CLI and 0...17 for TL1 Note: This alarm shall be cleared automatically, when the same user logsoff from the same user session.Additional Info contains: Login/Logout Timestamp, OperatorName, Type. Index2 = Management Type [upper 16 bits: CLI (0), TL1 (1)] + Session Number [lower 16 bits Note: Management Type will have value 0 for CLI and value 1 for TL1. It means the upper 16 bits will represent value 0 for CLI and value 1 for TL1. Note 2: this alarm is only supported on netwerk elements with IHUB-based NT's and 7363 MX netwerk elements!	Generated due to successful login attempt via Management Access. Check for security measures.
2	Comm	Maj	N, Y, Y	login-failure	SECUMGTACCESSTCA 0x00C00002	Too many invalid attempts to login alarm via Management Access.The Session number Will have the range of [100 65535],This alarm will be reported after a certain period of its previous occurrence.Note: This alarm shall be cleared manually.Additional Info contains: Login Timestamp, OperatorName, Type, Session Number. Index2 = Session Number	Generated due to too many invalid attempts to login via Management Access. Check for security measures.
Alarm type: 193 Alarm type = SIP DialPlan (193) - Index1 = sipDialPlanId(index of sipDialPlanTable) , Index2=not used							
1	Proc	Crit	Y, Y, Y	bad-digitmap (long)12648449	SIPBADDM 0x00C10001	The configured digitmap is unusable.	Check the configured digitmap.
Alarm type: 194 Alarm type = SIP VSP(Voice Service Provider) (194) - Index1 = sipVSPId(index of sipVSPTable) , Index2=not used							

(149 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
2	Comm	Crit	Y, Y, Y	none-dns-srv (long)12713986	SIPNONEDNSSRV 0x00C20002	No dns server give reply though there is dns server configured Additional Info contains: Service Gatewayname on which alarm occurred, such as: vsp3	Check the configuration or connection of DNS servers in ISAM-V
3	Comm	Crit	Y, Y, Y	no-dns-srv (long)12713987	SIPNODNSSRV 0x00C20003	No DNS servers are configured when send a SIP request which need DNS server Additional Info contains: Service Gatewayname on which alarm occurred, such as: vsp3	Check the configuration of DNS servers in ISAM-V
4	Comm	Crit	Y, Y, Y	none-srv (long)12713988	SIPNONESRV 0x00C20004	ISAM-V found that no SIP first hops are actually give reply to SIP request even though there are servers configured Additional Info contains: Service Gatewayname on which alarm occurred, such as: vsp3	Check the configuration of SIP servers in ISAM-V
5	Comm	Crit	Y, Y, Y	no-srv (long)12713989	SIPNOSRV 0x00C20005	No SIP first hops are configured when send SIP request Additional Info contains: Service Gatewayname on which alarm occurred, such as: vsp3	Check the configuration of SIP servers in ISAM-V
6	Comm	Crit	Y, Y, Y	reg-srv-unreach (long)12713990	SRSRVUNRCH 0x00C20006	ISAM-V found that no register servers are actually give reply to SIP register even though there are register servers configured Additional Info contains: Service Gatewayname on which alarm occurred, such as: vsp3	Check configuration of the register servers of ISAM-V and those allowed to SIP servers ISAM-V should connected
7	Comm	Crit	Y, Y, Y	proxy-srv-unreach (long)12713991	SPSRVUNRCH 0x00C20007	ISAM-V found that no proxy servers are actually give reply to SIP request even though there are proxy servers configured Additional Info contains: Service Gatewayname on which alarm occurred, such as: vsp3	Check configuration of the proxy servers of ISAM-V and those allowed to SIP servers ISAM-V should connected

(150 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
9	Comm	Warn	Y, Y, Y	fo-trigger (long)12713993	FOTRIGGER 0x00C20009	ISAM-V/7363 found that Fail Over (SIP server level) happened. Additional Info contains: Service Gatewayname on which alarm occurred, such as: vsp3	The alarm inform the operator Fail-Over behavior happened. If FO finished, the alarm will be reset automatically.
10	QOS	Warn	Y, Y, Y	fb-trigger (long)12713994	FBTRIGGER 0x00C2000A	ISAM-V/7363 found that Fail Back (SIP server level) happened. Additional Info contains: Service Gatewayname on which alarm occurred, such as: vsp3	The alarm inform the operator Fial-Back behavior happened. If FB finished, the alarm will be reset automatically.
11	QOS	Warn	Y, Y, Y	du-trigger (long)12713995	DUTRIGGER 0x00C2000B	ISAM-V/7363 found that Deliberate Update (SIP server level) happened. Additional Info contains: Service Gatewayname on which alarm occurred, such as: vsp3	The alarm inform the operator Deliberate Update behavior happened. If DU finished, the alarm will be reset automatically.
12	Proc	Crit	Y, Y, Y	ssp-missing (long)12713996	SSPMISSING 0x00C2000C	The SIP Service profile in the configured SSP to Service Gateway association is not found in the activated CDE file. Additional Info contains: Service Gatewayname on which alarm occurred, such as: vsp3	The alarm shall be cleared upon the occurrence of one of the following cases: - the configured SSP to SG association is removed (the system autonomously assigns the SSP with lowest SSP ID to the SG) - a new CDE file is downloaded an activated that includes the configured SSP - the SSP to SG association is modified as to contain an SSP that is present in the activated CDE file.
13	Proc	Crit	Y, Y, Y	dns-pool-exceed (long)12713997	DNSPONBREXCEED 0x00C2000D	The number of different SG associated DNS pools is exceeding max 5. Additional Info contains: Service Gatewayname on which alarm occurred, such as: vsp3	The number of different SG associated DNS pools is exceeding max 5. How to repair: - To unify the DNS pools across all Service Gateways - To remove the configured DNS pool that caused the alarm and replace by manual IP configuration.
14	Comm	Maj	Y, Y, Y	lsa-fo-trigger (long)12713998	LSAFOTRIGGER 0x00C2000E	SIP voice service degraded - fail over to LSA server. Additional Info contains: Service Gatewayname on which alarm occurred, such as: vsp3.	Primary server has broken down, please check. This alarm is cleared when the last termination fail back to normal SIP server.

(151 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
Alarm type: 195 Alarm type = EPON PON TCA (195) - Index1 = eponPonConfigIfIndex (Index of PON), Index2 = See Specific Alarm.							
1	Comm	Maj	Y, Y, Y	eolt-txpwr-hi-alrm (long)12779521	OLTTXPWHI 0x00C30001	The Tx optical power is too high than the configured alarm high threshold.	Check Tx power and decrease singal level
2	Comm	Maj	Y, Y, Y	eolt-txpwr-lw-alrm (long)12779522	OLTTXPWLO 0x00C30002	The Tx optical power is tool low than the configured alarm low threshold.	Check Tx power and increase signal level
3	Equ	Maj	Y, Y, Y	eolt-txbias-hi-alrm (long)12779523	OLTTXBIASHI 0x00C30003	The Tx bias is too high than the configured alarm high threshold.	Check Tx bias and decrease Bias
4	Equ	Maj	Y, Y, Y	eolt-txbias-lw-alrm (long)12779524	OLTTXBIASLO 0x00C30004	The Tx bias is tool low than the configured alarm low threshold.	Check Tx bias and increase Bias
5	Equ	Maj	Y, Y, Y	eolt-volt-hi-alrm (long)12779525	OLTVOLHI 0x00C30005	The voltage is too high than the configured alarm high threshold.	Check voltage and decrease voltage
6	Equ	Maj	Y, Y, Y	eolt-volt-lw-alrm (long)12779526	OLTVOLLO 0x00C30006	The voltage is tool low than the configured alarm low threshold.	Check voltage and increase voltage
7	Equ	Maj	Y, Y, Y	eolt-temp-hi-alrm (long)12779527	OLTTEMPEHI 0x00C30007	The temperature is too high than the configured alarm high threshold.	Check temperature and decrease temperature
8	Equ	Maj	Y, Y, Y	eolt-temp-lw-alrm (long)12779528	OLTTEMPELO 0x00C30008	The temperature is tool low than the configured alarm low threshold.	Check temperature and increase temperature
9	Comm	Warn	N, Y, Y	eolt-txpwr-hi-warn (long)12779529	OLTTXPWHIWARN 0x00C30009	The Tx optical power is too high than the configured warning high threshold.	Check Tx power and decrease singal level
10	Comm	Warn	N, Y, Y	eolt-txpwr-lw-warn (long)12779530	OLTTXPWLOWARN 0x00C3000A	The Tx optical power is tool low than the configured warning low threshold.	Check Tx power and increase signal level
11	Equ	Warn	N, Y, Y	eolt-txbias-hi-warn (long)12779531	OLTTXBIASHIWARN 0x00C3000B	The Tx bias is too high than the configured warning high threshold.	Check Tx bias and decrease Bias
12	Equ	Warn	N, Y, Y	eolt-txbias-lw-warn (long)12779532	OLTTXBIASLOWARN 0x00C3000C	The Tx bias is tool low than the configured warning low threshold.	Check Tx bias and increase Bias
13	Equ	Warn	N, Y, Y	eolt-volt-hi-warn (long)12779533	OLTVOLHIWARN 0x00C3000D	The voltage is too high than the configured warning high threshold.	Check voltage and decrease voltage
14	Equ	Warn	N, Y, Y	eolt-volt-lw-warn (long)12779534	OLTVOLLOWARN 0x00C3000E	The voltage is too low than the configured warning low threshold.	Check voltage and increase voltage
15	Equ	Warn	N, Y, Y	eolt-temp-hi-warn (long)12779535	OLTTEMPEHIWARN 0x00C3000F	The temperature is too high than the configured warning high threshold.	Check temperature and decrease temperature

(152 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
16	Equ	Warn	N, Y, Y	eolt-temp-lw-warn (long)12779536	OLTTEMPELOWARN 0x00C30010	The temperature is too low than the configured warning low threshold.	Check temperature and increase temperature
17	Comm	Maj	Y, Y, Y	eolt-xfp-txpwr-hi-alrm (long)12779537	OLTEXTTXPWHI 0x00C30011	The Tx optical power is too high than the configured alarm high threshold of XFP.	Check 10G XFP Tx power and decrease singal level
18	Comm	Maj	Y, Y, Y	eolt-xfp-txpwr-lw-alrm (long)12779538	OLTEXTTXPWLO 0x00C30012	The Tx optical power is tool low than the configured alarm low threshold of XFP.	Check 10G XFP Tx power and increase signal level
19	Equ	Maj	Y, Y, Y	eolt-xfp-bias-hi-alrm (long)12779539	OLTEXTTXBIASHI 0x00C30013	The Tx bias is too high than the configured alarm high threshold of XFP.	Check 10G XFP Tx bias and decrease Bias
20	Equ	Maj	Y, Y, Y	eolt-xfp-bias-lw-alrm (long)12779540	OLTEXTTXBIASLO 0x00C30014	The Tx bias is tool low than the configured alarm low threshold of XFP.	Check 10G XFP Tx bias and increase Bias
21	Comm	Warn	N, Y, Y	eolt-xfp-txpwr-hi-warn (long)12779541	OLTEXTTXPWHIWARN 0x00C30015	The Tx optical power is too high than the configured warning high threshold of XFP.	Check 10G XFP Tx power and decrease singal level
22	Comm	Warn	N, Y, Y	eolt-xfp-txpwr-lw-warn (long)12779542	OLTEXTTXPWLOWARN 0x00C30016	The Tx optical power is tool low than the configured warning low threshold of XFP.	Check 10G XFP Tx power and increase signal level
23	Equ	Warn	N, Y, Y	eolt-xfp-bias-hi-warn (long)12779543	OLTEXTTXBIASHIWARN 0x00C30017	The Tx bias is too high than the configured warning high threshold of XFP.	Check 10G XFP Tx bias and decrease Bias
24	Equ	Warn	N, Y, Y	eolt-xfp-bias-lw-warn (long)12779544	OLTEXTTXBIASLOWARN 0x00C30018	The Tx bias is tool low than the configured warning low threshold of XFP.	Check 10G XFP Tx bias and increase Bias
Alarm type: 196 Alarm type = SIP Server (196) - Index1 = sipServerId(index of sipServerTable) , Index2=not used							
1	Comm	Crit	Y, Y, Y	transport-mismatch (long)12845057	SIPTRANSPORTMISMATCH 0x00C40001	Mismatch between the transport protocol(s) actually supported by ISAM-V and the transport protocol(s) to be used to access a SIP first hop.	Check configuration of the transport mode of ISAM-V and those allowed to SIP servers ISAM-V should connected.
2	Comm	Crit	Y, Y, Y	dns-lookup-failure (long)12845058	SIPDNSLOOKUPFAILURE 0x00C40002	DNS lookup failure	Check the configuration of DNS servers in ISAM-V
Alarm type: 197 Alarm type = IHUB BFD (197) - Index1=see specific alarm number, Index2 = see specific alarm number Additional Info layout: "IPInterfaceName,RemoteIpAddressType,RemoteIpAddress,LocalIpaddressType,LocalIpaddress,MaxResourceReason,MaxResourceValue,Protocol""vRtrId,vRtrIfIndex"							

(153 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
1	Comm	Maj	Y, Y, Y	bfd-session-down (long)12910593	BFDSESSIONDOWN 0x00C50001	The alarm is raised when BFD session goes down. Index1 : VPRN Service Identifier (svcId in the svcBaseInfoTable) or Base Router (value 0 indicates Base Router) Index2: unique identification for the alarm Additional Info Contains: IPInterfaceName,RemoteIpAddressType,RemoteIpAddress,LocalIpaddressType,LocalIpaddress,,,vRtrId,vRtrIfIndex The RemoteIpAddress refers to the BFD Session Remote Ip Address and the LocalIpAddress refers to the BFD Session Local Ip Address. RemoteIpAddressType and LocalIpaddressType can be either 1 or 2 for IPv4 or IPv6 respectively.	1. Bring the BFD session UP. 2. Delete the BFD session by disabling bfd-enable on the routing protocol(s). 3. Remove the session by disabling bfd on the interface using no bfd. 4. Shutdown the interface on which bfd is enabled. 5. Remove all the associated protocols on which bfd is enabled corresponding to that interface. 6. Shutdown the protocol/s for which bfd is enabled.
2	Comm	Maj	Y, Y, Y	bfd-max-resource (long)12910594	BFDMAXRESOURCE 0x00C50002	The alarm is raised when: Case 1: More than 95%of Max supported sessions reached Case 2: Tx / Rx rate exceeded above 95% of the maximum Index1=not used, Index2=not used Additional Info Contains: ,,,,,MaxResourceReason, MaxResourceValue, The MaxResourceReason will have values 0,1 or 2 for exceeding the 95% limits of max number of sessions, Tx rate and Rx rate as per mib definitions below: #define VAL_vRtrBfdMaxSessionReason_maxRxPacketRate 2 #define VAL_vRtrBfdMaxSessionReason_maxTxPacketRate 1 #define VAL_vRtrBfdMaxSessionReason_maxSessionsPerSlot 0 The MaxResourceValue will have the value of number of sessions, Tx rate or Rx rate depending on the MaxResourceReason.	1. Deletes sessions so that the number of sessions go below 90% of the maximum supported sessions. 2. Increases the receive / transmit interval in interface bfd configuration or deletes sessions so that the Tx / Rx rate goes below 90% of the maximum.

(154 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
3	Comm	Maj	Y, Y, Y	bfd-stale-entry (long)12910595	BFDSTALEENTRY 0x00C50003	The alarm is raised when an operator configures a BFD Session which fails due to following reasons: 1. crossing of 100% of BFD Max Resources 2. due to other/environment issues. Index1: VPRN Service Identifier (svcId in the svcBaseInfoTable) or Base Router (value 0 indicates Base Router) Index2: unique identification for the alarm Additional Info Contains: IPInterfaceName,RemoteIpAddressType,RemoteIpAddress,LocalIpaddressType,LocalIpaddress,,,Protocol vRtrId,vRtrIfIndex The RemoteIpAddress refers to the BFD Session Remote Ip Address and the LocalIpAddress refers to the BFD Session Local Ip Address. RemoteIpAddressType and LocalIpaddressType can be either 1 or 2 for IPv4 or IPv6 respectively. Protocol will have one of the below protocol values in string as defined in MIB: vRtrIfBfdSessionProtocols OBJECT-TYPE SYNTAX BITS { ospfv2 (0), pim (1), isis (2), staticRoute (3), mcRing (4), rsvp (5), bgp (6), vrrp (7), srrp (8), mcep (9), ldp (10), ipsecTunnel(11) } The strings used will be ospf2, pim, isis, static, mc-ring, rsvp, bgp, vrrp, srrp, mcep, ldp and ipsecTun respectively to align with the CLI display format.	Remove the bfd-enable configuration from the session for which this alarm is raised. The raised alarm can also be cleared by the following ways: For static route: 1. When the operator succeeds in configuring the BFD Session by deleting few BFD Sessions or by manipulating Tx / Rx rates and then recreating the failed session. 2. When the static route is disabled 3. When the interface is shutdown 4. When the interface goes operationally down For OSPF: 1. When the OSPF Neighbor state becomes not FULL or 2way. 2. When VPRN service or the OSPF protocol or the OSPF interface or the IP interface is shutdown or when the OSPF configuration is deleted. For ISIS: 1. When the ISIS state with the adjacency (isisISAdjState) becomes failed or down. 2. When the ISIS protocol or the ISIS interface or the ISIS interface for a level or the IP interface is shutdown or when the ISIS configuration is deleted. For PIM: 1. When the PIM Neighbor adjacency goes down 2. PIM interface is made admin down 3. PIM node is made admin down 4. Interface is removed For BGP: 1. When the BGP peer goes to an operational state other than Up. 2. When the VPRN service is shutdown or when the BGP protocol or BGP group or BGP peer is shutdown. For T-LDP: 1. When the TCP session goes down. 2. When the explicit configured peer is removed. 3. When the LDP instance is stopped or when the LDP configuration is deleted.

(155 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
							4. When the operational state of the SDP goes down 5. When the SDP is shutdown. 6. When the SDP binding is shutdown. 7. When the service is shutdown. For OSPF, ISIS, PIM, BGP: 1. These protocols have a retry mechanism to add the failed BFD sessions. Retry will happen for every 30 seconds interval. 2. When the operator deletes few BFD Sessions or by manipulating tx / rx rates and while retrying, existing failed session succeeds in configuring the new BFD Session.
Alarm type: 201 Alarm type = AI Platform(201) - Index1 = slot Index , Index2 = [unique nr of application * 65536]+virtual platform for which applies: The 'unique nr of application' = 0 for the AIPLATFFAIL alarm, and The 'slot Index'=0 and the 'virtual platform' = 0 for the AIINSTALLFAIL alarm when generated for the application, decoupled from any platform (i.e. the ISAM performed alarm correlation to all AI platforms). In addition the application name will be available for the AIINSTALLFAIL alarm in the 'additionalInfo' field.							
3	Proc	Maj	N, Y, Y	ip-assign-fail (long)13172739	AIPLATF_IPASSIGN_STATUS 0x00C90003	Ip pool is empty, new dhcp client can not get ip address.	No specific advise.
Alarm type: 202 Alarm type = CFM-IACM(202) For GPON, XGS-PON, XG-PON and NG-PON2 - Index1 = dot1agCfmMepIdentifier, Index2 = Unique number to identify combination of dot1agCfmMdIndex and dot1agCfmMaIndex							
1	Comm	Min	Y, Y, Y	cfm-defrdiccm (long)13238273	CFMDEFRDICCM 0x00CA0001	The last CCM received in this MA from some remote MEP contained the RDI bit. Additional Info contains: dot1agCfmMdIndex,dot1agCfmMaIndext,,dot1agCfmMepIfIndex	Check for MEPS in MA with the CCIEnabled flag. Check operational status of links needed for the CCM transmission towards peer
2	Comm	Min	Y, Y, Y	cfm-defmacstatus (long)13238274	CFMDEFMACSTATUS 0x00CA0002	The last CCM received in this MA from some remote MEP indicated that the transmitting MEP s associated MAC is reporting an error status via the Port Status TLV or Interface Status TLV. Additional Info contains: dot1agCfmMdIndex,dot1agCfmMaIndex,,dot1agCfmMepIfIndex.	Check for failed bridge or aggregated ports in the remote MEPs in the MA

(156 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
3	Comm	Maj	Y, Y, Y	cfm-defremoteccm (long)13238275	CFMDEFREMOTECCM 0x00CA0003	This MA is not receiving CCMs from some remote MEP in its configured list. Loss of continuity (LOC). Additional Info contains: dot1agCfmMdIndex,dot1agCfmMaIndex,,dot1agCfmMepIfIndex	Check CCM misconfigurations (peer MEP list), device failures, link failures
4	Comm	Maj	Y, Y, Y	cfm-deferrorccm (long)13238276	CFMDEFERRORCCM 0x00CA0004	This MA is receiving invalid CCMs. Additional Info contains: dot1agCfmMdIndex,dot1agCfmMaIndex,,dot1agCfmMepIfIndex	Check MA configuration: peer MEP list, MEPIDs, CCM transmission periods
5	Comm	Maj	Y, Y, Y	cfm-defxconccm (long)13238277	CFMDEFXCONCCM 0x00CA0005	This MA is receiving CCMs that could be from some other MA. Mismerge condition. Additional Info contains: dot1agCfmMdIndex,dot1agCfmMaIndex,,dot1agCfmMepIfIndex	Check MAID configuration. Check service configuration
6	Comm	Min	Y, Y, Y	cfm-defais (long)13238278	CFMDEFAIS 0x00CA0006	This MA is receiving AIS. Additional Info contains : dot1agCfmMdIndex, dot1agCfmMaIndex,,dot1agCfmMepIfIndex.	Remote MEP found in dot1agCfmMepDbTable, check device failures or physical links on that MEP.
Alarm type: 203 Alarm type = EFM-IACM(203) - Index1 = ifIndex of Ethernet like interface, Index2 = Used only by AMS. Indicates the type of the interface for which the alarm is reported. 1- XDSL 2- SHDSL 3-Ethernet 0-Unknown. This index2 is not reported in CLI/TL1							
1	Comm	Min	Y, Y, Y	efm-oam-cpelinkfault (long)13303809	CPELNKFAULT 0x00CB0001	The PHY of the CPE connected to the port with Index 1, has detected a receive fault.	Check the operational state of the port identified by Index 1.
2	Comm	Min	N, Y, Y	efm-oam-cpedyinggasp (long)13303810	CPEDYINGGASP 0x00CB0002	An unrecoverable failure condition has occurred at the CPE connected to the port with Index 1.	CPE is failing: CPE should be restarted or replaced.
3	Comm	Min	Y, Y, Y	efm-oam-cpecrevt (long)13303811	CPECREVT 0x00CB0003	An unspecified critical event has occurred at the CPE connected to the port with Index 1.	Check the operational state of the port identified by Index 1; restart CPE.
Alarm type: 204 Alarm type = ONT TR069SERV (204) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponTR069ServerUniIndex, Index2 = not used							

(157 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
1	Comm	Min	Y, Y, Y	ont-tr069-serv-mis (long)13369345	TR069MIS 0x00CC0001	A condition meaning that either the ONT did not accept the configuration requests for the provisioned TR069 management server	A condition meaning that either the ONT did not accept the configuration requests for the provisioned TR069 management server. Possible reasons are: 1. It is not supported by the ONT. 2. Some parameters are not proper Possible solutions are to restart ONT, restart LT, or to deprovision the TR069 management server since not supported.
Alarm type: 205 Alarm type = ONT SNMP (205) - For GPON Index1 = gponSnmpIpServiceUniIndex, Index2 = not used							
1	Comm	Min	Y, Y, Y	ont-snmp-mis (long)13434881	ONTSNMP_MIS 0x00CD0001	A condition meaning that either the ONT did not accept the configuration requests for the provisioned ONT SNMP agent.	A condition meaning that either the ONT did not accept the configuration requests for the provisioned ONT SNMP agent. Possible reasons are: 1. It is not supported by the ONT. 2. Some parameters are not proper Possible solutions are to restart ONT, restart LT, or to deprovision the ONT SNMP agent since not supported.
Alarm type: 206 Alarm type = RSSI TCA (206) - Index1 =sfpDiagLogicalSlot, Index2 = sfpDiagSfpFaceplateNumber							
1	Comm	Maj	Y, Y, Y	tx-power-high-alarm (long)13500417	NTNTIOTXPWHI 0x00CE0001	The Tx optical power is higher than the configured alarm high threshold.	Check Tx power and decrease singal level
2	Comm	Maj	Y, Y, Y	tx-power-low-alarm (long)13500418	NTNTIOTXPWLO 0x00CE0002	The Tx optical power is lower than the configured alarm low threshold.	Check Tx power and increase signal level
3	Comm	Maj	Y, Y, Y	rx-power-high-alarm (long)13500419	NTNTIORXPWHI 0x00CE0003	The Rx optical power is higher than the configured alarm high threshold. This alarm is used for NT/NTIO ports only.	Check Rx Optical signal power and decrease signal level.
4	Comm	Maj	Y, Y, Y	rx-power-low-alarm (long)13500420	NTNTIORXPWLO 0x00CE0004	The Rx optical power is lower than the configured alarm low threshold This alarm is used for NT/NTIO ports only.	Check Rx Optical signal power and increase signal level.

(158 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
5	Equ	Maj	Y, Y, Y	tx-biascur-high-alarm (long)13500421	NTNTIOTXBIASHI 0x00CE0005	The Tx bias Current is higher than the configured alarm high threshold.	Check Tx bias and decrease Bias
6	Equ	Maj	Y, Y, Y	tx-biascur-low-alarm (long)13500422	NTNTIOTXBIASLO 0x00CE0006	The Tx bias Current is lower than the configured alarm low threshold.	Check Tx bias and increase Bias
7	Equ	Maj	Y, Y, Y	volt-high-alarm (long)13500423	NTNTIOVOLHI 0x00CE0007	The voltage is higher than the configured alarm high threshold.	Check voltage and decrease voltage
8	Equ	Maj	Y, Y, Y	volt-low-alarm (long)13500424	NTNTIOVOLLO 0x00CE0008	The voltage is lower than the configured alarm low threshold.	Check voltage and increase voltage
9	Equ	Maj	Y, Y, Y	temp-high-alarm (long)13500425	NTNTIOTEMPHI 0x00CE0009	The temperature is higher than the configured alarm high threshold.	Check temperature and decrease temperature
10	Equ	Maj	Y, Y, Y	temp-low-alarm (long)13500426	NTNTIOTEMPLO 0x00CE000A	The temperature is lower than the configured alarm low threshold.	Check temperature and increase temperature
11	Comm	Warn	N, Y, Y	tx-power-high-warn (long)13500427	NTNTIOTXPWHIWARN 0x00CE000B	The Tx optical power is higher than the configured warning high threshold.	Check Tx power and decrease singal level
12	Comm	Warn	N, Y, Y	tx-power-low-warn (long)13500428	NTNTIOTXPWLOWARN 0x00CE000C	The Tx optical power is lower than the configured warning low threshold.	Check Tx power and increase signal level
13	Comm	Warn	N, Y, Y	rx-power-high-warn (long)13500429	NTNTIORXPWHIWARN 0x00CE000D	The Rx optical power is higher than the configured warning high threshold.This alarm is used for NT/NTIO ports only.	Check Rx Optical signal power and decrease signal level.
14	Comm	Warn	N, Y, Y	rx-power-low-warn (long)13500430	NTNTIORXPWLOWARN 0x00CE000E	The Rx optical power is lower than the configured warning low threshold.This alarm is used for NT/NTIO ports only.	Check Rx Optical signal power and increase signal level.
15	Equ	Warn	N, Y, Y	tx-biascur-high-warn (long)13500431	NTNTIOTXBIASHIWARN 0x00CE000F	The Tx bias Current is higher than the configured warning high threshold.	Check Tx bias and decrease Bias
16	Equ	Warn	N, Y, Y	tx-biascur-low-warn (long)13500432	NTNTIOTXBIASLOWARN 0x00CE0010	The Tx bias Current is lower than the configured warning low threshold.	Check Tx bias and increase Bias
17	Equ	Warn	N, Y, Y	volt-high-warn (long)13500433	NTNTIOVOLHIWARN 0x00CE0011	The voltage is higher than the configured warning high threshold.	Check voltage and decrease voltage
18	Equ	Warn	N, Y, Y	volt-low-warn (long)13500434	NTNTIOVOLLOWARN 0x00CE0012	The voltage is lower than the configured warning low threshold.	Check voltage and increase voltage

(159 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
19	Equ	Warn	N, Y, Y	temp-high-warn (long)13500435	NTNTIOTEMPEHIWARN 0x00CE0013	The temperature is higher than the configured warning high threshold.	Check temperature and decrease temperature
20	Equ	Warn	N, Y, Y	temp-low-warn (long)13500436	NTNTIOTEMPELOWWARN 0x00CE0014	The temperature is lower than the configured warning low threshold.	Check temperature and increase temperature
Alarm type: 207 Alarm type = Bulk Sync (207) - For GPON and XGS-PON dual-rate Index1 = IfIndex of PON or Channel Pair, Index2 = not used							
1	Equ	Min	Y, Y, Y	bsf-dhcpv4 (long)13565953	BSFDHCPV4 0x00CF0001	The bulk synchronization for application DHCPv4 failed	-
2	Equ	Min	Y, Y, Y	bsf-dhcpv6 (long)13565954	BSFDHCPV6 0x00CF0002	The bulk synchronization for application DHCPv6 failed	-
3	Equ	Min	Y, Y, Y	bsf-pon (long)13565955	BSFPON 0x00CF0003	The bulk synchronization for application PON failed	-
4	Equ	Min	Y, Y, Y	bsf-vbridge (long)13565956	BSFVBRIDGE 0x00CF0004	The bulk synchronization for application VLAN Bridge Management failed	-
5	Equ	Min	Y, Y, Y	bsf-qos (long)13565957	BSFQOS 0x00CF0005	The bulk synchronization for application QOS failed	-
6	Equ	Min	Y, Y, Y	bsf-igmp (long)13565958	BSFIGMP 0x00CF0006	The bulk synchronization for application IGMP failed (applicable from 4.4.01 onwards)	-
7	Equ	Min	Y, Y, Y	bsf-lxfwd (long)13565959	BSFLXFWD 0x00CF0007	The bulk synchronization for application LXFWD failed.	-
Alarm type: 208 Alarm type = Protection Group (208) - For GPON, XG-PON1 and XGS-PON dual-rate Index1 = IfIndex of PON or Channel Pair, Index2 = not used							
1	Equ	Maj	N, Y, Y	prot-not-available (long)13631489	PROTNOTAVAIL 0x00D00001	There is no protection available within the Protection Group	Check availability of protection equipment
2	Equ	Crit	Y, Y, Y	prot-switchover-fail (long)13631490	PROTSWFAIL 0x00D00002	Switchover to standby PON failed	
Alarm type: 209 Alarm type = 2E1/DS1 SFP Framer Alarm (209) - Index1 = LogicalSlot , Index 2 : TributaryId [upper 16 bits: Trib1(0), Trib2(1)]+ SfpFaceplateNumber [lower 16 bits].							

(160 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
1	Comm	Maj	Y, Y, Y	dsx1-rei-from-liu (long)13697025	DSX1_REI_LIU 0x00D10001	Remote Error Indication alarm from LIU	1. Determine whether problem is due to physical interface cabling. REI is the result of the far end E1/DS1 equipment detecting a problem with its receive signal and indicating a remote alarm indication back. 2. If no physical cabling problem exists, check far-end E1/DS1 equipment for alarms and resolve.
2	Comm	Maj	Y, Y, Y	dsx1-rdi-from-liu (long)13697026	DSX1_RDI_LIU 0x00D10002	Remote Defect Alarm from LIU	1. Determine whether problem is due to physical interface cabling. RDI is the result of the far end E1/DS1 equipment detecting a problem with its receive signal and indicating a remote alarm indication back. 2. If no physical cabling problem exists, check far
3	Comm	Min	N, Y, Y	dsx1-crc6-from-liu (long)13697027	DSX1_CRC6_LIU 0x00D10003	Cylic Redundancy check-6 alarm from LIU	1. Determine whether there are problems in the network that could cause bit-errors. 2. Verify if the far-end DS1 equipment is using CRC-6 in the frame.
4	Comm	Min	N, Y, Y	dsx1-crc4-from-liu (long)13697028	DSX1_CRC4_LIU 0x00D10004	Cylic Redundancy check-4 alarm from LIU	1. Determine whether there are problems in the network (E1-side) that could cause bit-errors. 2. Verify if the far-end E1 equipment is using CRC-4 in the frame.
5	Comm	Min	N, Y, Y	dsx1-crc4-th-from-liu (long)13697029	DSX1_CRC4_TLIU 0x00D10005	Cylic Redundancy check-4 threshold alarm from LIU	1. Determine whether there are problems in the network (E1-side) that could cause bit-errors. 2. Verify if the far-end E1 equipment is using CRC-4 in the frame.

(161 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
6	Comm	Maj	Y, Y, Y	dsx1-ais-from-liu (long)13697030	DSX1_AIS_LIU 0x00D10006	Alarm Indication Signal alarm from LIU	1. Determine whether problem is due to E1/DS1 network/equipment problem or misprovisioning. AIS represents a failure upstream in the network where AIS is inserted downstream toward the downstream equipment to indicate that a failure exists upstream. 2. If no E1/DS1 network/equipment problem, check E1/DS1 provisioning on the far-end for valid traffic path configuration.
7	Comm	Maj	Y, Y, Y	dsx1-los-from-liu (long)13697031	DSX1_LOS_LIU 0x00D10007	Loss of signal alarm from LIU	1. Determine whether problem is due to physical interface cabling or due to actual failure of signal from far end E1/DS1 equipment. 2. If no physical cabling problem exists, check far-end E1/DS1 transmit capabilities or verify the far-end equipment is not out-of-service.
8	Comm	Maj	Y, Y, Y	dsx1-lof-from-liu (long)13697032	DSX1_LOF_LIU 0x00D10008	Loss of framing alarm from LIU	1. Determine whether problem is due to physical interface cabling, misprovisioning, or signal from far end E1/DS1 equipment. 2. If no physical cabling problem exists, check for misprovisioning of framing format between equipment. Also check far-end E1/DS1 transmit capabilities.
9	Comm	Maj	Y, Y, Y	dsx1-lomf-from-liu (long)13697033	DSX1_LOMF_LIU 0x00D10009	Loss of Multi-frame alarm from LIU	1. Determine whether problem is due to physical interface cabling, misprovisioning, or signal from far end E1/DS1 equipment. 2. If no physical cabling problem exists, check for misprovisioning of framing format between equipment. Also check far-end E1/DS1 transmit capabilities.

(162 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
10	Comm	Maj	Y, Y, Y	dsx1-rei-from-iwf (long)13697034	DSX1_REI_IWF 0x00D1000A	Remote Error Indication alarm from IWF	1. Determine whether problem is due to physical interface cabling. REI is the result of the far end E1/DS1 equipment (EMAN side) detecting a problem with its receive signal and indicating a remote alarm indication back. 2. If no physical cabling problem exists, check far-end E1/DS1 equipment for alarms and resolve.
11	Comm	Maj	Y, Y, Y	dsx1-rdi-from-iwf (long)13697035	DSX1_RDI_IWF 0x00D1000B	Remote Defect Alarm from IWF	1. Determine whether problem is due to physical interface cabling. RDI is the result of the far end E1/DS1 equipment (EMAN side) detecting a problem with its receive signal and indicating a remote alarm indication back. 2. If no physical cabling problem exists, check far-end E1/DS1 equipment for alarms and resolve.
12	Comm	Min	N, Y, Y	dsx1-crc6-from-iwf (long)13697036	DSX1_CRC6_IWF 0x00D1000C	Cylic Redundancy check-6 alarm from IWF	1. Determine whether there are problems in the network (EMAN) that could cause bit-errors. 2. Verify if the far-end equipment is using CRC-6in the frame.
13	Comm	Min	N, Y, Y	dsx1-crc4-from-iwf (long)13697037	DSX1_CRC4_IWF 0x00D1000D	Cylic Redundancy check-4 alarm from IWF	1. Determine whether there are problems in the network (EMAN) that could cause bit-errors. 2. Verify if the far-end equipment is using CRC-4 in the frame.
14	Comm	Min	N, Y, Y	dsx1-crc4-th-from-iwf (long)13697038	DSX1_CRC4_TIWF 0x00D1000E	Redundancy check-4 threshold alarm from IWF	1. Determine whether there are problems in the network (EMAN) that could cause bit-errors. 2. Verify if the far-end equipment is using CRC-4 in the frame.

(163 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
15	Comm	Maj	Y, Y, Y	dsx1-ais-from-iwf (long)13697039	DSX1_AIS_IWF 0x00D1000F	Alarm Indication Signal alarm from IWF	1. Determine whether problem is due to E1/DS1 network/equipment problem or misprovisioning. AIS represents a failure upstream in the network where AIS is inserted downstream toward the downstream equipment to indicate that a failure exists upstream. 2. If no E1/DS1 network/equipment problem, check E1/DS1 provisioning on the far-end for valid traffic path configuration..
16	Comm	Maj	Y, Y, Y	dsx1-los-from-iwf (long)13697040	DSX1_LOS_IWF 0x00D10010	Loss of signal alarm from IWF	1. Determine whether problem is due to physical interface cabling, misprovisioning, or signal from far end DS1 equipment. 2. If no physical cabling problem exists, check for misprovisioning of framing format between equipment. Also check far-end DS1 transmit capabilities.
17	Comm	Maj	Y, Y, Y	dsx1-lof-from-iwf (long)13697041	DSX1_LOF_IWF 0x00D10011	Loss of framing alarm from IWF	1. Determine the raisone for packet-loss on the CES pseudowire. Has there been an outage of a network element ? 2. Verify if the far-end device (EMAN side) is still operational and sending CES frames.
18	Comm	Maj	Y, Y, Y	dsx1-lomf-from-iwf (long)13697042	DSX1_LOMF_IWF 0x00D10012	Loss of Multi-frame alarm from IWF	1. Determine whether problem is due to physical interface cabling, misprovisioning, or signal from far end E1/DS1 equipment (EMAN side). 2. If no physical cabling problem exists, check for misprovisioning of framing format between equipment. Also check far-end E1/DS1 transmit capabilities..
Alarm type: 210 Alarm type =2E1/DS1 SFP CLOCK Alarm (210)) - Index1 = LogicalSlot, Index2 = sfpFacePlateNumber							
1	Comm	Maj	Y, Y, Y	dsx1-serdes-fail (long)13762561	DSX1_SERDES_FAIL 0x00D20001	SERDES clock alarm failure	1. Check clock source configuration, 2. Verify if SERDES clock is traceable to a reliable clock (PRC)

(164 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
2	Comm	Maj	Y, Y, Y	dsx1-tributary1-fail (long)13762562	DSX1_TRIB1_FAIL 0x00D20002	Failure alarm: The tributary 1 clock is not present	Check Clock Source configurations
3	Comm	Maj	Y, Y, Y	dsx1-tributary2-fail (long)13762563	DSX1_TRIB2_FAIL 0x00D20003	Failure alarm: The tributary 2 clock is not present	Check Clock Source configurations
4	Comm	Maj	Y, Y, Y	dsx1-los-fail (long)13762564	DSX1_LOS_FAIL 0x00D20004	Sync fail alarm: All the selected tribs in Loss of Signal	1. Determine whether problem is due to physical interface cabling or due to actual failure of signal from far end DS1 equipment. 2. If no physical cabling problem exists, check far-end DS1/E1 transmit capabilities.
5	Comm	Maj	Y, Y, Y	dsx1-ais-sync (long)13762565	DSX1_AIS_SYNC 0x00D20005	Sync fail alarm: Alarm Indication signal on the tributary selected as sync source	1. Determine whether problem is due to E1/DS1 network/equipment problem or misprovisioning. AIS represents a failure upstream in the network where AIS is inserted downstream toward the downstream equipment to indicate that a failure exists upstream. 2. If no E1/DS1 network/equipment problem, check E1/DS1 provisioning on the far-end for valid traffic path configuration.
6	Comm	Maj	Y, Y, Y	dsx1-lof-sync (long)13762566	DSX1_LOF_SYNC 0x00D20006	Sync fail alarm: Loss of Framing on the tributary selected as sync source	1. Determine whether problem is due to physical interface cabling, misprovisioning, or signal from far end E1/DS1 equipment. 2. If no physical cabling problem exists, check for misprovisioning of framing format between equipment. Also check far-end E1/DS1 transmit capabilities.
7	Comm	Maj	Y, Y, Y	dsx1-los-sync (long)13762567	DSX1_LOS_SYNC 0x00D20007	Sync fail alarm: Loss of signal on the tributary selected as sync source	1. Determine whether problem is due to physical interface cabling or due to actual failure of signal from far end E1/DS1 equipment. 2. If no physical cabling problem exists, check far-end E1/DS1 transmit capabilities or verify the far-end equipment is not out-of-service.

(165 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
8	Comm	Maj	Y, Y, Y	dsx1-deg-fail (long)13762568	DSX1_DEG_FAIL 0x00D20008	Signal degrade Alarm	Check clock source configuration and determine whether problem is due to physical interface cabling or due to actual failure of signal from far end DS1/E1 equipment or due to a failure in the signal from a PRC traceable clock.
Alarm type: 211 Alarm type = PppCcEngineTca (211)) - Index1 = pppCcEngineIndex, Index2 =not used							
1	Comm	Min	Y, Y, Y	pppce-trans-15min-tca (long)13828097	PPPCC_TRANS15MINTCA 0x00D30001	Alarm is generated when the configure threshold for the number of events where a PPP CC,session cannot be established within the engine because of transaction time out in a 15 minutes interval is crossed	Check BRAS reachabilty
2	Comm	Min	Y, Y, Y	pppce-sess-15min-tca (long)13828098	PPPCC_SESS15MINTCA 0x00D30002	Alarm is generated when the configure threshold for the number of events where a PPP CC session is disconnected within the engine because of inactive session in a 15 minutes interval is crossed.	Check DSL stability and BRAS reachability
3	Comm	Min	Y, Y, Y	pppce-trans-1day-tca (long)13828099	PPPCC_TRANS1DAYTCA 0x00D30003	Alarm is generated when the configure threshold for the number of events where a PPP CC,session cannot be established within the engine because of transaction time out in a 1 Day interval is crossed	Check BRAS reachabilty
4	Comm	Min	Y, Y, Y	pppce-sess-1day-tca (long)13828100	PPPCC_SESS1DAYTCA 0x00D30004	Alarm is generated when the configure threshold for the number of events where a PPP CC session is disconnected within the engine because of inactive session in a 1 Day interval is crossed.	Check DSL stability and BRAS reachability
Alarm type: 212 Alarm type = IHUB ETHCFM(212) - Index1 = Mep identifier (i.e dot1agCfmMepIdentifier from dot1agCfmMepTable), Index2=unique identifier, Additional Info layout: "Maintenance Domain Index, Maintenance Association Index" Note: CCM Defect will be reported only if the defect prio is equal to or higher than configured low-priority-defect (i.e "dot1agCfmMepLowPrDef").							

(166 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
1	Comm	Min	Y, Y, Y	eth-cfm-defrdiccm (long)13893633	RDICCM 0x00D40001	The alarm is raised when the last CCM received in this MA from some remote MEP contains the RDI bit. The alarm is cleared . When a CCM frame is received from a remote MEP with RDI bit clear. . When eth-cfm is shutdown on local MEP. . When low-priority-defect is configured as greater than this defect. Index1=MEPID, Index2=Unique Identifier Additional Info contains: Domain index, Association index.	Check for MEPS in MA the CCIEnabled flag. Check operational status of links needed for the CCM transmission towards peer.
2	Comm	Min	Y, Y, Y	eth-cfm-defmacstatus (long)13893634	SOMEMACSTATUS CCM 0x00D40002	The alarm is raised when the last CCM received in this MA from some remote MEP indicated that the transmitting MEP's associated MAC is reporting an error status via the port status TLV or interface status TLV. The alarm is cleared . When a CCM frame is received from the remote MEP with reporting problem is cleared. . When eth-cfm is shutdown on local MEP. . When low-priority-defect is configured as greater than this defect. Index1=MEPID, Index2=Unique Identifier Additional Info contains: Domain index, Association index.	Remote MEP found in dot1agCfmMepDbTable, check operational status of physical links on that MEP.

(167 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
3	Comm	Maj	Y, Y, Y	eth-cfm-defremoteccm (long)13893635	SOMERMEPCCM 0x00D40003	The alarm is raised when this MAC address is not receiving CCMs from some remote MEP in its configured list. Loss of continuity (LOC). The alarm is cleared . When a valid CCM frame is received from the remote MEP. . When remote MEP is removed. . When eth-cfm is shutdown on local MEP. . When low-priority-defect is configured as greater than this defect. Index1=MEPID, Index2=Unique Identifier Additional Info contains: Domain index, Association index.	Restore CCM misconfigurations (peer MEP list), device failures, link failures. Check for admin status of the ccm from peer MEP.
4	Comm	Maj	Y, Y, Y	eth-cfm-deferrorccm (long)13893636	ERRORCCM 0x00D40004	The alarm is raised when the system receives at least one invalid CCM from remote mep whose CCM Interval has not yet timed out. The alarm is cleared . When the defect condition no longer holds for an interval which equal to 3.5 times the remote MEP's last CCM interval. . When eth-cfm is shutdown on local MEP. . When low-priority-defect is configured as greater than this defect. Index1=MEPID, Index2=Unique Identifier Additional Info contains: Domain index, Association index.	Check MA configuration: peer MEP list, MEPIDs, CCM interval etc to see if there is any mis-configuration or mis-match between MEP peers.

(168 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
5	Comm	Maj	Y, Y, Y	eth-cfm-defxconccm (long)13893637	XCONCCM 0x00D40005	The alarm is raised when the system receives at least one CCM from either another MAID or a lower MD Level or unsupported MD format whose CCM Interval has not yet timed out. The alarm is cleared . When the defect condition no longer holds for an interval which equal to 3.5 times the remote MEP's last CCM interval. . When eth-cfm is shutdown on local MEP. . When low-priority-defect is configured as greater than this defect. Index1=MEPID, Index2=Unique Identifier Additional Info contains: Domain index, Association index.	Check MAID configuration. Check service configuration.
Alarm type: 213 Alarm type = ONT Diagnostics (213) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = ifIndex of ONT, Index2 = See Specific Alarm.							
1	Comm	Maj	Y, Y, Y	ont-loopdetect (long)13959169	GPON_ONT_LOOPDETECT 0x00D50001	Port loop happened at ONT side index2=logical number of ONT LAN port	Chenk ONT LAN link and figure out which ports are looped
Alarm type: 216 Alarm type = IHUB RSVP (216) - Index1 = Base Router (value 0 indicates Base Router), Index2 = see specific alarm number							

(169 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
1	Comm	Min	N, Y, Y	rsvp-neighbor-down (long)14155777	RSVPNEIGHBORDOWN 0x00D80001	The alarm is raised when the RSVP Neighbor state changes to inactive. (Ie., When the particular neighbor hello-timeout happens.) The alarm is cleared when . RSVP Neighbor state changes to active . IP interface is shutdown . RSVP interface is shutdown . RSVP instance is shutdown Otherwise it needs manual clearing by the operator. Index2 = Neighbor Index (non zero value in which the Virtual Index can not overlap between alarms; to be used as Index2 when manually clearing the alarm) Additional Info contains: IPInterfaceName, Neighbor-Address vRtrRsvpIfVRtrIfIndex Note: May require MANUAL clearing.	Check the peer configuration and operational status. Check if the peer is part of lsp path (which is active)
2	Comm	Crit	Y, Y, Y	rsvp-neighbor-down (long)14155778	RSVPDOWN 0x00D80002	The alarm is raised when the RSVP protocol Instance goes down. The alarm is cleared when . RSVP protocol is restarted . RSVP instance is shutdown Index2 = 0 Additional Info contains: empty string.	Check MPLS admin status Check RSVP/MPLS configuration Check memory usage for RSVP/MPLS
Alarm type: 217 Alarm type = Alarm Table(217) - Index1 = not used, Index2 = not used.							
1	Comm	Crit	N, Y, Y	alrm-tbl-overflow (long)14221313	ALRMTBLOVERFLOW 0x00D90001	Alarm is raised when the internal alarm table has overflowed. If the alarm table is full, newly raised higher severity alarms will push out lower severity alarms from the table. To minimize the chance to be pushed out, the severity for this alarm is set to critical The alarm is cleared when sufficient free entries.	Change the alarm severity to ignore for alarms of no interest.
Alarm type: 218 Alarm type = IHUB TCA (218) - Index1 = Ethernet Port (tmnxPortPortID in the tmnxPortTable), Index2 = not used							

(170 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
1	Comm	Maj	N, Y, Y	tca-outputbw (long)14286849	TCA_OUTPUTBW 0x00DA0001	The alarm is raised when the average output bandwidth on an uplink port since the beginning of the current 15 minute interval crosses the configured threshold (%) for N 15-min intervals(Where N is the configured tca-interval and can have a value of max 32). The Alarm is cleared when in the previous 32 valid intervals the number of times the threshold exceeded is less than TCA interval (N). For the alarm to get cleared there must be 32 valid intervals for which the PM history exists. During startup it will take minimum 32 intervals for the alarm to get cleared.	Check the port's bandwidth usage
2	Comm	Maj	N, Y, Y	tca-inputbw (long)14286850	TCA_INPUTBW 0x00DA0002	The alarm is raised when the average input bandwidth on an uplink port since the beginning of the current 15 minute interval crosses the configured threshold (%) for 'N' 15-min intervals(Where N is the configured tca-interval and can have a value of max 32). The Alarm is cleared when in the previous 32 valid intervals the number of times the threshold exceeded is less than 'TCA interval (N)'. For the alarm to get cleared there must be 32 valid intervals for which the PM history exists. During startup it will take minimum 32 intervals for the alarm to get cleared.	Check the port's bandwidth usage

(171 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
3	Comm	Maj	N, Y, Y	tca-rxcrcalign (long)14286851	TCA_RXCRCALIGN 0x00DA0003	The alarm is raised when the received crc align errors on an uplink port since the beginning of the current 15 minute interval crosses the configured threshold (%) for 'N' 15-min intervals(Where N is the configured tca-interval and can have a value of max 32). The Alarm is cleared when in the previous 32 valid intervals the number of times the threshold exceeded is less than 'TCA interval (N)'. For the alarm to get cleared there must be 32 valid intervals for which the PM history exists. During startup it will take minimum 32 intervals for the alarm to get cleared.	Check the port's physical connections
4	Comm	Maj	N, Y, Y	tca-txcrcalign (long)14286852	TCA_TXCRCALIGN 0x00DA0004	The alarm is raised when the transmitted crc align errors on an uplink port since the beginning of the current 15 minute interval crosses the configured threshold (%) for 'N' 15-min intervals(Where N is the configured tca-interval and can have a value of max 32). The Alarm is cleared when in the previous 32 valid intervals the number of times the threshold exceeded is less than 'TCA interval (N)'. For the alarm to get cleared there must be 32 valid intervals for which the PM history exists. During startup it will take minimum 32 intervals for the alarm to get cleared.	Check the port's physical connections

(172 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
5	Comm	Maj	N, Y, Y	tca-txcollisions (long)14286853	TCA_TXCOLLISIONS 0x00DA0005	The alarm is raised when the transmitted collision errors on an uplink port since the beginning of the current 15 minute interval crosses the configured threshold (%) for 'N' 15-min intervals(Where N is the configured tca-interval and can have a value of max 32). The Alarm is cleared when in the previous 32 valid intervals the number of times the threshold exceeded is less than 'TCA interval (N)'. For the alarm to get cleared there must be 32 valid intervals for which the PM history exists. During startup it will take minimum 32 intervals for the alarm to get cleared.	Check the port's physical connections
6	Comm	Maj	N, Y, Y	tca-outputhighbw (long)14286854	TCA_OUTPUTBW_HIGH 0x00DA0006	The alarm is raised when the average output bandwidth on a LT port since the beginning of the current 15 minute interval crosses the configured high threshold for 'N' 15-min intervals (where N is the configured tca-interval and can have a value of max 32). Alarm additional info will be shown in alarm table. The additional info format looks 'lt physical slot 'slot number''. The Alarm is cleared when in the 'N' valid intervals the number of times the threshold exceeded is less than TCA interval (N).	Check the LT port's high bandwidth output usage.

(173 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
7	Comm	Maj	N, Y, Y	tca-outputmedbw (long)14286855	TCA_OUTPUTBW_MEDIUM 0x00DA0007	The alarm is raised when the average output bandwidth on an LT port since the beginning of the current 15 minute interval crosses the configured medium threshold for 'N' 15-min intervals (where N is the configured tca-interval and can have a value of max 32). Alarm additional info will be shown in alarm table. The additional info format looks 'lt physical slot 'slot number''. The Alarm is cleared when in the 'N' valid intervals the number of times the threshold exceeded is less than TCA interval (N).	Check the LT port's medium bandwidth output usage.
8	Comm	Maj	N, Y, Y	tca-outputlowbw (long)14286856	TCA_OUTPUTBW_LOW 0x00DA0008	The alarm is raised when the average output bandwidth on an LT port since the beginning of the current 15 minute interval crosses the configured low threshold for 'N' 15-min intervals (where N is the configured tca-interval and can have a value of max 32). Alarm additional info will be shown in alarm table. The additional info format looks 'lt physical slot 'slot number''. The Alarm is cleared when in the 'N' valid intervals the number of times the threshold exceeded is less than TCA interval (N).	Check the LT port's low bandwidth output usage.

(174 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
9	Comm	Maj	N, Y, Y	tca-inputhighbw (long)14286857	TCA_INPUTBW_HIGH 0x00DA0009	The alarm is raised when the average input bandwidth on an LT port since the beginning of the current 15 minute interval crosses the configured high threshold for 'N' 15-min intervals (where N is the configured tca-interval and can have a value of max 32). Alarm additional info will be shown in alarm table. The additional info format looks 'lt physical slot 'slot number''. The Alarm is cleared when in the 'N' valid intervals the number of times the threshold exceeded is less than TCA interval (N).	Check the LT port's high bandwidth input usage.
10	Comm	Maj	N, Y, Y	tca-inputmediumbw (long)14286858	TCA_INPUTBW_MEDIUM 0x00DA000A	The alarm is raised when the average input bandwidth on an LT port since the beginning of the current 15 minute interval crosses the configured medium threshold for 'N' 15-min intervals (where N is the configured tca-interval and can have a value of max 32). Alarm additional info will be shown in alarm table. The additional info format looks 'lt physical slot 'slot number''. The Alarm is cleared when in the 'N' valid intervals the number of times the threshold exceeded is less than TCA interval (N).	Check the LT port's medium bandwidth input usage.

(175 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
11	Comm	Maj	N, Y, Y	tca-inputlowbw (long)14286859	TCA_INPUTBW_LOW 0x00DA000B	The alarm is raised when the average input bandwidth on an LT port since the beginning of the current 15 minute interval crosses the configured low threshold for 'N' 15-min intervals (where N is the configured tca-interval and can have a value of max 32). Alarm additional info will be shown in alarm table. The additional info format looks 'lt physical slot 'slot number''. The Alarm is cleared when in the 'N' valid intervals the number of times the threshold exceeded is less than TCA interval (N).	Check the LT port's low bandwidth input usage.
Alarm type: 219 Alarm type = SFU ONT General Supplemental (219) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponOntEquipIfIndex (IfIndex of ONT), Index2 = not used.							
1	Equ	Min	N, Y, Y	sfu-sup-sw-file-error (long)14352385	SWDLFILE_SFU 0x00DB0001	Download of software to ONT has failed because the image file is missing or has an error.	1. Ensure that planned ONT software version is physically present on the OLT. 2. Retry the download again. 3. Reload the ONT image on the OLT. Call Nokia customer service.
2	Equ	Maj	N, Y, Y	sfu-sup-fan-failure (long)14352386	FANALM_SFU 0x00DB0002	Fan Failure at the ONT/ONU	1. Check Fan 2. Check Ambient Temperature
3	Equ	Maj	N, Y, Y	sfu-sup-temp-high-warn (long)14352387	HITEMPWARN_SFU 0x00DB0003	Abnormally high temperature at the ONT/ONU	1. Check Fan 2. Check Ambient Temperature
4	Equ	Maj	Y, Y, Y	sfu-sup-temp-shutoff (long)14352388	HITEMPSHUTOFF_SFU 0x00DB0004	Services disabled to prevent ONT/ONU HW damage due to excessively high temperature.	1. Check Fan 2. Check Ambient Temperature
5	Comm	Min	N, Y, Y	sfu-sup-emergency-call (long)14352389	ECALLACT_SFU 0x00DB0005	Emergency Call active on ONT.	Indication that an emergency phone call is active. Wait for the call to terminate. Note: During an emergency call, no upgrade or modification to the system should be performed which could cause call termination.

(176 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
7	Equ	Min	N, Y, Y	sfu-sup-swverctrl-err (long)14352391	SWVERCTLERR_SFU 0x00DB0007	ONT Software version control error. Occurs when no ONT software match found in ONT SW version control table. Note: Only valid when ENT-ONT PLANVER or DLVER is provisioned as AUTO .	A condition meaning no ONT software match found in ONT SW version control table. Note: Only valid when either ENT-ONT PLANVER or DLVER is provisioned as AUTO. Possible reasons for alarm are: 1. If PLANVER attribute on ONT is AUTO, check ACTHWVER/PLANSWVAR for match of provisioned AUTOHWVER/AUTOSWVAR values in the ONT SW version control table. 2. If DLVER attribute on ONT is AUTO , check ACTHWVER/PLANSWVAR for match of provisioned AUTOHWVER/AUTOSWVAR values in the ONT SW version control table. If no match exists in ONT SW version control table, either update PLANSWVAR and/or add a new entry to the ONT SW version control table in a manner that causes the AUTO setting to have a match. Otherwise disable feature by changing PLANVER and DLVER to not be AUTO.
8	Equ	Crit	N, Y, Y	sfu-sup-poe-exceed-max (long)14352392	POE_EXCEED_SFU 0x00DB0008	Configured PoE feeding exceed the maximum output power of ONU	Adjust the feeding of each configured port to fit the ONT output
9	Comm	Maj	Y, Y, Y	sfu-sup-cfg-dnld-fail (long)14352393	CFGDLDFAIL_SFU 0x00DB0009	Download of voice xml file to ONT failed (For OMCI download method)	1. Ensure the voice configuration file is physically present on the OLT. If not, ensure the voice configuration file is on the ftp server and the ftp server is available. 2. Ensure the OMCI between OLT and ONT is ok 3. Retry the download again.
10	Equ	Min	N, Y, Y	sfu-sup-rssi-cfg-mism (long)14352394	PRFMIS_SFU 0x00DB000A	ONT RSSI configuration mismatch	Check ONT capability and whether support this function or parameter
11	Equ	Min	N, Y, Y	sfu-sup-sfp-tx-low (long)14352395	TXPWL_SFU 0x00DB000B	ONT SFP Tx Power is lower than configured Alarm low threshold	Check and increase ONT Tx power

(177 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
12	Equ	Min	N, Y, Y	sfu-sup-sfp-temp-high (long)14352396	TMPH_SFU 0x00DB000C	ONT SFP Temperature is higher than configured Alarm high threshold	Check and decrease ONT SFP temperrature
13	Equ	Min	N, Y, Y	sfu-sup-sfp-volt-high (long)14352397	VOLTH_SFU 0x00DB000D	ONT SFP Voltage is higher than configured Alarm high threshold	Check and decrease ONT SFP voltage
14	Equ	Min	N, Y, Y	sfu-sup-sfp-bias-high (long)14352398	BIASH_SFU 0x00DB000E	ONT SFP Bias is higher than configured Alarm high threshold	Check and decrease ONT SFP bias current
15	Equ	Min	N, Y, Y	sfu-sup-ld-cfg-mism (long)14352399	ONTLOOPDETECTMIS_SFU 0x00DB000F	ONT loop detection configuration mismatch	Check ONT capability and whether support loop detection
16	Comm	Maj	Y, Y, Y	sfu-sup-olt-rx-low (long)14352400	GOLTRXPWLO_SFU 0x00DB0010	Receive power from ONT at OLT side is lower than the sensor sensitivity lower limit (Decrease the number of ONT or remove optical attenuator)	1,check optical attenuator or the line problem 2,check SFP module,
17	Comm	Maj	Y, Y, Y	sfu-sup-olt-rx-high (long)14352401	GOLTRXPWHI_SFU 0x00DB0011	Receive power from ONT at OLT side is higher than the sensor sensitivity upper limit	1,check optical attenuator or the line problem 2,check SFP module,
18	Comm	Warn	N, Y, Y	sfu-sup-olt-rx-lo-warn (long)14352402	GOLTRXPWLOWARN_SFU 0x00DB0012	Receive power from ONT at OLT side is lower than the sensor sensitivity lower WARNING limit.	1,check optical attenuator or the line problem 2,check SFP module,
19	Comm	Warn	N, Y, Y	sfu-sup-olt-rx-hi-warn (long)14352403	GOLTRXPWHIWARN_SFU 0x00DB0013	Receive power from ONT at OLT side is higher than the sensor sensitivity upper WARNING limit.	1,check optical attenuator or the line problem 2,check SFP module,
20	Equ	Maj	Y, Y, Y	sfu-sup-tod-out-sync (long)14352404	TODOUTSYNC 0x00DB0014	ONU lost the TOD sync from OLT	-
21	Comm	Maj	Y, Y, Y	sfu-sup-ont-tune-fail (long)14352405	TUNEFAIL 0x00DB0015	ONT failed to tune to wavelength commanded by OLT. Additional info contains 2 comma delineated decimal format AIDs of Target Channel Pair AND Parked Channel Pair (TargetRack, TargetShelf, TargetLTSlot, TargetChannelPair, ParkedRack, ParkedShelf, ParkedLTSlot, ParkedChannelPair) e.g. 1,1,1,1,2,2,2,2 . NOTE: This alarm is only relevant for NG-PON2 (i.e. not GPON or XG-PON1)	Check OLT and/or ONT to see why failed to tune.

(178 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
22	Equ	Min	N, Y, Y	sfu-tr069-parm-fail (long)14352406	HGUTR069MEA 0x00DB0016	ONT did not accept the configuration for HGU TR069 parameters.	check HGU TR069 parameters to see why failed to be provisioned.
23	Equ	Min	N, Y, Y	sfu-sup-tod-mismatch (long)14352407	TODMISMATCH 0x00DB0017	ONT did not accept the configuration of multiple PTP Port Profiles.	check whether multiple PTP Port Profiles are supported by ONT.
24	Equ	Min	N, Y, Y	sfu-sup-poe-overload -yell (long)14352408	POE_YELLOWEXCE ED 0x00DB0018	ONU is nearing its maximum ability to supply the known PoE demand of the attached PDs.	Check the Power of PDs under the ONT.
25	Equ	Maj	N, Y, Y	sfu-opti-malfunc (long)14352409	OPTICAL_MALFUNC _SFU 0x00DB0019	ONT detects the malfunction of its optical transceiver.	Check the ONT's optical transceiver.
Alarm type: 220 Alarm type = SOHO ONT General Supplemental (220) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponOntEquipIfIndex (IfIndex of ONT),Index2 = not used.							
1	Equ	Min	N, Y, Y	soho-sup-sw-file-error (long)14417921	SWDLFILE_SOHO 0x00DC0001	Download of software to ONT has failed because the image file is missing or has an error.	1. Ensure that planned ONT software version is physically present on the OLT. 2. Retry the download again. 3. Reload the ONT image on the OLT. Call Nokia customer service.
2	Equ	Maj	N, Y, Y	soho-sup-fan-failure (long)14417922	FANALM_SOHO 0x00DC0002	Fan Failure at the ONT/ONU	1. Check Fan 2. Check Ambient Temperature
3	Equ	Maj	N, Y, Y	soho-sup-temp-high-warn (long)14417923	HITEMPWARN_SOH O 0x00DC0003	Abnormally high temperature at the ONT/ONU	1. Check Fan 2. Check Ambient Temperature
4	Equ	Maj	Y, Y, Y	soho-sup-temp-shutof f (long)14417924	HITEMPSHUTOFF_S OHO 0x00DC0004	Services disabled to prevent ONT/ONU HW damage due to excessively high temperature.	1. Check Fan 2. Check Ambient Temperature
5	Comm	Min	N, Y, Y	soho-sup-emergency-call (long)14417925	ECALLACT_SOHO 0x00DC0005	Emergency Call active on ONT.	Indication that an emergency phone call is active. Wait for the call to terminate. Note: During an emergency call, no upgrade or modification to the system should be performed which could cause call termination.

(179 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
7	Equ	Min	N, Y, Y	soho-sup-swverctrl-err (long)14417927	SWVERCTLERR_SOHO 0x00DC0007	ONT Software version control error. Occurs when no ONT software match found in ONT SW version control table. Note: Only valid when ENT-ONT PLANVER or DLVER is provisioned as AUTO .	A condition meaning no ONT software match found in ONT SW version control table. Note: Only valid when either ENT-ONT PLANVER or DLVER is provisioned as AUTO. Possible reasons for alarm are: 1. If PLANVER attribute on ONT is AUTO, check ACTHWVER/PLANSWVAR for match of provisioned AUTOHWVER/AUTOSWVAR values in the ONT SW version control table. 2. If DLVER attribute on ONT is AUTO , check ACTHWVER/PLANSWVAR for match of provisioned AUTOHWVER/AUTOSWVAR values in the ONT SW version control table. If no match exists in ONT SW version control table, either update PLANSWVAR and/or add a new entry to the ONT SW version control table in a manner that causes the AUTO setting to have a match. Otherwise disable feature by changing PLANVER and DLVER to not be AUTO.
8	Equ	Crit	N, Y, Y	soho-sup-poe-exceed-max (long)14417928	POE_EXCEED_SOHO 0x00DC0008	Configured PoE feeding exceed the maximum output power of ONU	Adjust the feeding of each configured port to fit the ONT output
9	Comm	Maj	Y, Y, Y	soho-sup-cfg-dnld-fail (long)14417929	CFGDLDFAIL_SOHO 0x00DC0009	Download of voice xml file to ONT failed (For OMCI download method)	1. Ensure the voice configuration file is physically present on the OLT. If not, ensure the voice configuration file is on the ftp server and the ftp server is available. 2. Ensure the OMCI between OLT and ONT is ok 3. Retry the download again.
10	Equ	Min	N, Y, Y	soho-sup-rssi-cfg-mism (long)14417930	PRFMIS_SOHO 0x00DC000A	ONT RSSI configuration mismatch	Check ONT capability and whether support this function or parameter
11	Equ	Min	N, Y, Y	soho-sup-sfp-tx-low (long)14417931	TXPWL_SOHO 0x00DC000B	ONT SFP Tx Power is lower than configured Alarm low threshold	Check and increase ONT Tx power

(180 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
12	Equ	Min	N, Y, Y	soho-sup-sfp-temp-high (long)14417932	TMPH_SOHO 0x00DC000C	ONT SFP Temperature is higher than configured Alarm high threshold	Check and decrease ONT SFP temperrature
13	Equ	Min	N, Y, Y	soho-sup-sfp-volt-high (long)14417933	VOLTH_SOHO 0x00DC000D	ONT SFP Voltage is higher than configured Alarm high threshold	Check and decrease ONT SFP voltage
14	Equ	Min	N, Y, Y	soho-sup-sfp-bias-high (long)14417934	BIASH_SOHO 0x00DC000E	ONT SFP Bias is higher than configured Alarm high threshold	Check and decrease ONT SFP bias current
15	Equ	Min	N, Y, Y	soho-sup-ld-cfg-mism (long)14417935	ONTLOOPDETECTMIS_SOHO 0x00DC000F	ONT loop detection configuration mismatch	Check ONT capability and whether support loop detection
16	Comm	Maj	Y, Y, Y	soho-sup-olt-rx-low (long)14417936	GOLTRXPWLO_SOHO 0x00DC0010	Receive power from ONT at OLT side is lower than the sensor sensitivity lower limit (Decrease the number of ONT or remove optical attenuator)	1,check optical attenuator or the line problem 2,check SFP module,
17	Comm	Maj	Y, Y, Y	soho-sup-olt-rx-high (long)14417937	GOLTRXPWHI_SOHO 0x00DC0011	Receive power from ONT at OLT side is higher than the sensor sensitivity upper limit.	1,check optical attenuator or the line problem 2,check SFP module,
18	Comm	Warn	N, Y, Y	soho-sup-olt-rx-lo-warn (long)14417938	GOLTRXPWLOWARN_SOHO 0x00DC0012	Receive power from ONT at OLT side is lower than the sensor sensitivity lower WARNING limit.	1,check optical attenuator or the line problem 2,check SFP module,
19	Comm	Warn	N, Y, Y	soho-sup-olt-rx-hi-warn (long)14417939	GOLTRXPWHIWARN_SOHO 0x00DC0013	Receive power from ONT at OLT side is higher than the sensor sensitivity upper WARNING limit.	1,check optical attenuator or the line problem 2,check SFP module,
20	Equ	Maj	Y, Y, Y	soho-sup-tod-out-sync (long)14417940	TODOUTSYNC 0x00DC0014	ONU lost the TOD sync from OLT	-
21	Comm	Maj	Y, Y, Y	soho-sup-ont-tune-fail (long)14417941	TUNEFAIL 0x00DC0015	ONT failed to tune to wavelength commanded by OLT. Additional info contains 2 comma delineated decimal format AIDs of Target Channel Pair AND Parked Channel Pair (TargetRack, TargetShelf, TargetLTSlot, TargetChannelPair, ParkedRack, ParkedShelf, ParkedLTSlot, ParkedChannelPair) e.g. 1,1,1,1,2,2,2,2 . NOTE: This alarm is only relevant for NG-PON2 (i.e. not GPON or XG-PON1)	1. Check OLT and/or ONT to see why failed to tune.

(181 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
22	Equ	Min	N, Y, Y	soho-tr069-parm-fail (long)14417942	HGUTR069MEA 0x00DC0016	ONT did not accept the configuration for HGU TR069 parameters.	Check HGU TR069 parameters to see why failed to be provisioned.
23	Equ	Min	N, Y, Y	soho-sup-tod-mismatch (long)14417943	TODMISMATCH 0x00DC0017	ONT did not accept the configuration of multiple PTP Port Profiles.	Check whether multiple PTP Port Profiles are supported by ONT.
24	Equ	Min	N, Y, Y	soho-sup-poe-overload-yell (long)14417944	POE_YELLOWEXCEED 0x00DC0018	ONU is nearing its maximum ability to supply the known PoE demand of the attached PDs.	Check the Power of PDs under the ONT.
25	Equ	Maj	N, Y, Y	soho-opti-malfunc (long)14417945	OPTICAL_MALFUNC_SOHO 0x00DC0019	ONT detects the malfunction of its optical transceiver.	Check the ONT's optical transceiver.
Alarm type: 221 Alarm type = MDU ONT General Supplemental (221) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = gponOntEquipIfIndex (IfIndex of ONT),Index2 = not used.							
1	Equ	Min	N, Y, Y	mdu-sup-sw-file-error (long)14483457	SWDLFILE_MDU 0x00DD0001	Download of software to ONT has failed because the image file is missing or has an error.	1. Ensure that planned ONT software version is physically present on the OLT. 2. Retry the download again. 3. Reload the ONT image on the OLT. Call Nokia customer service.
2	Equ	Maj	N, Y, Y	mdu-sup-fan-failure (long)14483458	FANALM_MDU 0x00DD0002	Fan Failure at the ONT/ONU	1. Check Fan 2. Check Ambient Temperature
3	Equ	Maj	N, Y, Y	mdu-sup-temp-high-warn (long)14483459	HITEMPWARN_MDU 0x00DD0003	Abnormally high temperature at the ONT/ONU	1. Check Fan 2. Check Ambient Temperature
4	Equ	Maj	Y, Y, Y	mdu-sup-temp-shutoff (long)14483460	HITEMPSHUTOFF_MDU 0x00DD0004	Services disabled to prevent ONT/ONU HW damage due to excessively high temperature.	1. Check Fan 2. Check Ambient Temperature
5	Comm	Min	N, Y, Y	mdu-sup-emergency-call (long)14483461	ECALLACT_MDU 0x00DD0005	Emergency Call active on ONT.	Indication that an emergency phone call is active. Wait for the call to terminate. Note: During an emergency call, no upgrade or modification to the system should be performed which could cause call termination.

(182 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
7	Equ	Min	N, Y, Y	mdu-sup-swverctrl-err (long)14483463	SWVERCTLERR_MDU 0x00DD0007	ONT Software version control error. Occurs when no ONT software match found in ONT SW version control table. Note: Only valid when ENT-ONT PLANVER or DLVER is provisioned as AUTO .	A condition meaning no ONT software match found in ONT SW version control table. Note: Only valid when either ENT-ONT PLANVER or DLVER is provisioned as AUTO. Possible reasons for alarm are: 1. If PLANVER attribute on ONT is AUTO, check ACTHWVER/PLANSWVAR for match of provisioned AUTOHWVER/AUTOSWVAR values in the ONT SW version control table. 2. If DLVER attribute on ONT is AUTO , check ACTHWVER/PLANSWVAR for match of provisioned AUTOHWVER/AUTOSWVAR values in the ONT SW version control table. If no match exists in ONT SW version control table, either update PLANSWVAR and/or add a new entry to the ONT SW version control table in a manner that causes the AUTO setting to have a match. Otherwise disable feature by changing PLANVER and DLVER to not be AUTO.
8	Equ	Crit	N, Y, Y	mdu-sup-poe-exceed-max (long)14483464	POE_EXCEED_MDU 0x00DD0008	Configured PoE feeding exceed the maximum output power of ONU	Adjust the feeding of each configured port to fit the ONT output
9	Comm	Maj	Y, Y, Y	mdu-sup-cfg-dnld-fail (long)14483465	CFGDLDFAIL_MDU 0x00DD0009	Download of voice xml file to ONT failed (For OMCI download method)	1. Ensure the voice configuration file is physically present on the OLT. If not, ensure the voice configuration file is on the ftp server and the ftp server is available. 2. Ensure the OMCI between OLT and ONT is ok 3. Retry the download again.
10	Equ	Min	N, Y, Y	mdu-sup-rssi-cfg-mism (long)14483466	PRFMIS_MDU 0x00DD000A	ONT RSSI configuration mismatch	Check ONT capability and whether support this function or parameter
11	Equ	Min	N, Y, Y	mdu-sup-sfp-tx-low (long)14483467	TXPWL_MDU 0x00DD000B	ONT SFP Tx Power is lower than configured Alarm low threshold	Check and increase ONT Tx power

(183 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
12	Equ	Min	N, Y, Y	mdu-sup-sfp-temp-high (long)14483468	TMPH_MDU 0x00DD000C	ONT SFP Temperature is higher than configured Alarm high threshold	Check and decrease ONT SFP temperrature
13	Equ	Min	N, Y, Y	mdu-sup-sfp-volt-high (long)14483469	VOLTH_MDU 0x00DD000D	ONT SFP Voltage is higher than configured Alarm high threshold	Check and decrease ONT SFP voltage
14	Equ	Min	N, Y, Y	mdu-sup-sfp-bias-high (long)14483470	BIASH_MDU 0x00DD000E	ONT SFP Bias is higher than configured Alarm high threshold	Check and decrease ONT SFP bias current
15	Equ	Min	N, Y, Y	mdu-sup-ld-cfg-mism (long)14483471	ONTLOOPDETECTMIS_MDU 0x00DD000F	ONT loop detection configuration mismatch	Check ONT capability and whether support loop detection
16	Comm	Maj	Y, Y, Y	mdu-sup-olt-rx-low (long)14483472	GOLTRXPWLO_MDU 0x00DD0010	Receive power from ONT at OLT side is lower than the sensor sensitivity lower limit (Decrease the number of ONT or remove optical attenuator)	1,check optical attenuator or the line problem 2,check SFP module,
17	Comm	Maj	Y, Y, Y	mdu-sup-olt-rx-high (long)14483473	GOLTRXPWHI_MDU 0x00DD0011	Receive power from ONT at OLT side is higher than the sensor sensitivity upper limit	1,check optical attenuator or the line problem 2,check SFP module,
18	Comm	Warn	N, Y, Y	mdu-sup-olt-rx-lo-warn (long)14483474	GOLTRXPWLOWARN_MDU 0x00DD0012	Receive power from ONT at OLT side is lower than the sensor sensitivity lower WARNING limit.	1,check optical attenuator or the line problem 2,check SFP module,
19	Comm	Warn	N, Y, Y	mdu-sup-olt-rx-hi-warn (long)14483475	GOLTRXPWHIWARN_MDU 0x00DD0013	Receive power from ONT at OLT side is higher than the sensor sensitivity upper WARNING limit.	1,check optical attenuator or the line problem 2,check SFP module,
20	Equ	Maj	Y, Y, Y	mdu-sup-tod-out-sync (long)14483476	TODOUTSYNC 0x00DD0014	ONU lost the TOD sync from OLT	-
21	Comm	Maj	Y, Y, Y	mdu-sup-ont-tune-fail (long)14483477	TUNEFAIL 0x00DD0015	ONT failed to tune to wavelength commanded by OLT. Additional info contains 2 comma delineated decimal format AIDs of Target Channel Pair AND Parked Channel Pair (TargetRack, TargetShelf, TargetLTSlot, TargetChannelPair, ParkedRack, ParkedShelf, ParkedLTSlot, ParkedChannelPair) e.g. 1,1,1,1,2,2,2,2 NOTE: This alarm is only relevant for NG-PON2 (i.e. not GPON or XG-PON1)	Check OLT and/or ONT to see why failed to tune.

(184 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
22	Equ	Min	N, Y, Y	mdu-tr069-parm-fail (long)14483478	HGUTR069MEA 0x00DD0016	ONT did not accept the configuration for HGU TR069 parameters.	Check HGU TR069 parameters to see why failed to be provisioned.
23	Equ	Min	N, Y, Y	mdu-sup-tod-mismatch (long)14483479	TODMISMATCH 0x00DD0017	ONT did not accept the configuration of multiple PTP Port Profiles.	Check whether multiple PTP Port Profiles are supported by ONT.
24	Equ	Min	N, Y, Y	mdu-sup-poe-overload-yell (long)14483480	POE_YELLOWEXCEED 0x00DD0018	ONU is nearing its maximum ability to supply the known PoE demand of the attached PDs.	Check the Power of PDs under the ONT.
25	Equ	Maj	N, Y, Y	mdu-opti-malfunc (long)14483481	OPTICAL_MALFUNC_MDU 0x00DD0019	ONT detects the malfunction of its optical transceiver.	Check the ONT's optical transceiver.
Alarm type: 222 Alarm type = IHUB ETH-RING (222) - Index1 = Eth-Ring Index (tmnxEthRingIndex in TIMETRA-ETH-RING-MIB.mib), Index2 = Eth-Ring Path Index(tmnxEthRingPathIndex in TIMETRA-ETH-RING-MIB.mib)							
1	Comm	Min	N, Y, Y	eth-ring-path-block (long)14548993	ETHRINGBLOCK 0x00DE0001	The alarm is raised when eth-ring path forward state changes to blocking. The alarm is cleared when: the eth-ring path forward state changes to forwarding, the eth-ring path is administratively shutdown, the eth-ring instance is administratively shutdown. Note: Manual clearing is not supported.	Check the if the port or lag on which the path is configured is operational down or if the corresponding path-mep has encountered a ccm-failure. If the port / lag is oper-up and there is no ccm failure for the path-mep,then the Eth-Ring-Path is blocked due to normal protocol functionality,in this case no action is required.
Alarm type: 223 Alarm type = AUTOSWITCH (223) - Index1 = InterfaceIndex, Index2 = Not used.							
1	Comm	Maj	Y, Y, Y	auto-switch (long)14614529	AUTOSWITCH_STATUS 0x00DF0001	Auto-Switching between ATMoADSL and PTMoVDSL status. This alarm supports an additional information and specifies: 'status'. Where 'status' specifies 'success'.	Check for configuration data or physical line or peer modem type
2	Comm	Maj	Y, Y, Y	auswqueuefullatm (long)14614530	ASW_QFULL_ATM 0x00DF0002	Fallback queue is full and cannot add more request (VDSLx to ADSLx).	Just a warning. Disable autoswitch on line.
3	Comm	Maj	Y, Y, Y	auswbkpfailatm (long)14614531	ASW_CFGDATABKPFAIL_ATM 0x00DF0003	Auto-switch manager failed to do the VDSLx configurations in case there is a step-up request (ADSLx to VDSLx) due to partial or no bridge port configuration for the line in request.	Check XDSL and ATM higher layer configuration.

(185 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
4	Comm	Maj	Y, Y, Y	auswrecfgfailatm (long)14614532	ASW_RECFGFAIL_ATM 0x00DF0004	Auto-switch manager failed to do the ADSLx configurations in case there is a fallback request (VDSLx to ADSLx).	Check XDSL and ATM higher layer configuration.
5	Comm	Maj	Y, Y, Y	auswdataunatm (long)14614533	ASW_CFGDATAUN_ATM 0x00DF0005	Auto-switch manager failed to take the backup of the configurations from a2vlog in case of fallback request.	Just a warning, to take back-up re-trigger auto-switch enable with ATM mode.
6	Comm	Maj	Y, Y, Y	auswqueuefulptm (long)14614534	ASW_QFULL_PTM 0x00DF0006	Step-up queue is full and cannot add more request (ADSLx to VDSLx).	Just a warning. Disable autoswitch on line.
7	Comm	Maj	Y, Y, Y	auswbkpfailptm (long)14614535	ASW_CFGDATABKPFAIL_PTM 0x00DF0007	Auto-switch manager failed to do the ADSLx configurations in case there is a fallback request (VDSLx to ADSLx) due to partial or no bridge port configuration for the line in request.	Check XDSL and PTM higher layer configuration.
8	Comm	Maj	Y, Y, Y	auswrecfgfailptm (long)14614536	ASW_RECFGFAIL_PTM 0x00DF0008	Auto-switch manager failed to do the VDSLx configurations in case there is a step-up request (ADSLx to VDSLx).	Check XDSL and PTM higher layer configuration.
9	Comm	Maj	Y, Y, Y	auswdataunptm (long)14614537	ASW_CFGDATAUN_PTM 0x00DF0009	Auto-switch manager failed to take the backup of the configurations from v2alog in case of step-up request.	Just a warning, PTM higher layer config backup is not taken properly.
10	Comm	Maj	Y, Y, Y	auswbakpfailatm (long)14614538	ASW_BAKPFAIL_ATM 0x00DF000A	No or partial bridge port configurations for the line and operator enable auto-switch for the line.	Check XDSL and ATM higher layer configuration before enabling auto switch.
Alarm type: 225 Alarm type = PON BW Utilization TCAs (225) - For GPON, XGS-PON and XG-PON Index1 = (Index of PON), Index2 = see specific alarm.							
1	QOS	Warn	N, Y, Y	pon-t-txmcutilhi (long)14745601	T_TXMCUTILHI 0x00E10001	Downstream Multicast Utilization has exceeded High TCA setting.	None. Just a warning that traffic has exceeded a set bandwidth threshold.
2	QOS	Warn	N, Y, Y	pon-t-txmcutilmd (long)14745602	T_TXMCUTILMD 0x00E10002	Downstream Multicast Utilization has exceeded Medium TCA setting.	None. Just a warning that traffic has exceeded a set bandwidth threshold.
3	QOS	Warn	N, Y, Y	pon-t-txmcutillo (long)14745603	T_TXMCUTILLO 0x00E10003	Downstream Multicast Utilization has exceeded Low TCA setting.	None. Just a warning that traffic has exceeded a set bandwidth threshold.

(186 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
4	QOS	Warn	N, Y, Y	pon-t-txtotutilhi (long)14745604	T_TXTOTUTILHI 0x00E10004	Downstream Total Utilization has exceeded High TCA setting a Index2 = 1 (i.e. Transmit) a Additional Info contains last part of the ONT AID for the top ONT contributors (1st to 5th) followed by their corresponding utilizations (given as 1/100s of a percent, that is the range is 0-10000). E.G. a 1,2,3,4,5,5000,3333,222,10,1	None. Just a warning that traffic has exceeded a set bandwidth threshold.
5	QOS	Warn	N, Y, Y	pon-t-txtotutilmd (long)14745605	T_TXTOTUTILMD 0x00E10005	Downstream Total Utilization has exceeded Medium TCA setting a Index2 = 1 (i.e. Transmit) a Additional Info contains last part of the ONT AID for the top ONT contributors (1st to 5th) followed by their corresponding utilizations (given as 1/100s of a percent, that is the range is 0-10000). E.G. a 1,2,3,4,5,5000,3333,222,10,1	None. Just a warning that traffic has exceeded a set bandwidth threshold.
6	QOS	Warn	N, Y, Y	pon-t-txtotutillo (long)14745606	T_TXTOTUTILLO 0x00E10006	Downstream Total Utilization has exceeded Low TCA setting. a Index2 = 1 (i.e. Transmit) a Additional Info contains last part of the ONT AID for the top ONT contributors (1st to 5th) followed by their corresponding utilizations (given as 1/100s of a percent, that is the range is 0-10000). E.G. a 1,2,3,4,5,5000,3333,222,10,1	None. Just a warning that traffic has exceeded a set bandwidth threshold.
7	QOS	Warn	N, Y, Y	pon-t-rxtotutilhi (long)14745607	T_RXTOTUTILHI 0x00E10007	Upstream Total Utilization has exceeded High TCA setting a Index2 = 2 (i.e. Receive) a Additional Info contains last part of the ONT AID for the top ONT contributors (1st to 5th) followed by their corresponding utilizations (given as 1/100s of a percent, that is the range is 0-10000). E.G. a 1,2,3,4,5,5000,3333,222,10,1	None. Just a warning that traffic has exceeded a set bandwidth threshold.

(187 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
8	QOS	Warn	N, Y, Y	pon-t-rxtotutilmd (long)14745608	T_RXTOTUTILMD 0x00E10008	Upstream Total Utilization has exceeded Medium TCA setting a Index2 = 2 (i.e. Receive) a Additional Info contains last part of the ONT AID for the top ONT contributors (1st to 5th) followed by their corresponding utilizations (given as 1/100s of a percent, that is the range is 0-10000). E.G. a 1,2,3,4,5,5000,3333,222,10,1	None. Just a warning that traffic has exceeded a set bandwidth threshold.
9	QOS	Warn	N, Y, Y	pon-t-rxtotutillo (long)14745609	T_RXTOTUTILLO 0x00E10009	Upstream Total Utilization has exceeded Low TCA setting a Index2 = 2 (i.e. Receive) a Additional Info contains last part of the ONT AID for the top ONT contributors (1st to 5th) followed by their corresponding utilizations (given as 1/100s of a percent, that is the range is 0-10000). E.G. a 1,2,3,4,5,5000,3333,222,10,1	None. Just a warning that traffic has exceeded a set bandwidth threshold.
10	QOS	Warn	N, Y, Y	pon-t-dbacongperiod hi (long)14745610	T_DBACONGPERIO DHI 0x00E1000A	DBA Congestion Period has exceeded High TCA setting.	None. Just a warning that traffic has exceeded a set bandwidth threshold.
11	QOS	Warn	N, Y, Y	pon-t-dbacongperiod md (long)14745611	T_DBACONGPERIO DMD 0x00E1000B	DBA Congestion Period has exceeded Medium TCA setting.	None. Just a warning that traffic has exceeded a set bandwidth threshold.
12	QOS	Warn	N, Y, Y	pon-t-dbacongperiodl o (long)14745612	T_DBACONGPERIO DLO 0x00E1000C	DBA Congestion Period has exceeded Low TCA setting.	None. Just a warning that traffic has exceeded a set bandwidth threshold.
13	QOS	Warn	N, Y, Y	pon-t-txucdropfrmhi (long)14745613	T_TXUCDROPFRMH I 0x00E1000D	Tx Downstream Unicast Dropped Frames has exceeded High TCA setting.	None. A warning. If situation unacceptable, determine why frames are being dropped.
14	QOS	Warn	N, Y, Y	pon-t-txucdropfrmmd (long)14745614	T_TXUCDROPFRM MD 0x00E1000E	Tx Downstream Unicast Dropped Frames has exceeded Medium TCA setting.	None. A warning. If situation unacceptable, determine why frames are being dropped.
15	QOS	Warn	N, Y, Y	pon-t-txucdropfrmlo (long)14745615	T_TXUCDROPFRML O 0x00E1000F	Tx Downstream Unicast Dropped Frames has exceeded Low TCA setting.	None. A warning. If situation unacceptable, determine why frames are being dropped.

(188 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
16	QOS	Warn	N, Y, Y	pon-t-txmcdropfrmhi (long)14745616	T_TXMCDROPFRMHI 0x00E10010	Tx Downstream Multicast Dropped Frames has exceeded High TCA setting.	None. A warning. If situation unacceptable, determine why frames are being dropped.
17	QOS	Warn	N, Y, Y	pon-t-txmcdropfrmmd (long)14745617	T_TXMCDROPFRMMD 0x00E10011	Tx Downstream Multicast Dropped Frames has exceeded Medium TCA setting.	None. A warning. If situation unacceptable, determine why frames are being dropped.
18	QOS	Warn	N, Y, Y	pon-t-txmcdropfrmlo (long)14745618	T_TXMCDROPFRMLO 0x00E10012	Tx Downstream Multicast Dropped Frames has exceeded Low TCA setting.	None. A warning. If situation unacceptable, determine why frames are being dropped.
19	QOS	Warn	N, Y, Y	pon-t-txbcdropfrmhi (long)14745619	T_TXBCDROPFRMHI 0x00E10013	Tx Downstream Broadcast Dropped Frames has exceeded High TCA setting.	None. A warning. If situation unacceptable, determine why frames are being dropped.
20	QOS	Warn	N, Y, Y	pon-t-txbcdropfrmmd (long)14745620	T_TXBCDROPFRMMD 0x00E10014	Tx Downstream Broadcast Dropped Frames has exceeded Medium TCA setting.	None. A warning. If situation unacceptable, determine why frames are being dropped.
21	QOS	Warn	N, Y, Y	pon-t-txbcdropfrmlo (long)14745621	T_TXBCDROPFRMLO 0x00E10015	Tx Downstream Broadcast Dropped Frames has exceeded Low TCA setting.	None. A warning. If situation unacceptable, determine why frames are being dropped.
22	QOS	Warn	N, Y, Y	pon-t-rxtotdropfrmhi (long)14745622	T_RXTOTDROPFRMHI 0x00E10016	Rx Upstream Total Dropped Frames has exceeded High TCA setting.	None. A warning. If situation unacceptable, determine why frames are being dropped.
23	QOS	Warn	N, Y, Y	pon-t-rxtotdropfrmmd (long)14745623	T_RXTOTDROPFRMMD 0x00E10017	Rx Upstream Total Dropped Frames has exceeded Medium TCA setting.	None. A warning. If situation unacceptable, determine why frames are being dropped.
24	QOS	Warn	N, Y, Y	pon-t-rxtotdropfrmlo (long)14745624	T_RXTOTDROPFRMLO 0x00E10018	Rx Upstream Total Dropped Frames has exceeded Low TCA setting.	None. A warning. If situation unacceptable, determine why frames are being dropped.
Alarm type: 226 Alarm type = Channel Pair Miscellaneous (226) - For GPON Not SUPPORTED. For XGS-PON dual-rate and NG-PON2 - Index 1 = (IfIndex of Channel Pair), Index2 = See Specific Alarm.							
1	Equ	Crit	Y, Y, Y	chpr-com-fail (long)14811137	CPCOMMFAIL 0x00E20001	Channel Pair Communication Failure on OLT Port	Restart the Channel Pair
2	Equ	Crit	Y, Y, Y	chpr-tx-fail (long)14811138	CPTXFAIL 0x00E20002	Transmitter Failure on OLT Port	Check OLT laser

(189 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
3	Equ	Min	N, Y, Y	chpr-unprov-ont (long)14811139	CPNEWONT 0x00E20003	New ONT Detected. An unprovisioned ONT has been discovered on the Channel Pair (Index 2 = 1 to 128) . This Index 2 points to a SNMP table entry (bponPonDiscovOntTable) that contains the Serial Number, SLID, LOID and UsRate of the discovered ONT. Additional Info contains the values for Serial Number, SLID, LOID and UsRate of the discovered ONT e.g. SERNUM = ALCL00000001, SLID = SLIDabcd0001, LOID = admin1, USRATE = 10g.	No repair necessary\" \"indication to operator that further provisioning should commence -\" \"(Index 2 = 1 to 64)
4	Equ	Maj	Y, Y, Y	chpr-prov-mismatch (long)14811140	CPMEA 0x00E20004	Channel Pair failed to be provisioned. Mismatch between Channel Pair Equipment and Channel Pair provisioning attributes; Index2 not used	Provisioned attributes failed to be provisioned for Channel Pair. Reprovision the Channel Pair.
5	Comm	Maj	Y, Y, Y	chpr-loss-sig (long)14811141	CPLOS 0x00E20005	Channel Pair Loss of Signal. OLT is not receiving any upstream transmissions.	Check receive Channel Pair Fiber input at OLT.
6	Equ	Maj	N, Y, Y	chpr-diagnostic (long)14811142	CPROGUETEST 0x00E20006	A diagnostics is currently active on the Channel Pair looking for misbehaviing ONTs	
7	Equ	Min	N, Y, Y	chpr-loid-conflict (long)14811143	CPLOIDCONFLICT 0x00E20007	An ONT has been discovered on the Channel Pair (Index 2 = 1 to 128). But its LOID is already in use.This Index 2 points to a SNMP table (bponPonDiscovOntTable) entry that contains the Serial Number,SLID and LOID of the discovered ONT.	No repair necessary.

(190 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
8	Equ	Min	N, Y, Y	chpr-loid-pwd-err (long)14811144	CPLOIDPWDERR 0x00E20008	An ONT has been discovered on the Channel Pair (Index 2 = 1 to 128). But its LOID Password is not correct.This Index 2 points to a SNMP table (bponPonDiscovOntTable) entry that contains the Serial Number,SLID and LOID of the discovered ONT.	No repair necessary.
9	Comm	Min	Y, Y, Y	chpr-stk-laser-dis (long)14811145	CPSTKLASERDIS 0x00E20009	This alarm indicates that due to 'rogue ONT testing' an 'unranged ONT' on the Channel Pair may have been DISABLED via OLT broadcast	
10	Equ	Maj	Y, Y, Y	chpr-sfp-mismatch (long)14811146	CPSFPMISMATCH 0x00E2000A	This alarm indicates that their is a mismatch between the channel-pair provisioned SFP laser characteristics and actual SFP laser transceive that is plugge in. Only applicable for NG-Channel Pair2	This alarm indicates that their is a mismatch between the channel-pair provisioned SFP laser characteristics and actual SFP laser transceive that is plugged in. Either re-provision the channel-pair to match the SFP. Or plug in a new SFP that matches the provisioning, or do both.
11	Equ	Maj	N, Y, Y	chpr-rng-mismatch (long)14811147	CPRNGMISMATCH 0x00E2000B	Max ranging ONTs number configured on the Channel Pair is less than the actual number of connected ONT on Channel Pair.	Configure max ranging onts number, connect more onts than this number in the Channel Pair, under this condition, will raise this alarm. 12 hours later the alarm will be cleared. If the operator clears the alarm manually by command, the alarm will be cleared. The alarm will be raised again if condition still exist.
12	Equ	Maj	N, Y, Y	chpr-alien-test (long)14811148	CPALIENTEST 0x00E2000C	A diagnostic test is currently active on the Channel Pair to discover alien (non Channel Pair) ONTs. Index 2 not used.	An alien (non Channel Pair) ONT discovery test is currently active. Wait for the test to complete or abort/stop the test. Once the test ends, check for CPALIENDETECTED alarm.

(191 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
13	Equ	Maj	N, Y, Y	chpr-alien-detect (long)14811149	CPALIENDETECTED 0x00E2000D	An alien (non Channel Pair) ONT is detected on the Channel Pair. This alarm is used to notify the operator but doesn't affect the Channel Pair status. Index 2 not used.	This alarm indicates that there is at least one alien (non Channel Pair) ONU detected on the Channel Pair. Alien ONTs interrupt the ranging and re-ranging of other ONTs. Investigate the operating environment as soon as possible and disconnect these alien ONTs. The alarm clears when the alien ONT is disconnected and a next alien test does not detect an alien ONT anymore.
14	Equ	Crit	N, Y, Y	chpr-deact-hightca (long)14811150	CPDEACTHIGHTCA 0x00E2000E	Deactivated ONU (refers to ONU that is admin up and oper status down) amount has crossed the high threshold. Additional info : percent/number mode, # and % of adminup ONU, # and % of active ONU, # and % of deactivated ONU, # and % of dying gasp ONU (# is the number, % is the percent).	Check the reason that the ONUs under the channel pair are deactivated.
15	Equ	Warn	N, Y, Y	chpr-deact-lowtca (long)14811151	CPDEACTLOWTCA 0x00E2000F	Deactivated ONU (refers to ONU that is admin up and oper status down) amount has crossed the low threshold. Additional info : percent/number mode, # and % of adminup ONU, # and % of active ONU, # and % of deactivated ONU, # and % of dying gasp ONU (# is the number, % is the percent).	Check the reason that the ONUs under the channel pair are deactivated.
16	Equ	Maj	Y, Y, Y	chpr-dp-integ (long)14811152	CPDPINTEG 0x00E20010	This alarm is raised when the number of ONTs associated with the channelpair, provisioned with SIP lines and having SIPREGTO alarm, has crossed the data path integrity threshold.	Check the reason for SIP Registration Timeout alarms on POTS lines associated with this Channel-Pair.
Alarm type: 227 Alarm type = Channel Pair BW Utilization TCAs (227) - For GPON NOT SUPPORTED. For XGS-PON dual-rate and NG-PON2 Index1 = (Index of Channel Pair), Index2 = see specific alarm.							
1	QOS	Warn	N, Y, Y	chpr-t-txmcutilhi (long)14876673	T_TXMCUTILHI 0x00E30001	Downstream Multicast Utilization has exceeded High TCA setting.	None. Just a warning that traffic has exceeded a set bandwidth threshold.

(192 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
2	QOS	Warn	N, Y, Y	chpr-t-txmcutilmd (long)14876674	T_TXMCUTILMD 0x00E30002	Downstream Multicast Utilization has exceeded Medium TCA setting.	None. Just a warning that traffic has exceeded a set bandwidth threshold.
3	QOS	Warn	N, Y, Y	chpr-t-txmcutillo (long)14876675	T_TXMCUTILLO 0x00E30003	Downstream Multicast Utilization has exceeded Low TCA setting.	None. Just a warning that traffic has exceeded a set bandwidth threshold.
4	QOS	Warn	N, Y, Y	chpr-t-txtotutilhi (long)14876676	T_TXTOTUTILHI 0x00E30004	Downstream Total Utilization has exceeded High TCA setting. a Index2 = 2 (i.e. Transmit) a Additional Info contains last part of the ONT AID for the top ONT contributors (1st to 5th) followed by their corresponding utilizations (given as 1/100s of a percent, that is the range is 0-10000). E.G. a 1,2,3,4,5,5000,3333,222,10,1	None. Just a warning that traffic has exceeded a set bandwidth threshold.
5	QOS	Warn	N, Y, Y	chpr-t-txtotutilmd (long)14876677	T_TXTOTUTILMD 0x00E30005	Downstream Total Utilization has exceeded Medium TCA setting a Index2 = 2 (i.e. Transmit) a Additional Info contains last part of the ONT AID for the top ONT contributors (1st to 5th) followed by their corresponding utilizations (given as 1/100s of a percent, that is the range is 0-10000). E.G. a 1,2,3,4,5,5000,3333,222,10,1	None. Just a warning that traffic has exceeded a set bandwidth threshold.
6	QOS	Warn	N, Y, Y	chpr-t-txtotutillo (long)14876678	T_TXTOTUTILLO 0x00E30006	Downstream Total Utilization has exceeded Low TCA setting a Index2 = 2 (i.e. Transmit) a Additional Info contains last part of the ONT AID for the top ONT contributors (1st to 5th) followed by their corresponding utilizations (given as 1/100s of a percent, that is the range is 0-10000). E.G. a 1,2,3,4,5,5000,3333,222,10,1	None. Just a warning that traffic has exceeded a set bandwidth threshold.

(193 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
7	QOS	Warn	N, Y, Y	chpr-t-rxtotutilhi (long)14876679	T_RXTOTUTILHI 0x00E30007	Upstream Total Utilization has exceeded High TCA setting. a Index2 = 2 (i.e. Receive) a Additional Info contains last part of the ONT AID for the top ONT contributors (1st to 5th) followed by their corresponding utilizations (given as 1/100s of a percent, that is the range is 0-10000). E.G. a 1,2,3,4,5,5000,3333,222,10,1	None. Just a warning that traffic has exceeded a set bandwidth threshold.
8	QOS	Warn	N, Y, Y	chpr-t-rxtotutilmd (long)14876680	T_RXTOTUTILMD 0x00E30008	Upstream Total Utilization has exceeded Medium TCA setting. a Index2 = 2 (i.e. Receive a Additional Info contains last part of the ONT AID for the top ONT contributors (1st to 5th) followed by their corresponding utilizations (given as 1/100s of a percent, that is the range is 0-10000). E.G. a 1,2,3,4,5,5000,3333,222,10,1	None. Just a warning that traffic has exceeded a set bandwidth threshold.
9	QOS	Warn	N, Y, Y	chpr-t-rxtotutillo (long)14876681	T_RXTOTUTILLO 0x00E30009	Upstream Total Utilization has exceeded Low TCA setting a Index2 = 2 (i.e. Receive) a Additional Info contains last part of the ONT AID for the top ONT contributors (1st to 5th) followed by their corresponding utilizations (given as 1/100s of a percent, that is the range is 0-10000). E.G. a 1,2,3,4,5,5000,3333,222,10,1	None. Just a warning that traffic has exceeded a set bandwidth threshold.
10	QOS	Warn	N, Y, Y	chpr-t-dbacongperiod hi (long)14876682	T_DBACONGPERIO DHI 0x00E3000A	DBA Congestion Period has exceeded High TCA setting.	None. Just a warning that traffic has exceeded a set bandwidth threshold.
11	QOS	Warn	N, Y, Y	chpr-t-dbacongperiod md (long)14876683	T_DBACONGPERIO DMD 0x00E3000B	DBA Congestion Period has exceeded Medium TCA setting.	None. Just a warning that traffic has exceeded a set bandwidth threshold.
12	QOS	Warn	N, Y, Y	chpr-t-dbacongperiodl o (long)14876684	T_DBACONGPERIO DLO 0x00E3000C	DBA Congestion Period has exceeded Low TCA setting.	None. Just a warning that traffic has exceeded a set bandwidth threshold.

(194 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
13	QOS	Warn	N, Y, Y	chpr-t-txucdropfrmhi (long)14876685	T_TXUCDROPFRMHI 0x00E3000D	Tx Downstream Unicast Dropped Frames has exceeded High TCA setting.	None. A warning. If situation unacceptable, determine why frames are being dropped.
14	QOS	Warn	N, Y, Y	chpr-t-txucdropfrmmd (long)14876686	T_TXUCDROPFRMMD 0x00E3000E	Tx Downstream Unicast Dropped Frames has exceeded Medium TCA setting.	None. A warning. If situation unacceptable, determine why frames are being dropped.
15	QOS	Warn	N, Y, Y	chpr-t-txucdropfrmlo (long)14876687	T_TXUCDROPFRMLO 0x00E3000F	Tx Downstream Unicast Dropped Frames has exceeded Low TCA setting.	None. A warning. If situation unacceptable, determine why frames are being dropped.
16	QOS	Warn	N, Y, Y	chpr-t-txmcdropfrmhi (long)14876688	T_TXMCDROPFRMHI 0x00E30010	Tx Downstream Multicast Dropped Frames has exceeded High TCA setting.	None. A warning. If situation unacceptable, determine why frames are being dropped.
17	QOS	Warn	N, Y, Y	chpr-t-txmcdropfrmmd (long)14876689	T_TXMCDROPFRMMD 0x00E30011	Tx Downstream Multicast Dropped Frames has exceeded Medium TCA setting.	None. A warning. If situation unacceptable, determine why frames are being dropped.
18	QOS	Warn	N, Y, Y	chpr-t-txmcdropfrmlo (long)14876690	T_TXMCDROPFRMLO 0x00E30012	Tx Downstream Multicast Dropped Frames has exceeded Low TCA setting.	None. A warning. If situation unacceptable, determine why frames are being dropped.
19	QOS	Warn	N, Y, Y	chpr-t-txbcdropfrmhi (long)14876691	T_TXBCDROPFRMHI 0x00E30013	Tx Downstream Broadcast Dropped Frames has exceeded High TCA setting.	None. A warning. If situation unacceptable, determine why frames are being dropped.
20	QOS	Warn	N, Y, Y	chpr-t-txbcdropfrmmd (long)14876692	T_TXBCDROPFRMMD 0x00E30014	Tx Downstream Broadcast Dropped Frames has exceeded Medium TCA setting.	None. A warning. If situation unacceptable, determine why frames are being dropped.
21	QOS	Warn	N, Y, Y	chpr-t-txbcdropfrmlo (long)14876693	T_TXBCDROPFRMLO 0x00E30015	Tx Downstream Broadcast Dropped Frames has exceeded Low TCA setting.	None. A warning. If situation unacceptable, determine why frames are being dropped.
22	QOS	Warn	N, Y, Y	chpr-t-rxtotdropfrmhi (long)14876694	T_RXTOTDROPFRMHI 0x00E30016	Rx Upstream Total Dropped Frames has exceeded High TCA setting.	None. A warning. If situation unacceptable, determine why frames are being dropped.
23	QOS	Warn	N, Y, Y	chpr-t-rxtotdropfrmmd (long)14876695	T_RXTOTDROPFRMMD 0x00E30017	Rx Upstream Total Dropped Frames has exceeded Medium TCA setting.	None. A warning. If situation unacceptable, determine why frames are being dropped.
24	QOS	Warn	N, Y, Y	chpr-t-rxtotdropfrmlo (long)14876696	T_RXTOTDROPFRMLO 0x00E30018	Rx Upstream Total Dropped Frames has exceeded Low TCA setting.	None. A warning. If situation unacceptable, determine why frames are being dropped.

(195 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
Alarm type: 228 Alarm type = ONT Configuration File Download (228) - For GPON, XGS-PON, XG-PON and NG-PON2 Index1 = (ifIndex of ONT), Index2 = (Config File Number --> 1 = CfgFile1 , 2 = CfgFile2)							
1	Equ	Min	N, Y, Y	cfg-dld-fail (long)14942209	CFGDLFAIL 0x00E40001	Download of Config File to ONT has failed	1. Retry the download again. 2. If it fails again, manually clear the alarm. Call Nokia customer service.
2	Equ	Maj	Y, Y, Y	cfg-act-fail (long)14942210	CFGACTFAIL 0x00E40002	ONT failed to activate the selected Config File.	1. Retry another activation . 2. If it fails again, manually clear the alarm. Call Nokia customer service.
3	Equ	Min	N, Y, Y	cfg-dld-ip (long)14942211	CFGDLIP 0x00E40003	A condition meaning that a transfer of Config File from the OLT to the ONT is pending or is actually being transmitted.	Not a problem. This is a transient condition that self clears once download activity ceases.
4	Equ	Min	N, Y, Y	cfg-ver-mismatch (long)14942212	CFGVER 0x00E40004	A condition meaning that the Planned Config File version does not equal the Active Config File version.	1. Make the Active version equal Planned version via successful activation or 2. Make the Planned version equal Active version via operator update.
5	Equ	Min	N, Y, Y	cfg-file-missing (long)14942213	CFGDLFILE 0x00E40005	Download of Config File to ONT has failed because the file is missing or has an error.	1. Ensure that Planned Config File version is physically present on the OLT. 2. Retry the download again. 3. Reload the config file on the OLT. Call Nokia customer service.

(196 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
6	Equ	Min	N, Y, Y	cfg-verctrl-err (long)14942214	CFGVERCTLERR 0x00E40006	ONT Config File version control error. Occurs when no match found in ONT SW version control table. Note: Only valid when ENT-ONT PLANVER or DLVER is provisioned as AUTO .	A condition meaning no Config File match found in ONT SW version control table. Note: Only valid when either ENT-ONT PLANVER or DLVER is provisioned as AUTO. Possible reasons for alarm are: 1. If PLANVER attribute on ONT is AUTO, check ACTHWVER/PLANSWVAR for match of provisioned AUTOHWVER/AUTOSWVAR values in the ONT SW version control table. 2. If DLVER attribute on ONT is AUTO, check ACTHWVER/PLANSWVAR for match of provisioned AUTOHWVER/AUTOSWVAR values in the ONT SW version control table. If no match exists in ONT SW version control table, either update PLANSWVAR and/or add a new entry to the ONT SW version control table in a manner that causes the AUTO setting to have a match. Otherwise disable feature by changing PLANVER and DLVER to not be AUTO.
7	Equ	Min	N, Y, Y	cfg-not-supported (long)14942214	CFGNOTSUPPORT 0x00E40007	ONT Does Not Support Config File Download Functionality (CFGDLNSUPP)	1. Set PLNDCFGFILE and DLCFGFILE attribute to DISABLED, or change with an ONT that supports the config file download function. 2. Call ALU customer service
Alarm type: 229 Alarm type = OLT CHANNEL PAIR TC TCA (229) - For GPON NOT SUPPORTED For XGS-PON dual rate and NG-PON2 Index1 = (Index of Channel Pair), Index2 = Not Used.							
1	QOS	Warn	N, Y, Y	olt-chpr-tc-err-frag (long)15007745	CP_ERRFRAGS 0x00E50001	OLT Near End (Receive at OLT) Number of a Channel Pair unforwarded GEM Fragments due to Header Errors or Unavailable Resources Threshold Crossing Alert.	1. Check Receive Channel Pair signal at OLT. 2. Check Transmit Channel Pair signal at ONT. 3. Check ONT for ONT TC ERRFRAGS and isolate at ONT level if ONT counts exist. 4. Reset LT 5. Replace associated LT at OLT if PM counts persist.

(197 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
2	Comm	Maj	Y, Y, Y	olt-chpr-up-bw-tca (long)15007746	CP_BWTCA 0x00E50002	TCA for OLT Channel Pair upstream BW during specified interval	None. A warning. If situation unacceptable, determine why Upstream BW is high.
3	Comm	Maj	Y, Y, Y	olt-chpr-down-bw-tca (long)15007747	CP_BWTCA 0x00E50003	TCA for OLT Channel Pair downstream BW during specified interval	None. A warning. If situation unacceptable, determine why Downstream BW is high.
Alarm type: 230 Alarm type = ONT General Supplemental 2 (230) - Index1 = gponOntEquipIfIndex (IfIndex of ONT), Index2 = not used.							
1	Equ	Min	N, Y, Y	ont-gen-temp-low (long)15073281	TMPL 0x00E60001	Temperature is lower than low threshold.	Check and increase ONT SFP temperature.
2	Equ	Min	N, Y, Y	ont-gen-volt-low (long)15073282	VOLTL 0x00E60002	Voltage is lower than low threshold.	Check and increase ONT SFP voltage.
3	Equ	Min	N, Y, Y	ont-gen-tx-pwr-high (long)15073283	TXPWH 0x00E60003	Tx power is higher than high threshold.	Check and decrease ONT SFP Tx power.
4	Equ	Min	N, Y, Y	ont-gen-bias-low (long)15073284	BIASL 0x00E60004	Bias is lower than lower threshold.	Check and increase ONT SFP bias.
5	Equ	Warn	N, Y, Y	ont-gen-rx-hwarn (long)15073285	RXPWHWARN 0x00E60005	Rx power is higher than warn threshold.	Check and decrease ONT SFP Rx power.
6	Equ	Warn	N, Y, Y	ont-gen-rx-lwarn (long)15073286	RXPWLWARN 0x00E60006	Rx power is lower than warn threshold.	Check and increase ONT SFP Rx power.
7	Equ	Warn	N, Y, Y	ont-gen-tx-hwarn (long)15073287	TXPWHWARN 0x00E60007	Tx power is higher than warn threshold.	Check and decrease ONT SFP Tx power.
8	Equ	Warn	N, Y, Y	ont-gen-tx-lwarn (long)15073288	TXPWLWARN 0x00E60008	Tx power is lower than warn threshold.	Check and increase ONT SFP Tx power.
9	Equ	Warn	N, Y, Y	ont-gen-temp-hwarn (long)15073289	TMPHWARN 0x00E60009	Temperature is higher than warn threshold.	Check and decrease ONT SFP temperature.
10	Equ	Warn	N, Y, Y	ont-gen-temp-lwarn (long)15073290	TMPLWARN 0x00E6000A	Temperature is lower than warn threshold.	Check and increase ONT SFP temperature.
11	Equ	Warn	N, Y, Y	ont-gen-volt-hwarn (long)15073291	VOLTHWARN 0x00E6000B	Voltage is higher than warn threshold.	Check and decrease ONT SFP voltage.
12	Equ	Warn	N, Y, Y	ont-gen-volt-lwarn (long)15073292	VOLTLWARN 0x00E6000C	Voltage is lower than warn threshold.	Check and increase ONT SFP voltage.
13	Equ	Warn	N, Y, Y	ont-gen-bias-hwarn (long)15073293	BIASHWARN 0x00E6000D	Bias is higher than warn threshold.	Check and decrease ONT SFP bias.
14	Equ	Warn	N, Y, Y	ont-gen-bias-lwarn (long)15073294	BIASLWARN 0x00E6000E	Bias is lower than warn threshold.	Check and increase ONT SFP bias.
Alarm type: 231 Alarm type = SFU ONT General Supplemental 2 (231) - Index1 = gponOntEquipIfIndex (IfIndex of ONT), Index2 = not used.							

(198 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
1	Equ	Min	N, Y, Y	sfu-sup2-temp-low (long)15138817	TMPL_SFU 0x00E70001	Temperature is lower than low threshold.	Check and increase ONT SFP temperature.
2	Equ	Min	N, Y, Y	sfu-sup2-volt-low (long)15138818	VOLTL_SFU 0x00E70002	Voltage is lower than low threshold.	Check and increase ONT SFP voltage.
3	Equ	Min	N, Y, Y	sfu-sup2-tx-high (long)15138819	TXPWH_SFU 0x00E70003	Tx power is higher than high threshold.	Check and decrease ONT SFP Tx power.
4	Equ	Min	N, Y, Y	sfu-sup2-bias-low (long)15138820	BIASL_SFU 0x00E70004	Bias is lower than lower threshold.	Check and increase ONT SFP bias.
5	Equ	Warn	N, Y, Y	sfu-sup2-rx-hwarn (long)15138821	RXPWHWARN_SFU 0x00E70005	Rx power is higher than warn threshold.	Check and decrease ONT SFP Rx power.
6	Equ	Warn	N, Y, Y	sfu-sup2-rx-lwarn (long)15138822	RXPWLWARN_SFU 0x00E70006	Rx power is lower than warn threshold.	Check and increase ONT SFP Rx power.
7	Equ	Warn	N, Y, Y	sfu-sup2-tx-hwarn (long)15138823	TXPWHWARN_SFU 0x00E70007	Tx power is higher than warn threshold.	Check and decrease ONT SFP Tx power.
8	Equ	Warn	N, Y, Y	sfu-sup2-tx-lwarn (long)15138824	TXPWLWARN_SFU 0x00E70008	Tx power is lower than warn threshold.	Check and increase ONT SFP Tx power.
9	Equ	Warn	N, Y, Y	sfu-sup2-temp-hwarn (long)15138825	TMPHWARN_SFU 0x00E70009	Temperature is higher than warn threshold.	Check and decrease ONT SFP temperature.
10	Equ	Warn	N, Y, Y	sfu-sup2-temp-lwarn (long)15138826	TMPLWARN_SFU 0x00E7000A	Temperature is lower than warn threshold.	Check and increase ONT SFP temperature.
11	Equ	Warn	N, Y, Y	sfu-sup2-volt-hwarn (long)15138827	VOLTHWARN_SFU 0x00E7000B	Voltage is higher than warn threshold.	Check and decrease ONT SFP voltage.
12	Equ	Warn	N, Y, Y	sfu-sup2-volt-lwarn (long)15138828	VOLTLWARN_SFU 0x00E7000C	Voltage is lower than warn threshold.	Check and increase ONT SFP voltage.
13	Equ	Warn	N, Y, Y	sfu-sup2-bias-hwarn (long)15138829	BIASHWARN_SFU 0x00E7000D	Bias is higher than warn threshold.	Check and decrease ONT SFP bias.
14	Equ	Warn	N, Y, Y	sfu-sup2-bias-lwarn (long)15138830	BIASLWARN_SFU 0x00E7000E	Bias is lower than warn threshold.	Check and increase ONT SFP bias.
Alarm type: 232 Alarm type = SOHO ONT General Supplemental 2 (232) - Index1 = gponOntEquipIfIndex (IfIndex of ONT), Index2 = not used.							
1	Equ	Min	N, Y, Y	soho-sup2-temp-low (long)15204353	TMPL_SOHO 0x00E80001	Temperature is lower than low threshold.	Check and increase ONT SFP temperature.
2	Equ	Min	N, Y, Y	soho-sup2-volt-low (long)15204354	VOLTL_SOHO 0x00E80002	Voltage is lower than low threshold.	Check and increase ONT SFP voltage.
3	Equ	Min	N, Y, Y	soho-sup2-tx-high (long)15204355	TXPWH_SOHO 0x00E80003	Tx power is higher than high threshold.	Check and decrease ONT SFP Tx power.
4	Equ	Min	N, Y, Y	soho-sup2-bias-low (long)15204356	BIASL_SOHO 0x00E80004	Bias is lower than lower threshold.	Check and increase ONT SFP bias.

(199 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
5	Equ	Warn	N, Y, Y	soho-sup2-rx-hwarn (long)15204357	RXPWHWARN_SOHO 0x00E80005	Rx power is higher than warn threshold.	Check and decrease ONT SFP Rx power.
6	Equ	Warn	N, Y, Y	soho-sup2-rx-lwarn (long)15204358	RXPWLWARN_SOHO 0x00E80006	Rx power is lower than warn threshold.	Check and increase ONT SFP Rx power.
7	Equ	Warn	N, Y, Y	soho-sup2-tx-hwarn (long)15204359	TXPWHWARN_SOHO 0x00E80007	Tx power is higher than warn threshold.	Check and decrease ONT SFP Tx power.
8	Equ	Warn	N, Y, Y	soho-sup2-tx-lwarn (long)15204360	TXPWLWARN_SOHO 0x00E80008	Tx power is lower than warn threshold.	Check and increase ONT SFP Tx power.
9	Equ	Warn	N, Y, Y	soho-sup2-temp-hwarn (long)15204361	TMPHWARN_SOHO 0x00E80009	Temperature is higher than warn threshold.	Check and decrease ONT SFP temperature.
10	Equ	Warn	N, Y, Y	soho-sup2-temp-lwarn (long)15204362	TMPLWARN_SOHO 0x00E8000A	Temperature is lower than warn threshold.	Check and increase ONT SFP temperature.
11	Equ	Warn	N, Y, Y	soho-sup2-volt-hwarn (long)15204363	VOLTHWARN_SOHO 0x00E8000B	Voltage is higher than warn threshold.	Check and decrease ONT SFP voltage.
12	Equ	Warn	N, Y, Y	soho-sup2-volt-lwarn (long)15204364	VOLTLWARN_SOHO 0x00E8000C	Voltage is lower than warn threshold.	Check and increase ONT SFP voltage.
13	Equ	Warn	N, Y, Y	soho-sup2-bias-hwarn (long)15204365	BIASHWARN_SOHO 0x00E8000D	Bias is higher than warn threshold.	Check and decrease ONT SFP bias.
14	Equ	Warn	N, Y, Y	soho-sup2-bias-lwarn (long)15204366	BIASLWARN_SOHO 0x00E8000E	Bias is lower than warn threshold.	Check and increase ONT SFP bias.
Alarm type: 233 Alarm type = MDU ONT General Supplemental 2 (233) - Index1 = gponOntEquipIfIndex (IfIndex of ONT), Index2 = not used.							
1	Equ	Min	N, Y, Y	mdu-sup2-temp-low (long)15269889	TMPL_MDU 0x00E90001	Temperature is lower than low threshold.	Check and increase ONT SFP temperature.
2	Equ	Min	N, Y, Y	mdu-sup2-volt-low (long)15269890	VOLTL_MDU 0x00E90002	Voltage is lower than low threshold.	Check and increase ONT SFP voltage.
3	Equ	Min	N, Y, Y	mdu-sup2-tx-high (long)15269891	TXPWH_MDU 0x00E90003	Tx power is higher than high threshold.	Check and decrease ONT SFP Tx power.
4	Equ	Min	N, Y, Y	mdu-sup2-bias-low (long)15269892	BIASL_MDU 0x00E90004	Bias is lower than lower threshold.	Check and increase ONT SFP bias.
5	Equ	Warn	N, Y, Y	mdu-sup2-rx-hwarn (long)15269893	RXPWHWARN_MDU 0x00E90005	Rx power is higher than warn threshold.	Check and decrease ONT SFP Rx power.

(200 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
6	Equ	Warn	N, Y, Y	mdu-sup2-rx-lwarn (long)15269894	RXPWLWARN_MDU 0x00E90006	Rx power is lower than warn threshold.	Check and increase ONT SFP Rx power.
7	Equ	Warn	N, Y, Y	mdu-sup2-tx-hwarn (long)15269895	TXPWHWARN_MDU 0x00E90007	Tx power is higher than warn threshold.	Check and decrease ONT SFP Tx power.
8	Equ	Warn	N, Y, Y	mdu-sup2-tx-lwarn (long)15269896	TXPWLWARN_MDU 0x00E90008	Tx power is lower than warn threshold.	Check and increase ONT SFP Tx power.
9	Equ	Warn	N, Y, Y	mdu-sup2-temp-hwar n (long)15269897	TMPHWARN_MDU 0x00E90009	Temperature is higher than warn threshold.	Check and decrease ONT SFP temperature.
10	Equ	Warn	N, Y, Y	mdu-sup2-temp-lwarn (long)15269898	TMPLWARN_MDU 0x00E9000A	Temperature is lower than warn threshold.	Check and increase ONT SFP temperature.
11	Equ	Warn	N, Y, Y	mdu-sup2-volt-hwarn (long)15269899	VOLTHWARN_MDU 0x00E9000B	Voltage is higher than warn threshold.	Check and decrease ONT SFP voltage.
12	Equ	Warn	N, Y, Y	mdu-sup2-volt-lwarn (long)15269900	VOLTLWARN_MDU 0x00E9000C	Voltage is lower than warn threshold.	Check and increase ONT SFP voltage.
13	Equ	Warn	N, Y, Y	mdu-sup2-bias-hwarn (long)15269901	BIASHWARN_MDU 0x00E9000D	Bias is higher than warn threshold.	Check and decrease ONT SFP bias.
14	Equ	Warn	N, Y, Y	mdu-sup2-bias-lwarn (long)15269902	BIASLWARN_MDU 0x00E9000E	Bias is lower than warn threshold.	Check and increase ONT SFP bias.
Alarm type: 234 Alarm type = Uplink EthSFP (234) - Index1 = ifIndex of Ethernet interface (of port type ‘uplink’), Index2 = not used.							
1	Comm	Crit	Y, Y, Y	uplink-sfp-los (long)15335425	UPLINKSFPLOS 0x00EA0001	Uplink SFP loss-of-signal	Check physical line
2	Comm	Crit	Y, Y, Y	uplink-sfp-tx-fail (long)15335426	UPLINKSFPTXF 0x00EA0002	Uplink SFP Tx failure	Check SFP module
3	Comm	Crit	Y, Y, Y	uplink-sfp-not-prst (long)15335427	UPLINKSFPNP 0x00EA0003	Uplink SFP is not detected	Check SPP
4	Comm	Crit	Y, Y, Y	uplink-sfp-inv-id (long)15335428	UPLINKSFPINVID 0x00EA0004	Uplink SFP does not have valid Nokia ID	Check SFP module ID
5	Comm	Crit	Y, Y, Y	nni-sfp-t-exceed (long)15400965	UPLINKSFPTEMP 0x00EA0005	NNI SFP temperature exceeds the threshold which is same as the temperature to cause board in thermal major alarm.	Chceck SFP temperature
6	Comm	Crit	Y, Y, Y	uplink-sfp-mismatch (long)15335430	UPLINKSFPMISMAT CH 0x00EA0006	Uplink SFP mismatches the configured MAU type	Check SFP type
Alarm type: 235 Alarm type = NNI EthSFP (235) - Index1 = ifIndex of Ethernet interface (of port type ‘NNI), Index2 = not used.							

(201 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
1	Comm	Crit	Y, Y, Y	nni-sfp-los (long)15400961	NNISFPLOS 0x00EB0001	NNI SFP loss-of-signal	Check physical line
2	Comm	Crit	Y, Y, Y	nni-sfp-tx-fail (long)15400962	NNISFPTXF 0x00EB0002	NNI SFP Tx failure	Check SFP module
3	Comm	Crit	Y, Y, Y	nni-sfp-not-prst (long)15400963	NNISFPNP 0x00EB0003	NNI SFP is not detected	Check SPP
4	Comm	Crit	Y, Y, Y	nni-sfp-inv-id (long)15400964	NNISFPINVID 0x00EB0004	NNI SFP does not have valid Nokia ID	Check SFP module ID
5	Comm	Crit	Y, Y, Y	nni-sfp-t-exceed (long)15400965	NNISFPTEMP 0x00EB0005	NNI SFP temperature exceeds the threshold which is same as the temperature to cause board in thermal major alarm.	Chceck SFP temperature
6	Comm	Crit	Y, Y, Y	nni-sfp-mismatch (long)15400966	NNISFPMISMATCH 0x00EB0006	NNI SFP mismatches the configured MAU type	Check SFP type
Alarm type: 236 Alarm type = xDSL_2 (236) - Index1 = ifIndex of Xdsl physical port, Index2 = not used.							
1	Comm	Min	Y, Y, Y	xdsl-ne-lor (long)15466497	LOR 0x00EC0001	Near End Loss of RMC	Check the physical line. Consider review of US RMC configuration
2	Comm	Min	Y, Y, Y	xdsl-fe-lor (long)15466498	LOR 0x00EC0002	Far End Loss of RMC	Check the physical line. Consider review of DS RMC configuration
3	Comm	Min	Y, Y, Y	xdsl-ne-gdr-below-min (long)15466499	LOWGDR 0x00EC0003	Downstream GDR below minimum GDR	Lower the minimum Gamma Data Rate in DS. Consider review of the DS MAXNDR configuration. Check powering and temperature reports.
4	Comm	Min	Y, Y, Y	xdsl-fe-gdr-below-min (long)15466500	LOWGDR 0x00EC0004	Upstream GDR below minimum GDR	Lower the minimum Gamma Data Rate in US. Consider review of the US MAXNDR configuration. Check powering and temperature reports
Alarm type: 237 Alarm type = HGU TR069 CUST Alarm(237) ? For GPON Index1 = gponOntEquipIfIndex (IfIndex of ONT), Index2 = not used. For XGS-PON, XG-PON and NG-PON2 not supported.							
1	Comm	Min	N, Y, Y	cust-alm1 (long)15532033	HGUTR069CUST1 0x00ED0001	HGU TR069 customized alarm 1.	Check the configuration according to the alarm definition to see why failed.
2	Comm	Min	N, Y, Y	cust-alm2 (long)15532034	HGUTR069CUST2 0x00ED0002	HGU TR069 customized alarm 2.	Check the configuration according to the alarm definition to see why failed.

(202 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
3	Comm	Min	N, Y, Y	cust-alm3 (long)15532035	HGUTR069CUST3 0x00ED0003	HGU TR069 customized alarm 3.	Check the configuration according to the alarm definition to see why failed.
4	Comm	Min	N, Y, Y	cust-alm1 (long)15532036	HGUTR069CUST4 0x00ED0004	HGU TR069 customized alarm 4.	Check the configuration according to the alarm definition to see why failed.
5	Comm	Min	N, Y, Y	cust-alm5 (long)15532037	HGUTR069CUST5 0x00ED0005	HGU TR069 customized alarm 5.	Check the configuration according to the alarm definition to see why failed.
6	Comm	Min	N, Y, Y	cust-alm6 (long)15532038	HGUTR069CUST6 0x00ED0006	HGU TR069 customized alarm 6.	Check the configuration according to the alarm definition to see why failed.
7	Comm	Min	N, Y, Y	cust-alm7 (long)15532039	HGUTR069CUST7 0x00ED0007	HGU TR069 customized alarm 7.	Check the configuration according to the alarm definition to see why failed.
8	Comm	Min	N, Y, Y	cust-alm8 (long)15532040	HGUTR069CUST8 0x00ED0008	HGU TR069 customized alarm 8.	Check the configuration according to the alarm definition to see why failed.
9	Comm	Min	N, Y, Y	cust-alm9 (long)15532041	HGUTR069CUST9 0x00ED0009	HGU TR069 customized alarm 9.	Check the configuration according to the alarm definition to see why failed.
10	Comm	Min	N, Y, Y	cust-alm10 (long)15532042	HGUTR069CUST10 0x00ED000A	HGU TR069 customized alarm 10.	Check the configuration according to the alarm definition to see why failed.
11	Comm	Min	N, Y, Y	cust-alm11 (long)15532043	HGUTR069CUST11 0x00ED000B	HGU TR069 customized alarm 11.	Check the configuration according to the alarm definition to see why failed.
12	Comm	Min	N, Y, Y	cust-alm12 (long)15532044	HGUTR069CUST12 0x00ED000C	HGU TR069 customized alarm 12.	Check the configuration according to the alarm definition to see why failed.
13	Comm	Min	N, Y, Y	cust-alm13 (long)15532045	HGUTR069CUST13 0x00ED000D	HGU TR069 customized alarm 13.	Check the configuration according to the alarm definition to see why failed.
14	Comm	Min	N, Y, Y	cust-alm14 (long)15532046	HGUTR069CUST14 0x00ED000E	HGU TR069 customized alarm 14.	Check the configuration according to the alarm definition to see why failed.
15	Comm	Min	N, Y, Y	cust-alm15 (long)15532047	HGUTR069CUST15 0x00ED000F	HGU TR069 customized alarm 15.	Check the configuration according to the alarm definition to see why failed.
16	Comm	Min	N, Y, Y	cust-alm16 (long)15532048	HGUTR069CUST16 0x00ED0010	HGU TR069 customized alarm 16.	Check the configuration according to the alarm definition to see why failed.
17	Comm	Min	N, Y, Y	cust-alm17 (long)15532049	HGUTR069CUST17 0x00ED0011	HGU TR069 customized alarm 17.	Check the configuration according to the alarm definition to see why failed.

(203 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
18	Comm	Min	N, Y, Y	cust-alm18 (long)15532050	HGUTR069CUST18 0x00ED0012	HGU TR069 customized alarm 18.	Check the configuration according to the alarm definition to see why failed.
19	Comm	Min	N, Y, Y	cust-alm19 (long)15532051	HGUTR069CUST19 0x00ED0013	HGU TR069 customized alarm 19.	Check the configuration according to the alarm definition to see why failed.
20	Comm	Min	N, Y, Y	cust-alm20 (long)15532052	HGUTR069CUST20 0x00ED0014	HGU TR069 customized alarm 20.	Check the configuration according to the alarm definition to see why failed.
21	Comm	Min	N, Y, Y	cust-alm21 (long)15532053	HGUTR069CUST21 0x00ED0015	HGU TR069 customized alarm 21.	Check the configuration according to the alarm definition to see why failed.
22	Comm	Min	N, Y, Y	cust-alm22 (long)15532054	HGUTR069CUST22 0x00ED0016	HGU TR069 customized alarm 22.	Check the configuration according to the alarm definition to see why failed.
23	Comm	Min	N, Y, Y	cust-alm23 (long)15532055	HGUTR069CUST23 0x00ED0017	HGU TR069 customized alarm 23.	Check the configuration according to the alarm definition to see why failed.
24	Comm	Min	N, Y, Y	cust-alm24 (long)15532056	HGUTR069CUST24 0x00ED0018	HGU TR069 customized alarm 24.	Check the configuration according to the alarm definition to see why failed.
25	Comm	Min	N, Y, Y	cust-alm25 (long)15532057	HGUTR069CUST25 0x00ED0019	HGU TR069 customized alarm 25.	Check the configuration according to the alarm definition to see why failed.
26	Comm	Min	N, Y, Y	cust-alm26 (long)15532058	HGUTR069CUST26 0x00ED001A	HGU TR069 customized alarm 26.	Check the configuration according to the alarm definition to see why failed.
27	Comm	Min	N, Y, Y	cust-alm27 (long)15532059	HGUTR069CUST27 0x00ED001B	HGU TR069 customized alarm 27.	Check the configuration according to the alarm definition to see why failed.
28	Comm	Min	N, Y, Y	cust-alm28 (long)15532060	HGUTR069CUST28 0x00ED001C	HGU TR069 customized alarm 28.	Check the configuration according to the alarm definition to see why failed.
29	Comm	Min	N, Y, Y	cust-alm29 (long)15532061	HGUTR069CUST29 0x00ED001D	HGU TR069 customized alarm 29.	Check the configuration according to the alarm definition to see why failed.
30	Comm	Min	N, Y, Y	cust-alm30 (long)15532062	HGUTR069CUST30 0x00ED001E	HGU TR069 customized alarm 30.	Check the configuration according to the alarm definition to see why failed.
31	Comm	Min	N, Y, Y	cust-alm31 (long)15532063	HGUTR069CUST31 0x00ED001F	HGU TR069 customized alarm 31.	Check the configuration according to the alarm definition to see why failed.
Alarm type: 238 Alarm type = EquipPSUAlarms Alarm (238) - Index1 = eqptHolderId (index in equipment holder Table), Index2 = not used							

(204 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
1	Equ	Crit	Y, Y, Y	psu-fail-crit (long)15597569	PSU_CRIT 0x00EE0001	Critical failure due to combination of PSU A and PSU B non-critical failures. Service affecting.	Open the box and check / replace both PSU Units.
2	Equ	Maj	N, Y, Y	psu-a-fail-presence (long)15597570	PSU_A_PRES 0x00EE0002	Presence signal of PSU has dropped. Loadsharing PSU has taken over.	Open the box and check / replace the affected PSU.
3	Equ	Maj	N, Y, Y	psu-a-fail-vin-ac-nok (long)15597571	PSU_A_VIN_AC_NOK 0x00EE0003	PSU input voltage failure. Input AC voltage is NOK (can be under or over voltage).	Open the box and check the input (coax /filter/PSU) of the affected PSU.
4	Equ	Maj	N, Y, Y	psu-a-fail-vin-uv (long)15597572	PSU_A_VIN_UV 0x00EE0004	PSU input voltage failure. Input voltage has dropped below lower threshold.	Open the box and check the input (coax /filter/PSU) of the affected PSU.
5	Equ	Maj	N, Y, Y	psu-a-fail-vin-ov (long)15597573	PSU_A_VIN_OV 0x00EE0005	PSU input voltage failure. Input voltage has risen above safe threshold.	Open the box and check the input (coax /filter/PSU) of the affected PSU.
6	Equ	Maj	N, Y, Y	psu-a-fail-vout-uv (long)15597574	PSU_A_VOUT_UV 0x00EE0006	PSU output voltage failure. Output voltage has dropped below safe operating threshold.	Open the box and check / replace the affected PSU.
7	Equ	Maj	N, Y, Y	psu-a-fail-vout-ov (long)15597575	PSU_A_VOUT_OV 0x00EE0007	PSU output voltage failure. Output voltage has risen above safe operating threshold.	Open the box and check / replace the affected PSU.
8	Equ	Maj	N, Y, Y	psu-a-fail-iout-oc (long)15597576	PSU_A_IOUT_OC 0x00EE0008	PSU output over current failure detected.	Check the power consumption of the box using show equipment power-supply, if out of bound check / replace PSU.
9	Equ	Maj	N, Y, Y	psu-a-fail-overtemp (long)15597577	PSU_A_TEMP_OT 0x00EE0009	PSU over temperature failure detected.	Open the box and check consistency if required replace the affected PSU.
17	Equ	Maj	N, Y, Y	psu-b-fail-presence (long)15597585	PSU_B_PRES 0x00EE0011	Presence signal of PSU has dropped. Loadsharing PSU has taken over.	Open the box and check / replace the affected PSU.
18	Equ	Maj	N, Y, Y	psu-b-fail-vin-ac-nok (long)15597586	PSU_B_VIN_AC_NOK 0x00EE0012	PSU input voltage failure. Input AC voltage is NOK (can be under or over voltage).	Open the box and check the input (coax /filter/PSU) of the affected PSU.
19	Equ	Maj	N, Y, Y	psu-b-fail-vin-uv (long)15597587	PSU_B_VIN_UV 0x00EE0013	PSU input voltage failure. Input voltage has dropped below lower threshold.	Open the box and check the input (coax /filter/PSU) of the affected PSU.
20	Equ	Maj	N, Y, Y	psu-b-fail-vin-ov (long)15597588	PSU_B_VIN_OV 0x00EE0014	PSU input voltage failure. Input voltage has risen above safe threshold.	Open the box and check the input (coax /filter/PSU) of the affected PSU.

(205 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
21	Equ	Maj	N, Y, Y	psu-b-fail-vout-uv (long)15597589	PSU_B_VOUT_UV 0x00EE0015	PSU output voltage failure. Output voltage has dropped below safe operating threshold.	Open the box and check / replace the affected PSU.
22	Equ	Maj	N, Y, Y	psu-b-fail-vout-ov (long)15597590	PSU_B_VOUT_OV 0x00EE0016	PSU output voltage failure. Output voltage has risen above safe operating threshold.	Open the box and check / replace the affected PSU.
23	Equ	Maj	N, Y, Y	psu-b-fail-iout-oc (long)15597591	PSU_B_IOUT_OC 0x00EE0017	PSU output over current failure detected.	Check the power consumption of the box using show equipment power-supply, if out of bound check / replace PSU.
24	Equ	Maj	N, Y, Y	psu-b-fail-overtemp (long)15597592	PSU_B_TEMP_OT 0x00EE0018	PSU over temperature failure detected.	Open the box and check consistency if required replace the affected PSU.
Alarm type: 239 Alarm type = ONT protection (239) - For NG-PON2 Index1 = Index1 = ng2MobilityOntIndex (IfIndex of ONT), Index2 = not used. For GPON, XGS-PON and XG-PON not supported.							
1	Equ	Maj	N, Y, Y	ont-prot-not-available (long)15663105	ONTPROTNOTAVAIL 0x00EF0001	ONT protection is currently not available.	Check availability of the preferred or protecting channel pair for this ONT.
Alarm type: 240 Alarm type = Ethernet Ring (240) - Index1 = Index1 = ethRingInstanceId (uniquely identifies the instance of the ERPS ring), Index2 = ethRingPathIndex (Index of the path attached to a ethernet ring instance)							
1	Comm	Min	N, Y, Y	ethernet-ring-pthfwst (long)15728641	ETHERNETRING_PATHFWSTATE 0x00F00001	Raised when the Ring Path state is blocked and Cleared when the ring path state is forward or shutdown of Ring instance or path.	Check for the connectivity break down of the reported path on the Eth-Ring.
2	Comm	Min	N, Y, Y	ethernet-ring-fop-to (long)15728642	ETHERNETRING_FOPTIMEOUT 0x00F00002	Raised when an eth-ring node does not receive any R-APS messages for 3.5 times the interval.	Check for the connectivity break down of the reported path on the Eth-Ring.
3	Comm	Min	N, Y, Y	ethernet-ring-fop-pm (long)15728643	ETHERNETRING_FOPPM 0x00F00003	Raised when a node configured as an RPL owner in an ERPS Ring receives an NR-RB with a node ID different from its own node ID and cleared when the node is not receiving any NR-RB packets for a period of (k * RAPS Frame Interval) sec, where 3.25 is smaller or equal then k and k is smaller or equal then 3.5.	Check configurations, two or more nodes are configured as an RPL owner in a ring, make the owner unique in an ERPS Ring Instance.

(206 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
Alarm type: 241 Alarm type = Secondary MEGACO Termination (241) - Index1 = Voice signaling board slot id / EquipmentId (The format is like Rack_Id/Shelf_Id/Slot_Id/EquipmentId. EquipmentId is a identifier of the NE holding the board in voice signaling board), Index2 = accTerminationUserPortId (identifier of the user port).							
1	Comm	Maj	Y, Y, Y	meg-unknown-sub-sec (long)15794177	UNSUB_S 0x00F10001	The Megaco subscriber exists in voice signaling board but not in media gateway controller. Additional Info: secondary MEGACO termination.	Check user port identification.
6	Comm	Maj	Y, Y, Y	line-showering-sec (long)15794182	LINESHOWER_S 0x00F10006	A subscriber line exceeds 20 off-hook / on-hook events / minute. Additional Info: secondary MEGACO termination.	Check the subscriber line, find the confused lines.
Alarm type: 242 Alarm type = SIP Secondary Termination (242) - Index1 = IfIndex of PSTN physical port, Index2 = not used.							
7	Comm	Maj	Y, Y, Y	reg-domainname-sec (long)15859719	SIPREGDNSEC 0x00F20007	SIP registration failure, because of resolve domain name failure. Additional info: secondary SIP termination.	Check domain name
8	Comm	Maj	Y, Y, Y	reg-auth-sec (long)15859720	SIPREGAUTHSEC 0x00F20008	SIP registration failure, because of authenticate failure. Additional info: secondary SIP termination.	Check auth element
9	Comm	Maj	Y, Y, Y	reg-timeout-sec (long)15859721	SIPREGTOSEC 0x00F20009	SIP registration failure, because of message timeout. Additional info: secondary SIP termination.	Check network
10	Comm	Maj	Y, Y, Y	reg-srvfailresp-sec (long)15859722	SIPREGFRSPSEC 0x00F2000A	SIP registration failure, because of failure response from server. Additional Info: secondary SIP termination: SIP error response received from the registrar server.	Check SIP server
11	Comm	Maj	Y, Y, Y	inv-domainname-sec (long)15859723	SIPINVDNSEC 0x00F2000B	SIP invite failure, because of resolve domain name failure. Additional info: secondary SIP termination.	Check domain name
12	Comm	Maj	Y, Y, Y	inv-auth-sec (long)15859724	SIPINVAUTHSEC 0x00F2000C	SIP invite failure, because of authenticate failure. Additional info: secondary SIP termination.	Check auth element
13	Comm	Maj	Y, Y, Y	inv-timeout-sec (long)15859725	SIPINVTOSEC 0x00F2000D	SIP invite failure, because of message timeout. Additional info: secondary SIP termination.	Check network

(207 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
14	Comm	Maj	Y, Y, Y	inv-srvfailresp-sec (long)15859726	SIPINVFRSPSEC 0x00F2000E	SIP invite failure, because of failure response from server. Additional info: secondary SIP termination.	Check SIP server
15	Comm	Maj	Y, Y, Y	subs-srvfailresp-sec (long)15859727	SIPSUBSFRSPSEC 0x00F2000F	SIP subscribe failure, because of failure response from server. Additional info: secondary SIP termination.	Check SIP server
16	Comm	Maj	Y, Y, Y	subs-domainname-sec (long)15859728	SIPSUBSDNSEC 0x00F20010	SIP subscribe failure, because of resolve domain name failure. Additional info: secondary SIP termination.	Check domain name
17	Comm	Maj	Y, Y, Y	subs-auth-sec (long)15859729	SIPSUBSAUTHSEC 0x00F20011	SIP subscribe failure, because of authenticate failure. Additional info: secondary SIP termination.	Check auth element
18	Comm	Maj	Y, Y, Y	subs-refreshfail-sec (long)15859730	SIPSUBSRFSEC 0x00F20012	SIP subscribe refresh failure, because of message timeout. Additional info: secondary SIP termination.	Check network
19	Comm	Maj	Y, Y, Y	subs-inittimeout-sec (long)15859731	SIPSUBSTOSEC 0x00F20013	SIP subscribe initial failure, because of message timeout. Additional info: secondary SIP termination.	Check network
20	Comm	Min	N, Y, Y	emergency-call-sec (long)15859732	SIPEMERGCALLSEC 0x00F20014	Emergency call is ongoing. Additional info: secondary SIP termination. When emergency call finish, it will be cleared.	When emergency call finish, it will be cleared
Alarm type: 244 Alarm type = CAS R2 Channel (244) - Index1 = IfIndex of CAS R2 physical port, Index2 = channel-id.							
1	Comm	Maj	Y, Y, Y	exp-seizureack (long)15990785	CHBLKSEIACK_S 0x00F40001	Channel was blocked due to failure in the reception of the SEIZURE ACK signal.	1. Determine whether problem is due to physical interface cabling or due to actual failure of signal from far end E1 equipment. 2. If no physical cabling problem exists, check far-end E1 transmit capabilities.
2	Comm	Maj	Y, Y, Y	exp-disconack (long)15990786	CHBLKDISACK_S 0x00F40002	Channel was blocked due to failure in the reception of the DISCONNECTION ACK signal.	1. Determine whether problem is due to physical interface cabling or due to actual failure of signal from far end E1 equipment. 2. If no physical cabling problem exists, check far-end E1 transmit capabilities.

(208 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
3	Comm	Maj	Y, Y, Y	exp-forcerelack (long)15990787	CHBLKRELACK 0x00F40003	Channel was blocked due to failure in the reception of the BACKWARD DISCONNECTION ACK signal.	1. Determine whether problem is due to physical interface cabling or due to actual failure of signal from far end E1 equipment. 2. If no physical cabling problem exists, check far-end E1 transmit capabilities.
Alarm type: 246 Alarm type = LldpMed (246) - Index1 = IfIndex of GPON UNI or NGPON2 UNI. Index2 = not used.							
1	Equ	Min	Y, Y, Y	lldpmed-portcfg-mis (long)16121857	LLDPMED_ENUM_PT 0x00F60001	A condition meaning that the ONT did not accept the configuration requests for the provisioned LLDPMed Port Configuration.	.
2	Equ	Min	Y, Y, Y	lldpmed-mediapl-mis (long)16121858	LLDPMED_ENUM_MP 0x00F60002	A condition meaning that the ONT did not accept the configuration requests for the provisioned LLDPMed Media Policy.	.
Alarm type: 247 Alarm type = PseudoWire (247) - Index1 = IfIndex of E1 physical port. Index2 = not used.							
1	Comm	Maj	Y, Y, Y	packet-loss (long)16187393	PACKETLOSS 0x00F70001	When the CESoPSN IWF enters or exits the packet loss state, Comcerto reports the appropriate indication messages to Host.	1. Determine whether problem is due to network problem or misconfiguration. 2. In case no network problem, check for misconfiguration of the pseudowire service between endpoints.
2	Comm	Maj	Y, Y, Y	remote-packet-loss (long)16187394	REMOTEPACKETLOSS 0x00F70002	When remote packet loss is detected (if enabled), Comcerto reports the appropriate indication message. Remote packet loss is indicated by reception of packets with their CW R bit set.	1. Determine whether problem is due to network problem or misconfiguration. 2. In case no network problem, check for misconfiguration of the pseudowire service between endpoints.
3	Comm	Maj	Y, Y, Y	no-dsp-resource (long)16187395	NODSPRESOURCE 0x00F70003	When the system allocation DSP resource failed, report indication message to Host.	1. Determine whether problem is due to no enough DSP resource or misconfiguration. 2. In case no enough DSP resource, check for misconfiguration of the pseudowire service between endpoints. 3. In case no enough DSP resource and no misconfiguration, operator should reduce the number of DS0 channel or delete this pseudo wire.

(209 of 210)

No.	Class	Sev.	SA, DR, DL	CLI alarm (code value)	TL1 alarm (code value)	Description	Repair action
Alarm type: 248 Alarm type = LAG (248) - Index1 = IfIndex of LAG, Index2 = not used.							
1	Comm	Maj	Y, Y, Y	la-down (long)16252929	LACPGROUPDOWN 0x00F80001	The LAG is operationally down.	Check LAG configuration or link of eth ports in the LAG.
2	Comm	Maj	N, Y, Y	la-standby-na (long)16252930	BACKPORTLACK 0x00F80002	The number of operational link is lower than or equal to the threshold of cross-lt LAG.	Check link of eth ports on standby slot.
3	Comm	Maj	Y, Y, Y	la-switch-fail (long)16252931	LACPGROUPSWFAIL 0x00F80003	There is a problem in switching over. Standby slot did not respond the switchover request from active slot.	Check whether standy slot is busy or blocked.
4	Comm	Maj	Y, Y, Y	la-degrade (long)16252932	LACPGROUPDEGRADE 0x00F80004	The number of active ports is less than the MIN(number of configured member ports on the active LT, maximum active port number). There is more than one port in the LAG and at least one port is admin up.	Check the LAG configuration or the number of active ports in the LAG.
Alarm type: 250 Alarm type = LT internal port (250) Index1 = index of LSM GE Uplink port, Index2 = NTA or NTB.							
1	Comm	Crit	Y, Y, Y	fcs-thresh-exceed (long)16384001	FCS_NUM_EXCEED_THRESHOLD 0x00FA0001	The number of failed 40G-KR4 initialization attempts is exceeded, i.e. FCS errors are detected on either the LT backplane or internal 40G-KR4 interfaces.	Replace the LT or disable 40G-KR4 for that slot.

(210 of 210)

Appendixes

3 Additional information syntax

3 Additional information syntax

3.1 Additional information syntax

3.1 Additional information syntax

When an alarm supports the “Additional Info” field, the following items must be considered:

- the order of the parameters will be fixed per alarm type. Order is defined by the alarm
- additional Info can contain two Ascii strings. The first string is used by TL1, CLI and AMS. The second string is only for AMS, in order to have all required SNMP object IDs map the alarm correctly. Consider the following:
  - the Ascii strings are always NULL terminated
  - each of the two strings can be empty, and this is indicated in the alarm description as ""
  - for multiple parameters, parameters shall be separated by a comma ","
  - optional parameters will have no value (i.e., no value between 2 separating commas) or a reserved/fixed value when not present (i.e., C-VLAN will be set to 0 when not present). This fixed value will be zero (i.e., "0")unless otherwise stated
  - MAC addresses will contain a dash between fields (e.g., 12-34-56-78-90-12)
  - IPv4 addresses will contain a period, "." between fields (e.g., 192.168.1.1)
  - IPv6 addresses will use notation with 8 hexadecimal words. Leading zeros can be omitted, as can a single series of succeeding zeros (e.g., 2001:DB8:0:0:2AA:FF:FE3F:2A1C *or* 2001:DB8::2AA:FF:FE3F:2A1C)
  - other values are in decimal format or in hex when preceded with "0x"
- additional Info will *not* contain a parameter name. Parameter names must be added by the Element Manager with the parameter name followed by ":" and then the value
- the maximum length of Additional Info content is 160 bytes
- some alarms contain the parameter VlanId as part of their additional info. (e.g., Alarm type = VLANPort [175], alarm number 1). Figure 1 shows the format of the 32-bit field (for VlanId):
- the amount of additional information entries available in the system is restricted and lower than the total amount of available alarm entries. when a lot of alarms are generated that contain additional information, the additional information entries can be used up. In this case, the system will not add the additional information anymore to the newly generated alarms that have additional information as long as all additional information entries are used up. As soon and additional information entries become free again, for example; when an old alarm containing additional information is cleared, or when alarm delta log table entries containing additional information are freed, the system will start again to add additional information to the alarms when applicable.

Figure 1 **VlanID as part of additional information**

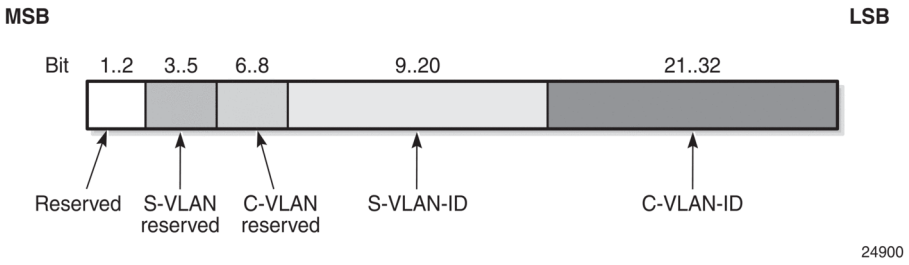

Customer Document and Product Support

Customer Documentation

Customer Documentation Welcome Page

Technical Support

Product Support Portal

Documentation Feedback

Customer Documentation Feedback

© 2016-2020 Nokia.
3HH-13538-AAAA-TCZZA