

Collision Repair Information Bulletin

FOR THE COLLISION REPAIR PROFESSIONAL

TITLE:	Welded Outer Panel Replacement	2020-194
SECTION:	Non-Structural	Page 1 of 1
APPLICABLE VEHICLES:	All Toyota & Lexus	
DATE:	March 2020	

Welded Outer Panel Repair Precautions:


- Collision Repair Manuals found on [TIS](#) provide information about the vehicle such as:
 - Work notices and precautions for Welding and SRS Airbag System.
 - Welding for Outer Panel replacement. Note: Outer welded panels are considered Rephosphorized/mild steel (Not high strength steel).
 - High Strength and UHSS Ultra High Strength Steel can be identified by the Structural Outline.
- Limit heat-affect to the panel being welded and to nearby High Strength Steel and Ultra High Strength Steel components.
- Corrosion protection material must be applied to back-side of weld heat-affect areas.
- Follow corrosion protection outlined in CRIB #186

Cut and Join Locations:

Minor damage to welded outer panels may not require replacement of an entire rephosphorized steel service part at published cut and join locations. Partial replacement of the component may minimize intrusion and provide a more stream-lined repair. This includes non-structural panels that have full procedures listed in the collision repair manual.

Approved Joining Methods:

For welded outer panel replacement, butt welding is the preferred method of attachment. However, when butt welding is not possible, lap welding, flanging and backing are approved alternative joining methods. When alternative joining methods are used, limit overlap to improve corrosion protection coverage. Ensure appropriate corrosion prevention coatings are applied to the backside of all welded locations.

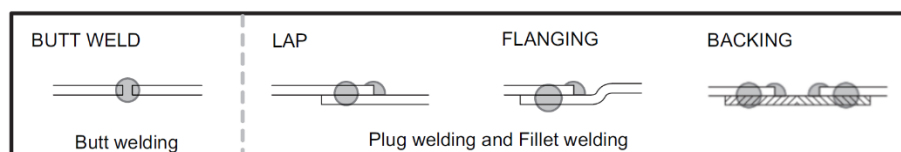

For more information on this and other important collision repair topics visit the Toyota Technical Information System (TIS) www.techinfo.toyota.com