

COLLISION REPAIR INFORMATION BULLETIN



SUBJECT:	REFINISH PROCEDURES FOR PANELS WITHOUT BODY LINES		
BULLETIN NO.:	TS-TCI-CRIB-2034	DATE ISSUED:	May, 2013
MODELS:	All Toyota & Scion Models	SECTION:	Refinish

Toyota and Scion vehicles offer eye-pleasing customer appeal associated with leading edge technology. As body styles continue to get smoother and more aerodynamic, refinish technicians can face difficult decisions in meeting customer expectations when refinishing smooth panels without body lines.



Historically, refinish technicians used a technique called “solvent blending” on areas without character or body lines. This system worked well on certain older technology thermoplastic/thermoset finishes. However, vehicles today utilize more advanced paints applied at the factory that do not necessarily easily lend themselves to this type of repair procedure. The reason is simple; the bond between the OEM finish and the newly applied refinish paint do not “blend” or “melt” into one another.

Problems directly attributed to solvent blending are:

- Peeling: caused by poor adhesion between the original factory coat and refinish coat.
- Visible paint lines: caused by polishing, buffing or detailing the thin resin area.
- Fading: caused by ultra-violet sunlight.

NOTE: Issue of this Collision Repair Information Bulletin by Toyota Canada Inc. is to ensure that proper repair information is available. It does not constitute an authorization for repair. PLEASE ROUTE THIS BULLETIN TO YOUR COLLISION REPAIR CENTER MANAGER AND COLLISION & REFINISH TECHNICIANS.



TS–TCI–CRIB–2034

May, 2013

REFINISH PROCEDURES FOR PANELS WITHOUT BODY LINES

To meet these challenges, and maintain environmental compliance, Toyota/Scion recommends the following procedure when restoring your customer's vehicle:

- Remove any moldings, trim, removable components (i.e.: door handles, logos, lights, etc.) from the panel as well as any adjacent panel being painted. Top coat must be applied to the whole panel including under the removed components.
- Mask the vehicle as usual to prevent overspray.
- Chemically clean the vehicle prior to any spray application.
- Apply base color coat to the spot repair site.
- Spray into the adjacent panel as necessary for an undetectable color match.
- Apply the first coat of urethane clear coat to the repair site only.
- For a two clear coat system, spray only the second coat to the end of the panel.
- For a three clear coat system, spray only the final coat to the end of the panel.

The process is virtually the same for refinishing any panel, but to obtain really professional results, the difference is where the application of the last top coat (solid paint or clear coat) ends. Properly spraying the final full coat insures maximum adhesion, ultra-violet sunlight protection and is environmentally safer compared to using over-reduced clear coats. Using over-reduced clear coats during a solvent blend does not provide the same level of high quality repairs for newer models with factory clear coat.

As Illustration A below shows, the vehicle has no body lines or drip rails that break up the quarter panel from the roof, the opposing quarter panel and the A-pillar, therefore, applying the last coat of clear coat to the nearest panel edge is necessary to help ensure a professional looking finish. In the illustration shown, when painting the left quarter panel, the final coat must extend into the roof, the left A-pillar, the right quarter panel and the right A-pillar. All trim (i.e.: rubber window mouldings, door handles, trim, etc.) and any headlights/tail lights must be removed to ensure the final coat is under those components to prevent visible paint lines. This will also help ensure that peeling will not occur in or near those locations due to poor adhesion between the original factory and refinish coat. By doing so, the finish will not be affected by ultra-violet sunlight.

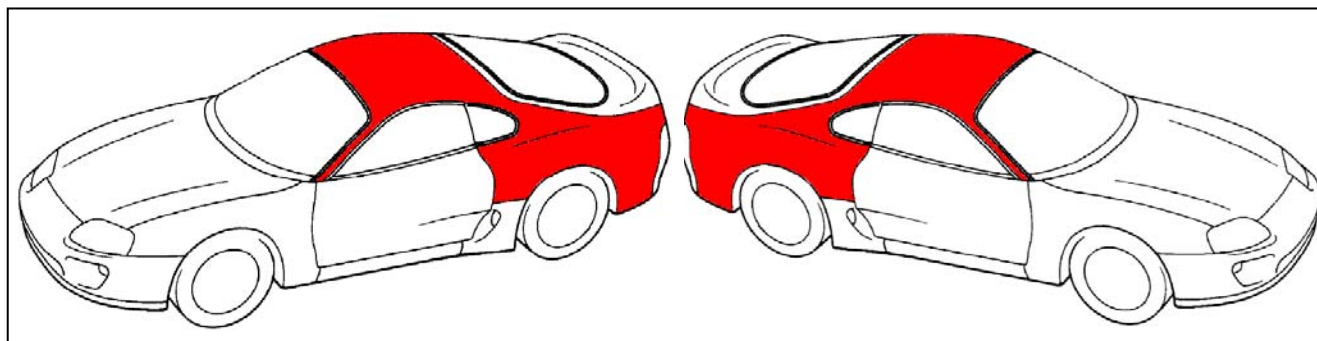


Illustration A




TS-TCI-CRIB-2034

May, 2013

REFINISH PROCEDURES FOR PANELS WITHOUT BODY LINES

If a character or body line does exist however, using a method known as “reverse taping” is recommended. This procedure is well known in the automotive refinishing industry. Reverse taping is performed by taping half of the sticky side of the tape on the part of the car you want to protect, rolling the other half up and back loosely and hold it with a few tabs of tape. This leaves only a soft edge of the sticky side of the tape and if removed while the paint is wet will leave almost no visible paint edge.

Most newer generation vehicles incorporate a drip edge moulding on the roof to break up larger panels like the quarter panel from the roof as shown in Illustration B to the right. This is very helpful when faced with the same situation as above with a quarter panel repair. When a roof drip edge moulding is present, only the quarter panel, the small section of the roof above the doors up to the moulding and the A-pillar on the same side will require refinishing.

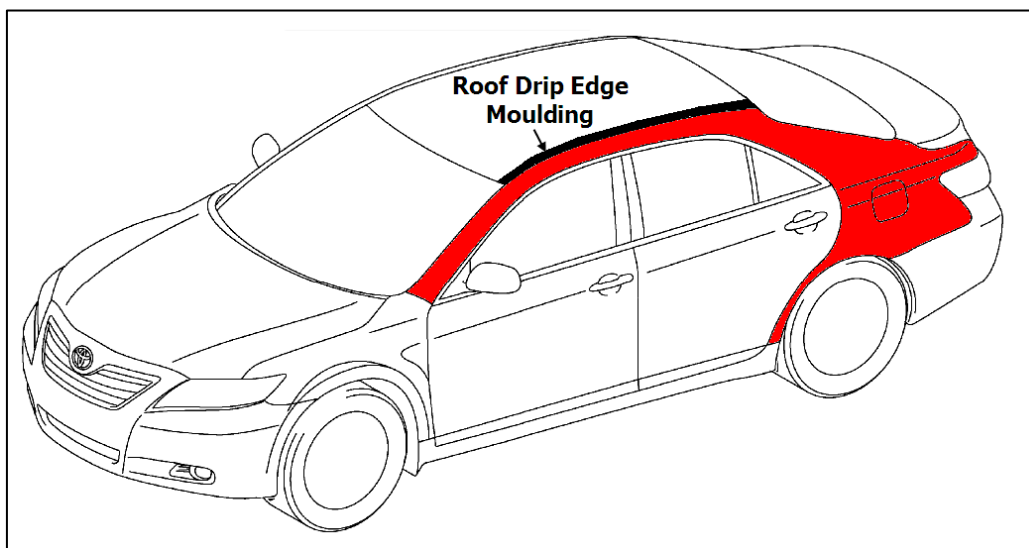**Illustration B**


For specific Toyota/Scion guidelines for professional painting techniques, please refer to the next two pages of this bulletin for recommended paint refinishing processes. Always follow the proper safety procedures and use any required protective clothing or equipment when carrying out the operations described in this bulletin.



TS-TCI-CRIB-2034

May, 2013

REFINISH PROCEDURES FOR PANELS WITHOUT BODY LINES

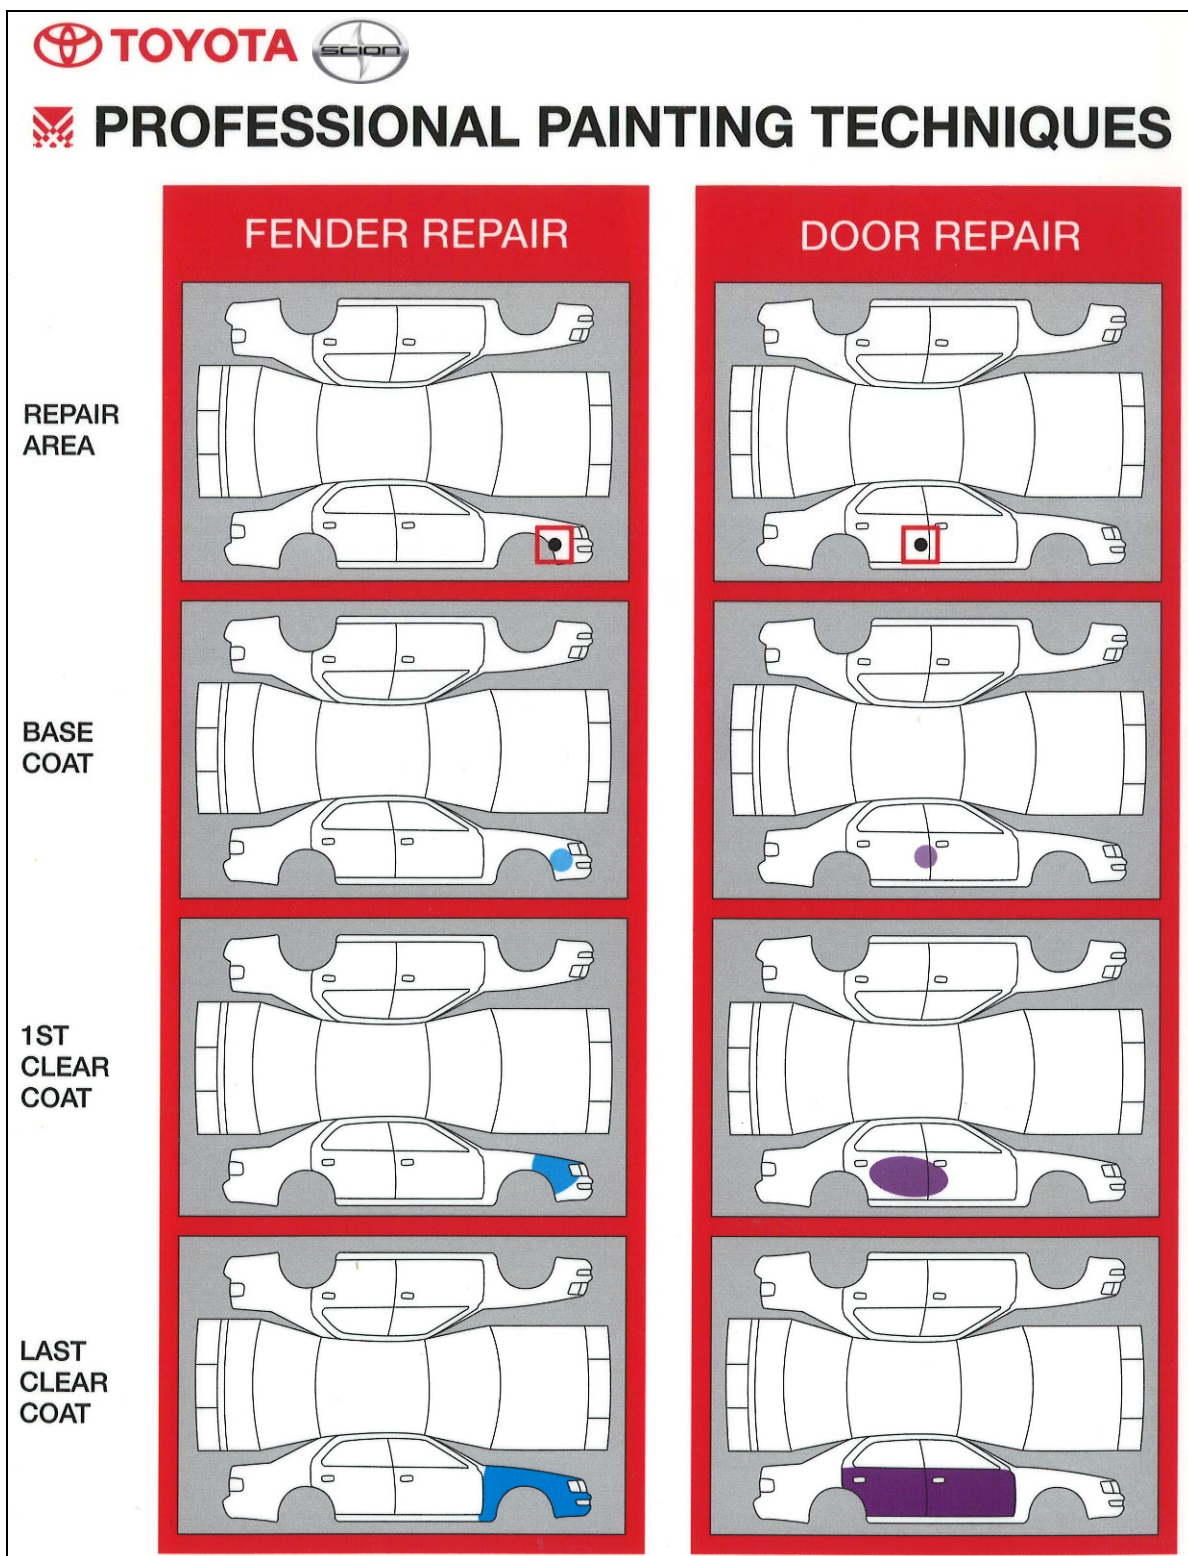



TS-TCI-CRIB-2034

May, 2013

REFINISH PROCEDURES FOR PANELS WITHOUT BODY LINES

TOYOTA

PROFESSIONAL PAINTING TECHNIQUES

	QUARTER PANEL REPAIR See Note ♦1 Below	HOOD REPAIR
REPAIR AREA		
BASE COAT		
1ST CLEAR COAT		
LAST CLEAR COAT		

♦1 When no body lines or drip rails exist. For vehicles with a body line of drip rail, refer to the Illustration B on page 3 of this bulletin.