Printed holders: what goes where

Every tower gets the same three holders. Each holder carries one device that is taped to the tower now; the chopper, ESCON and motor unit stay where they are.

Printed part (file)	Device it carries	Device held by	Holder fixed to tower by
DIN-rail mount (iaa100_din_mount.stl)	Futek IAA100 force amplifier (small black box, load-cell cable)	nothing: the IAA100 clicks onto the rail	2 x M6x16 + 2 T-nuts, one slot
24 V plate (rs15_plate.stl)	Mean Well RS-15-24 (small 24 V supply)	2 x M3x6 from the back	2 x M6x16 + 2 T-nuts, one slot
48 V brackets A + B (rsp2000_brackets.stl; B alone: rsp2000_bracket_B.stl)	Mean Well RSP-2000-48 (large 48 V supply, 1.95 kg)	A: 2 x M4x12, B: 1 x M4x12, from the back	2 x M6x16 + 2 T-nuts each, both slots of one face

Per tower / for all 4 towers

Printed: 1 DIN-rail mount, 1 24 V plate, 1 pair of 48 V brackets / 4, 4, 4 pairs.
Screws: 8 x M6x16 button head, 8 slot-10 T-nuts, 2 x M3x6, 3 x M4x12 / 32, 32, 8, 12.

Before you start

1. Power: the tower's power strip unplugged from the wall. Mains wiring (230 V side of both supplies) stays with the electrician.
2. T-nuts: slide-in T-nuts only go in from the end of the profile. If the profile ends are blocked (motor unit on top, floor mount at the bottom), use drop-in (swivel / hammer-head) slot-10 T-nuts: they go in from the front and turn 90 degrees when tightened.
3. Fit: done with the fit-check print (2026-10-22): the key (0.2 mm clearance) slides into the slot without play. Keep it for all parts.
4. Always fit the device to its holder first, then the holder to the tower.

Words used

1. Key: the 9.6 mm ridge on the back of each holder. It sits in the profile slot and stops the holder from turning.
2. Slot: the groove along each face of the aluminium profile. Each 90 mm face has two slots, 45 mm apart.
3. Face: one of the four flat sides of the tower profile.

What to print now

Fit-check print (2026-10-22): IAA100 mount and RS-15 plate fit the devices, 48 V bracket A fits the supply's cable end. Two changes since then: the RS-15 plate is longer (M6 holes moved out: one hit the end stop, the other sat under the mains cables), and bracket B (fan end) was never in the fit check.

File (hardware/enclosures/out/)	How many	Bed size (mm)	Note
rs15_plate.stl	4 (1 per tower)	128 x 51 x 14	new version; the fit-check RS-15 plate is not used
rsp2000_bracket_B.stl	1	62 x 107 x 18	completes tower 1 with the fit-check bracket A
rsp2000_brackets.stl	3 (A + B each)	62 x 224 x 18	towers 2-4; ASA, or PETG with 40 %+ infill
iaa100_din_mount.stl	3	100 x 40 x 15	towers 2-4; the fit-check one is tower 1's


Print settings (same as the fit check, which printed fine)

1. Flat, key side down, exactly as exported: no part is taller than 18 mm. Do not stand parts on end (that toppled 4 times, 2026-10-19).
2. Supports from the build plate under the plate wings (2.5 mm) and under the DIN rail flanges.
3. Do not scale and do not thicken the key, the 5 mm plate under the M6 heads or the hole positions: they set the fit.
4. PETG or ASA. The 48 V brackets carry 1.95 kg and get warm: ASA, or PETG with 40 % or more infill.

Where on the tower (recommended)

Heights are not fixed: put each holder where its cables reach without strain. If a device is already taped at a spot that works, put its holder right there. The layout below is the recommended starting point.

Seen from above

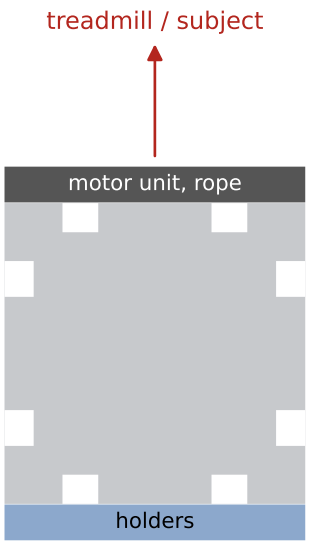


back face: electronics

Put the holders on the face pointing away from the treadmill: the rope side stays clear and nobody on the treadmill can touch the 48 V parts. A side face is fine if the back is blocked.

Rules behind the layout


1. IAA100: within reach of the load-cell cable (the load cell hangs in the rope near the eyebolt), and of the 5-wire signal cable.
2. RS-15-24 next to the IAA100: its +V / -V go to IAA100 pins 1 / 2. Its 230 V terminals face away from hands; the electrician covers them.
3. IAA100 and RS-15 use the same slot, one above the other (side by side they would overlap by 0.5 mm). The RS-15 plate is 128 mm long.
4. RSP-2000 low on the tower: 1.95 kg, close to the power strip and to the chopper (its +V / -V go to chopper pins 4 / 5). Hang it along the profile, both brackets in both slots, fans at the ends not blocked, 10 mm air gap behind.
5. Leave a hand's width free around the chopper and ESCON: they get warm.

Back face from behind
(heights not to scale)

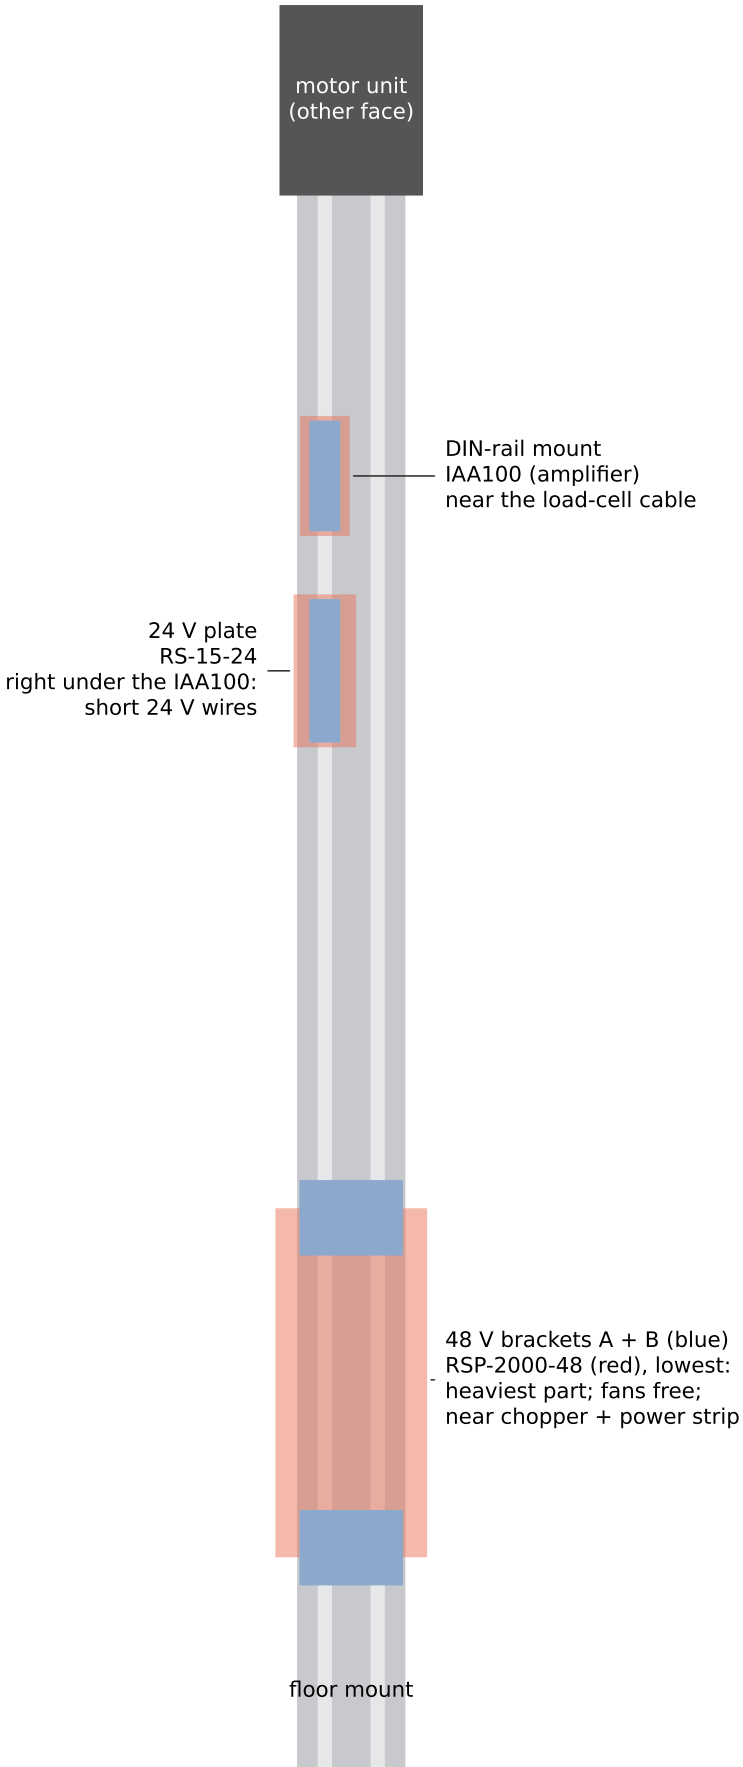


1. IAA100 on the DIN-rail mount

The printed part

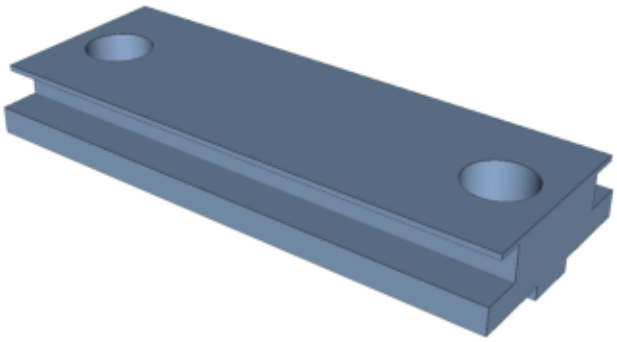

On the profile (grey), device (red)

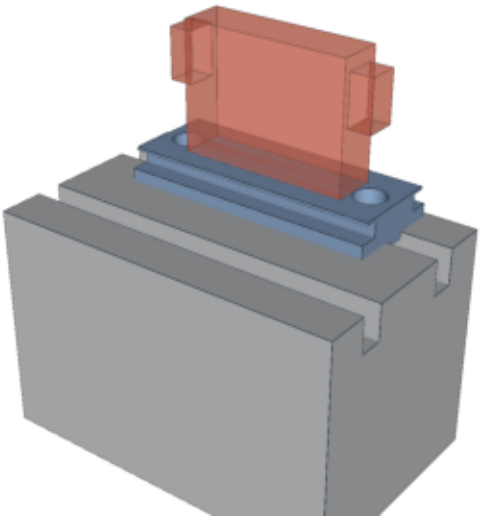

Holds the Futek IAA100 force amplifier (now taped) on the tower. The IAA100 has a spring DIN clip on its back; this part is a short 35 mm DIN rail that bolts into one slot, so the amplifier clicks on and off without screws.

Steps


1. Choose a slot on the tower face near the load cell cable; slide 2 slot-10 T-nuts into it, about 80 mm apart.
2. Put the mount on with the key in the slot and the rail facing out; bolt it with 2 M6 bolts through the holes at the ends (reach them through the openings in the rail).
3. Hook the top of the IAA100's DIN clip over the rail, press the bottom until it clicks.
4. Orientation: sensor plug (4-pin) toward the load cell, power/output plug (5-pin) toward the breadboard cable.
5. To remove: pull the clip's spring tab down (small screwdriver) and tilt the amplifier off.

Check


Push the amplifier: it does not move. Load-cell cable and signal cable reach without pulling.

2. RS-15-24 on the 24 V plate

The printed part

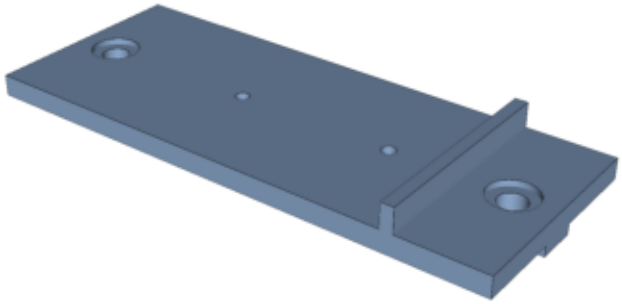

On the profile (grey), device (red)

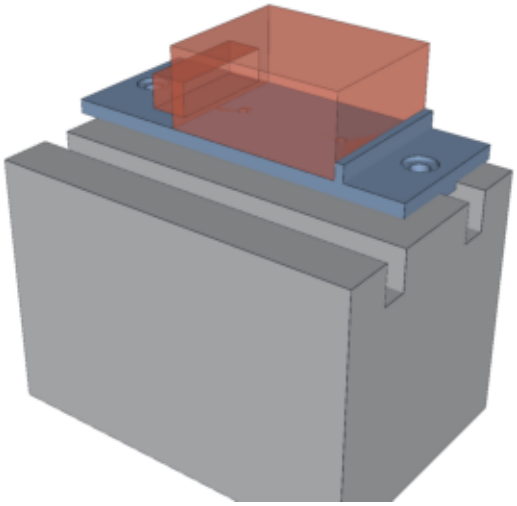

Holds the Mean Well RS-15-24, the 24 V supply of the force amplifier (now taped). Fixed by the supply's own 2 M3 holes; an end stop keeps it square.

Steps


1. Mains first: the supply stays unplugged; its 230 V terminals are wired and covered only by the electrician.
2. Put the supply on the plate, the end stop against the end opposite the screw terminals.
3. From the back of the plate, screw 2 M3 x 6 screws into the supply's bottom holes (max 3 mm into the case: no longer screws).
4. Slide 2 slot-10 T-nuts into a slot, 128 mm free; bolt the plate on with 2 M6 bolts through the holes at both ends (the one at the terminal end is 25 mm past the supply, away from the mains cables).
5. Route the 24 V output (+V, -V) to the IAA100 power plug (pin 1 +Vin, pin 2 GND).

Check


Supply sits flat against the end stop; screws not longer than M3x6 (max 3 mm into the case). Both M6 heads clear: the mains cables do not touch the one at the terminal end. 230 V terminals covered before the strip is plugged in.

3. RSP-2000-48 on the two brackets

2 printed parts: bracket A (2 small holes) and B (1 small hole)

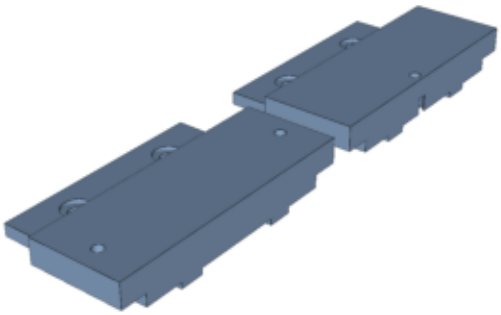

On the profile (grey), device (red)

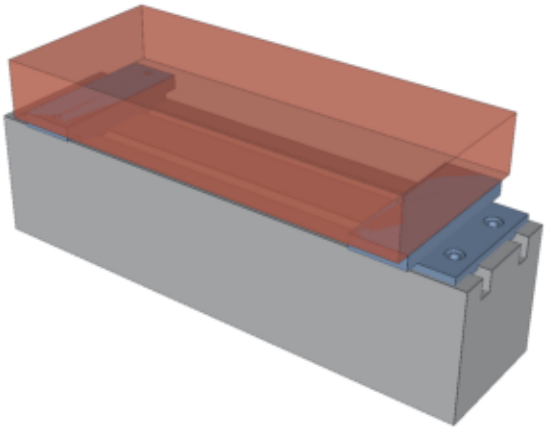

Hold the Mean Well RSP-2000-48, the motor supply (1.95 kg), on one profile face with a 10 mm air gap. Bracket A takes the 2 M4 holes at the end without fans, bracket B the single M4 hole at the fan end.

Steps

1. Supply switched off and unplugged; leave its mains side to the electrician.
2. Lay the supply with its wide face (the one with 3 M4 holes, case 952D) up. Put bracket A on the end with 2 holes and bracket B on the fan end, pads on the supply, the bolt flanges pointing away from the supply.
3. Screw M4 x 12 screws from the back of each bracket into the supply (2 in A, 1 in B); max 4 mm into the case. B's screw goes into the hole near the middle of the fan end (34.5 mm from the end); the 2 small holes beside it are not for mounting.
4. Slide 4 slot-10 T-nuts into the tower face: one in each of its 2 slots for each bracket. The two brackets' bolts end up 319 mm apart.
5. Lift supply + brackets onto the profile, keys in both slots, and bolt each bracket with its 2 M6 bolts. Two people: one holds.
6. Check: fans and vents free, 10 mm gap behind the supply, output cables (+V, -V) reach the chopper terminals 4 / 5.

Check

Two people. Push the supply: nothing moves, keys sit in both slots. Fans and vents free, 10 mm gap behind. Output cables reach chopper pins 4 / 5 without strain.