



DEALER BEST PRACTICE SERIES

Fabricated Tool for Final Drive Shaft Disassembly

Maintenance and Repair Application Component Life Management Component Renewal (CRC) MARC Management

Fabricated Tool for Final Drive Shaft Disassembly0

1.0 Introduction1

2.0 Best Practice Description.....1

3.0 Implementation Steps5

4.0 Benefits.....7

5.0 Resources Required7

6.0 Supporting Attachments / References7

7.0 Related Best Practices7

8.0 Acknowledgements.....8

DISCLAIMER: The information and potential benefits included in this document are based upon information provided by one or more Cat® dealers, and such dealer(s) opinion of “Best Practices”. Caterpillar makes no representation or warranty about the information contained in this document or the products referenced herein. Caterpillar welcomes additional “Best Practice” recommendations from our dealer network.

1.0 Introduction

To reduce the risk breakdown of the second reduction's carrier during the remove of shaft with the press in Caterpillar trucks, this Best Practice is a simple fabricated tool that is compatible with the Models 793B, 793C, 793D and 793F.

2.0 Best Practice Description

Ferreyros has developed a simple tool that supports the carrier, to perform a safety job of disassembly during the use of the hydraulic press.



Carrier



Plate

THE INFORMATION HEREIN MAY NOT BE COPIED OR TRANSMITTED TO OTHERS WITHOUT THE WRITTEN PERMISSION OF CATERPILLAR


Fabricated Tool for Final Drive Carrier Shaft
Disassembly

DATE
2/19/2015


CHG
NO
00

NUMBER
1405-4.03-1340

The carrier is coupled to the plate.

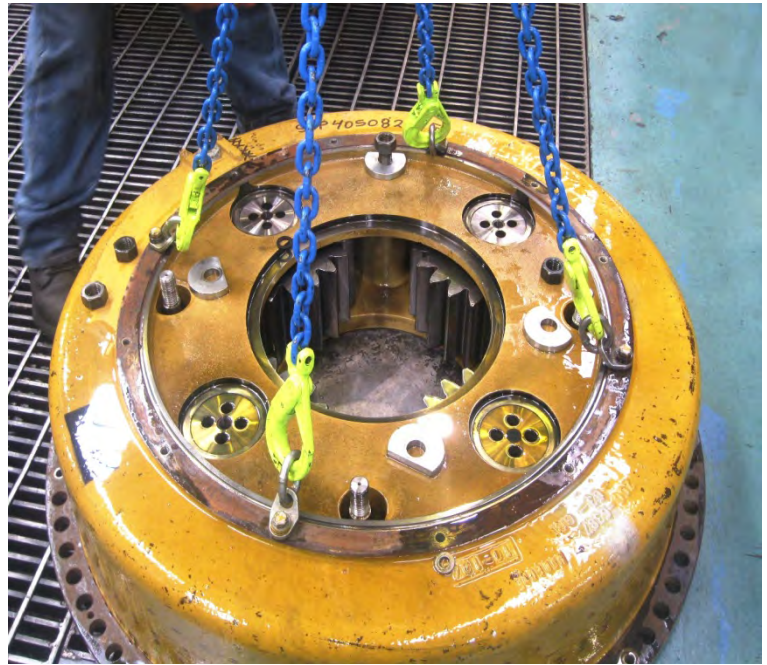

Secure screw

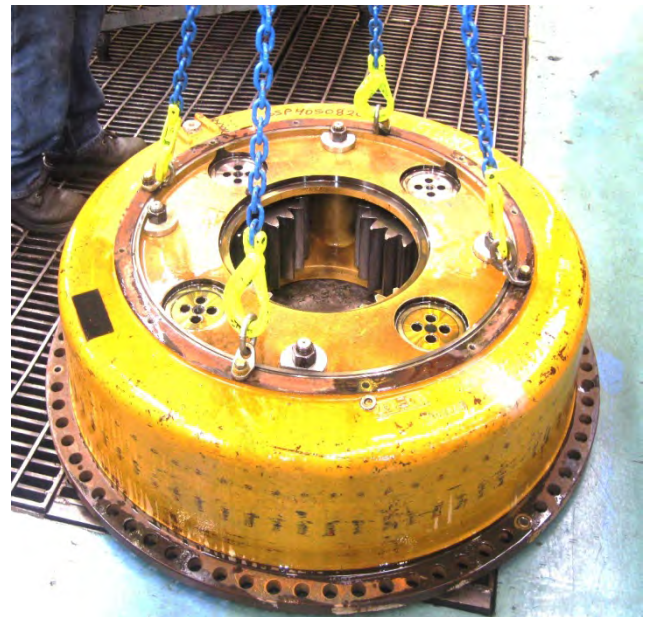

THE INFORMATION HEREIN MAY NOT BE COPIED OR TRANSMITTED TO OTHERS WITHOUT THE WRITTEN PERMISSION OF CATERPILLAR

**Fabricated Tool for Final Drive Carrier Shaft
Disassembly**

DATE
2/19/2015

CHG
NO
00

NUMBER
1405-4.03-1340

The carrier plate assembly is transported to the hydraulic press



THE INFORMATION HEREIN MAY NOT BE COPIED OR TRANSMITTED TO OTHERS WITHOUT THE WRITTEN PERMISSION OF CATERPILLAR


Fabricated Tool for Final Drive Carrier Shaft
Disassembly

DATE
2/19/2015

CHG
NO
00


NUMBER
1405-4.03-1340

This Best Practice allows the gears, after removing the shafts, not fall and stay in place. On the other hand, allows the carrier does not contact the base of the press.

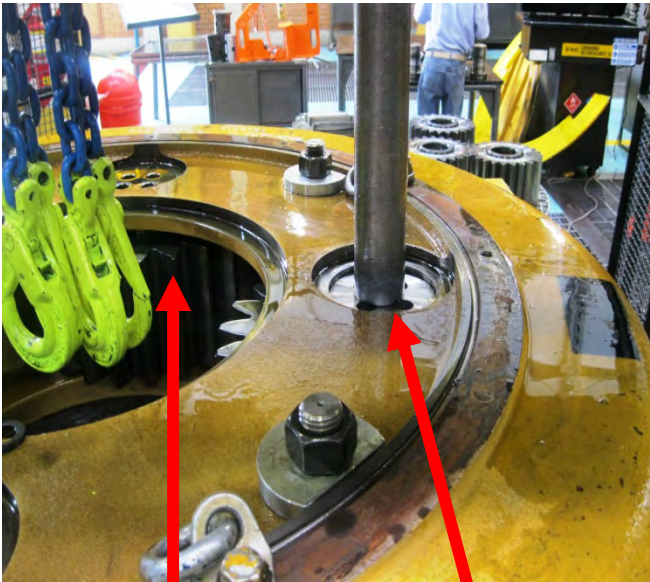

Gear

Shafts

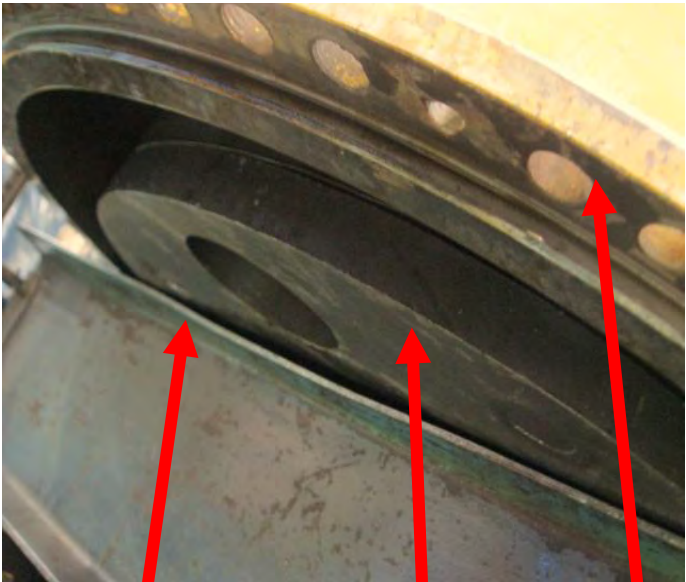

Base of hydraulic press

Plate

Carrier


Therefore, the use of this tool increases the disassembly process only 10 minutes.

THE INFORMATION HEREIN MAY NOT BE COPIED OR TRANSMITTED TO OTHERS WITHOUT THE WRITTEN PERMISSION OF CATERPILLAR			
Fabricated Tool for Final Drive Carrier Shaft Disassembly	DATE	CHG NO	NUMBER
	2/19/2015	00	1405-4.03-1340

3.0 Implementation Steps

The following drawings show the designs with dimensions (in millimeters) of the extraction plate, bolt and washer. The bolts are only guides, that have been installed under pressure from the back and then secured with welding.

1. Extraction Plate:

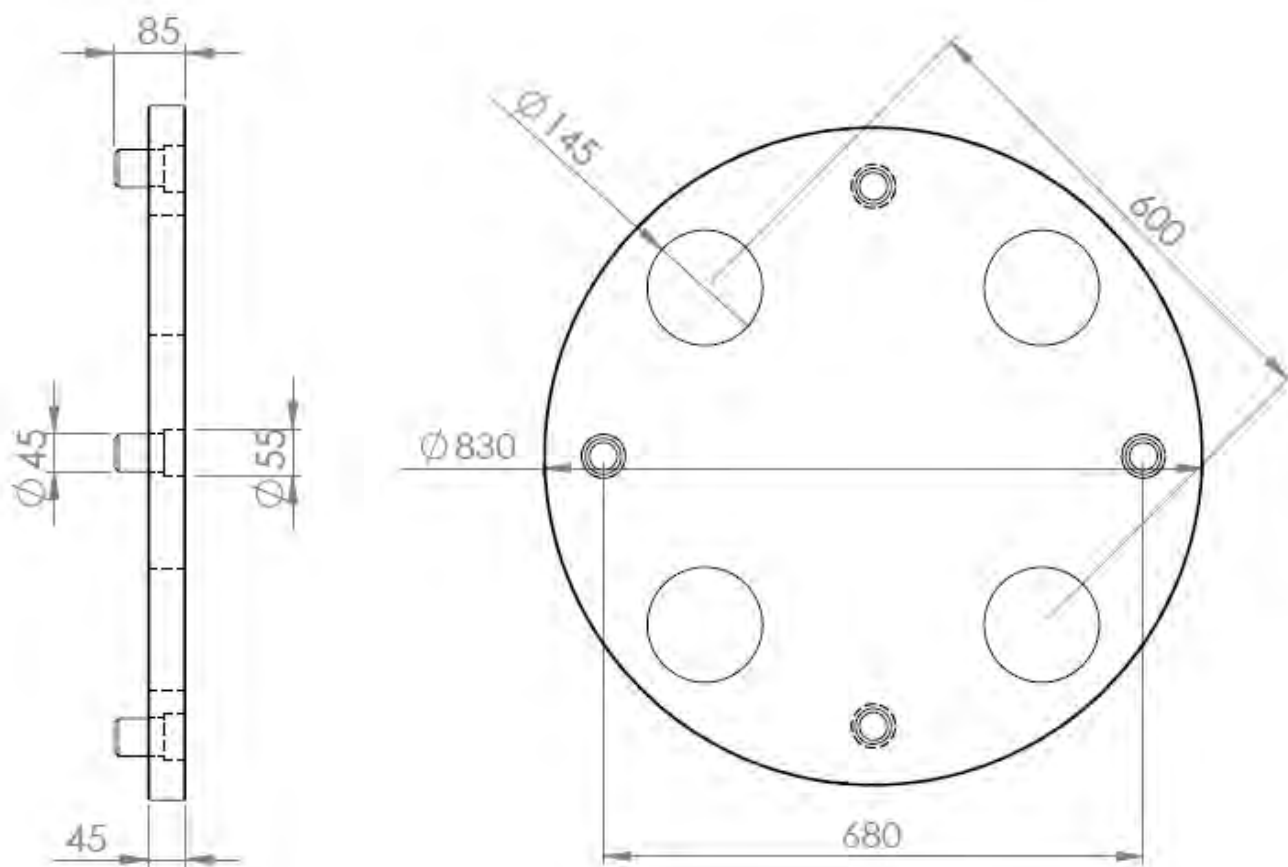


THE INFORMATION HEREIN MAY NOT BE COPIED OR TRANSMITTED TO OTHERS WITHOUT THE WRITTEN PERMISSION OF CATERPILLAR

Fabricated Tool for Final Drive Carrier Shaft
Disassembly


DATE
2/19/2015

CHG
NO
00

NUMBER
1405-4.03-1340

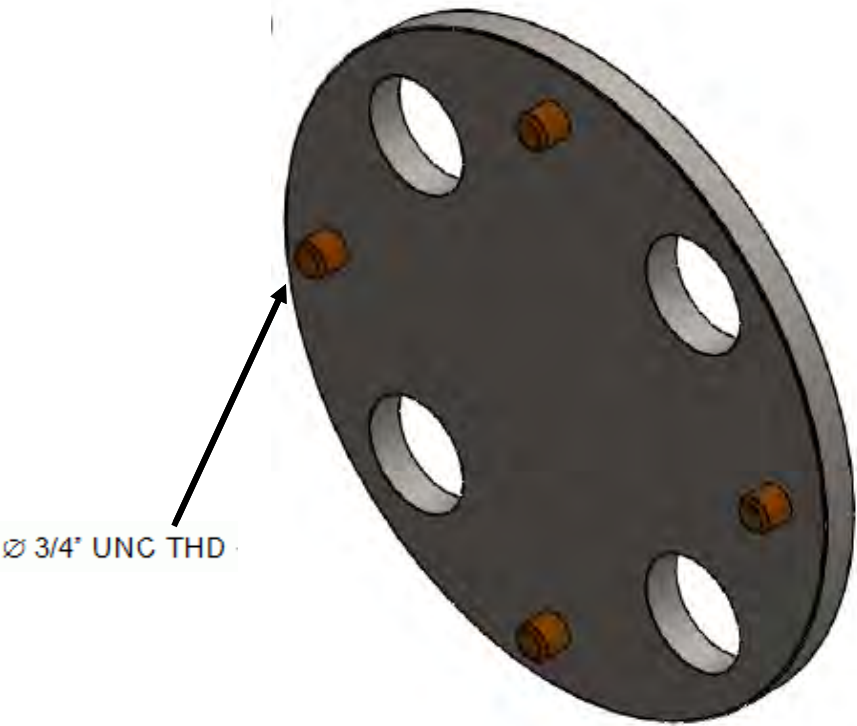

2. Bolt:

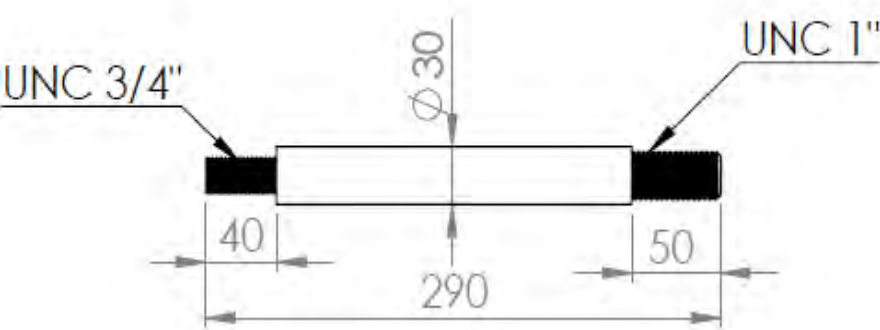


THE INFORMATION HEREIN MAY NOT BE COPIED OR TRANSMITTED TO OTHERS WITHOUT THE WRITTEN PERMISSION OF CATERPILLAR

Fabricated Tool for Final Drive Carrier Shaft
Disassembly

DATE
2/19/2015

CHG
NO
00

NUMBER
1405-4.03-1340

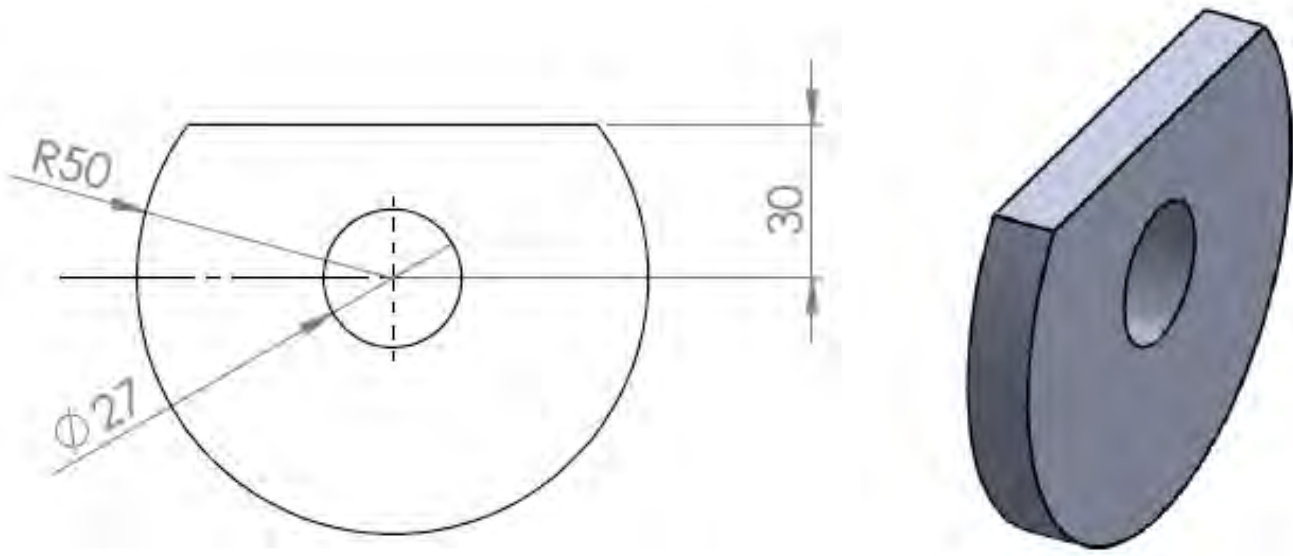3. Washer:

3	WASHER	1:2
2	BOLT	1:5
1	EXTRACTION PLATE	1:10
ITEM	DESCRIPTION	ESCALA

4.0 Benefits

- Reduces the risk of breakdown of the carrier.
- Allows the gears are not moved from their place.
- Improves safety in the work area.

5.0 Resources Required

- Low cost to fabricate the tool.

6.0 Supporting Attachments / References

None

7.0 Related Best Practices

None

THE INFORMATION HEREIN MAY NOT BE COPIED OR TRANSMITTED TO OTHERS WITHOUT THE WRITTEN PERMISSION OF CATERPILLAR

Fabricated Tool for Final Drive Carrier Shaft
Disassembly

DATE
2/19/2015

CHG
NO
00

NUMBER
1405-4.03-1340

8.0 Acknowledgements

This Best Practice was written by:

Aninu Mitacc
Ferreyros S.A.A.

The idea for this best practice belongs to:

Carlos Cossio
Ferreyros S.A.A.

Lizandro Loayza
Ferreyros S.A.A.

THE INFORMATION HEREIN MAY NOT BE COPIED OR TRANSMITTED TO OTHERS WITHOUT THE WRITTEN PERMISSION OF CATERPILLAR

Fabricated Tool for Final Drive Carrier Shaft
Disassembly

DATE
2/19/2015

CHG
NO
00

NUMBER
1405-4.03-1340