



Oil Leakage Prevention Adapter for 385C FS (EAM prefix) Engine DYNO Test

Maintenance and
Repair

Application

Component Life
Management

Component
Renewal (CRC)

MARC
Management

Oil Leakage Prevention Adapter for 385C FS (EAM prefix) Engine DYNO Test	0
1.0 Introduction	1
2.0 Best Practice Description	1
3.0 Implementation Steps.....	2
4.0 Benefits	3
5.0 Resources Required.....	3
6.0 Supporting Attachments / References	3
7.0 Related Best Practices	3
8.0 Acknowledgements	3

DISCLAIMER: The information and potential benefits included in this document are based upon information provided by one or more Cat® dealers, and such dealer(s) opinion of “Best Practices.” Caterpillar makes no representation or warranty about the information contained in this document or the products referenced herein. Caterpillar welcomes additional “Best Practice” recommendations from our dealer network.


1.0 Introduction

When the 385C FS Engine (EAM prefix) was tested with a DYNO, the oil leaked from the rear housing of the engine with the gears installed. To prevent this, the gears were not installed during the assembly of the engine, they were installed after the engine was tested. While this method fixed the problem with the oil leakage, it has caused extra movements to the engine like the assembly – test – more assembly.

This tool allows testing of the engine with the gears installed without the oil leakage.

2.0 Best Practice Description

Borusan Makina Kazakhstan has developed the cap-like adapter that is installed into the rear housing of the engine by using 3 retaining bolts, CAT screws (8 x 0T-0772 & 2 x 0T-0320) & CAT seal (1 x 3D-8417) and prevents the oil leakage during the DYNO test.

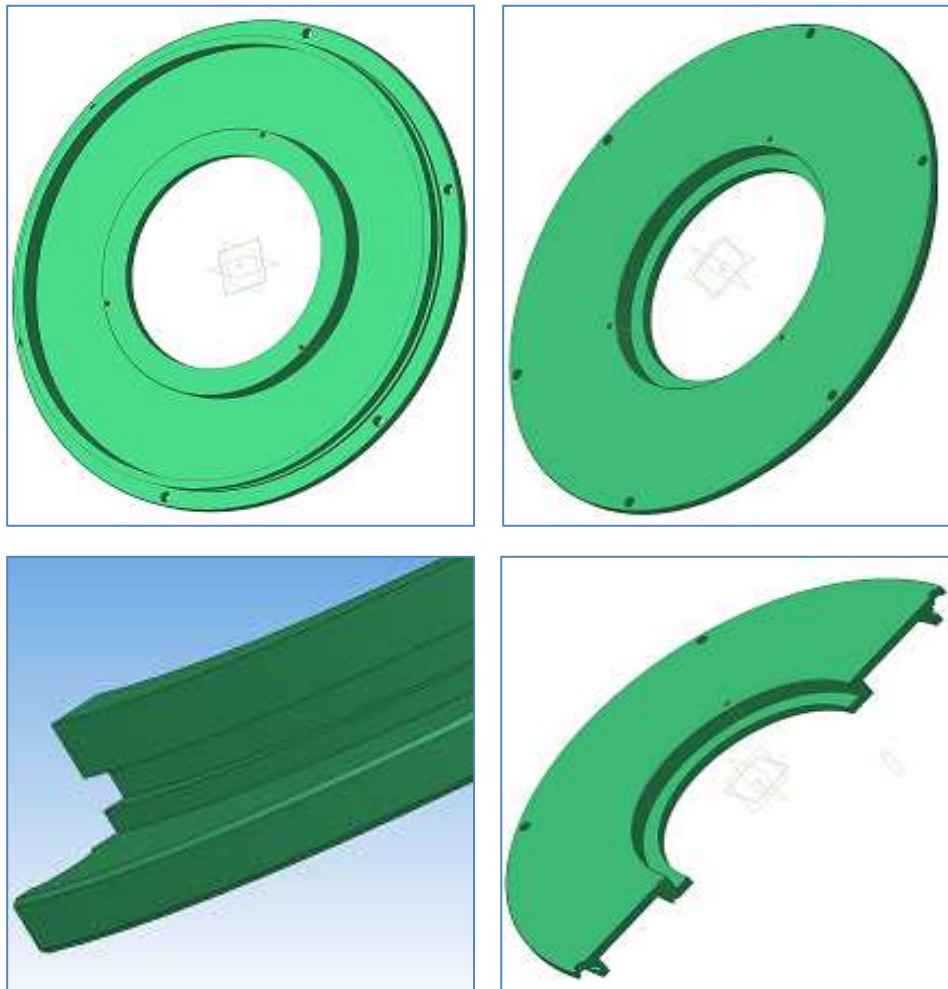

The views of the cap from different sides and in section

THE INFORMATION HEREIN MAY NOT BE COPIED OR TRANSMITTED TO OTHERS WITHOUT THE WRITTEN PERMISSION OF CATERPILLAR

Oil Leakage Prevention for 385C FS Engine

DATE
6/7/2017

CHG
NO
00

NUMBER
1402-4.03-1335

3.0 Implementation Steps

The adapter in use.


1. The adapter is installed into the rear housing of the engine before the DYNO test. The center adapter was furnished in this case by Power Test (www.pwrtst.com). If you choose to use another DYNO supplier, please note that center adapter may be a different size and require a different seal and different bore size, in the seal retainer, to mount it in.



Retaining Bolts



3D-8417 Seal

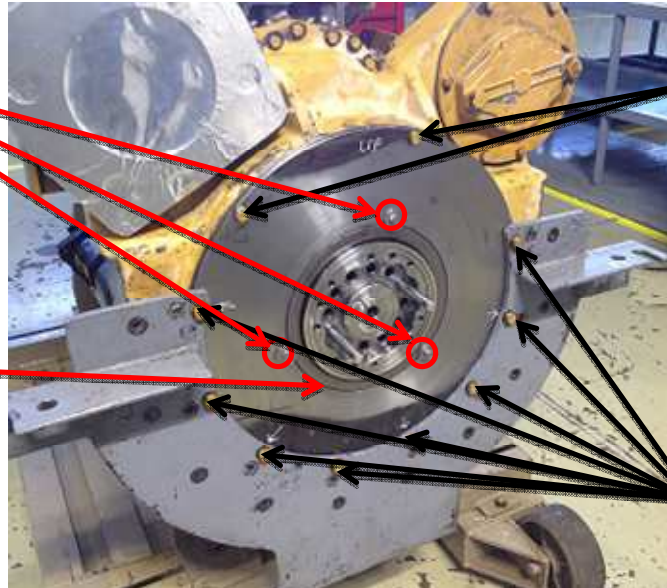

0T-0320 SCREWS

0T-0772 SCREWS

2. The drive shaft installation & DYNO test of the engine with the adapter installed.



Cat Seal part 6V-5043
SEAL-O-RING



No oil has leaked during the DYNO test of the C18 engine of the 385C FS machine with prefix EAM.

THE INFORMATION HEREIN MAY NOT BE COPIED OR TRANSMITTED TO OTHERS WITHOUT THE WRITTEN PERMISSION OF CATERPILLAR

Oil Leakage Prevention for 385C FS Engine

DATE
6/7/2017

CHG
NO
00

NUMBER
1402-4.03-1335

4.0 Benefits

- Prevents the oil leakage during the engine DYNO test.
- Removes the necessity to install the gears after the engine DYNO test.

5.0 Resources Required

- 10 x CAT screws (8 x 0T-0772 & 2 x 0T-0320);
- 1 x CAT seal (1 x 3D-8417);
- 3 x retaining bolts made by the turner;
- 1 x 6V-5043 SEAL-O-RING

6.0 Supporting Attachments / References

The adapter and retaining bolts fabrication drawings are attached to this Best Practice.

7.0 Related Best Practices

N/A

8.0 Acknowledgements

The idea of creating & implementing this Best Practice belongs to:

Ali CEKIC
Engine Team Leader
Borusan Makina Kazakhstan LLP
acekic@borusan.com
+7 (701) 951 97 97

Almaz KENZHETAYEV
Machine Shop Supervisor
Borusan Makina Kazakhstan LLP
akenzhetayev@borusan.com
+7 (701) 803 04 87

Bauyrzhan AKHANOV
Designer
Borusan Makina Kazakhstan LLP

Rafaiil FOLMAN
Turner
Borusan Makina Kazakhstan LLP
Machine Shop

Alexander ROGOZIK
Technician
Borusan Makina Kazakhstan LLP
Machine Shop

This Best Practice was written by:
Gulnaz MANSUROVA
CRC Process Engineer
Borusan Makina Kazakhstan LLP
gmansurova@borusan.com
+7 (701) 951 98 14

THE INFORMATION HEREIN MAY NOT BE COPIED OR TRANSMITTED TO OTHERS WITHOUT THE WRITTEN PERMISSION OF CATERPILLAR

Oil Leakage Prevention for 385C FS Engine

DATE
6/7/2017

CHG
NO
00

NUMBER
1402-4.03-1335