010067 Judgement Guide -11-12MY Triton & Challenger– LCA

1) Objective.
   This document is to assist in correct replacement judgement and MUST be used in conjunction with the 010067 Inspection and Judgement Procedure document.
   Note: All of the reference pages listed below refer to this document

2) Check for paint mark/new sticker. (Refer page 2, step 2)
   If these are present **NO REPLACMENT IS REQUIRED.**


3) Check the width of the welding bead at the **CENTRE ONLY.** (Refer page 5, step 1)
   Note: It is **NOT A REQUIREMENT** for the bead width to exceed the gauge width at other positions.

4) Check the welding gap between the lower plate and pipe. (Refer page 5, step 2).
   This check is to confirm correct pipe to plate placement prior to being welded.
   Note: Ensure the gauge is **KEPT PARALLEL TO THE WELDING BEAD.**

5) Check the welding line position
   Setting the gauges (Refer to page 6, step 3.1)
   Note 1. Use the **CORRECT GAUGES** for the side you are checking to prevent incorrect judgement.
   Note 2. Unsure the locator **pin #1** is touching the **trim line A.**
   Note 3. Unsure the locator **pin #2** is touching the **trim line A and B.**

   Judging the welding bead position. ((Refer to page 6, step 3.2)
   The requirement is for the welding bead to be visible on **BOTH SIDES** of the gauge window for the **FULL LENGTH** of the **WINDOW ONLY.**

   Note: The weld does **NOT** have to be even or consistent in width, it only needs to be **VISIBLE** and **CONTINUOUS.**
   Note:The examples shown below (with the welding bead visible in both windows for the full length) **are ALL ACCEPTABLE and DO NOT REQUIRE REPLACEMENT.**

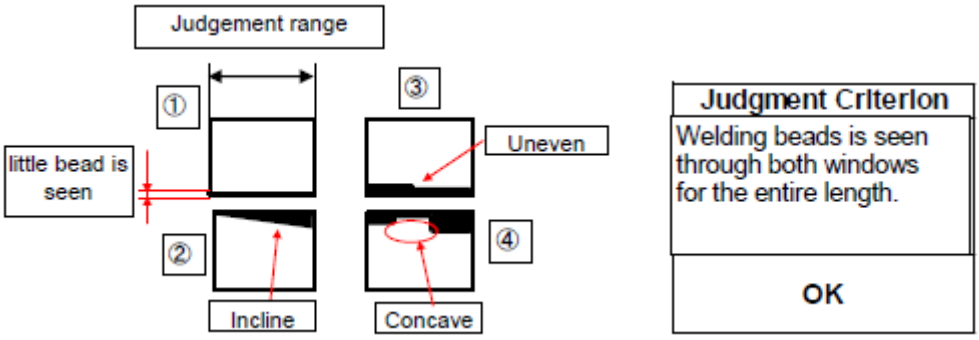

6) Gauge Tolerance factor.
   The gauges have a built in tolerance for safety purposes. This means in cases where you judge the result as a **MARGINAL PASS** it will be **ACCEPTABLE** and still have the **DESIGN LEVEL STRENGTH.**