MMAL DEALER BULLETIN

Bulletin Subject	**Triton Raider LCA Torque**		
Applicable Model(s)	26MY Triton Raider (MV4Z43 RDR Option)		
Notice Category	**Service Campaign**	Technical Bulletin	**020230**
Service Group	33 Front Suspension	Latest Revision Issued	26/10/2026
Revision	N/A	MMAL Reference	N/A

Printed copies may not reflect the latest updates. Please consult the online version

Mitsubishi Motors Australia Limited (MMAL) is conducting a service campaign (effective from 27/10/2026) to facilitate rectification of a Premcar manufacturing issue on 26MY Triton Raider.

Dealer Responsibility

Dealers must check whether a vehicle has any outstanding campaigns by performing a Vehicle Search in the Warranty Portal and complete all outstanding campaigns as required. This must be done whenever an owner makes a service booking or presents a vehicle, or during new or used vehicle PDI.

IMPORTANT

VEHICLES STILL IN DEALER STOCK MUST BE RECTIFIED BEFORE HAND-OVER TO THE CUSTOMER

Product Description

26MY MV Triton Raider assembled by Premcar to 12 August 2026.
301 vehicles affected.

Concern

During wheel alignment at Premcar, the front lower control arm bolts, where loosened, were retorqued to 105Nm (standard M12 bolt spec) instead of Mitsubishi Workshop Manual spec of 139Nm.
Accelerated testing by Premcar engineers concluded that 105Nm is sufficient to prevent joint movement under severe vibrations and impacts.

Cause

Premcar oversight discovered during an internal audit.

Production Fix

Premcar revised their assembly process in line with Mitsubishi WSM spec.

Disclaimer: The fact that a Workshop Instruction has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.
Note: Details contained in this Workshop Instruction and Attachments are current at the time of publication, MMAL however reserves the right to make changes at any time without prior notice or obligation. Printed copies may not reflect the latest updates. Please consult the online version.
Commercial In Confidence

Copyright © Mitsubishi Motors Australia Limited. Reproduction in whole or part prohibited.

Bulletin Subject	**Triton Raider LCA Torque**		
Applicable Model(s)	26MY Triton Raider (MV4Z43 RDR Option)		
Notice Category	**Service Campaign**	Technical Bulletin	**020230**
Service Group	33 Front Suspension	Latest Revision Issued	26/10/2026
Revision	N/A	MMAL Reference	N/A

Rectification Procedure

1. Before commencing work:

- **Photograph the VIN stamping** for attachment to the repair order and claim
- **Photograph the odometer reading** for attachment to the repair order and claim
- Check the vehicle VIN matches the VIN printed on the repair order
  STOP work if the VIN does not match, and clarify the correct vehicle

2. Place vehicle on a 4-post hoist
3. Remove the under cover
4. Check if LCA nuts turn below 70Nm
5. Perform front wheel alignment if necessary
6. Retorque LCA nuts
7. Refit under cover

Refer to the work instructions on next page for further details

Parts Order Information

No parts should be required.
In the unlikely event that damaged parts are discovered during inspection, raise a SCA using 020230 as the position code.

Campaign Claim Procedure

Submit a claim for this Service Campaign via the MMAL Warranty Portal.

Campaign	Claim Options	Labour Details	
		Operation	Time
020230	Retorque Lwr LCA	02023010	0.3H
	Retorque Lwr LCA + W/Align	02023011	1.0H

Revision Details


Initial Release – No revision applicable.

Disclaimer: The fact that a Workshop Instruction has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.
Note: Details contained in this Workshop Instruction and Attachments are current at the time of publication, MMAL however reserves the right to make changes at any time without prior notice or obligation. Printed copies may not reflect the latest updates. Please consult the online version.
Commercial In Confidence

Copyright © Mitsubishi Motors Australia Limited. Reproduction in whole or part prohibited.

Bulletin Subject	**Triton Raider LCA Torque**			
Applicable Model(s)	26MY Triton Raider (MV4Z43 RDR Option)			
Notice Category	**Service Campaign**	Technical Bulletin	**020230**	
Service Group	33 Front Suspension	Latest Revision Issued	26/10/2026	
Revision	N/A	MMAL Reference	N/A	

Work Instructions

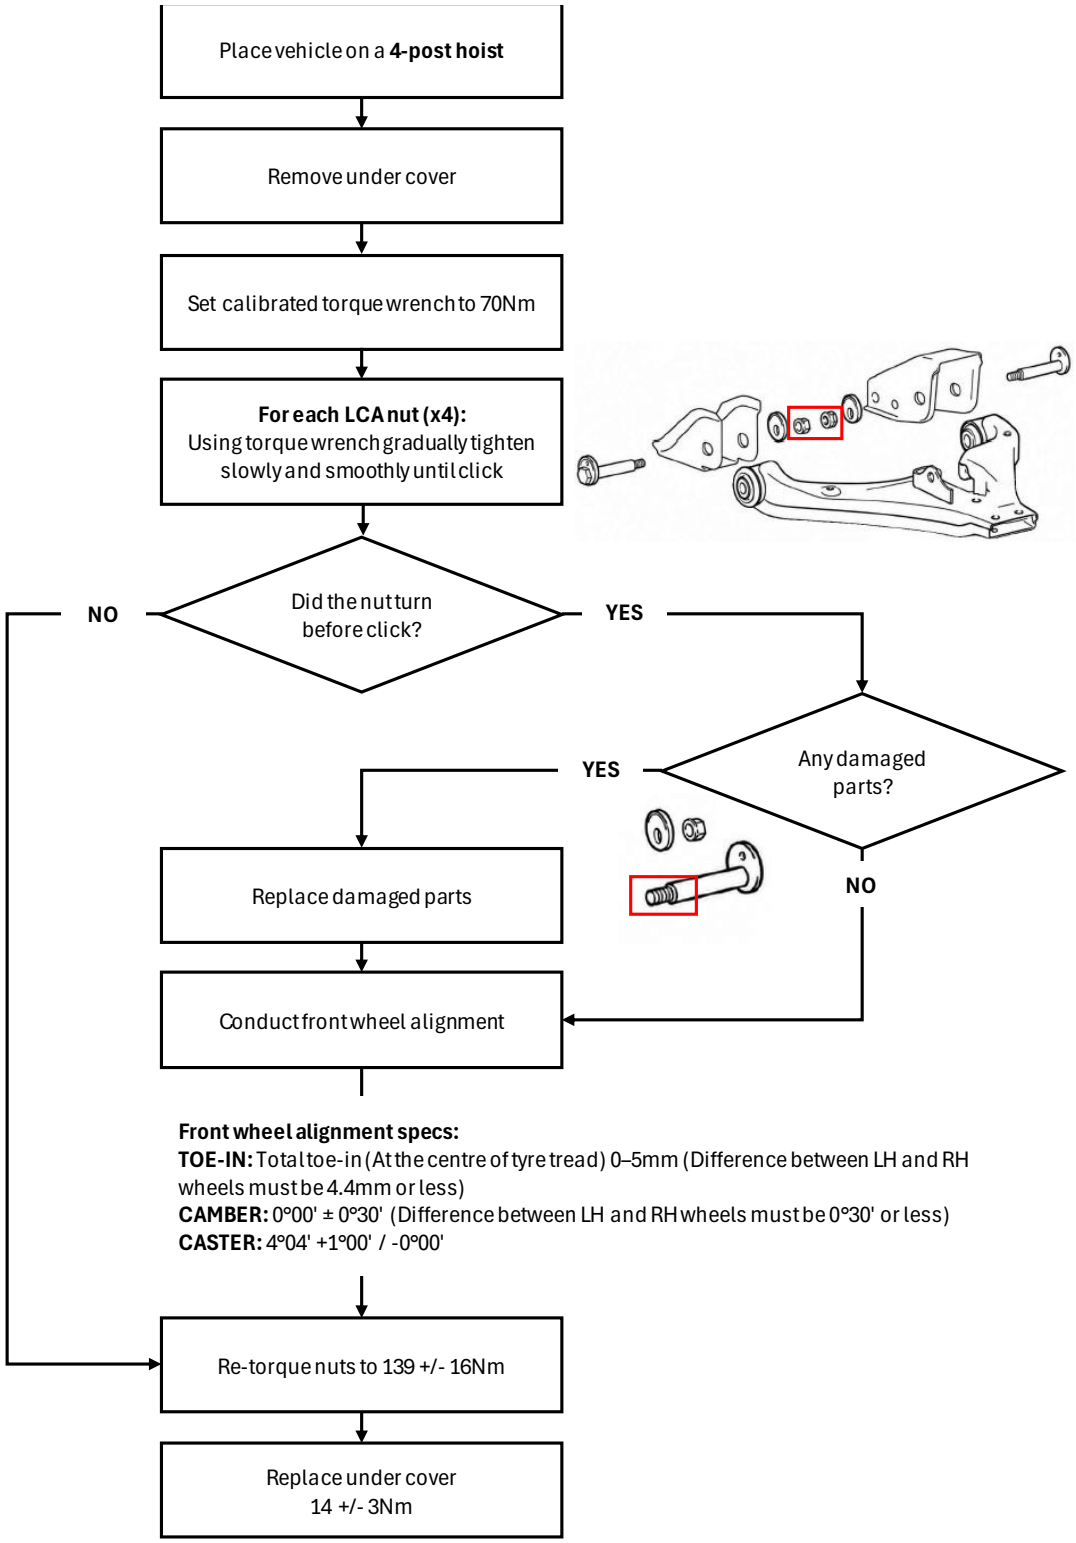

Disclaimer: The fact that a Workshop Instruction has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.
Note: Details contained in this Workshop Instruction and Attachments are current at the time of publication, MMAL however reserves the right to make changes at any time without prior notice or obligation. Printed copies may not reflect the latest updates. Please consult the online version.
Commercial In Confidence

Copyright © Mitsubishi Motors Australia Limited. Reproduction in whole or part prohibited.