
ADVISORY HOTLINE FIX

Group: 42 - Body	**Original Date: 20/08/2018**	**No. QE42-003, MQ42-003, XB42-002, ZJ42-005, NX42-001, LA42-003, YA42-001, CJ42-003**
Model: All	**Subject: Buzzing noise from doors/speakers.**	
Revised on ..... (date) **Revised on** ..... (date) **Revised on** ..... (date)	Michael Miller Manager Field Services	
MMAL Ref N/A	**Document consists of 2 page/s**	

(1) **Subject:** Buzzing noise from doors / speakers.

(2) **Description:** The purpose of this advisory Hotline Fix is to help dealers diagnose complaints in regards to harmonic vibrations from various door components created from low Hz tones (bass).

(3) **Action:** If a customer advises of a buzzing type noise, MMAL advise that technicians can access an online tone generator with a smart phone, and connect to the entertainment unit. Using the tone generator (shown below), isolate any door(s) that have the harmonic vibration evident in the tone range of 40Hz to 200Hz.

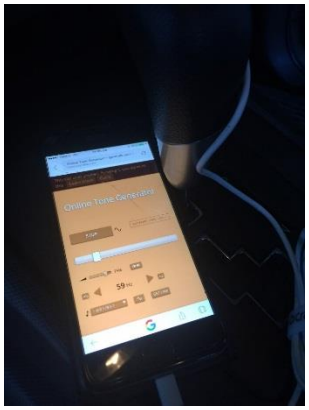

Using this method, dealers can locate the source of any vibration/buzzing noises, and determine if they are due to loose/worn components, or normal characteristic.

Refer to the below procedure as an example of how a door rattle/buzzing noise was located and repaired, without replacing any components unnecessarily.

(4) **Procedure:** With the door trim removed, explore and note sources of vibration (shown here is an example of a wiring loom vibrating and causing the noise).

Continued Page 2.

Disclaimer: *The fact that a Hotline Fix has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty*.

Note: This document should be forwarded direct to the Service Manager for action and distribution to all affected staff

Copyright © Mitsubishi Motors Australia Limited
Please note: The information contained in this document is CONFIDENTIAL and intended for Mitsubishi Dealer use only. It must not be provided to third parties.



Adapt techniques to minimise sources of noise, such as cloth tape for harness insulation and double sided tape to secure the plastic waterproof membrane to the door.





Note: The above procedure is suggestive and not prescriptive. Please exercise judgement when performing any such repairs in the field.

(5) Warranty: Standard terms and conditions apply**.**

Note: Warranty may not apply to rattles (refer to the vehicle's Service and Warranty Booklet).