MMAL DEALER BULLETIN

Bulletin Subject	**Touch Screen of SDA2 Audio Unit Is Unresponsive**		
Applicable model(s)	ZL Outlander (ICE & PHEV), XD ASX, QF Pajero Sport		
Notice Category	**Hotline fix**	Technical Bulletin	**2025-006**
Service Group	54 Chassis Electrical	Latest Revision Issued	18/12/2025
Revision number	Third	MMAL Reference	TSL2312039-A

Complaint

Audio/Navigation unit touch screen is consistently unresponsive, either in sections or over the whole screen and does not change with key cycle.

Cause

Due to insufficient protection of the touch screen panel against UV radiation, the panel may deteriorate, and sections/all of the panel may become unresponsive.

Production improvement

The touch screen panel UV protective layer has been improved.

Model	Model Years	Production Improvement Date
ZL Outlander ICE and PHEV	20MY	N/A*
XD ASX	20-23MY	16/06/2023
QF Pajero Sport	20-22MY	27/01/2022

*Note: ZL Outlander improvement implemented after end of production.

Please submit QQQ DQRs for all cases post the countermeasure dates listed above, with video/s showing the concern and photos of the unit label.

Correction

On a customer complaint basis, confirm that sections or all of the touch screen is unresponsive to touch consistently (condition does not change with key cycle). If the condition is confirmed, replace the audio unit via the component exchange system in the SAP Dealer Portal.

Out Of Warranty Coverage

Extended warranty is applicable for this concern – 7 years / Unlimited km (applies to vehicles where the new vehicle warranty does not already exceed this amount). For vehicles outside of the new vehicle warranty period (and within 7 years of the warranty start date), please submit a Goodwill Authority request for this repair. Once the Goodwill Authority request has been approved, the component exchange system will allow a "one off" component exchange for the relevant VIN. For this process to work correctly, the exact VIN and External Number combination from your approved Goodwill Authority request must be used in the VIN and Repair Order Number fields when submitting in the component exchange system (refer to examples and submission notes on page 2).

Continued page 2.

Disclaimer: The fact that a Workshop Instruction has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.
Note: Details contained in this Workshop Instruction and Attachments are current at the time of publication, MMAL however reserves the right to make changes at any time without prior notice or obligation. Printed copies may not reflect the latest updates. Please consult the online version.

Copyright © Mitsubishi Motors Australia Limited. Reproduction in whole or part prohibited.


Bulletin Subject	**Touch Screen of SDA2 Audio Unit Is Unresponsive**		
Applicable model(s)	ZL Outlander (ICE & PHEV), XD ASX, QF Pajero Sport		
Notice Category	**Hotline fix**	Technical Bulletin	**2025-006**
Service Group	54 Chassis Electrical	Latest Revision Issued	18/12/2025
Revision number	Third	MMAL Reference	TSL2312039-A

Out Of Warranty (OOW) Exchange submission notes:


1. The exchange request must be completed after the Goodwill is approved, but before submitting a claim for the repair, for the component exchange system to accept the OOW submission.

2. Use the "External Number" exactly as it appears on the Goodwill, including any spaces (the best method is to copy and paste this number into the component exchange request from the Goodwill, once it is approved). If this does not work, please add an extra space between the RO and job number reference and retry.

Example Authority Display:

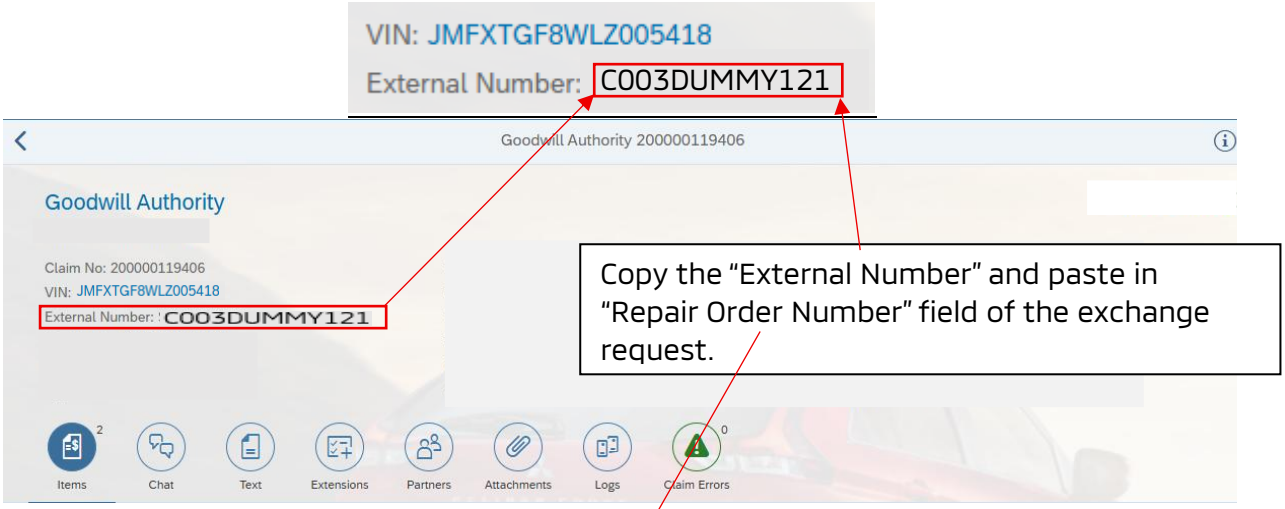

Example Exchange Request Input:

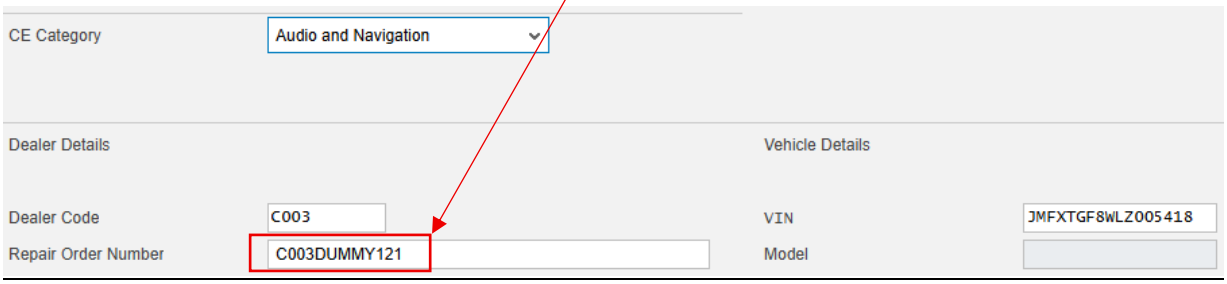

Note: If you experience any issues with this process, please submit a case via Mi-Dealer Assist addressed to Technical Support – Do not contact Mitsubishi Electric for assistance with this process.

Disclaimer: The fact that a Workshop Instruction has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.
Note: Details contained in this Workshop Instruction and Attachments are current at the time of publication, MMAL however reserves the right to make changes at any time without prior notice or obligation. Printed copies may not reflect the latest updates. Please consult the online version.


Copyright © Mitsubishi Motors Australia Limited. Reproduction in whole or part prohibited.

Bulletin Subject	**Touch Screen of SDA2 Audio Unit Is Unresponsive**		
Applicable model(s)	ZL Outlander (ICE & PHEV), XD ASX, QF Pajero Sport		
Notice Category	**Hotline fix**	Technical Bulletin	**2025-006**
Service Group	54 Chassis Electrical	Latest Revision Issued	18/12/2025
Revision number	Third	MMAL Reference	TSL2312039-A

Obtaining the serial number (without audio unit removal – alternate method).

If the audio unit "home" screen is accessible, the serial number may be obtained via the following method.

1. Turn the ignition to "ACC" or "ON" position.
2. Allow the unit to boot –

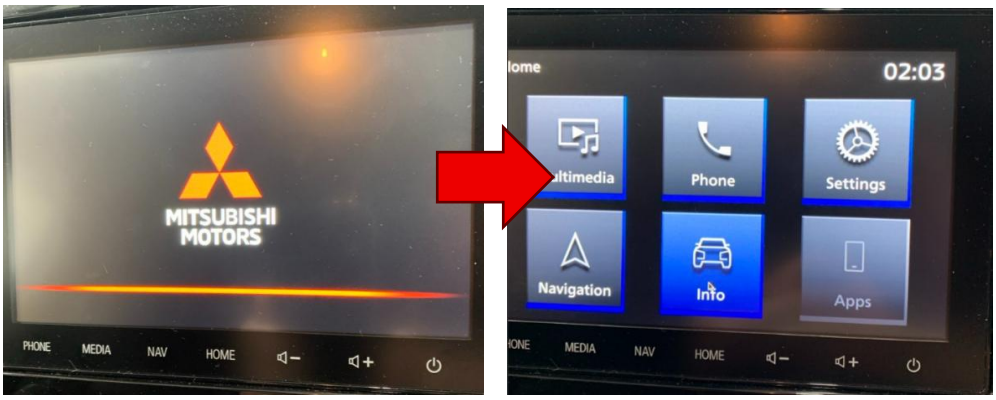

3. Plug in a USB mouse (wired or wireless) to the USB port in the vehicle. "The device not supported!" warning will appear – ignore this warning.




Disclaimer: The fact that a Workshop Instruction has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.
Note: Details contained in this Workshop Instruction and Attachments are current at the time of publication, MMAL however reserves the right to make changes at any time without prior notice or obligation. Printed copies may not reflect the latest updates. Please consult the online version.

Copyright © Mitsubishi Motors Australia Limited. Reproduction in whole or part prohibited.

Bulletin Subject	**Touch Screen of SDA2 Audio Unit Is Unresponsive**		
Applicable model(s)	ZL Outlander (ICE & PHEV), XD ASX, QF Pajero Sport		
Notice Category	**Hotline fix**	Technical Bulletin	**2025-006**
Service Group	54 Chassis Electrical	Latest Revision Issued	18/12/2025
Revision number	Third	MMAL Reference	TSL2312039-A

4. Click on the left mouse button and a cursor should appear. Move the mouse cursor and left click on the "Info" button.

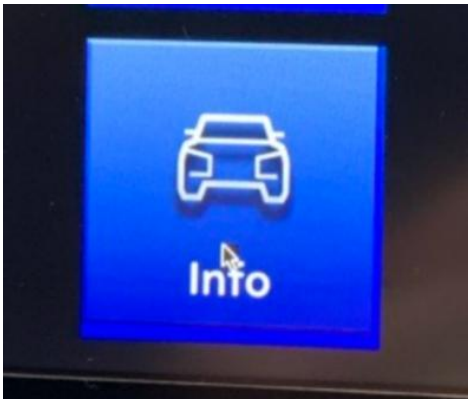

5. Move the mouse cursor and left click on the "Version Information" button.



6. The unit serial number will be displayed in the "SN" field.



Disclaimer: The fact that a Workshop Instruction has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.
Note: Details contained in this Workshop Instruction and Attachments are current at the time of publication, MMAL however reserves the right to make changes at any time without prior notice or obligation. Printed copies may not reflect the latest updates. Please consult the online version.

Copyright © Mitsubishi Motors Australia Limited. Reproduction in whole or part prohibited.

Bulletin Subject	**Touch Screen of SDA2 Audio Unit Is Unresponsive**		
Applicable model(s)	ZL Outlander (ICE & PHEV), XD ASX, QF Pajero Sport		
Notice Category	**Hotline fix**	Technical Bulletin	**2025-006**
Service Group	54 Chassis Electrical	Latest Revision Issued	18/12/2025
Revision number	Third	MMAL Reference	TSL2312039-A

⚠Printed copies may not reflect the latest updates. Please consult the online version

Parts Information

Confirm the original audio unit part number for the affected vehicle via ASA CAPS and order the relevant part number via component exchange system in the SAP Dealer Portal. Instructions for use of the component exchange system can be found here.

Warranty Information

Standard terms and conditions apply.

Please code all claims as per standard exchange audio guidelines – Refer to the Warranty Procedure Manual and Service Procedure Manual for details.

Revision Details

2nd edition

- "Out Of Warranty Coverage" section updated

3rd edition

- Out Of Warranty (OOW) Exchange submission notes updated

Disclaimer: The fact that a Workshop Instruction has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.
Note: Details contained in this Workshop Instruction and Attachments are current at the time of publication, MMAL however reserves the right to make changes at any time without prior notice or obligation. Printed copies may not reflect the latest updates. Please consult the online version.

Copyright © Mitsubishi Motors Australia Limited. Reproduction in whole or part prohibited.