

ADVISORY HOTLINE FIX


Group: 11 - Engine	**Original Date: 27th October**	**No. MN11-003, PB11-003**
Model: MN Triton, PB/PC Challenger.	**Subject: Timing belt tensioner arm bolt snaps on 4D56 engine.**	
Revised on ..... (date) **Revised on** ..... (date) **Revised on** ..... (date)	Y Oda, Deputy Director, Aftersales	
MMAL Ref P4640, P4518	This document consists of 1 page.	

(1) **Subject:** Timing belt tensioner arm bolt snaps on 4D56 engine.

(2) **Possible Cause:** After investigation of failures, it has been concluded that the timing belt tensioner arm bolt has been incorrectly tensioned, leading to loosening of the bolt. Once the bolt is loosened, an incorrect load point is created on the threaded portion of the bolt, instead of the bolt shoulder, leading to fatigue breakage of the threaded section where the thread begins in the oil pump casing (see below).

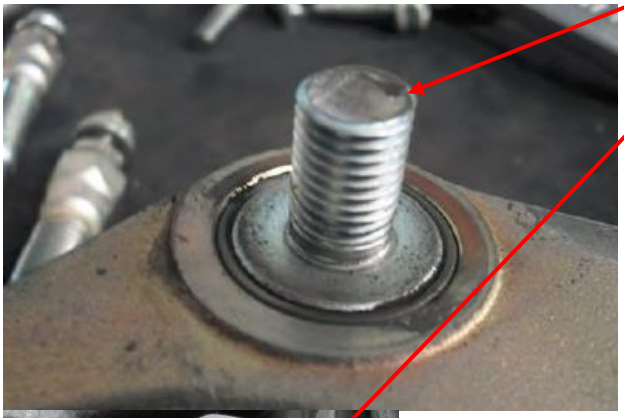

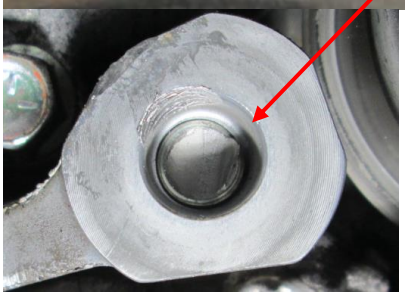

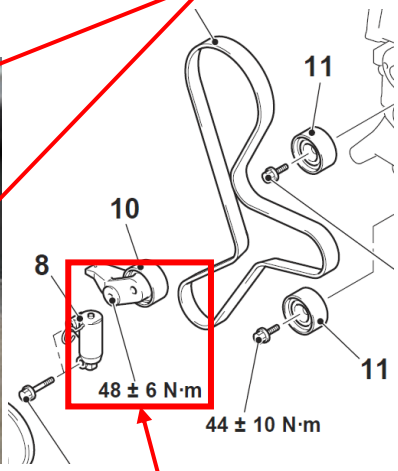

This bolt is torque critical. Please tension as per WSM specification (48 +/- 6 Nm).

Please Note: MMAL are only aware of failures that have occurred after this bolt has been removed and refitted during service. Dealers are reminded that this bolt is a torque critical component, as bolt breakage can lead to catastrophic engine failure.

(3) **Field Fix/Action:** N/A, information only.

(4) **Warranty Information:** Warranty is not applicable for this concern.

Disclaimer: *The fact that a Hotline Fix has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty*.

Note: This document should be forwarded direct to the Service Manager for action and distribution to all affected staff

Copyright © Mitsubishi Motors Australia Limited
Please note: The information contained in this document is CONFIDENTIAL and intended for Mitsubishi Dealer use only. It must not be provided to third parties.