HOTLINE FIX

Group: 14 Cooling	**Original Date:** 13 May 2015	**No.** MN14-001, PB14-001
Model: Triton / Challenger 4D56	**Subject:** 4D56 Hi Power Engine Overheat Reports	
Revised on 04/06/2015..... (date) **Revised on** ..... (date) **Revised on** ..... (date)	Yoshi Tatewaki Manager, Field Service.	
MMAL Ref 020116	**Document consists of 3 pages**	

(1) **Subject**: 4D56 Hi Power Engine Overheat Reports (Post preventative Service Campaign 020116)

(2) **Information**: There have been a small number of reports regarding engine overheat after performing the preventive action service campaign 020116. It should be noted that the campaign 020116 will not prevent overheating in all cases (such as loss of coolant, blocked radiator etc. The software update as part of the campaign is designed to place the vehicle in a protective mode should an overheat condition occur for some other reason. To assist identification of the root cause, and take appropriate corrective action, it is important to take a structured diagnostic approach for each case.

(3) **Reporting Requirements**: To ensure we have a full understanding of the many possible causes, this has been added to the mandatory reporting requirements in the newly issued General Letter GL-15-011

(4) **Field Fix/Action**: The attached flow chart is provided to "guide" you towards a "structured" diagnostic approach. The information included in the flow chart is suggested and not prescriptive; please carry out the steps that are relevant, based on your observations and vehicle history (maintenance/repair).

Note: In the event your observations and vehicle history direct you to a different diagnostic path, please document the reasons and what was done.

(5) Warranty: Standard terms and conditions apply.

"DQR's are still required to be submitted for this concern until further notice"

Disclaimer: *The fact that a Hotline Fix has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty*.

Note: This document should be forwarded direct to the Service Manager for action and distribution to all affected staff

Copyright © Mitsubishi Motors Australia Limited
Please note: The information contained in this document is CONFIDENTIAL and intended for Mitsubishi Dealer use only. It must not be provided to third parties.

Overheat flow chart – Post campaign 020116

Upon customer complaint of vehicle overheating

Step 1. Please record any non-genuine accessories fitted to the vehicle. Check for DTCs using MUTIII - Is Engine Coolant Over Temperature Condition DTC P0217 logged?

Please note: This method is suggested and not prescriptive. Your physical observations / vehicle history may direct you to a different diagnostic path. If you do use a different diagnostic path, document what and why. Please use this flow chart as a guide .

Yes (Go to step 2A)

No (Got to step 2B)

Step 2A. Record the DTC on your repair order. Check the coolant level - Has any coolant been added by a dealer or the customer since campaign 020116 was carried out?

Step 2B. Check the coolant level - Has any coolant been added by a dealer or the customer since campaign 020116 was carried out?

No (Go to step 3A)


No (Go to step 3B)

Step 3A. Check operation of thermostat, check for internal / external blockages to radiator, cooling system restrictions, operation of radiator fan / clutch and ECT sensor and wiring as per WSM. Repair any faults found, confirm repair and return vehicle to service

Yes

(Go to step 4)

Step 3B. Check operation of thermostat, check for internal / external blockages to radiator, cooling system restrictions, operation of radiator fan / clutch, temperature gauge sender, wiring and engine grounding as per WSM. Repair any faults found, confirm repair and return vehicle to service

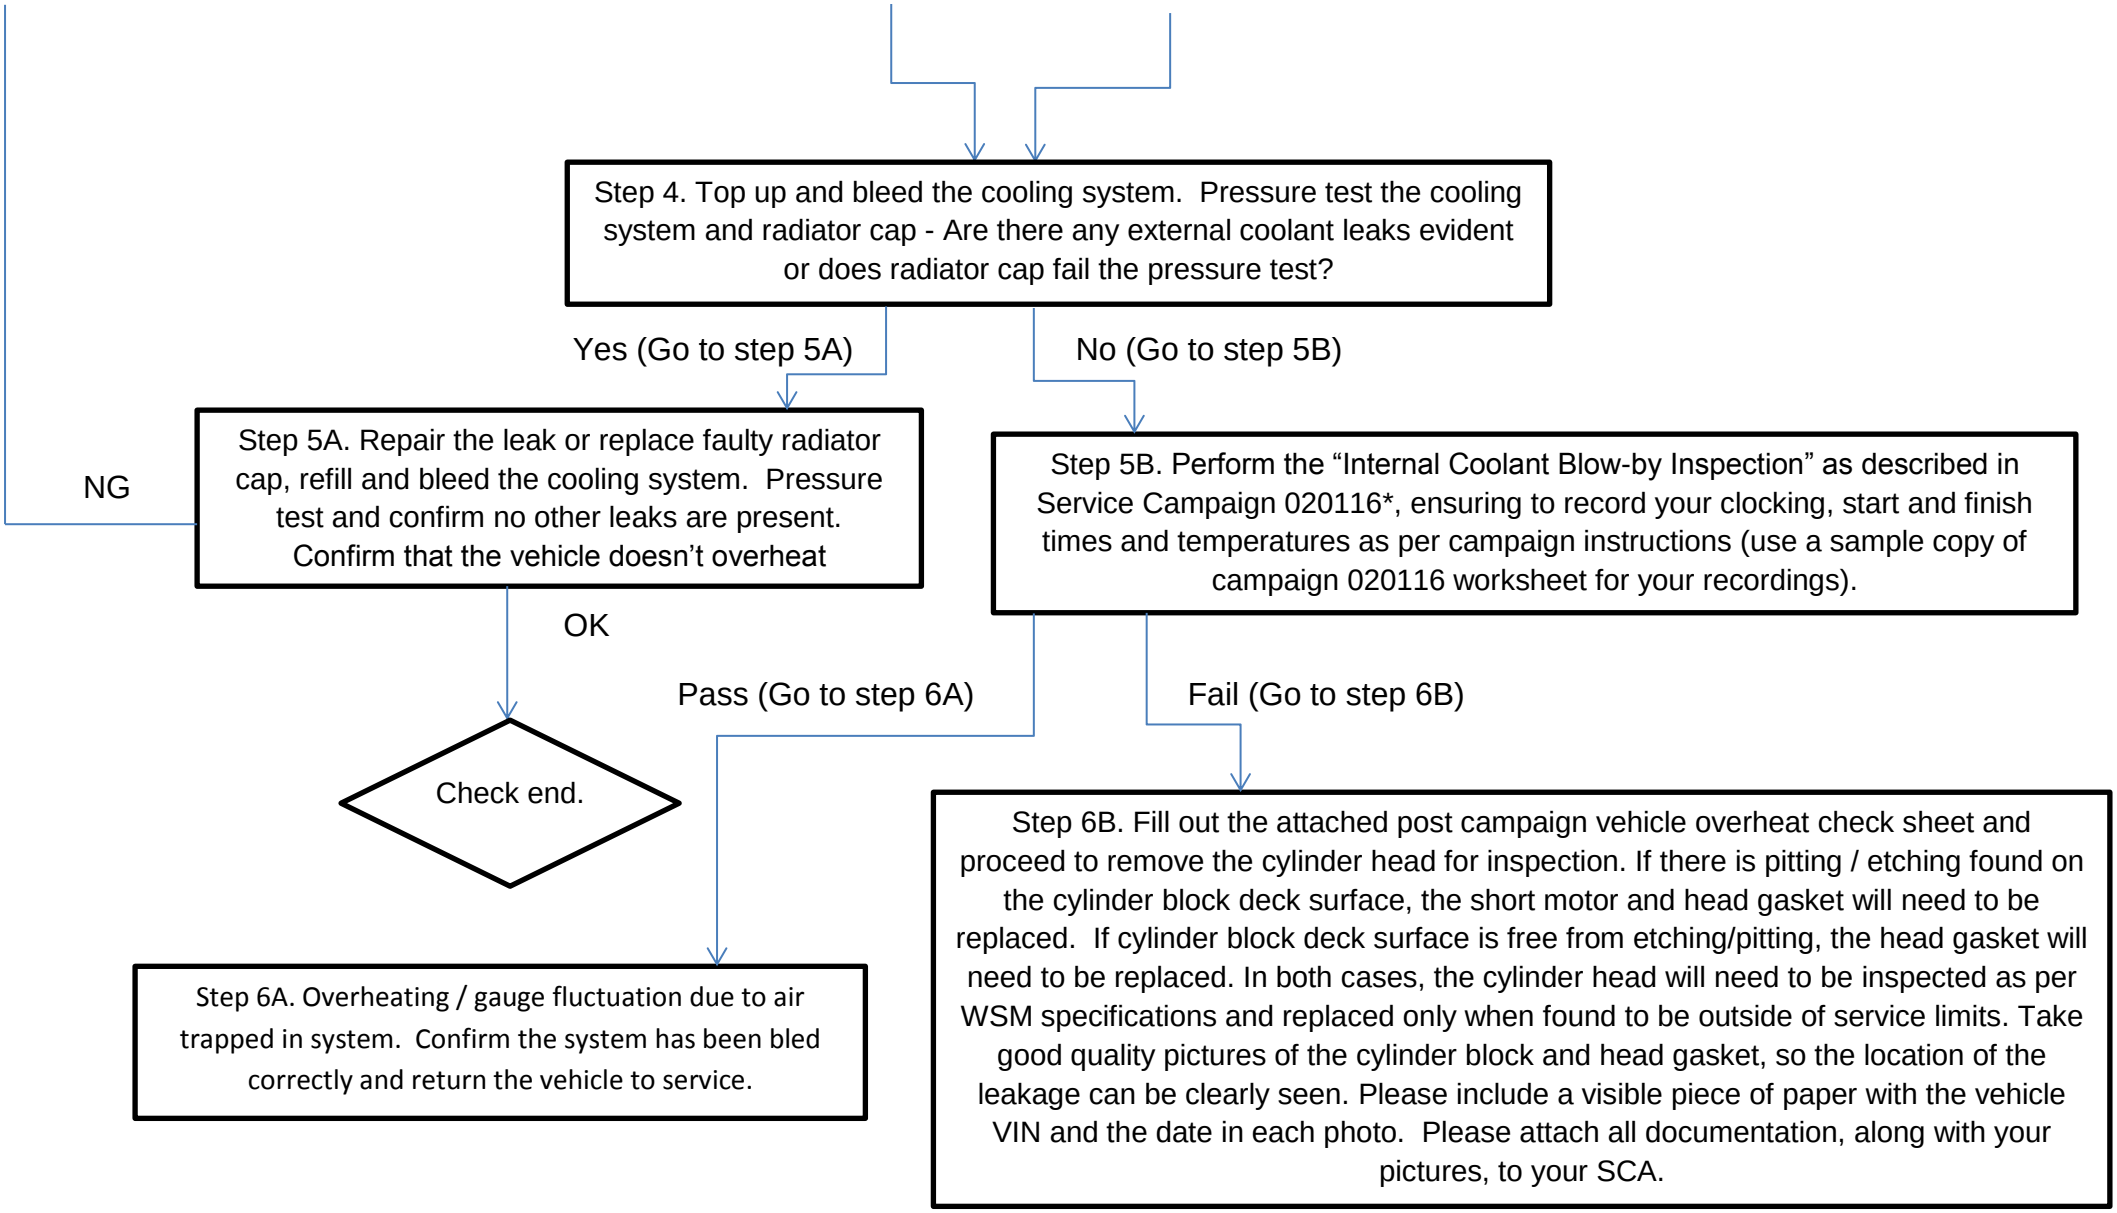

*Note: The coolant concentration will need to be at 50% and the original spec 109kpa radiator cap fitted for this test (please retain a cap from a previous campaign vehicle for testing). In the event that an old cap is not available, a replacement cap Part No. MR597126 can be ordered at a maximum of 1 per dealer, for testing purposes.