Hotline Fix – MQ13-002, QE13-001

Note: This document should be forwarded direct to the Service Manager for action and distribution to all affected staff.

Printed versions of this document may be out of date, check the online version.

Subject

Vehicle logging various DPF related DTC's due to temperature sensor failure.

Issued

Revision E -03/09/2021

Previous Versions

Revision A	24/3/2017
Revision B	05/04/2017
Revision C	04/05/2018
Revision D	23/07/2018

Group

13 – Diesel Fuel

MMAL Reference

P4826

Applicable Vehicles

MQ Triton, QE Pajero Sport

Possible Cause

DPF Temperature sensor #3 (Data List Item 119) may have an intermittent internal fault, causing an incorrect reading to be supplied to engine ECU.

Production Fix

A yellow mark was introduced during manufacturing that is aligned with the bracket to ensure no excess stress on the sensor wiring for vehicles manufactured after 1/7/2016.

Field Fix/Action

On a customer complaint basis only - if you have a vehicle logging DPF related fault codes in the engine ECU (including, but not limited to, the codes listed below),

P1499	Abnormally high DPF Temperature
P1498	Excessive PM accumulated in the DPF
P252F	Engine Oil level Malfunction
P1428	No.3 Exhaust Gas Temp Sensor Circuit High

Disclaimer: *The fact that a Hotline Fix has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty*.
Please note: The information contained in this document is CONFIDENTIAL and intended for Mitsubishi Dealer use only. It must not be provided to third parties.

Copyright © Mitsubishi Motors Australia Limited

Hotline Fix – MQ13-002, QE13-001

Note: This document should be forwarded direct to the Service Manager for action and distribution to all affected staff.

Printed versions of this document may be out of date, check the online version.

Please inspect Data List Items 117, 118, and 119 in Engine ECU data list. Monitor readings during a road test (approx. 20 minutes in duration), and if the readings from Item #119 become erratic, please replace DPF Temp Sensor #3 and re-route the wiring as per the attached instruction (page 3), then reassess the vehicle. This advice is advisory only and should be used in conjunction with the relevant sections of WSM.


NOTE:

If no evidence of erratic readings is found, consult QR-50, TT-002.

If erratic readings are found for vehicles post countermeasure, please attach a screenshot or drive recording of the readings, as well as the data below, to a QQQ DQR.

- VIN
- DTC logged.
- Main usage of vehicle (family car, work vehicle etc.)
- What type of road does customer primarily drive on, rough/smooth?
- What percentage of driving does customer spend on rough roads vs smooth roads?
- Typical driving speed
- Road condition when failure occurs.
- Before removal, please take a photos of the exhaust temperature sensor harness to show harness and bracket location.
- There is a yellow marking on the harness. Please take a photos showing location of yellow mark in relation to bracket.

Parts Information

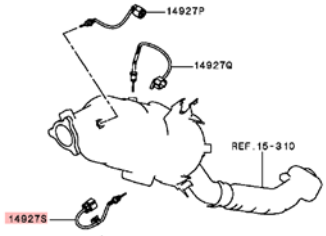

Part Name	Part Number	QTY
Sensor, Exhaust High Temperature	1587A092	1
Band	MB617127	As per CAPS

Disclaimer: *The fact that a Hotline Fix has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty*.
Please note: The information contained in this document is CONFIDENTIAL and intended for Mitsubishi Dealer use only. It must not be provided to third parties.


Copyright © Mitsubishi Motors Australia Limited

Hotline Fix – MQ13-002, QE13-001

Note: This document should be forwarded direct to the Service Manager for action and distribution to all affected staff.

Printed versions of this document may be out of date, check the online version.

Wiring rework instructions:

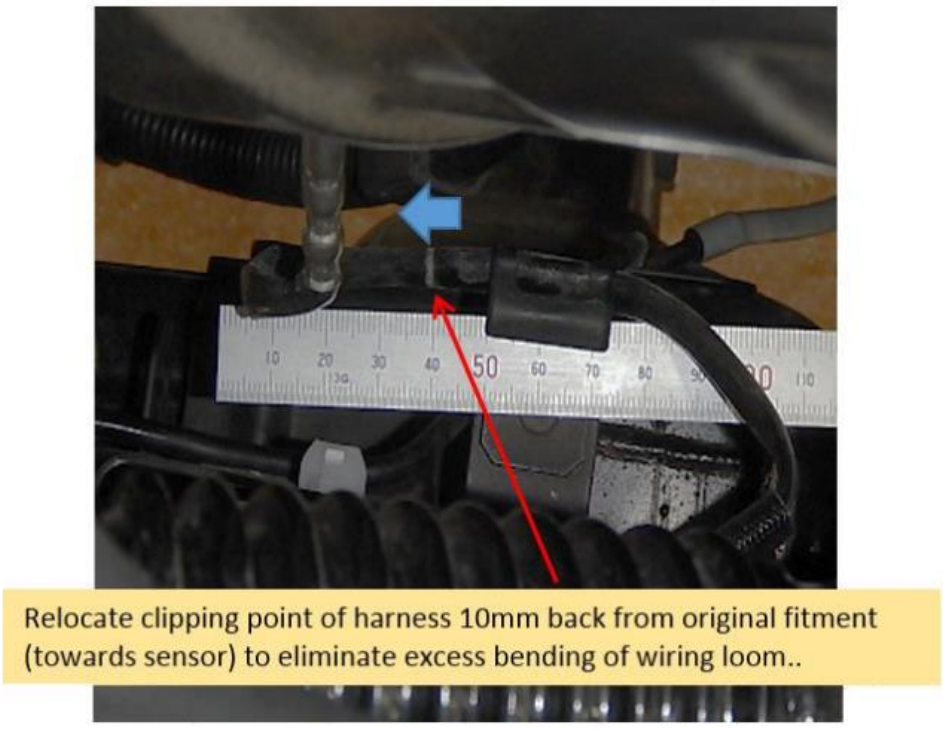

Relocate clipping point of harness 10mm back from original fitment (towards sensor) to eliminate excess bending of wiring loom..

Warranty Information

Claim Details	
Claim Type	Warranty (YC01)
Position Code	178333
Complaint Code	91
Circumstance Code	As Advised by Customer
Diagnosis Code	27
Claim Items	
Main Labour Operation	17833310
Labour Qty	1
Labour Time	As per LOTS
Spare Part Material - Causal Part -	1587A092
Quantity	1
Miscellaneous Parts	MB617127 - Band
Quantity	As per CAPS

Standard warranty terms and conditions apply.

Disclaimer: *The fact that a Hotline Fix has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty*.
Please note: The information contained in this document is CONFIDENTIAL and intended for Mitsubishi Dealer use only. It must not be provided to third parties.

Copyright © Mitsubishi Motors Australia Limited