
MMAL DEALER BULLETIN

Bulletin Subject	**Coolant seepage/leakage from core plug at rear of cylinder head on 4N15 Engine.**		
Applicable model(s)	MQ/MR Triton, QE/QF Pajero Sport		
Notice Category	**Hotline fix**	Technical Bulletin	**MQ/MR/QE/QF14-001**
Service Group	14 - Engine Cooling	Latest Revision Issued	22/12/2025
Revision number	C	MMAL Reference	TSL2407029-A

Complaint

Coolant seeps/leaks from around the core plug

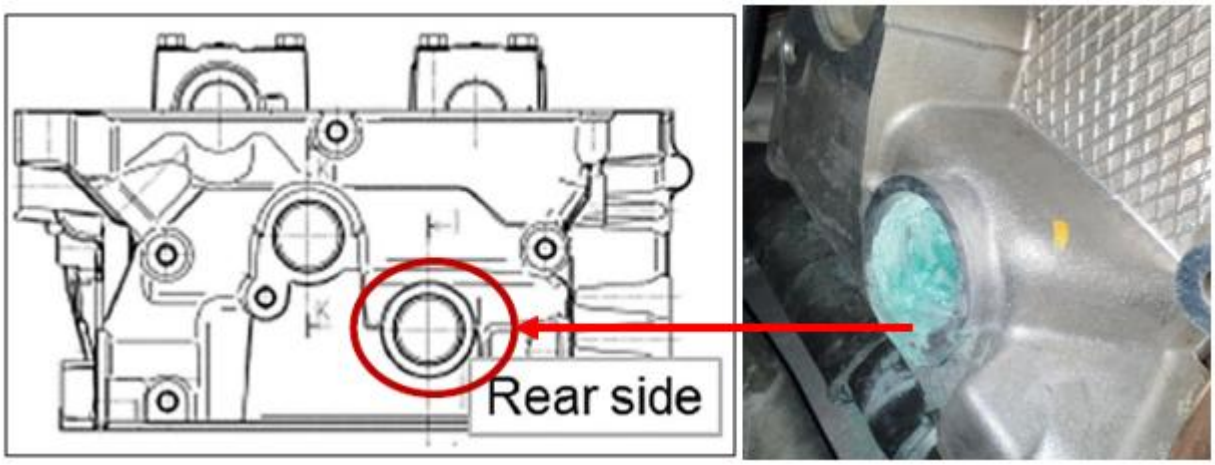

Cause

The core plug may have been installed to the incorrect depth or straightness. If this occurs, repeated hot/cold cycling of the engine may allow the core plug to move in the bore. This movement breaks the bond of the core plug adhesive, allowing the core plug to progress to a position that allows coolant to bypass the plug.

Production improvement

The Cylinder Head assembly process has been improved in production as follows:


1) Improved cleaning process for the core plug bore hole before plug installation in the production line (for improvement of adhesive bond).

2) Reduce the specification for the maximum tilt level of the core plug (Within ±0.5mm at depth points A, B, C & D of the plug).

Disclaimer: The fact that a Workshop Instruction has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.
Note: Details contained in this Workshop Instruction and Attachments are current at the time of publication, MMAL however reserves the right to make changes at any time without prior notice or obligation. Printed copies may not reflect the latest updates. Please consult the online version.
General Information

Copyright © Mitsubishi Motors Australia Limited. Reproduction in whole or part prohibited.

Bulletin Subject	**Coolant seepage/leakage from core plug at rear of cylinder head on 4N15 Engine.**		
Applicable model(s)	MQ/MR Triton, QE/QF Pajero Sport		
Notice Category	**Hotline fix**	Technical Bulletin	**MQ/MR/QE/QF14-001**
Service Group	14 - Engine Cooling	Latest Revision Issued	22/12/2025
Revision number	C	MMAL Reference	TSL2407029-A

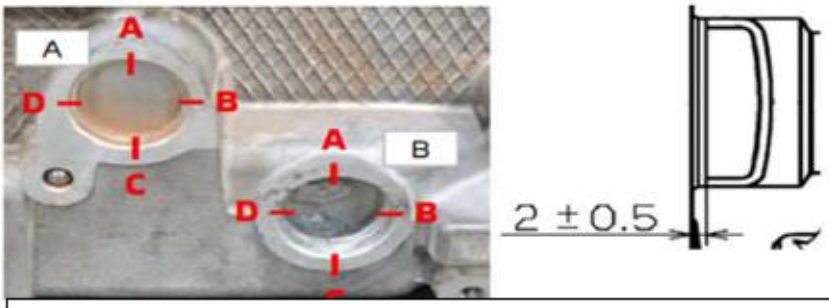

New Assembly Specification - Depth of A, B, C & D are now all within 0.5mm of each other.

Effective VIN and date

Model	Effective VIN	Production Fix Date (supplier)
Pajero Sport	TBA	21/10/2024
Triton	N/A	N/A (fix is post End of Production)

Correction

Type 1: For vehicles within 3 years or 100,000km of RDA -

On a customer complaint basis, **replace** the **cylinder head** as per workshop manual instructions.

Correction Notes:

- Ensure camshaft scissor gear/s are preloaded correctly as per WSM instruction during assembly or camshaft/crankshaft timing correlation issues will occur.
- Ensure balancer cartridge timing is not altered during repair or engine vibration will occur.
- The crankshaft must not be rotated anticlockwise with the cylinder head and timing components in place. Anticlockwise rotation of the crankshaft in this state can cause damage to the timing chain and guides, which can result in engine failure.
- Valve springs for inlet and exhaust are unique. Inlet valve springs must not be used for exhaust valves or vice versa. Inlet valve springs must be oriented correctly. Refer to the workshop manual for identification and orientation instructions. Failure to correctly fit the valve springs can result in engine failure.
- Ensure cylinder block is inspected for damage/straightness (using a straight edge) prior to submission of your SCA. Any resultant damage due to coolant leakage should be recorded and noted on your SCA, along with any additional parts requirements. (refer to the repair check sheet on page 5 of this document).
- Ensure any resultant DTC/s and Freeze Frame data are saved and attached to your SCA (refer to the process on page 6 of this document).

Disclaimer: The fact that a Workshop Instruction has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.
Note: Details contained in this Workshop Instruction and Attachments are current at the time of publication, MMAL however reserves the right to make changes at any time without prior notice or obligation. Printed copies may not reflect the latest updates. Please consult the online version.
General Information

Copyright © Mitsubishi Motors Australia Limited. Reproduction in whole or part prohibited.

Bulletin Subject	**Coolant seepage/leakage from core plug at rear of cylinder head on 4N15 Engine.**		
Applicable model(s)	MQ/MR Triton, QE/QF Pajero Sport		
Notice Category	**Hotline fix**	Technical Bulletin	**MQ/MR/QE/QF14-001**
Service Group	14 - Engine Cooling	Latest Revision Issued	22/12/2025
Revision number	C	MMAL Reference	TSL2407029-A

Correction Notes (Type 1 - Continued):

- Exhaust manifold straightness should be confirmed as per WSM specification during repair. If the manifold is found to be out of specification, it should be replaced during repair following WSM instructions, including all single use and revised parts. All measurements taken need to be included on your SCA when replacing the manifold and associated parts (refer to the repair check sheet on page 5 of this document).
- Please follow the injector handling guide in Quick Reference QR-50 Tech Tip TT-008 to prevent damaging the injectors during repair operations on the cylinder head.

Type 2: For vehicles that have exceeded 3 years from RDA or 100,000km odometer –

On a customer complaint basis, **replace** the cylinder head **core plug** as per the attached instructions.

Correction Notes:

- Follow the core plug replacement instructions **exactly** to prevent damage to the cylinder head/other vehicle components and ensure a robust repair.
- The nominated sealant Threebond 1360F must be used for **all** repairs or correct adhesion of the core plug may not be achieved.
- For vehicles where P0217 Engine coolant over temperature DTC has been stored, DTC and Freeze Frame Data (FFD) **must** be obtained from the vehicle as it presented and saved for attachment to any subsequent claim (refer page 8 of this document). Such vehicles should be inspected for any supplementary coolant leakage and tested thoroughly for any consequential damage of overheating (before completing this repair if possible).
- If consequential damage is identified due to coolant loss from the core plug only (no other contributing factors), the subsequent repair should be carried out and claimed in accordance with standard warranty process and procedures.

Disclaimer: The fact that a Workshop Instruction has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.
Note: Details contained in this Workshop Instruction and Attachments are current at the time of publication, MMAL however reserves the right to make changes at any time without prior notice or obligation. Printed copies may not reflect the latest updates. Please consult the online version.
General Information

Copyright © Mitsubishi Motors Australia Limited. Reproduction in whole or part prohibited.

Bulletin Subject	**Coolant seepage/leakage from core plug at rear of cylinder head on 4N15 Engine.**		
Applicable model(s)	MQ/MR Triton, QE/QF Pajero Sport		
Notice Category	**Hotline fix**	Technical Bulletin	**MQ/MR/QE/QF14-001**
Service Group	14 - Engine Cooling	Latest Revision Issued	22/12/2025
Revision number	C	MMAL Reference	TSL2407029-A

⚠Printed copies may not reflect the latest updates. Please consult the online version

Parts Information – Repair Type 1

Part Name	Part No.	Quantity.
HEAD ASSY,ENG CYLINDER	11041W310P	1
GASKET KIT,ENG OVERHAUL	Refer to ASA CAPS for required kit P/No.	1
BOLT,CYLINDER HEAD	1005B586	As required
COOLANT	Refer to Genuine Fluids Guide	As required
LIQUID GASKET,ENG	MZ100191EX or equivalent	As required

Parts note:

- The parts listed above are the basic parts required for this repair. Depending on the repair method used and repair requirements, other parts may be needed. Any other required parts need to be included on your SCA along with any supporting evidence as outlined in the Field Fix "Notes" section of this Hotline Fix.

Parts Information – Repair Type 2

Part Name	Part No.	Quantity.
CAP,CYLINDER HEAD	MF665540	1
SEALANT, THREEBOND 1360F	EG100014	As Required (maximum 1ml required per repair)
COOLANT	Refer to Genuine Fluids Guide	As required

Parts note:

- The parts listed above are the basic parts required for this repair. Depending on the repair requirements, other parts may be needed. Any other required parts need to be included on your claim along with any supporting evidence as outlined in the Field Fix "Notes" section of this Hotline Fix.

Disclaimer: The fact that a Workshop Instruction has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.
Note: Details contained in this Workshop Instruction and Attachments are current at the time of publication, MMAL however reserves the right to make changes at any time without prior notice or obligation. Printed copies may not reflect the latest updates. Please consult the online version.
General Information

Copyright © Mitsubishi Motors Australia Limited. Reproduction in whole or part prohibited.

Bulletin Subject	**Coolant seepage/leakage from core plug at rear of cylinder head on 4N15 Engine.**		
Applicable model(s)	MQ/MR Triton, QE/QF Pajero Sport		
Notice Category	**Hotline fix**	Technical Bulletin	**MQ/MR/QE/QF14-001**
Service Group	14 - Engine Cooling	Latest Revision Issued	22/12/2025
Revision number	C	MMAL Reference	TSL2407029-A

Warranty Information – Repair Type 1

Claim Details	**Repair Type 1: Cylinder head replacement**	
Claim Type	Warranty	
Position Code	111224	
Complaint Code	72	
Circumstance Code	As Advised by Customer	
Diagnosis Code	48	
Claim Items	**2WD**	**4WD**
Main Labour Operation	111210SW	111210TQ
Labour Qty	1	
Labour Time	As per LOTS time	
Causal Part -	11041W310P	
Dealer Quantity	1	
Spare Part Material	GASKET KIT,ENG OVERHAUL	
Part Number	Refer to ASA CAPS	
Dealer Quantity	1	
Spare Part Material	BOLT,CYLINDER HEAD	
Part Number	1005B586	
Dealer Quantity	10	
Miscellaneous Parts	COOLANT	
Part Number	COOLBLUE	
Dealer Quantity	As Required.	
Miscellaneous Parts	LIQUID GASKET, ENG	
Part Number	SEALANT	
Dealer Quantity	As Required	

Warranty Notes – Repair Type 1:

- Completed "Repair Check Sheet", including all photos and measurements must be attached to your SCA.
- This Hotline Fix number must be included in the claim remarks or subject line.
- Parts and labour listed above are the minimum required parts to complete this repair. Any other required parts or labour need to be included on your SCA along with any supporting evidence as outlined in the Field Fix "Notes" section of this Hotline Fix.

Disclaimer: The fact that a Workshop Instruction has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.
Note: Details contained in this Workshop Instruction and Attachments are current at the time of publication, MMAL however reserves the right to make changes at any time without prior notice or obligation. Printed copies may not reflect the latest updates. Please consult the online version.
General Information

Copyright © Mitsubishi Motors Australia Limited. Reproduction in whole or part prohibited.

Bulletin Subject	**Coolant seepage/leakage from core plug at rear of cylinder head on 4N15 Engine.**		
Applicable model(s)	MQ/MR Triton, QE/QF Pajero Sport		
Notice Category	**Hotline fix**	Technical Bulletin	**MQ/MR/QE/QF14-001**
Service Group	14 - Engine Cooling	Latest Revision Issued	22/12/2025
Revision number	C	MMAL Reference	TSL2407029-A

Warranty Information – Repair Type 2

Claim Details	**Repair Type 2: Core Plug Replacement**
Claim Type	Warranty
Position Code	111224
Complaint Code	72
Circumstance Code	As Advised by Customer
Diagnosis Code	48
Claim Items	
Main Labour Operation	111224H1
Labour Qty	1
Labour Time	As per LOTS time
Causal Part -	MF665540
Dealer Quantity	1
Miscellaneous Parts	COOLANT
Part Number	COOLBLUE
Dealer Quantity	As Required.
Miscellaneous Parts	SEALANT,THREEBOND 1360F
Part Number	SEAL1360F
Dealer Quantity	As Required (maximum 1ml per repair)

Warranty Notes – Repair Type 2:

- This Hotline Fix number must be included in the claim remarks or subject line.
- **No authority** is required when the repair involves **only the replacement of the core plug** (for vehicles within the New Car Warranty period).
- All DTC and FFD must be attached to the relevant authority and/or claim.
- Measurements taken during the core plug installation must be recorded on your repair order and warranty claim.

Revision Details

Revision A -

- Warranty Information, Parts Information and Correction Notes updated.

Revision B –

- Warranty Information, Parts Information and Correction Notes updated.

Revision C –



- Warranty Information, Parts Information and Correction Notes updated (core plug replacement procedure added).

Disclaimer: The fact that a Workshop Instruction has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.
Note: Details contained in this Workshop Instruction and Attachments are current at the time of publication, MMAL however reserves the right to make changes at any time without prior notice or obligation. Printed copies may not reflect the latest updates. Please consult the online version.
General Information

Copyright © Mitsubishi Motors Australia Limited. Reproduction in whole or part prohibited.

Bulletin Subject	**Coolant seepage/leakage from core plug at rear of cylinder head on 4N15 Engine.**		
Applicable model(s)	MQ/MR Triton, QE/QF Pajero Sport		
Notice Category	**Hotline fix**	Technical Bulletin	**MQ/MR/QE/QF14-001**
Service Group	14 - Engine Cooling	Latest Revision Issued	22/12/2025
Revision number	C	MMAL Reference	TSL2407029-A

Repair Check Sheet - Hotline Fix – MQ14-001, MR14-001, QE14-001, QF14-001

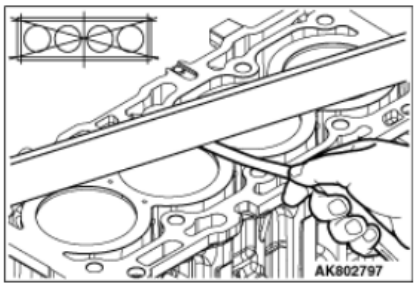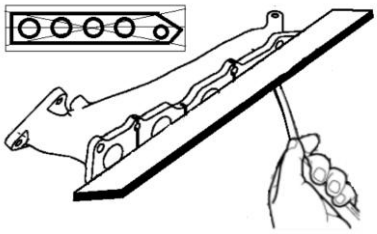Item	Measurement	Service Limit
Cylinder block distortion measured (maximum) 		0.05mm
Exhaust manifold distortion (maximum) 		0.7mm
Other Items	**Y**	**N**
Is there any customer complaint of overheating?		
Is the coolant level low (if yes, approximately how much coolant needs to be added to correct the level)?		
		< amount of coolant needed
Photos of initial leakage area taken and attached to SCA?		
Is there any resultant damage of overheat noted to cylinder block (scoring, cracks, etc – attach all photos to SCA)?		
DTC and Freeze Frame Data present (print to PDF list required – attach to SCA)?		


Disclaimer: The fact that a Workshop Instruction has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.
Note: Details contained in this Workshop Instruction and Attachments are current at the time of publication, MMAL however reserves the right to make changes at any time without prior notice or obligation. Printed copies may not reflect the latest updates. Please consult the online version.
General Information

Copyright © Mitsubishi Motors Australia Limited. Reproduction in whole or part prohibited.


Bulletin Subject	**Coolant seepage/leakage from core plug at rear of cylinder head on 4N15 Engine.**		
Applicable model(s)	MQ/MR Triton, QE/QF Pajero Sport		
Notice Category	**Hotline fix**	Technical Bulletin	**MQ/MR/QE/QF14-001**
Service Group	14 - Engine Cooling	Latest Revision Issued	22/12/2025
Revision number	C	MMAL Reference	TSL2407029-A

Process for obtaining DTC and freeze frame data using MUTIII SE

1. Select "MPI/GDI/Diesel -> Self Diagnosis"
2. Select "Freeze Frame Data (OBD)"

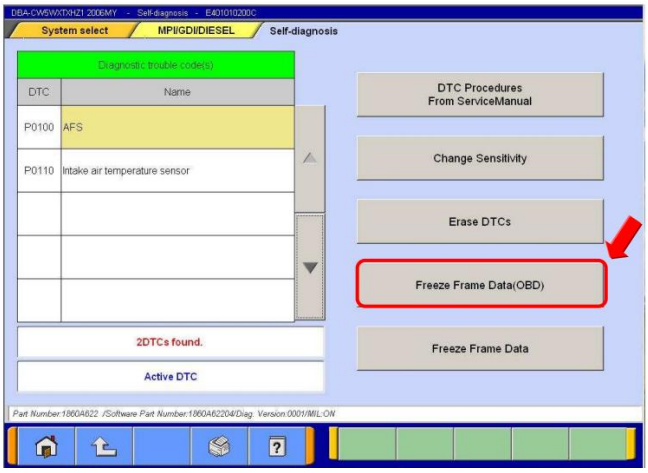

3. Click the "Print" icon

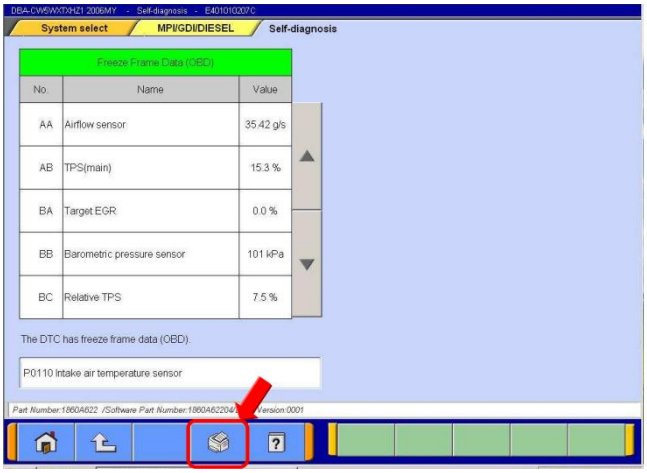

4. Select "Print List"



5. From the pop up, select "Print to PDF" and follow the prompts to save the PDF file.
6. Attach the saved PDF file to the SCA/Claim.

Disclaimer: The fact that a Workshop Instruction has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.
Note: Details contained in this Workshop Instruction and Attachments are current at the time of publication, MMAL however reserves the right to make changes at any time without prior notice or obligation. Printed copies may not reflect the latest updates. Please consult the online version.
General Information

Copyright © Mitsubishi Motors Australia Limited. Reproduction in whole or part prohibited.