ADVISORY HOTLINE FIX

Group: 52 – Interior	**Original Date:** 01/05/2018	**No.** MQ52-003
Model: MQ Triton	**Subject:** Recovering air vent after locking knob or fins.	
Revised on: …….. **Revised on:** …….. **Revised on:** ……..	R. Versteeg National Service Manager Service Operations	
MMAL Ref TSL1704026	**Document consists of 3 pages**	

1) **Subject**: Recovering air vent after locking knob or fins.

2) **Possible Cause**:

The following notes should be stressed to customers in order to avoid the breakage of the vents.

- The lowest fin is pushed down and rotates while cleaning the fins, and the knob is locked and cannot be moved. In the worst case scenario, if the knob is moved up, the centre fin may break.
- When the knob is moved due to hanging an air freshener a fin may get stuck. When a clip of the air freshener goes inside the air outlet, it may obstruct the movement of the fins. This may cause the fin to dislocate after the knob is moved.

3) **Production Fix**: An improved air outlet has been introduced from May 2017 production.

4) **Field Fix/Action**:

- Broken fins (due to being moved while stuck): Push the upper edge of the lowest fin to return to original position as described in the attached document, and explain the handling of the air vent to the customer.
- Stuck fins: Explain to customers that an air freshener may have caused this concern.

The vent can be replaced at customer expense if it is not able to be recovered. (Warranty does not cover breakage of trims by mishandling).

5) **Parts Information:**

Part name	Part number (New)	Part number (Old)	Remark
AIR OUTLET ASSY,CENTER LH	8030A407XA	8030A259XA	
AIR OUTLET ASSY,CENTER HIGH LH	8030A409XA	8030A327XA	Metal plate on knob
AIR OUTLET ASSY,CENTER RH	8030A408XA	8030A260XA	
AIR OUTLET ASSY,CENTER HIGH RH	8030A410XA	8030A328XA	Metal plate on knob

6) **Warranty Information***:* As per Warranty Policy.


Disclaimer: *The fact that a Hotline Fix has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty*.

Note: This document should be forwarded direct to the Service Manager for action and distribution to all affected staff


Copyright © Mitsubishi Motors Australia Limited
Please note: The information contained in this document is CONFIDENTIAL and intended for Mitsubishi Dealer use only. It must not be provided to third parties.

Attachment

1) Mechanism of fin movement

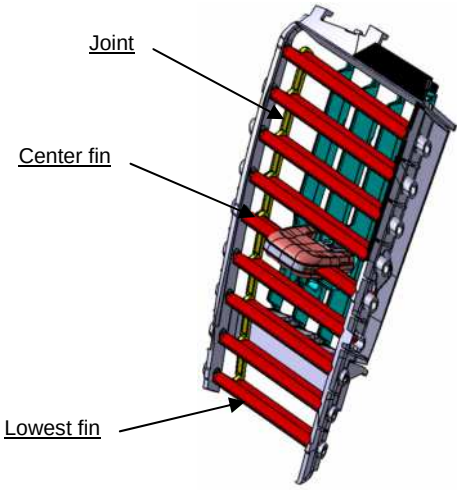

Nine horizontal fins are connected to a joint.
The joint moves all horizontal fins at the same time once the knob is moved.

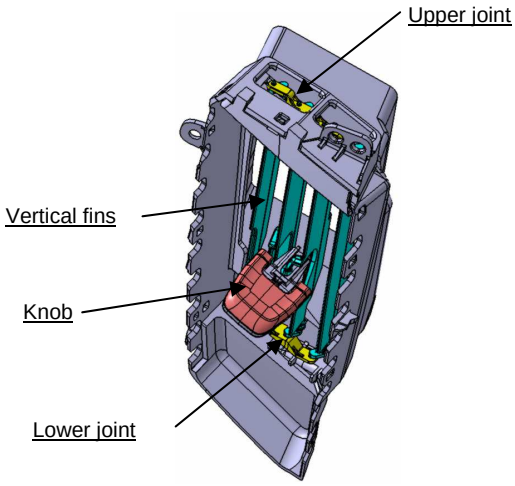

Behind the horizontal fins, there are four vertical fins.
They are connected to an upper and a lower joints.
The joints move all vertical fins at the same time once the knob is moved.

2) Details of causes and a method to recover normal movement of knob

(1) Stuck the fin then broken the fin.




1. The lowest fin is pushed down. (e.g. wiping the surface)




2. The lowest fin rotates.

Center fin broken at axis

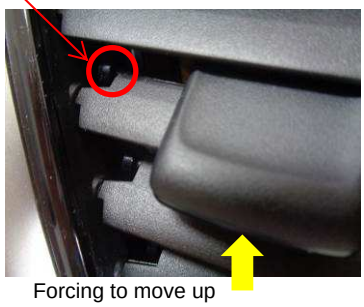

Forcing to move up

3. The knob locks. If it is forced to move up, the center fin is broken at the axis.

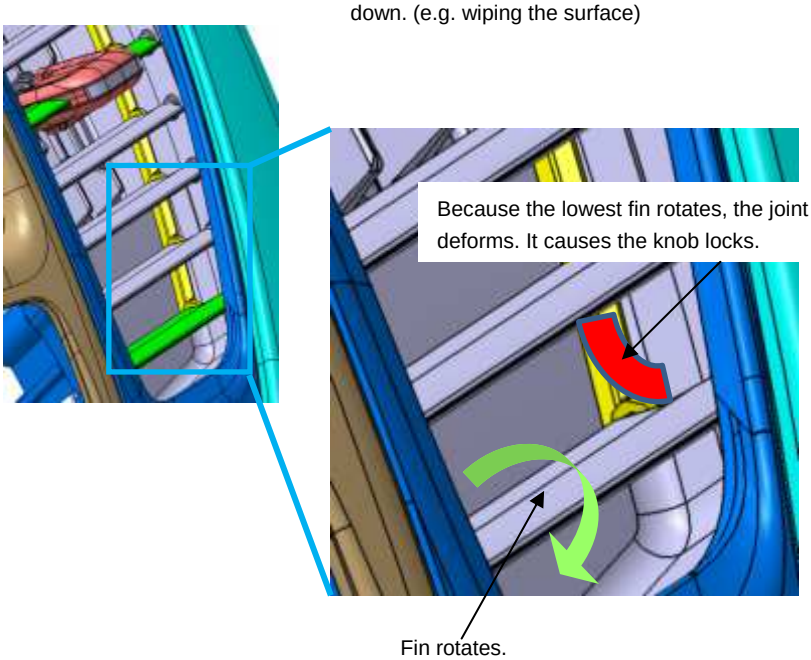



To recover the movement, push the upper edge of the lowest fin. The lowest fin comes back to the normal position.


(2) Stuck by air freshener




An air freshener lies on the air outlet.
It obstructs movement of fins.




A clip of an air freshener goes inside and stays between a fin and one another.
When a knob is moved left/right, the fin does not move but the joint tries to move.
The axis of the fin comes off from the joint.

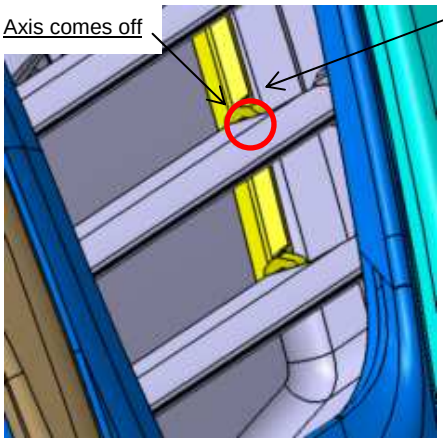


When the knob is up/down, fins do not move but the joint (yellow) tries to move.
The axis of the fin comes off from the joint.

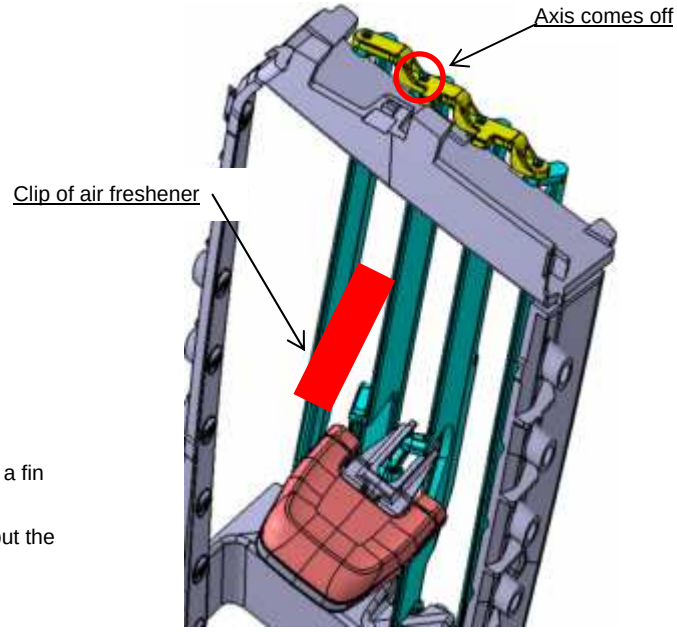

2) Details of Production Fix and how to distinguish it

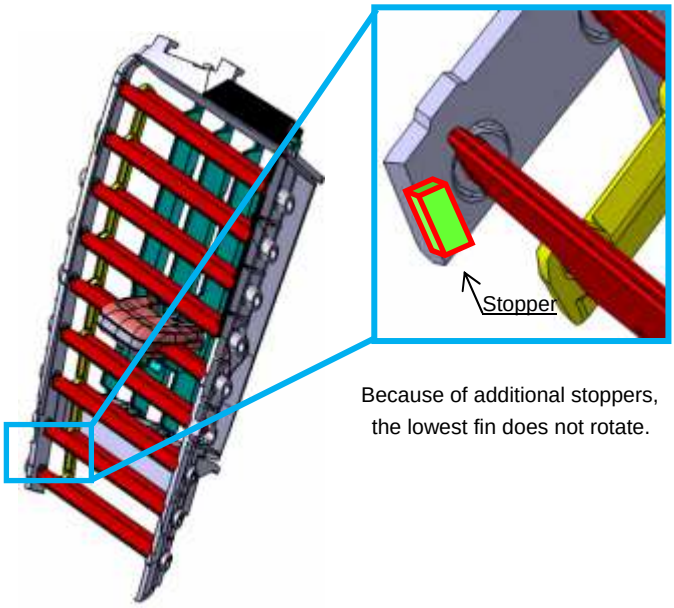

Because of additional stoppers,
the lowest fin does not rotate.

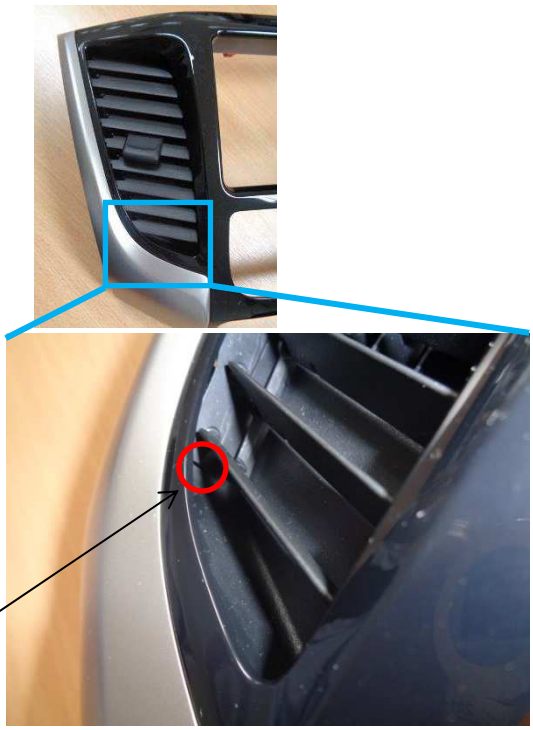

The stopper can be seen in the circle.