
ADVISORY HOTLINE FIX

Group: 33 – Front Suspension	**Original Date: 16th August 2019**	**No. MQ33-001, MR33-001, QE33-001**
Model: MQ/MR Triton, QE Pajero Sport	**Subject: Change to front stabiliser bar linkage torque setting.**	
Revised on 20/09/2019 ..... (date) **Revised on** ..... (date) **Revised on** ..... (date)	Neil Dunn Head of Service Service Operations	Neil M Dunn
MMAL Ref P4929	**Document consists of 2 pages.**	

(1) **Subject**: Change to front stabiliser bar linkage torque setting.


(2) **Possible Concern:** Due to rotational torque applied to the front stabiliser linkage during front suspension actuation, the stabilizer linkage retaining nut may loosen during service.

(3) **Production Fix**: Revised stabiliser linkage retaining nut torque settings applied from December 2018 production.

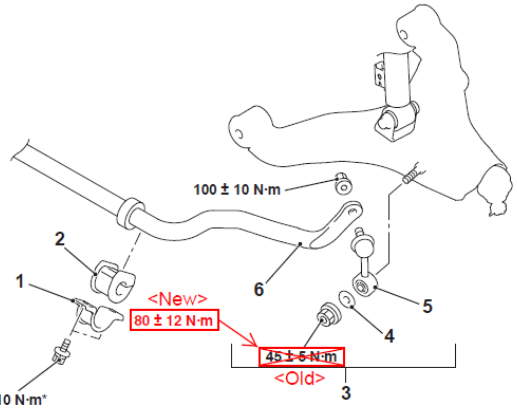

Removal steps
1. Stabilizer clamp
>>A<< 2. Stabilizer bushing
3. Stabilizer link assembly and stabilizer bar
4. Eye washer
5. Stabilizer link assembly
6. Stabilizer bar

INSTALLATION SERVICE POINT
>>A<< STABILIZER BUSHING INSTALLATION

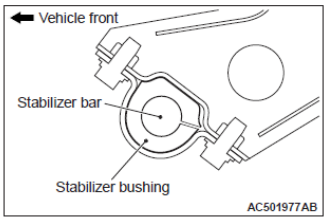

Install the bushing with its cut line located as shown in the figure.

Disclaimer: *The fact that a Hotline Fix has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.*

Note: This document should be forwarded direct to the Service Manager for action and distribution to all affected staff

Copyright © Mitsubishi Motors Australia Limited
Please note: The information contained in this document is CONFIDENTIAL and intended for Mitsubishi Dealer use only. It must not be provided to third parties.

(4) **Field Fix**: As per the vehicle's maintenance schedule, please ensure to "Check suspension system for damage and looseness" during periodic maintenance. If the stabiliser bar linkage retaining nuts are found to be loose, please re-tension as per the revised specification (Refer to Service Bulletin 33-2019-003 for further details). If the retaining nut/s are found to be missing, please replace the nut/s and torque to the revised specification.

(5) **Warranty Information:** Standard terms and conditions apply.

Disclaimer: *The fact that a Hotline Fix has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty*.

Note: This document should be forwarded direct to the Service Manager for action and distribution to all affected staff

Copyright © Mitsubishi Motors Australia Limited
Please note: The information contained in this document is CONFIDENTIAL and intended for Mitsubishi Dealer use only. It must not be provided to third parties.