Triton Mi-Display Software Update Procedure
Hotline Fix MR54-002

How to update the Mi-Display unit

Update the Mi-Display unit using a USB memory stick loaded with the latest software from the Getac.
(must be an <u>empty</u> **4G to 32G USB** memory stick)

Stored Information

- After the software is updated, customer setting information such as radio station presets (AM/FM/DAB), EQ settings, Bluetooth pairing setting, hands-free phone setting and phone address book, will be reset to factory setting. Therefore, make note of this information beforehand and re-setup after the software update.
- After the software is updated, the clock on the Mi-Display is reset and will need to be restored manually

ATTENTION

- Before updating the software, check the software version of the Mi-Display unit. (The software may already be the latest version)
- Before performing the update process, remove any other USB devices such as charging cables, USB memory sticks and others from the front of the floor console.
  ※There is no need to remove devices from the USB ports located in the rear of the floor console because it is for charging use only (no data transmission).
- Before performing the update process confirm that the screen protector originally supplied with the Mi-Display unit has been removed
- The software update must be performed with engine idling otherwise the auxiliary battery may drain during the update and the Mi-Display unit may need replacement. (It takes about 5 minutes from inserting the USB memory stick to completion)
- Do not move the vehicle or operate the Mi-Display unit until the software update is completed. Otherwise, the updating process may fail and the Mi-Display unit may need replacement.
- Make sure the software version is updated to the latest (countermeasure) version after updating.
- For the best Bluetooth experience, instruct the customer to remove the audio unit from their phone pairing history and re-pair.

Commercial-in-Confidence

Work flow

Confirmation of Mi-Display startup

Normal start up

Repeat reboot

Check screen appearance


Mi-Display unit replacement

(DIRECTED Warranty Procedure)

After countermeasure



Before countermeasure

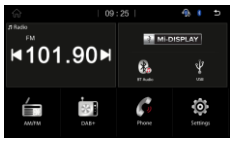

No action required

(Claim code 02020030)

Update software

(Claim code 02020010)

Check software version



System Version

V3.2

Replace User Manual (AU901745 – Dec 22)



AU901745 - Dec 22

Work completed


NOTE - If a Mi-Display unit is NOT fitted use **Claim code 02020031**

Commercial-in-Confidence


1. Use the Getac Infotainment Update Tool to load software to USB memory stick

CAUTION – This process will format the USB memory stick before uploading the required software – any files contained on the USB will be deleted

1. Insert the USB memory stick into the Getac
2. Navigate to the "**Additional Software**" menu and press "**Infotainment Update Tool**"

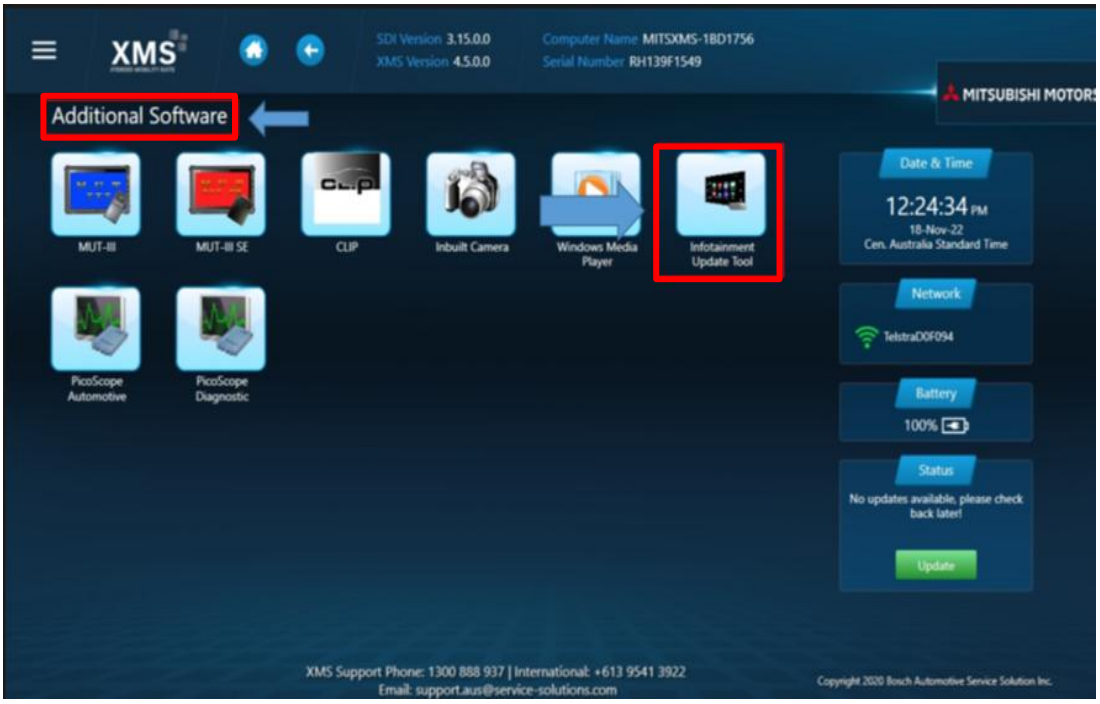

3. Select "**MI Display Update**" & press "**START!**"

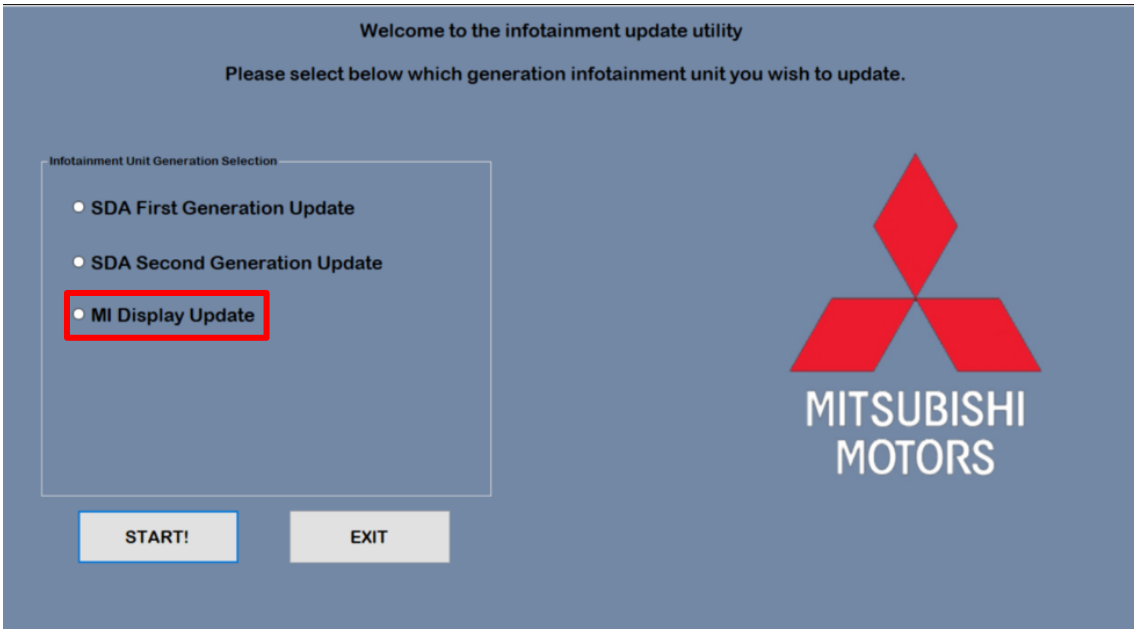


Commercial-In-Confidence

4. Select "**USB**" from top dropdown then select appropriate variant from bottom dropdown depending if vehicle has DAB or no DAB:

   Quick Reference:

   Auto Aircon **TRITON WITH DAB**

   Manual Aircon **TRITON WITHOUT DAB**

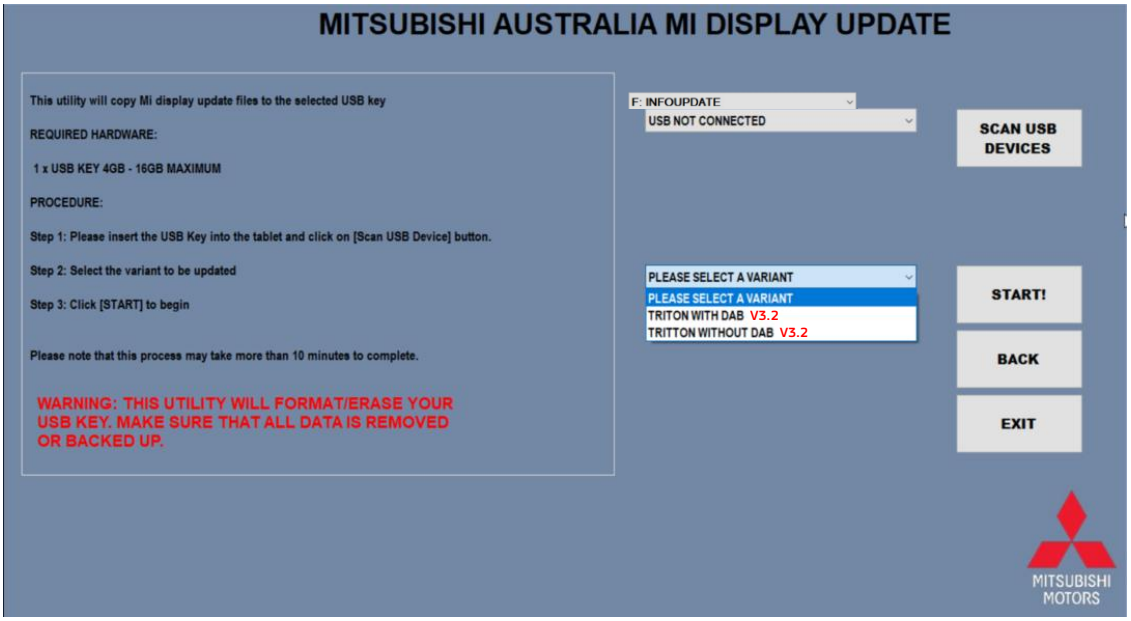

5. Press "**START!**" to begin transfer

   NOTE – If an error message appears start the procedure again with a different USB



6. After the software load is complete the Getac will direct to remove the USB

Commercial in Confidence

2. Start up the vehicle Mi-Display

Step on the brake pedal and push IG switch to start the engine

☞ Make sure vehicle is in Park and the parking brake is engaged

If the Mi-Display unit repeatedly reboots, **even after pressing reset button** on bottom left passengers side of screen – 'res'. It may be necessary to replace the unit. For the replacement procedure, refer to the DIRECTED warranty procedure.


3. Software version confirmation

Check the screen version by reviewing the home screen appearance

Screen appearance	Necessity of update	Work	Claim Code
	Update required (Before countermeasure)	Commence update on next page	020200120
	No update required (Already latest version)	Work complete	02020030
OTHER	No update required (Non Mi-Display unit fitted)	Work complete	02020031

4. Confirmation before starting update

Before performing update process, remove any USB devices already inserted into the ports such as charging cables, USB memory sticks and others.

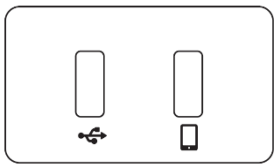

ATTENTION

The Mi-Display unit may fail if you start the update without first removing all USB devices from the front of the floor console

☞ USB devices in the port located at the rear of the floor console do not need to be removed (charging ports only - no data transmission).

Commercial-in-Confidence

5. Update the software


ATTENTION


Do not move the vehicle and operate the Mi-Display unit until the software update is completed correctly. Otherwise the updating process may fail and the Mi-Display unit may need replacement.

1. Insert the USB memory stick with the countermeasure software into either USB port at the front of the floor console
   ☞ Screen will automatically change to "**Upgrade**" screen.
2. Select "**MCU upgrade**" option, then select "**Update**"
   ☞ Update will take approx. 1min; progress can be seen on the screen.
   ☞ Software will complete initial update then Reboot



3. Remove the USB memory stick from the USB port and reinsert
   ☞ Screen will automatically change to "**Upgrade**" screen.
4. Select "**Complete upgrade**" option, then select "**Update**"
   ☞ Update will take approx. 1 minute; progress can be seen on the screen.
   ☞ When the progress bar reaches to 100%, the message below shows "**Burn success, welcome!**"

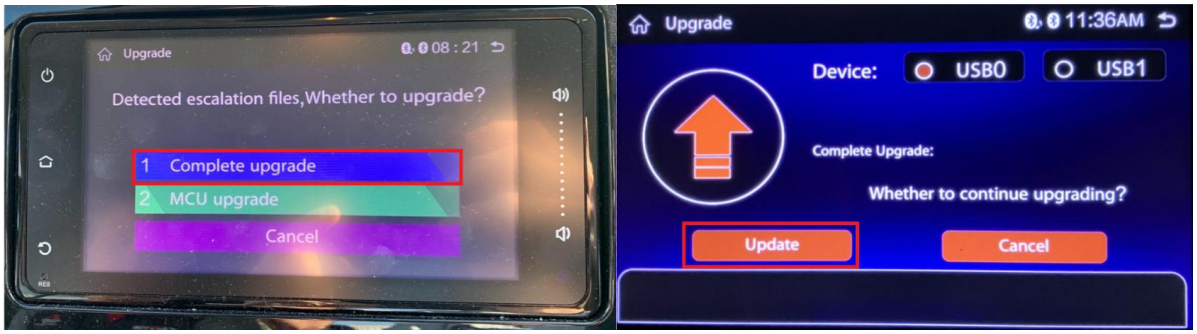

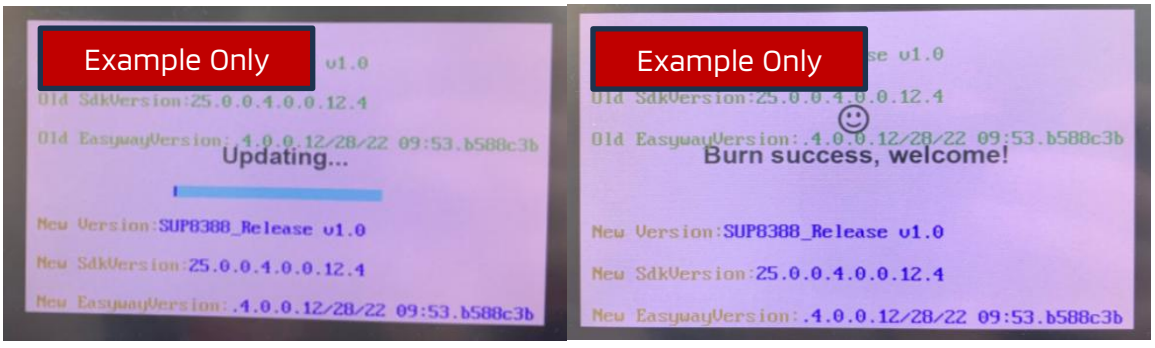

5. Turn off Ignition
6. Remove the USB memory stick from the USB port


Commercial in Confidence

7. Wait at least 15 seconds then turn the ignition back on
   - ☞ If the system is not left off for at least 30 seconds the screen will not come on, if this occurs turn the vehicle off and wait another 30 seconds
   - ☞ If the system does not reboot automatically **press the reset button** on bottom left passengers side of screen – 'res'.
   - ☞ The software update was successful if the screen appearance is the new one after rebooting.

Variant	Screen appearance
DAB	
Non DAB	


6. Confirm software version

1. Navigate to "**Settings**", scroll the menu and select "**Information**"

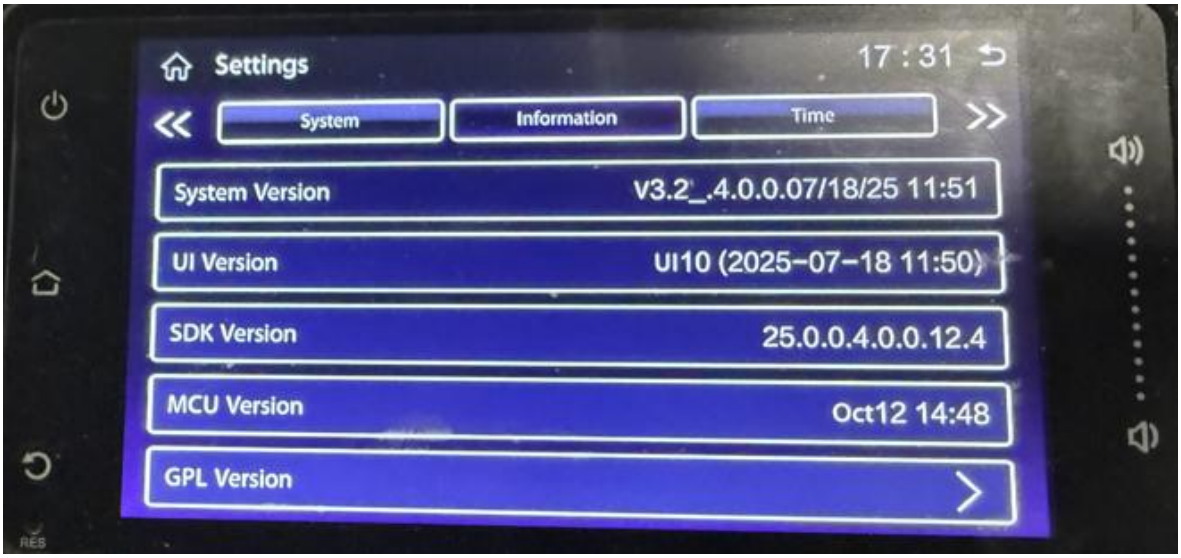

2. Make sure the software version matches above.

3. Scroll the menu and select "**Time**". Update the unit to the correct Date and Time and press "**Save**"

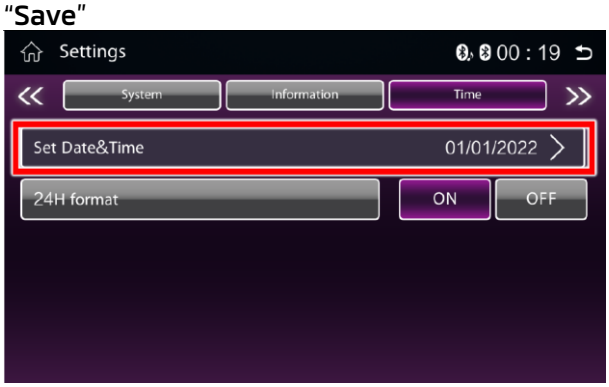



Commercial-In-Confidence


7. Update user preferences

1. Navigate to the radio source (AM/FM/DAB), press box in bottom right-hand corner, press "**Search**" button to update station list. To save user favorite, navigate to the desired preset station in the radio source menu and long press on preset station. Repeat for all other radio sources.



2. Return to the home menu, navigate to "**Settings**", select "**EQ**" and update user preferences to settings prior to update



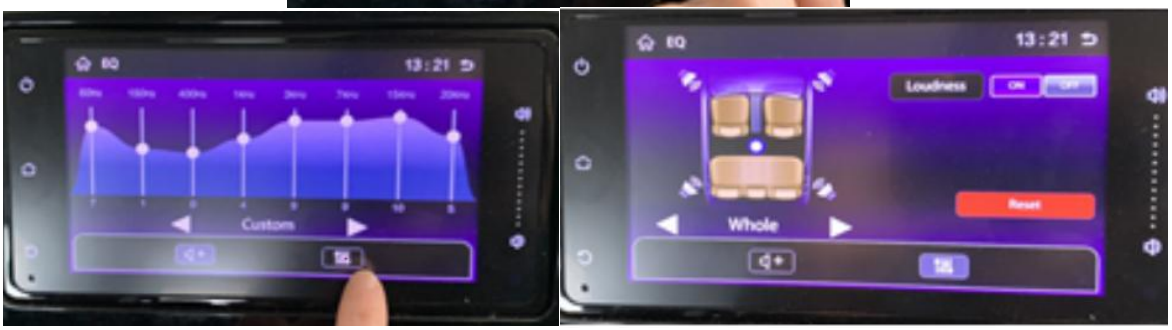

3. Request the owner to remove the Mi-Display unit from their phone Bluetooth settings and re-pair the unit.

8. Conduct checks to make sure unit is fully functional

1. Make sure the software version changes to the countermeasure one (Ref Section 6)
2. Before turning off the vehicle check ensure the following items are functional:
   - ☞ Turn Headlights ON/OFF and check unit that the Mi-Display dims
   - ☞ Steering Wheel Controls (Test in DAB source if available):

Volume Up	Previous Station
Volume Down	Next Station

   - ☞ Reverse Screen (Put Vehicle in reverse)
     - Reverse Lines will not be correctly calibrated on first restart after firmware update
     - Upon second restart the Reverse Lines will be correct

9. MI-Display user manual

Remove the old Mi-Display user manual from the vehicle and replace it with the updated user manual (P/N on rear cover AU901745 – Dec 22). Dispose of the old user manual.

Commercial in Confidence

10. Trouble shooting

Symptom	Response
Update will not start with inserting the USB memory stick. Mi-Display unit does not recognize the USB memory stick.	Remove the USB memory stick and re-insert it.
	Reboot the Mi-display unit by cycling ignition. If Mi-display still not starting, **press reset button** on bottom left passengers side of screen – 'res'.
	Change the USB memory stick to another one.
Update does not finish. (Takes more than 5 minutes)	Reboot the Mi-display unit by cycling ignition. If Mi-display still not starting, **press reset button** on bottom left passengers side of screen – 'res'.
	Change the USB memory stick to another one.
Mi-Display unit does not reboot after software update	**Press reset button** on bottom left passengers side of screen – 'res'.
B Mi-Display stuck on boot loop or blank screen	Refer to procedure on next page

B

Recovering AVN stuck on boot loop / blank screen

Prior to conducting this procedure ensure AVN has correct power supply & connections are secure.

Do a battery disconnect for 10 minutes to see if AVN resets itself.

If AVN resets, reinstall the firmware and test AVN for correct operation.

If AVN is still boot looped/blank screen, proceed with below steps.

Recovery Steps

1 – Turn ignition switch to '**OFF**' to power down AVN.

2 - Plug in USB drive with correct firmware files.

3 – Press and hold down '**volume down**' button on steering wheel (this will initiate read mode upon startup of AVN).

4 – Turn ignition switch to '**ACC**' position to switch AVN on. Keep pressing '**volume down**' button.

5 – Wait until '**firmware update**' screen appears and then remove finger from the '**volume down**' button.

6 – When firmware has completed install, '**burn success**' will appear. AVN should reset after approx. 30 secs and reboot again successfully.

If reboot does not occur after 30 secs and stays on '**burn success**', turn ignition switch to '**OFF**' so AVN powers down. Wait 20 seconds and then turn ignition switch back to '**ACC**' to power up AVN. AVN should then reboot successfully.

7 – Once AVN has been recovered and is at radio screen, remove USB drive, reinstall USB and update the MCU file as per normal firmware upgrade procedure.

8 – Fully test all functions of the AVN to ensure its ok. Switch AVN off (wait 20 secs) then back on (test functions) several times to confirm firmware is stable.

Note:

If the process above does not work after 3 attempts, try pressing down on the '**volume up**' button in place of the '**volume down**' button and repeat procedure.

If this procedure is still unsuccessful - please call **Directed – OE Service** on **03 8331 4800** for further technical assistance prior to releasing vehicle back to customer.

Commercial-in-Confidence